


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kurri Kurri High School (8177)
Region:	Hunter/Central Coast AMU
State Electorate:	Cessnock
Local Government Area:	Cessnock

Last Reviewed By:	Greencap 04-DEC-2014
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

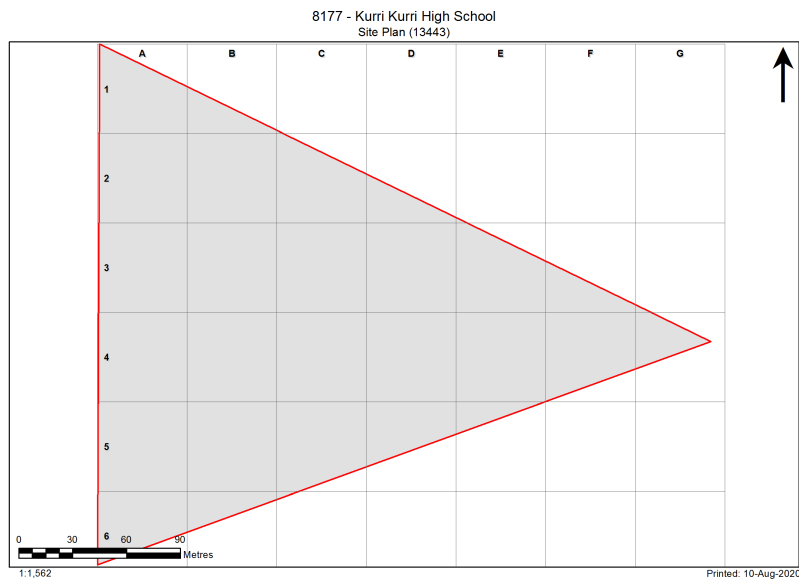

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning/Multi Purpose Facilities - 1951 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Staff Study - 17.63 m2</b>							
No Asbestos							
<b>B00A - R0002 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0003 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0004 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0005 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0006 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0007 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0008 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0009 - General Learning Space - 49.08 m2</b>							
No Asbestos							
<b>B00A - R0010 - General Storeroom - 4 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0011 - Clinic - Boys - 14.74 m2</b>							
No Asbestos							
<b>B00A - R0012 - Clinic-Toilets - 1.82 m2</b>							
No Asbestos							
<b>B00A - R0013 - Clinic-Toilets - 1.84 m2</b>							
No Asbestos							
<b>B00A - R0014 - Clinic - Girls - 14.59 m2</b>							
No Asbestos							
<b>B00A - R0015 - General Storeroom - 3.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0016 - General Storeroom - 5.5 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0017 - Staff Study - 12.91 m2</b>							
No Asbestos							
<b>B00A - R0018 - Cleaning Store - Distributed - .76 m2</b>							
No Asbestos							
<b>B00A - R0019 - Staff - Toilet - 4.35 m2</b>							
No Asbestos							
<b>B00A - R0020 - Staff Study - 13.18 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0021 - General Storeroom - 5.27 m2</b>							
No Asbestos							
<b>B00A - R0022 - Cleaning Store - Distributed - .76 m2</b>							
No Asbestos							
<b>B00A - R0023 - Toilets-Disabled - 4.32 m2</b>							
No Asbestos							
<b>B00A - R0024 - Movement - 248.24 m2</b>							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0025 - Staff Study - 20.27 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0026 - Distribution Board Cupboard - .56 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	0.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0027 - Distribution Board Cupboard - 1.37 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Flat AC Sheeting						
<b>B00A - R0029 - Movement - 4.72 m2</b>							
No Asbestos							
<b>B00A - R0030 - Control Room - 10.96 m2</b>							
No Asbestos							
<b>B00A - R0031 - Movement - 10.63 m2</b>							
No Asbestos							
<b>B00A - R0032 - Multi-Purpose Space - 278.08 m2</b>							
No Asbestos							
<b>B00A - R0033 - Movement - 8.62 m2</b>							
No Asbestos							
<b>B00A - R0034 - Movement - .41 m2</b>							
No Asbestos							
<b>B00A - R0035 - Movement - .98 m2</b>							
No Asbestos							
<b>B00A - R0036 - Stage - 74.75 m2</b>							
No Asbestos							
<b>B00A - R0037 - Movement - .98 m2</b>							
No Asbestos							
<b>B00A - R0041 - Deputy Principal Office - 12.71 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0042 - Interview/Meeting - 12.75 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0043 - General Storeroom - 2.17 m2</b>							
No Asbestos							
<b>B00A - R0044 - Staff - Toilet - 3.28 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R0046 - Secure Storeroom - 13.41 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00A - R0047 - Administration - Clerical - 12.81 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0050 - Movement - .49 m2</b>								
No Asbestos								
<b>B00A - R0051 - Control Room - .49 m2</b>								
No Asbestos								
<b>B00A - R0052 - Stage - 13.55 m2</b>								
No Asbestos								
<b>B00A - R0053 - External Movement - 10.09 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0054 - Movement - 2.33 m2</b>								
No Asbestos								
<b>B00A - R0055 - Movement - 10.14 m2</b>								
No Asbestos								
<b>B00A - R0057 - Movement - 3.93 m2</b>								
No Asbestos								
<b>B00A - R0058 - Movement - 3.96 m2</b>								
No Asbestos								
<b>B00A - R0059 - Covered Area - 15.07 m2</b>								
No Asbestos								
<b>B00A - R0061 - Covered Area - 322.71 m2</b>								
No Asbestos								
<b>B00A - R0062 - Toilets-Disabled - 12.08 m2</b>								
No Asbestos								
<b>B00A - R0063 - Stairs - 6.51 m2</b>								
No Asbestos								
<b>B00A - R0064 - Stairs - 15.47 m2</b>								
No Asbestos								
<b>B00A - R0065 - Stairs - 13.03 m2</b>								
No Asbestos								
<b>B00A - R0066 - Stairs - 6.25 m2</b>								
No Asbestos								
<b>B00A - R0067 - External Movement - 89.37 m2</b>								
Require Inspection								
<b>B00A - R0068 - Administration - Clerical - 74.96 m2</b>								
Require Inspection								
<b>B00A - R0069 - Public Reception - 38.41 m2</b>								
Require Inspection								
<b>B00A - R0070 - Movement - 29.6 m2</b>								
Require Inspection								
<b>B00A - R0071 - Toilet - Lobby - 1.63 m2</b>								
Require Inspection								
<b>B00A - R0072 - Toilets-Unisex - 4.23 m2</b>								
Require Inspection								
<b>B00A - R0073 - Deputy Principal Office - 18.06 m2</b>								
Require Inspection								
<b>B00A - R0074 - Interview/Meeting - 21.4 m2</b>								

Require Inspection							
<b>B00A - R0075 - Store - 4.82 m2</b>							
Require Inspection							
<b>B00A - R0076 - Movement - 22.85 m2</b>							
Require Inspection							
<b>B00A - R0077 - Movement - 13.61 m2</b>							
Require Inspection							
<b>B00A - R0078 - Commonroom - 13.3 m2</b>							
Require Inspection							
<b>B00A - R0079 - Staff Kitchen - 5.29 m2</b>							
Require Inspection							
<b>B00A - R0080 - Principal Office - 25.01 m2</b>							
Require Inspection							
<b>B00A - R0081 - Interview/Meeting - 14.55 m2</b>							
Require Inspection							
<b>B00A - R0082 - External Movement - 24.12 m2</b>							
Require Inspection							
<b>B00A - R1001 - Movement - 10.79 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1002 - Apparatus Store - 18.37 m2</b>							
No Asbestos							
<b>B00A - R1003 - General Learning Space - 50.2 m2</b>							
No Asbestos							
<b>B00A - R1004 - General Learning Space - 49.39 m2</b>							
No Asbestos							
<b>B00A - R1005 - General Learning Space - 49.31 m2</b>							
No Asbestos							
<b>B00A - R1006 - General Learning Space - 49.31 m2</b>							
No Asbestos							
<b>B00A - R1007 - Laboratory L.S. - 83.79 m2</b>							
No Asbestos							
<b>B00A - R1008 - Preparation - 16.56 m2</b>							
No Asbestos							
<b>B00A - R1009 - General Learning Space - 49.67 m2</b>							
No Asbestos							
<b>B00A - R1010 - Preparation - 16.47 m2</b>							
No Asbestos							
<b>B00A - R1011 - Laboratory L.S. - 83.86 m2</b>							
No Asbestos							
<b>B00A - R1012 - General Storeroom - 13.66 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1013 - Staff Study - 32.4 m2</b>							
No Asbestos							
<b>B00A - R1014 - Commonroom - 106.86 m2</b>							
No Asbestos							
<b>B00A - R1015 - Movement - 8.74 m2</b>							
No Asbestos							
<b>B00A - R1016 - Staff - Toilet - 7.27 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00A - R1017 - Staff - Toilet - 4.02 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00A - R1018 - Staff Study - 28.32 m2</b>							
No Asbestos							
<b>B00A - R1019 - Staff Study - 46.78 m2</b>							
No Asbestos							
<b>B00A - R1020 - Plant - 21.99 m2</b>							
No Asbestos							
<b>B00A - R1021 - Commonroom - 35.33 m2</b>							
No Asbestos							
<b>B00A - R1022 - Cleaning Store - Distributed - 1.58 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1023 - Staff Study - 35.01 m2</b>							
No Asbestos							
<b>B00A - R1024 - Cleaning Store - Distributed - 1.56 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1025 - Movement - 244.06 m2</b>							
No Asbestos							
<b>B00A - R1026 - Stairs - 10.18 m2</b>							
No Asbestos							
<b>B00A - R1027 - Stairs - 10.88 m2</b>							
No Asbestos							
<b>B00A - R1028 - Stairs - 7.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9001 - Staff Study - 9.26 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R9002 - Change - 53.63 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R9003 - Toilets-Boys - 2.07 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9004 - Toilets-Girls - 1.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9005 - Change - 51.53 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9006 - Sport Equipment Store - 15.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9007 - Staff Shower - 1.49 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9008 - Staff - Toilet - 3.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9009 - Movement - 22.68 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						

<b>B00A - R9010 - Staff - Toilet - 1.3 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9011 - Maintenance Bulk Store - 115.71 m2</b>							
Plumbing / Pipework	Insulation Material						
<b>B00A - R9012 - Cleaning Store - Distributed - 5.16 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9013 - Movement - 1.94 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9014 - Cleaning Store - Distributed - 7.43 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9015 - Movement - 3.77 m2</b>							
No Asbestos							
<b>B00A - R9016 - Stairs - 10.58 m2</b>							
No Asbestos							
<b>B00A - R9017 - Stairs - 6.81 m2</b>							
No Asbestos							
<b>B00B - Art/Technological &amp; Applied Studies - 1968 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Distribution Board Cupboard - .65 m2</b>					<b>Note: No inspection of live electrical installation</b>		
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0002 - Laboratory L.S. - 92.68 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
Window	Compressed AC Sheet	10	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Preparation - 29.07 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0005 - Apparatus Store - 9.37 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0006 - General Learning Space - 52.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Window	Compressed AC Sheet	7	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0007 - Food/Research Space - 8.15 m2</b>							



Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )							
Window	Compressed AC Sheet	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0008 - Food/Research Space - 8.4 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0009 - Food Technology L.S. - 89.01 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
Window	Compressed AC Sheet	8	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0010 - Distribution Board Cupboard - .66 m2</b>						<b>Note: No inspection of live electrical installation</b>		
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0011 - Staff Study - 24.11 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0012 - General Learning Space - 52.6 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0014 - Stairs - 16.77 m2</b>								
No Asbestos								
<b>B00B - R0015 - Toilets-Disabled - 12.61 m2</b>								
Require Inspection								
<b>B00B - R0016 - Movement - 176.37 m2</b>								
Require Inspection								
<b>B00B - R1001 - Distribution Board Cupboard - .64 m2</b>						<b>Note: No inspection of live electrical installation</b>		
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1002 - Seminar - 12.39 m2</b>								
No Asbestos								
<b>B00B - R1003 - Staff Study - 12.25 m2</b>								
No Asbestos								
<b>B00B - R1004 - Staff - Toilet - 3.68 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1005 - Bulk Store - 12.6 m2</b>								
Window	Compressed AC Sheet	3	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R1006 - Staff Study - 25.53 m2</b>								
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1007 - Art Learning Space - 65.53 m2</b>								
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1011 - Art Learning Space - 51.37 m2</b>								
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1012 - Art Learning Space - 59.86 m2</b>								
Window	Compressed AC Sheet	5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1013 - Darkroom Space - 10.09 m2</b>								
No Asbestos								
<b>B00B - R1014 - KiIn Space - 20.34 m2</b>								
Window	Compressed AC Sheet	3	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1015 - Distribution Board Cupboard - .45 m2</b>								
						<b>Note: No inspection of live electrical installation</b>		
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1016 - Art Learning Space - 52.61 m2</b>								
Window	Compressed AC Sheet	4	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1017 - Movement - 179.57 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	180m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1018 - Darkroom Space - 35.19 m2</b>								
Window	Compressed AC Sheet	7	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1019 - Plant - 4.54 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1020 - Stairs - 8.4 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - Science/General Learning - 1964 - Brick/Block</b>								
<b>Exterior</b>								
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area							
Ceiling Voids - Raked Ceiling	No Asbestos Found							
<b>Interior</b>								
<b>B00C - R0001 - Cleaning Store - Distributed - 4.71 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00C - R0002 - Music Store - 11.28 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00C - R0003 - Music Learning Space - 52.6 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							

Window	Compressed AC Sheet	7	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0004 - Music Learning Space - 52.6 m2</b>							
Window	Compressed AC Sheet	6	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	No Asbestos Found						
<b>B00C - R0005 - Movement - 9.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0006 - Practice/Seminar - 11.99 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Window	Compressed AC Sheet	3	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0007 - Music Store - 9.29 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0008 - Laboratory L.S. - 85.84 m2</b>							
No Asbestos							
<b>B00C - R0011 - Laboratory L.S. - 86.21 m2</b>							
No Asbestos							
<b>B00C - R0012 - Chemical Store - 9.21 m2</b>							
No Asbestos							
<b>B00C - R0013 - General Storeroom - 5.43 m2</b>							
No Asbestos							
<b>B00C - R0014 - Staff - Toilet - 5.02 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00C - R0015 - Movement - 116.11 m2</b>							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0016 - Movement - 11.92 m2</b>							
No Asbestos							
<b>B00C - R0017 - Stairs - 15.63 m2</b>							
No Asbestos							
<b>B00C - R0018 - Stairs - 15.63 m2</b>							
No Asbestos							
<b>B00C - R0019 - Preparation - 39.08 m2</b>							
No Asbestos							
<b>B00C - R1001 - General Storeroom - 11.27 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1002 - Cleaning Store - Distributed - 4.87 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1003 - General Learning Space - 52.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1004 - General Learning Space - 52.38 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1005 - Staff Study - 31.06 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1006 - General Learning Space - 52.46 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1007 - General Learning Space - 52.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1008 - General Learning Space - 52.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1009 - Computer Learning Space - 52.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1010 - General Storeroom - 9.28 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1011 - General Storeroom - 5.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1012 - Staff - Toilet - 4.44 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1013 - Movement - 116.11 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	117m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1014 - Stairs - 15.63 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1015 - Stairs - 15.63 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - Pupil Facilities - 1951 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0005 - Toilets-Girls - 16.25 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0006 - Movement - 60.26 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0007 - Movement - 152.02 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	152m2	Throughout	Minimal Damage (2)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0008 - Student Canteen - 84.12 m2</b>							
No Asbestos							
<b>B00D - R0009 - Movement - 1.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0010 - Staff - Toilet - 4.61 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0011 - Pantry - 9.08 m2</b>							

No Asbestos							
<b>B00D - R0012 - Movement - 61.82 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0015 - Toilets-Boys - 45.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0016 - Secure Storeroom - 20.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0017 - Toilets-Boys - 12.98 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0018 - Toilet - Lobby - 21.63 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0019 - Toilets-Girls - 76.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - Technological &amp; Applied Studies - 1951 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Laundry - 13.4 m2</b>							
No Asbestos							
<b>B00E - R0002 - General Storeroom - 5.49 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0003 - Food Technology L.S. - 79.04 m2</b>							
Furniture / Fixtures - Sink	Resinous Membrane						
<b>B00E - R0004 - Food/Research Space - 18.83 m2</b>							
Furniture / Fixtures - Sink	Resinous Membrane						
<b>B00E - R0005 - Cleaning Store - Distributed - .95 m2</b>							
No Asbestos							
<b>B00E - R0006 - General Storeroom - .81 m2</b>							
No Asbestos							
<b>B00E - R0007 - Food Technology L.S. - 88.48 m2</b>							
Furniture / Fixtures - Sink	Resinous Membrane						
<b>B00E - R0008 - Staff Study - 9.84 m2</b>							
No Asbestos							
<b>B00E - R0009 - Staff - Toilet - 4.35 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0010 - Movement - 26.1 m2</b>							
No Asbestos							
<b>B00E - R0011 - Movement - 2.1 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00E - R0012 - Covered Area - 169.49 m2</b>							
No Asbestos							
<b>B00F - Technological &amp; Applied Studies - 1951 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	100m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Staff Study - 36.51 m2</b>							
No Asbestos							
<b>B00F - R0002 - Movement - 4.24 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0003 - Staff - Toilet - 3.88 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0004 - Computer Learning Space - 77.58 m2</b>							
No Asbestos							
<b>B00F - R0005 - Staff Study - 11.72 m2</b>							
No Asbestos							
<b>B00F - R0006 - General Storeroom - 7.95 m2</b>							
No Asbestos							
<b>B00F - R0007 - Materials Technology L.S. - 104.03 m2</b>							
No Asbestos							
<b>B00F - R0008 - Materials Store - 15.88 m2</b>							
No Asbestos							
<b>B00F - R0009 - Staff Study - 7.16 m2</b>							
No Asbestos							
<b>B00F - R0010 - Materials Store - 23.36 m2</b>							
No Asbestos							
<b>B00F - R0011 - Materials Technology L.S. - 140.43 m2</b>							
No Asbestos							
<b>B00F - R0012 - Materials Store - 14.7 m2</b>							
No Asbestos							
<b>B00F - R0013 - Staff Study - 7.21 m2</b>							
No Asbestos							
<b>B00F - R0014 - Materials Technology L.S. - 118.21 m2</b>							
No Asbestos							
<b>B00F - R0015 - Welding Area - 6.06 m2</b>							
No Asbestos							
<b>B00F - R0016 - Movement - 116.53 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	117m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0017 - Movement - 7.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - Technological &amp; Applied Studies/Computer Learning - 1956 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids	Non Accessible Area							
<b>Interior</b>								
<b>B00G - R0001 - Movement - 32.25 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G - R0002 - Materials Technology L.S. - 67.76 m2</b>								
No Asbestos								
<b>B00G - R0003 - General Storeroom - 6.65 m2</b>								
No Asbestos								
<b>B00G - R0004 - General Storeroom - 6.59 m2</b>								
No Asbestos								
<b>B00G - R0005 - Computer Resource - 13.39 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00G - R0006 - Design L.S. - 67.83 m2</b>								
No Asbestos								
<b>B00G - R0007 - Garden Store Room - 67.69 m2</b>								
No Asbestos								
<b>B00L - Library - 1985 - Brick/Block</b>								
<b>Exterior</b>								
Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
<b>Interior</b>								
<b>B00L - R0002 - Main Area - 396.69 m2</b>								
No Asbestos								
<b>B00L - R0003 - General Storeroom - 4.75 m2</b>								
No Asbestos								
<b>B00L - R0004 - Audio Visual Workroom - 34.29 m2</b>								
No Asbestos								
<b>B00L - R0005 - Workroom - 39.89 m2</b>								
No Asbestos								
<b>B00L - R0006 - Librarian - 11.91 m2</b>								
No Asbestos								
<b>B00L - R0007 - Pupil Entry - 16.31 m2</b>								
No Asbestos								
<b>B00L - R0009 - Distribution Board Cupboard - 1.22 m2</b>								
No Asbestos								
<b>B00L - R0010 - Staff - Toilet - 2.4 m2</b>								
No Asbestos								
<b>B00L - R0011 - Staff - Toilet - 2.44 m2</b>								
No Asbestos								
<b>B00L - R0012 - Seminar - 13.4 m2</b>								
No Asbestos								
<b>B00L - R0013 - Cleaning Store - Distributed - .91 m2</b>								
No Asbestos								
<b>B00L - R0014 - Seminar - 20.63 m2</b>								
No Asbestos								
<b>B00L - R0015 - Movement - 168.24 m2</b>								
No Asbestos								

Note: No inspection of live electrical installation

**B00M - General Learning - 1910 - Timber****Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

**Interior****B00M - R0001 - General Learning Space - 42.39 m2**

Floor Coverings Res/Textile	Vinyl Tiles	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------	-----------------------------

**B00M - R0002 - General Storeroom - 14.71 m2**

No Asbestos

**B00M - R0003 - Practical Activity Area - 29.32 m2**

No Asbestos

**B00M - R0004 - General Learning Space - 40.41 m2**

Floor Coverings Res/Textile	Vinyl Tiles	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------	-----------------------------

**B00N - Performing Arts - 2001 - Brick/Veneer****Exterior**

Eaves Linings	Flat AC Sheeting						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

**Interior****B00N - R0001 - Music Learning Space - 64.77 m2**

Floor Coverings Res/Textile	No Asbestos Found						
-----------------------------	-------------------	--	--	--	--	--	--

**B00N - R0002 - Performance Workshop - 65.49 m2**

Floor Coverings Res/Textile	No Asbestos Found						
-----------------------------	-------------------	--	--	--	--	--	--

**B00N - R0003 - Performing Arts Changeroom - 6.47 m2**

Wall Linings Internal	Flat AC Sheeting						
-----------------------	------------------	--	--	--	--	--	--

**B00N - R0004 - Music Store - 9.57 m2**

Floor Coverings Res/Textile	No Asbestos Found						
-----------------------------	-------------------	--	--	--	--	--	--

**B00N - R0005 - Performing Arts Changeroom - 6.5 m2**

Floor Coverings Res/Textile	No Asbestos Found						
-----------------------------	-------------------	--	--	--	--	--	--

**B00N - R0006 - Music Store - 10.98 m2**

Floor Coverings Res/Textile	No Asbestos Found						
-----------------------------	-------------------	--	--	--	--	--	--

**B00N - R0007 - Staff Study - 10.91 m2**

Floor Coverings Res/Textile	No Asbestos Found						
-----------------------------	-------------------	--	--	--	--	--	--

**B00N - R0008 - Movement - 2.92 m2**

Ceiling Structures/Linings	Flat AC Sheeting						
----------------------------	------------------	--	--	--	--	--	--

**B00O - Technological & Applied Studies - 2007 - Brick/Veneer****Exterior**

Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

**Interior****B00O - R0001 - Workshop Area - 235.12 m2**

No Asbestos



**B00P - Physical Education - 2009 - Brick/Veneer****Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B00P - R0001 - Gymnasium - 621.4 m2**

No Asbestos

**B00P - R0002 - First Aid - 12 m2**

No Asbestos

**B00P - R0003 - Large Equipment Store - 23.95 m2**

No Asbestos

**B00P - R0004 - Chair Store - 33.66 m2**

No Asbestos

**B00P - R0005 - Access Student Shower/Toilet/Change - 9.04 m2**

No Asbestos

**B00P - R0006 - Plant - .72 m2**

No Asbestos

**B00P - R0007 - Cleaning Store - Distributed - 3.09 m2**

No Asbestos

**B00P - R0008 - Change - 29.11 m2**

No Asbestos

**B00P - R0009 - Change - 29.11 m2**

No Asbestos

**B00P - R0010 - Distribution Board Cupboard - 1.22 m2****Note: No inspection of live electrical installation**

No Asbestos

**B00P - R0011 - External Movement - 67.75 m2**

No Asbestos

**B00P - R0012 - Plant - 1 m2**

No Asbestos

## Demountables

### OS 601 11814 - Learning Unit - Standard/Withdrawal - Placement Date : 26-APR-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 601 12887 - Learning Unit - Standard/Withdrawal - Placement Date : 13-JAN-2020

No Asbestos Found

### OS 601 12950 - Learning Unit - Standard/Withdrawal - Placement Date : 27-JUN-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 601 13235 - Learning Unit - Standard/Withdrawal - Placement Date : 18-SEP-2014

#### Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

#### Interior

##### R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

##### R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

##### R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

### OS 836 13701 - H Cap Shower/Change/Toilet - Placement Date : 15-NOV-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 620 15416 - Single Learning Unit - H/Cap - Placement Date : 30-JUN-1995

#### Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

#### Interior

##### R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

##### R2- Home Base-I.O.

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

##### R3- Disabled Shower/laundry

Toilet Partitions	Compressed AC Sheet	2m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos

### OS 730 15959 - Needlework Textile Learning/Str/Fitting - Placement Date : 22-JAN-2001

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 601 16809 - Learning Unit - Standard/Withdrawal - Placement Date : 15-NOV-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 600 19761 - Learning Unit - Small - Placement Date : 13-JAN-2020

**Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found