


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kyogle High School (8189)
Region:	North Coast AMU
State Electorate:	Lismore
Local Government Area:	Kyogle

Last Reviewed By:	WSP 24-FEB-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

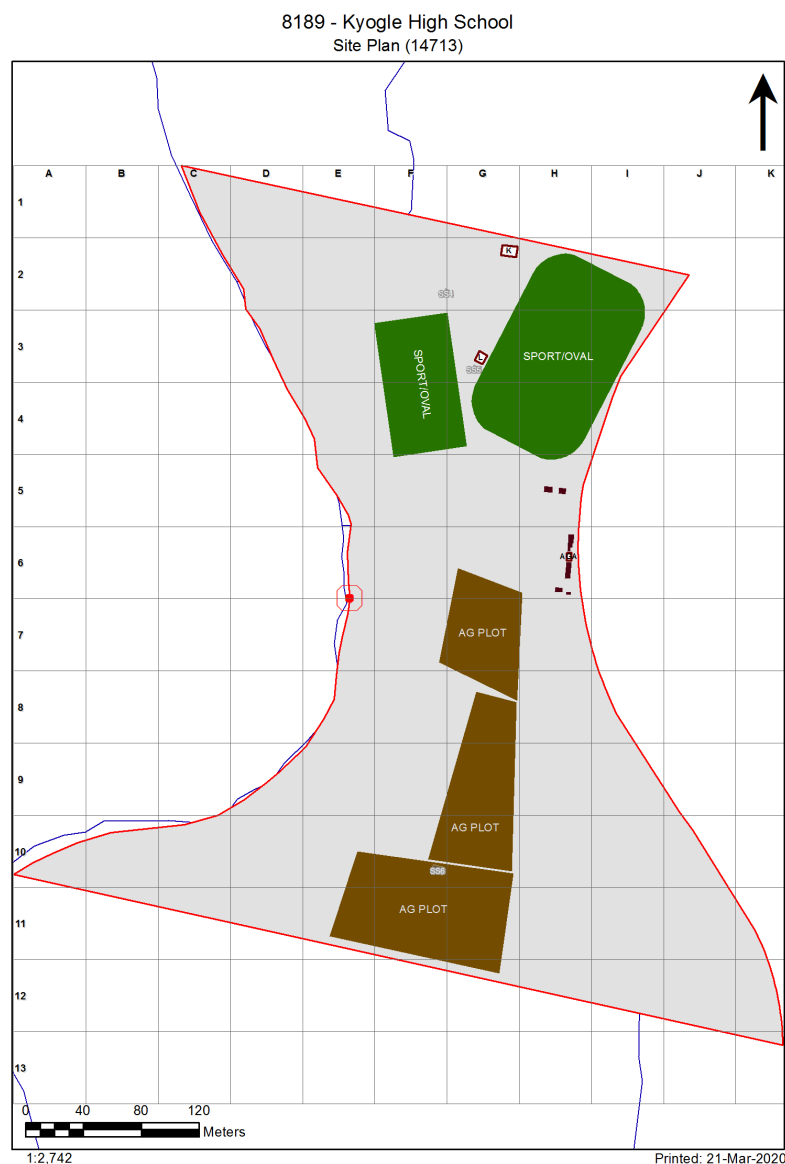

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1955 - Brick/Block							
Exterior							
Underfloor Voids	Packing	>1	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Secure Storeroom - 17.13 m2							
No Asbestos							
B00A - R0002 - Interview/Office - Type 1 - 13.87 m2							
No Asbestos							
B00A - R0003 - Administration - Clerical - 10.84 m2							
No Asbestos							
B00A - R0004 - Principal Office - 20.57 m2							
No Asbestos							
B00A - R0005 - Public Entry - 20.41 m2							
No Asbestos							
B00A - R0006 - Interview/Office - Type 1 - 9.78 m2							
No Asbestos							
B00A - R0007 - Administration - Clerical - 23.62 m2							
No Asbestos							
B00A - R0008 - Duplicating Workroom - 20.76 m2							
No Asbestos							
B00A - R0009 - Cleaning Store - Distributed - 3.65 m2							
No Asbestos							
B00A - R0010 - Distribution Board Cupboard - 1.32 m2							
No Asbestos							Note: No inspection of live electrical installation
B00A - R0011 - Deputy Principal Office - 16.9 m2							
No Asbestos							
B00A - R0012 - Commonroom - 85.43 m2							
No Asbestos							
B00A - R0013 - Staff - Toilet - 5.22 m2							
No Asbestos							
B00A - R0014 - Staff - Toilet - 5.36 m2							
No Asbestos							
B00A - R0015 - Movement - 64.5 m2							
No Asbestos							
B00A - R0016 - Clinic - Girls - 13.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0017 - Clinic-Toilets - 2.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0018 - Clinic - Boys - 13.19 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0019 - Clinic-Toilets - 2.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0020 - Movement - 7.26 m2							
No Asbestos							
B00A - R9001 - General Storeroom - 32.05 m2							

No Asbestos							
B00A - R9002 - Cleaning Store - Distributed - 6.09 m2							
No Asbestos							
B00A - R9003 - Movement - 6.24 m2							
No Asbestos							
B00B - Library/Science - 1955 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - Laboratory L.S. - 93.05 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0002 - Preparation - 48.8 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0004 - Distribution Board Cupboard - .47 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00B - R0006 - Movement - 2.55 m2							
No Asbestos							
B00B - R0007 - Laboratory L.S. - 93.06 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0008 - Computer Learning Space - 59.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0009 - Movement - 12.85 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0010 - Movement - 19.81 m2							
No Asbestos							
B00B - R0011 - Apparatus Store - 7.12 m2							
Ceiling Structures/Linings	No Asbestos Found						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0012 - Chemical Store - 7.07 m2							
Ceiling Structures/Linings	No Asbestos Found						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0013 - Stairs - 10.79 m2							
No Asbestos							
B00B - R0014 - Toilet - Lobby - 3.4 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0015 - Staff - Toilet - 1.77 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1001 - Staff Study - 12.96 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1002 - Study Space - 12.92 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1003 - Audio Visual Workroom - 12.92 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1004 - Duplicating Workroom - 12.81 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1006 - Distribution Board Cupboard - .77 m2								
Note: No inspection of live electrical installation								
No Asbestos								
B00B - R1008 - Main Area - 245.38 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)							
B00B - R1010 - Librarian - 5.87 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1011 - Workroom - 18.75 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1012 - Movement - 19.82 m2								
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R1013 - Stairs - 4.29 m2								
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00B - R1014 - Toilet - Lobby - 1.7 m2								
No Asbestos								
B00B - R1015 - Toilets-Unisex - 1.31 m2								
No Asbestos								
B00B - R1016 - Toilets-Unisex - 1.27 m2								
No Asbestos								
B00B - R1017 - Toilet - Lobby - 2 m2								
No Asbestos								
B00B - R1018 - Cleaning Supplies Store - 2.49 m2								
No Asbestos								
B00C - General Learning - 1962 - Brick/Block								
Exterior								
Underfloor Voids	Flat AC Sheeting	>1	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	AC Fragments/Debris - Flat AC Sheet							
Ceiling Voids	No Asbestos Found							
Interior								
B00C - R0001 - Movement - 57.94 m2								
No Asbestos								
B00C - R0002 - General Learning Space - 53.37 m2								
No Asbestos								
B00C - R0003 - General Learning Space - 53.3 m2								
No Asbestos								
B00C - R0004 - Movement - 27 m2								
No Asbestos								
B00C - R0005 - Cleaning Store - Distributed - 6.74 m2								
No Asbestos								

B00C - R0008 - Movement - 29.02 m2							
No Asbestos							
B00C - R0009 - Stairs - .78 m2							
No Asbestos							
B00C - R0010 - External Movement - 12.18 m2							
No Asbestos							
B00C - R1001 - General Learning Space - 54.01 m2							
No Asbestos							
B00C - R1002 - General Learning Space - 53.37 m2							
No Asbestos							
B00C - R1003 - Leading Teacher - 9.45 m2							
No Asbestos							
B00C - R1004 - Movement - 69.52 m2							
No Asbestos							
B00C - R1005 - Stairs - 13.64 m2							
No Asbestos							
B00D - General Learning - 1955 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris - Vinyl Floor Tile	1	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B00D - R0001 - General Learning Space - 50.3 m2							
No Asbestos							
B00D - R0002 - General Learning Space - 50.29 m2							
No Asbestos							
B00D - R0003 - Study Space - 17.87 m2							
No Asbestos							
B00D - R0004 - Staff Study - 39.62 m2							
No Asbestos							
B00D - R0006 - General Learning Space - 50.3 m2							
No Asbestos							
B00D - R0007 - General Learning Space - 50.29 m2							
No Asbestos							
B00D - R0008 - General Learning Space - 50.29 m2							
No Asbestos							
B00D - R0009 - General Learning Space - 50.3 m2							
No Asbestos							
B00D - R0010 - Distribution Board Cupboard - .93 m2							
No Asbestos							
B00D - R0011 - Resources Store - 10.11 m2							
No Asbestos							
B00D - R0012 - General Storeroom - 17.74 m2							
No Asbestos							
B00D - R0013 - Movement - 177.56 m2							
No Asbestos							
B00D - R0014 - Stairs - 18.1 m2							
No Asbestos							
B00D - R0015 - Stairs - 6.09 m2							
No Asbestos							

Note: No inspection of live electrical installation

B00D - R0016 - Movement - 19.91 m2		
No Asbestos		
B00D - R0017 - Staff - Toilet - 9.09 m2		
No Asbestos		
B00D - R0018 - Toilet - Lobby - 2.81 m2		
No Asbestos		
B00D - R1001 - General Learning Space - 50.37 m2		
No Asbestos		
B00D - R1002 - Preparation - 20.36 m2		
No Asbestos		
B00D - R1003 - Laboratory L.S. - 79.82 m2		
No Asbestos		
B00D - R1004 - General Learning Space - 50.38 m2		
No Asbestos		
B00D - R1006 - Staff Study - 39.87 m2		
No Asbestos		
B00D - R1007 - Staff Study - 21.15 m2		
No Asbestos		
B00D - R1008 - Computer Learning Space - 60.17 m2		
No Asbestos		
B00D - R1009 - Resources Store - 6.95 m2		
No Asbestos		
B00D - R1010 - Computer Resource - 13.79 m2		
No Asbestos		
B00D - R1011 - Resources Store - 17.25 m2		
Floor Coverings Res/Textile	Vinyl Tiles	
B00D - R1012 - Movement - 170.66 m2		
No Asbestos		
B00D - R1013 - Resources Store - 12.61 m2		
No Asbestos		
B00D - R1014 - Cleaning Store - Distributed - 4.48 m2		
No Asbestos		
B00D - R1015 - Stairs - 13.98 m2		
No Asbestos		
B00D - R1016 - Stairs - 12.92 m2		
No Asbestos		
B00D - R1017 - Staff - Toilet - 9.12 m2		
No Asbestos		
B00D - R1018 - Toilet - Lobby - 2.82 m2		
No Asbestos		
B00D - R9001 - Movement - 15.12 m2		
No Asbestos		
B00D - R9002 - Stairs - 6.68 m2		
No Asbestos		
B00E - General Learning - 1966 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Window	Mastic	
Interior		
B00E - R0001 - Cleaning Store - Distributed - 12.92 m2		

No Asbestos							
B00E - R0002 - Shower/Change - 33.83 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0003 - Staff Study - 5.27 m2							
No Asbestos							
B00E - R0004 - Staff Shower - 2.69 m2							
No Asbestos							
B00E - R0005 - Staff Study - 5.27 m2							
No Asbestos							
B00E - R0006 - Staff Shower - 2.67 m2							
No Asbestos							
B00E - R0007 - Sport Equipment Store - 15.9 m2							
No Asbestos							
B00E - R0008 - Sport Equipment Store - 19.54 m2							
No Asbestos							
B00E - R0009 - Cleaning Store - Distributed - 7.61 m2							
No Asbestos							
B00E - R0010 - Shower/Change - 34.36 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0011 - Darkroom Space - 25.16 m2							
No Asbestos							
B00E - R0012 - Gymnasium - 120.43 m2							
No Asbestos							
B00E - R0013 - General Storeroom - 25.89 m2							
No Asbestos							
B00E - R0014 - Sport Equipment Store - 6.16 m2							
No Asbestos							
B00E - R0015 - External Movement - 124.33 m2							
No Asbestos							
B00E - R0016 - Apparatus Store - 7.44 m2							
No Asbestos							
B00E - R0017 - Stairs - 2.41 m2							
No Asbestos							
B00E - R0018 - Stairs - 7.61 m2							
No Asbestos							
B00E - R0019 - External Movement - 5.43 m2							
No Asbestos							
B00E - R0020 - Lift - 3.21 m2							
No Asbestos							
B00E - R1001 - General Learning Space - 52.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1002 - Staff Study - 12.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1003 - Staff Study - 12.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1004 - Resources Store - 12.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1005 - Staff Study - 12.74 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Window	Mastic	
B00E - R1007 - Preparation - 28.11 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1008 - Preparation - 9.65 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1009 - Laboratory L.S. - 86.05 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00E - R1010 - Distribution Board Cupboard - .65 m2		Note: No inspection of live electrical installation
No Asbestos		
B00E - R1013 - External Stairs - 6.23 m2		
No Asbestos		
B00E - R1017 - Art Learning Space - 66.71 m2		
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1018 - Store - 18.27 m2		
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1019 - External Movement - 137.87 m2		
No Asbestos		
B00E - R1020 - Stairs - 5.06 m2		
No Asbestos		
B00E - R1021 - Stairs - 5.06 m2		
No Asbestos		
B00E - R1022 - External Movement - 5.19 m2		
No Asbestos		
B00E - R2001 - Music Learning Space - 51.97 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2002 - Resources Store - 9.19 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2003 - Cleaning Store - Distributed - 3.1 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2004 - Interview/Office - Type 1 - 25.99 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R2005 - Resources Store - 6.15 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2006 - Staff - Toilet - 6.12 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2007 - General Learning Space - 51.9 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2008 - Resources Store - 5.5 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2009 - Distribution Board Cupboard - .58 m2		Note: No inspection of live electrical installation
No Asbestos		

B00E - R2010 - Art Learning Space - 59.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R2011 - Resources Store - 6.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R2012 - Art Learning Space - 52.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R2013 - Kiln Space - 21.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R2014 - External Movement - 128.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting	129m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R2015 - Resources Store - 10.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R2016 - Stairs - 14.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R2017 - Stairs - 14.08 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	East, Lower portion	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R2018 - External Movement - 5.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - Multi Purpose Facilities - 1992 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris - Flat AC Sheet	1	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00H - R0001 - Pupil Entry - 36.77 m2							
No Asbestos							
B00H - R0002 - Movement - 2.69 m2							
No Asbestos							
B00H - R0003 - Control Room - 5.71 m2							
No Asbestos							
B00H - R0004 - Multi-Purpose Space - 245.96 m2							
No Asbestos							
B00H - R0005 - Toilets-Boys - 8.37 m2							
No Asbestos							
B00H - R0006 - Toilets-Girls - 10.8 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00H - R0007 - Stage - 77.47 m2							
No Asbestos							
B00H - R0008 - Resources Store - 2.86 m2							
No Asbestos							
B00H - R0009 - Cleaning Store - Distributed - 2.29 m2							
No Asbestos							
B00H - R0011 - Chair Store - 23.84 m2							

No Asbestos							
B00H - R0012 - Movement - 21.81 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R0014 - Movement - 9.24 m2							
No Asbestos							
B00H - R0016 - Ramp - 6.11 m2							
No Asbestos							
B00H - R0017 - Movement - 8.52 m2							
No Asbestos							
B00H - R0018 - Performance Workshop - 10.43 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R0019 - Audio Visual Workroom - 8.01 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R0020 - Seminar Space - 18.77 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R0021 - Seminar Space - 23.96 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00H - R9001 - General Storeroom - 51.56 m2							
No Asbestos							
B00H - R9002 - Plant Space - 11.8 m2							
No Asbestos							
B00H - R9003 - Ramp - 3.1 m2							
No Asbestos							
B00I - Building Services - 2005 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - Maintenance Bulk Store - 5.2 m2							
No Asbestos							
B00K - Pupil Facilities - 2005 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	8m2	East and West	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00K - R0001 - Movement - 8.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0002 - Toilets - Girls - 21.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0003 - Cleaning Distributed Store - .73 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0004 - Toilets - Boys - 22.78 m2							

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00K - R0005 - Movement - 8.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - Pupil Facilities - 2005 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00L - R0003 - Canteen Office/Store - 5.58 m2							
No Asbestos							
B00L - R0004 - Canteen Office/Store - 5.26 m2							
No Asbestos							
B00L - R0005 - External Movement - 11.95 m2							
No Asbestos							
B00L - R0006 - Canteen - 15.08 m2							
No Asbestos							
B00N - Building Services - 2008 - Metal Shed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00N - R0001 - General Assistants - 16.65 m2							
No Asbestos							
B00O - Other - 2013 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00O - R0001 - External Movement - 177.45 m2							
No Asbestos							
B00O - R0002 - Student Canteen - 44.45 m2							
No Asbestos							
B00O - R0003 - Office/Store - 4.69 m2							
No Asbestos							
B00O - R0004 - Toilets-Girls - 24.44 m2							
No Asbestos							
B00O - R0005 - Toilets-Disabled - 5.75 m2							
No Asbestos							
B00O - R0006 - Toilets-Boys - 26.38 m2							
No Asbestos							
B00O - R0007 - Vending Machines - 2.74 m2							
No Asbestos							
B00O - R0008 - Distribution Board Cupboard - .99 m2							
No Asbestos							Note: No inspection of live electrical installation

B00O - R0009 - Other - 8.04 m2	
No Asbestos	
B00O - R0010 - Toilet - Lobby - 3.93 m2	
No Asbestos	
B00O - R0011 - Handwashing Facilities - 8.52 m2	
No Asbestos	
B00O - R0012 - Toilet - Lobby - 4.05 m2	
No Asbestos	
B00P - Technological & Applied Studies - 2013 - Brick/Veneer	
Exterior	
Ceiling Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Interior	
B00P - R0001 - General Storeroom - 24.16 m2	
No Asbestos	
B00P - R0002 - Dust Extraction Space - 9.21 m2	
No Asbestos	
B00P - R0003 - L.P.G. Store - 3.18 m2	
No Asbestos	
B00P - R0004 - Plant - 1.63 m2	
No Asbestos	
B00P - R1001 - Wood Technology Bay - 126.02 m2	
No Asbestos	
B00P - R1002 - General Learning Space - Type 9 - 59.82 m2	
No Asbestos	
B00P - R1003 - Staff Study - 38.84 m2	
No Asbestos	
B00P - R1004 - Access Staff Shower/Toilet - 8.14 m2	
No Asbestos	
B00P - R1005 - Main Switch Board Cupboard - 8.2 m2	
No Asbestos	
B00P - R1006 - External Stairs - 11.24 m2	
No Asbestos	
B00P - R1007 - Workshop Area - 82.39 m2	
No Asbestos	
B00P - R1008 - Materials Store - 60.55 m2	
No Asbestos	
B00P - R1009 - Kiln Space - 10.31 m2	
No Asbestos	
B00P - R1010 - Project Store - Type 1 - 9.71 m2	
No Asbestos	
B00P - R1011 - Welding Area - 11.89 m2	
No Asbestos	
B00P - R1012 - Pottery Store - 7.43 m2	
No Asbestos	
B00P - R1013 - Seminar - Type 2 - 18.44 m2	
No Asbestos	
B00P - R1014 - Metal Technology Bay - 119.32 m2	

No Asbestos	
B00P - R1015 - Materials Store - 19.17 m2	
No Asbestos	
B00P - R1016 - External Movement - 79.48 m2	
No Asbestos	
B00P - R1017 - Distribution Board Cupboard - 1.19 m2	Note: No inspection of live electrical installation
No Asbestos	
B00P - R1018 - Distribution Board Cupboard - .71 m2	Note: No inspection of live electrical installation
No Asbestos	
B00P - R1019 - External Stairs - 14.15 m2	
No Asbestos	
B00P - R1020 - Movement - 11.93 m2	
No Asbestos	
B00P - R2001 - Kitchen - Type 1 - 127.32 m2	
No Asbestos	
B00P - R2002 - Seminar - 18.88 m2	
No Asbestos	
B00P - R2003 - Materials Store - 18.73 m2	
No Asbestos	
B00P - R2004 - General Learning Space - Type 7 - 69.49 m2	
No Asbestos	
B00P - R2005 - General Learning Space - Type 6 - 57.82 m2	
No Asbestos	
B00P - R2006 - Preparation - Materials - 23.33 m2	
No Asbestos	
B00P - R2007 - Pantry - 17.51 m2	
No Asbestos	
B00P - R2008 - Laundry - 6.79 m2	
No Asbestos	
B00P - R2009 - Movement - 28.58 m2	
No Asbestos	
B00P - R2010 - Food/Research Space - 38.13 m2	
No Asbestos	
B00P - R2011 - Materials Store - 18.05 m2	
No Asbestos	
B00P - R2012 - Pantry - 12.07 m2	
No Asbestos	
B00P - R2013 - Kitchen - Type 2 - 123.34 m2	
No Asbestos	
B00P - R2014 - Preparation - Materials - 14.64 m2	
No Asbestos	
B00P - R2015 - External Movement - 81.77 m2	
No Asbestos	
B00P - R2016 - External Stairs - 6.9 m2	
No Asbestos	
B00P - R2017 - External Stairs - 14.76 m2	
No Asbestos	
B00P - R2018 - Distribution Board Cupboard - .57 m2	Note: No inspection of live electrical installation
No Asbestos	
B00P - R2019 - Distribution Board Cupboard - .77 m2	Note: No inspection of live electrical installation
No Asbestos	
B00P - R2020 - Communications Cupboard - 2.06 m2	

No Asbestos							
B00P - R2021 - Movement - 11.93 m2							
No Asbestos							
B00P - R2022 - External Movement - 8.65 m2							
No Asbestos							
B00Q - Storage - 2018 - Metal Shed							
Exterior							
Require Inspection							
Interior							
B00Q - R0001 - General Storeroom - 44.85 m2							
Require Inspection							
B0AG - Agricultural Science - 1955 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B0AG - R0001 - Machine Storage - 89.05 m2							
No Asbestos							
B0AG - R0002 - General Storeroom - 8.47 m2							
No Asbestos							
B0AG - R0003 - Machine Storage - 20.94 m2							
No Asbestos							
B0AG - R0004 - General Storeroom - 12.44 m2							
No Asbestos							
B0AG - R0005 - Staff Change - 8.41 m2							
No Asbestos							
BAGA - Agricultural Science - 2008 - Metal Shed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
BAGA - R0001 - Growing/Breeding - 15.14 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	North and East	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)	Chrysotile (white asbestos)

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020