


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Kingsgrove North High School (8221)</b>
<b>Region:</b>	<b>Sydney AMU</b>
<b>State Electorate:</b>	<b>Canterbury</b>
<b>Local Government Area:</b>	<b>Canterbury-Bankstown</b>

<b>Last Reviewed By:</b>	<b>Greencap 13-AUG-2014</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

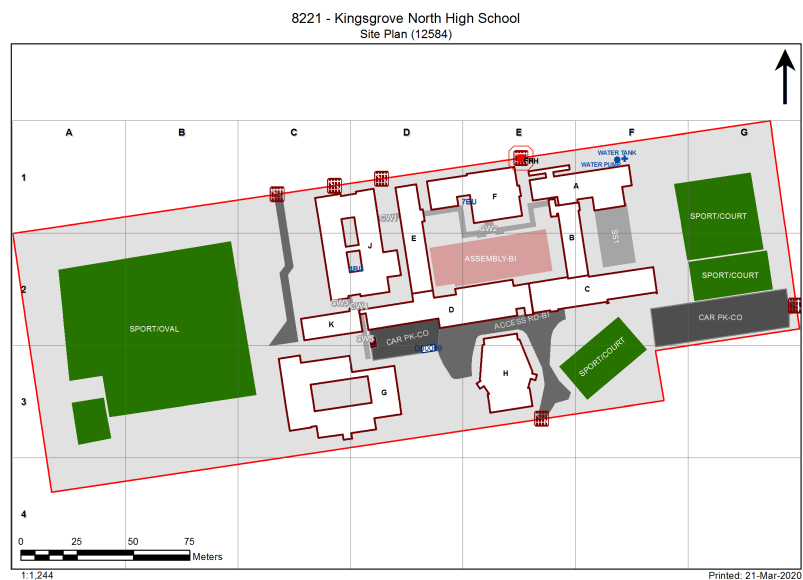

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/General Learning - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - General Learning Space - 54.9 m2</b>							
No Asbestos							
<b>B00A - R0002 - Computer Store - 8.87 m2</b>							
No Asbestos							
<b>B00A - R0003 - General Learning Space - 64.94 m2</b>							
No Asbestos							
<b>B00A - R0004 - General Learning Space - 48.74 m2</b>							
No Asbestos							
<b>B00A - R0012 - Administration - Clerical - 15.16 m2</b>							
No Asbestos							
<b>B00A - R0015 - Movement - 17.59 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0016 - Distribution Board Cupboard - .85 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00A - R0020 - Interview/Office - Type 1 - 10.34 m2</b>							
No Asbestos							
<b>B00A - R0021 - Interview/Office - Type 1 - 14.03 m2</b>							
No Asbestos							
<b>B00A - R0023 - General Storeroom - 8.66 m2</b>							
No Asbestos							
<b>B00A - R0024 - Staff Kitchen - 5.72 m2</b>							
No Asbestos							
<b>B00A - R0025 - Deputy Principal Office - 17.14 m2</b>							
No Asbestos							
<b>B00A - R0026 - Principal Office - 24.73 m2</b>							
No Asbestos							
<b>B00A - R0027 - Deputy Principal Office - 13.51 m2</b>							
Plant / Equipment - Air Conditioning Unit	Flat AC Sheeting						
<b>B00A - R0028 - External Movement - 55.13 m2</b>							
No Asbestos							
<b>B00A - R0029 - Covered Area - 82.45 m2</b>							
No Asbestos							
<b>B00A - R0031 - External Movement - 43.32 m2</b>							
Require Inspection							
<b>B00A - R0032 - Movement - 30.81 m2</b>							
Require Inspection							
<b>B00A - R0033 - Public Reception - 21.36 m2</b>							
Require Inspection							
<b>B00A - R0034 - Administration - Clerical - 49.62 m2</b>							
Require Inspection							

<b>B00A - R1001 - Design L.S. - 65.67 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1002 - Materials Store - 6 m2</b>							
No Asbestos							
<b>B00A - R1003 - Materials Store - 12.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1004 - Design L.S. - 64.65 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1005 - Materials Store - 6.11 m2</b>							
No Asbestos							
<b>B00A - R1006 - General Learning Space - 65.01 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1007 - General Learning Space - 51.65 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	52m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1008 - General Learning Space - 65.09 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1009 - Movement - 55.4 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00B - General Learning/Administration - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Movement - 72.13 m2</b>							
No Asbestos							
<b>B00B - R0002 - Clinic - Boys - 11.78 m2</b>							
No Asbestos							
<b>B00B - R0003 - Clinic-Toilets - 6.56 m2</b>							
No Asbestos							
<b>B00B - R0004 - Staff Study - 45.91 m2</b>							
No Asbestos							
<b>B00B - R0005 - Clinic - Girls - 16.54 m2</b>							
No Asbestos							
<b>B00B - R0006 - Staff Study - 22.49 m2</b>							
No Asbestos							
<b>B00B - R0007 - Staff Kitchen - 10.37 m2</b>							
No Asbestos							
<b>B00B - R0008 - Staff Study - 27.68 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0009 - Distribution Board Cupboard - .89 m2</b>							<b>Note: No inspection of live electrical installation</b>
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0010 - Staff Study - 18.57 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0011 - Staff - Toilet - 6.13 m2</b>							
No Asbestos							
<b>B00B - R0012 - Duplicating Workroom - 25.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0013 - Staff - Toilet - 10.08 m2</b>							
No Asbestos							
<b>B00B - R0014 - Stairs - 5.02 m2</b>							
No Asbestos							
<b>B00B - R0015 - External Movement - 21.1 m2</b>							
No Asbestos							
<b>B00B - R1001 - Movement - 65.64 m2</b>							
No Asbestos							
<b>B00B - R1002 - Computer Learning Space - 52.15 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1003 - Computer Learning Space - 65.3 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1004 - Computer Learning Space - 65.37 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1005 - General Storeroom - 3.08 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1006 - Staff Study - 19.27 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1007 - Stairs - 12.29 m2</b>							
No Asbestos							
<b>B00C - General Learning/Technological &amp; Applied Studies - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0002 - Distribution Board Cupboard - .26 m2</b>							<b>Note: No inspection of live electrical installation</b>

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0003 - General Storeroom - 9.49 m2</b>							
No Asbestos							
<b>B00C - R0004 - General Learning Space - 56.51 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R0005 - General Storeroom - 8.47 m2</b>							
No Asbestos							
<b>B00C - R0006 - General Storeroom - 8.5 m2</b>							
No Asbestos							
<b>B00C - R0007 - Special Learning Space - 56.65 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North above door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R0008 - Movement - 34.62 m2</b>							
No Asbestos							
<b>B00C - R0009 - Staff Study - 22.44 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R0010 - Food Technology L.S. - 64.3 m2</b>							
No Asbestos							
<b>B00C - R0011 - Food/Research Space - 24.28 m2</b>							
Plant / Equipment - Boiler	Fibre Cement Pipe	3	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0012 - Distribution Board Cupboard - .92 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0013 - Movement - 12.47 m2</b>							
No Asbestos							
<b>B00C - R0014 - Food Technology L.S. - 98.64 m2</b>							
No Asbestos							
<b>B00C - R0015 - Laundry - 4.03 m2</b>							
No Asbestos							
<b>B00C - R0016 - Pantry - 13.45 m2</b>							
No Asbestos							
<b>B00C - R0017 - Toilets-Girls - 64.39 m2</b>							
No Asbestos							
<b>B00C - R0018 - Movement - 5.92 m2</b>							
No Asbestos							
<b>B00C - R0019 - External Movement - 22.27 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00C - R0020 - Movement - 18.52 m2</b>							
No Asbestos							
<b>B00C - R0021 - External Movement - 75.93 m2</b>							
No Asbestos							
<b>B00C - R0022 - Movement - 2.09 m2</b>							

No Asbestos							
<b>B00C - R0023 - Movement - 12.7 m2</b>							
No Asbestos							
<b>B00C - R0024 - Staff Kitchen - 13.16 m2</b>							
No Asbestos							
<b>B00C - R1001 - General Storeroom - 12.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R1002 - General Learning Space - 51.93 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R1003 - General Learning Space - 52.08 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R1004 - General Learning Space - 65.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R1005 - General Learning Space - 65.28 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R1007 - Movement - 50.33 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00C - R1018 - External Movement - 2.56 m2</b>							
No Asbestos							
<b>B00D - General Learning/Pupil Facilities - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - Movement - 57.56 m2</b>							
No Asbestos							
<b>B00D - R0002 - Staff - Toilet - 6.57 m2</b>							
No Asbestos							
<b>B00D - R0003 - General Storeroom - 38.35 m2</b>							
No Asbestos							
<b>B00D - R0004 - Senior Study - 69.02 m2</b>							
No Asbestos							
<b>B00D - R0005 - Student Drinking Facilities - 183.56 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00D - R0006 - Movement - 61.69 m2</b>							
No Asbestos							
<b>B00D - R0007 - Toilets-Boys - 64.09 m2</b>							
No Asbestos							
<b>B00D - R0008 - Cleaning Supplies Store - 17.82 m2</b>							
No Asbestos							
<b>B00D - R0009 - Distribution Board Cupboard - .81 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

<b>B00D - R0010 - Chemical Store - 18.82 m2</b>							
No Asbestos							
<b>B00D - R0011 - No Access - 6.75 m2</b>							
No Asbestos							
<b>B00D - R0012 - Laboratory L.S. - 42.19 m2</b>							
Plant / Equipment - Fume Cupboard	Fibre Cement Pipe	4	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R0013 - Laboratory L.S. - 93.85 m2</b>							
No Asbestos							
<b>B00D - R0014 - Preparation - 23.78 m2</b>							
No Asbestos							
<b>B00D - R0015 - Apparatus Store - 13.76 m2</b>							
No Asbestos							
<b>B00D - R0016 - Student Canteen - 51.03 m2</b>							
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0017 - Staff - Toilet - 1.52 m2</b>							
No Asbestos							
<b>B00D - R0018 - Office/Store - 2.82 m2</b>							
No Asbestos							
<b>B00D - R0019 - Office/Store - 3.19 m2</b>							
No Asbestos							
<b>B00D - R0020 - Office/Store - 15.17 m2</b>							
No Asbestos							
<b>B00D - R0023 - External Movement - 62.79 m2</b>							
No Asbestos							
<b>B00D - R0024 - Movement - 30.74 m2</b>							
No Asbestos							
<b>B00D - R0025 - Store - 1.64 m2</b>							
No Asbestos							
<b>B00D - R0026 - Stairs - 4.37 m2</b>							
No Asbestos							
<b>B00D - R0027 - External Movement - 3.84 m2</b>							
No Asbestos							
<b>B00D - R0028 - No Access - 1.28 m2</b>							
No Asbestos							
<b>B00D - R0029 - Stairs - 3.88 m2</b>							
No Asbestos							
<b>B00D - R1002 - Interview/Office - Type 1 - 12.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1003 - General Learning Space - 52.07 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1004 - General Learning Space - 51.86 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1005 - General Storeroom - 11.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)



<b>B00D - R1006 - General Storeroom - 17.06 m2</b>							
No Asbestos							
<b>B00D - R1007 - Study Space - 15.93 m2</b>							
No Asbestos							
<b>B00D - R1008 - General Learning Space - 51.92 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1009 - General Learning Space - 51.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1010 - General Storeroom - 17.67 m2</b>							
No Asbestos							
<b>B00D - R1011 - Cleaning Store - Distributed - .54 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R1012 - General Storeroom - 3.3 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R1013 - General Learning Space - 65.58 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1014 - General Storeroom - 8.87 m2</b>							
No Asbestos							
<b>B00D - R1015 - General Storeroom - 8.87 m2</b>							
No Asbestos							
<b>B00D - R1016 - General Learning Space - 51.86 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1017 - Stairs - 15.54 m2</b>							
No Asbestos							
<b>B00D - R1018 - Stairs - 13.85 m2</b>							
No Asbestos							
<b>B00D - R1019 - Movement - 173 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00D - R1020 - Handwashing Facilities - .87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00E - General Learning/Science Learning - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Music Learning Space - 81.2 m2</b>							
No Asbestos							

B00E - R0002 - Distribution Board Cupboard - .64 m2							Note: No inspection of live electrical installation
No Asbestos							
B00E - R0003 - Cleaning Store - Distributed - .6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0004 - Movement - 5.21 m2							
No Asbestos							
B00E - R0005 - Laboratory L.S. - 87.4 m2							
No Asbestos							
B00E - R0006 - Preparation - 24.59 m2							
No Asbestos							
B00E - R0009 - Movement - 10.31 m2							
No Asbestos							
B00E - R0011 - Movement - 2.89 m2							
No Asbestos							
B00E - R0012 - Music Store - 6.04 m2							
No Asbestos							
B00E - R0013 - Music Store - 6.05 m2							
No Asbestos							
B00E - R0015 - External Movement - 6.31 m2							
No Asbestos							
B00E - R0016 - Stairs - 10.92 m2							
No Asbestos							
B00E - R0017 - No Access - 2.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B00E - R0018 - Laboratory L.S. - 93.9 m2							
No Asbestos							
B00E - R0019 - Movement - 39.66 m2							
No Asbestos							
B00E - R0020 - Movement - 40.97 m2							
No Asbestos							
B00E - R1001 - Music Learning Space - 65.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1002 - Music Learning Space - 52.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1003 - Cleaning Store - Distributed - .83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00E - R1004 - Distribution Board Cupboard - .83 m2							Note: No inspection of live electrical installation
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00E - R1005 - Music Store - 9.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1006 - Staff Study - 8.91 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1007 - Staff Study - 19.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1008 - General Learning Space - 38.96 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1009 - General Learning Space - 52.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1010 - General Learning Space - 52.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1011 - Staff Study - 20.96 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1012 - General Storeroom - 2.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1013 - Movement - 76.2 m2</b>							
No Asbestos							
<b>B00E - R1015 - Stairs - 14.36 m2</b>							
No Asbestos							
<b>B00F - Library/Staff Facilities - 1991 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - M1001 - Plant - 18.57 m2</b>							
No Asbestos							
<b>B00F - M1002 - Plant - 25.53 m2</b>							
No Asbestos							
<b>B00F - M1003 - Plant - 6.49 m2</b>							
No Asbestos							
<b>B00F - R0001 - Main Area - 206.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00F - R0002 - Cleaning Store - Distributed - 4.32 m2</b>							
No Asbestos							
<b>B00F - R0003 - Main Switchroom - 4.65 m2</b>							
No Asbestos							
<b>B00F - R0004 - Staff - Toilet - 3.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00F - R0005 - Workroom - 50.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00F - R0006 - Librarian - 16.09 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00F - R0007 - Staff - Toilet - 3.87 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00F - R0008 - General Storeroom - 7.8 m2</b>								
No Asbestos								
<b>B00F - R0009 - Audio Visual Workroom - 47.59 m2</b>								
No Asbestos								
<b>B00F - R0010 - General Storeroom - 2.9 m2</b>								
No Asbestos								
<b>B00F - R0011 - Commonroom - 142.42 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )							
<b>B00F - R0012 - Staff - Toilet - 6.04 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R0013 - Staff - Toilet - 5.59 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - R0014 - Distribution Board Cupboard - .52 m2</b>								
						<b>Note: No inspection of live electrical installation</b>		
No Asbestos								
<b>B00F - R0015 - Toilets-Girls - 15.02 m2</b>								
No Asbestos								
<b>B00F - R0016 - Cleaning Supplies Store - 13.51 m2</b>								
No Asbestos								
<b>B00F - R0017 - Movement - 59.63 m2</b>								
No Asbestos								
<b>B00F - R0018 - Movement - 12.72 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00F - R0019 - Stairs - .72 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00F - R0020 - Stairs - .38 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00F - R0021 - External Movement - 3.31 m2</b>								
No Asbestos								
<b>B00F - R1001 - Seminar - 16.33 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00F - R1002 - Seminar - 16.69 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00F - R1003 - Staff Study - 16.61 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00F - R1004 - Seminar - 16.73 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00F - R1005 - Seminar - 16.33 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							

<b>B00F - R1006 - Main Area - 204.37 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )	
<b>B00F - R1007 - Cleaning Store - Distributed - 1.59 m2</b>		
No Asbestos		
<b>B00F - R1008 - Distribution Board Cupboard - 1.59 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00F - R1009 - Seminar - 12.57 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00F - R1010 - Seminar - 12.06 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00F - R1011 - Stairs - 3.98 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00F - R1012 - Stairs - 3.98 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00G - Technological &amp; Applied Studies - 1976 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids - Raked Ceiling	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00G - R0001 - Design L.S. - 56.27 m2</b>		
Wall Linings Internal	Flat AC Sheeting	
<b>B00G - R0002 - Staff Study - 28.42 m2</b>		
Wall Linings Internal	Flat AC Sheeting	
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00G - R0003 - Staff - Toilet - 4.79 m2</b>		
No Asbestos		
<b>B00G - R0004 - Distribution Board Cupboard - .35 m2</b>		<b>Note: No inspection of live electrical installation</b>
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00G - R0005 - Resource/Project Store - 26.72 m2</b>		
Wall Linings Internal	Flat AC Sheeting	
<b>B00G - R0006 - Design L.S. - 56.36 m2</b>		
Wall Linings Internal	Flat AC Sheeting	
<b>B00G - R0007 - Materials Technology L.S. - 91.02 m2</b>		
No Asbestos		
<b>B00G - R0008 - Wood Technology Bay - 33.81 m2</b>		
No Asbestos		
<b>B00G - R0009 - Materials Technology L.S. - 91.03 m2</b>		
No Asbestos		
<b>B00G - R0010 - Resource/Project Store - 13.5 m2</b>		
Wall Linings Internal	Flat AC Sheeting	
<b>B00G - R0011 - Distribution Board Cupboard - 1.04 m2</b>		<b>Note: No inspection of live electrical installation</b>
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00G - R0012 - Cleaning Store - Distributed - 1.01 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	

<b>B00G - R0013 - Welding Store - 15.21 m2</b>							
No Asbestos							
<b>B00G - R0014 - Materials Technology L.S. - 91.02 m2</b>							
No Asbestos							
<b>B00G - R0015 - Metal Technology Bay - 37.34 m2</b>							
No Asbestos							
<b>B00G - R0016 - Materials Technology L.S. - 91.02 m2</b>							
No Asbestos							
<b>B00G - R0017 - Welding Store - 13.87 m2</b>							
No Asbestos							
<b>B00G - R0018 - Materials Store - 31.61 m2</b>							
No Asbestos							
<b>B00G - R0019 - Materials Technology L.S. - 70.62 m2</b>							
No Asbestos							
<b>B00G - R0020 - Movement - 6.09 m2</b>							
No Asbestos							
<b>B00G - R0021 - Welding Store - 2.98 m2</b>							
No Asbestos							
<b>B00G - R0022 - L.P.G Store - 1.07 m2</b>							
No Asbestos							
<b>B00G - R0023 - Materials Technology L.S. - 49.5 m2</b>							
No Asbestos							
<b>B00G - R0027 - Dust Extraction Space - 9.9 m2</b>							
No Asbestos							
<b>B00G - R0028 - Movement - 279.95 m2</b>							
No Asbestos							
<b>B00H - Multi Purpose Facilities - 1961 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - M0001 - Control Room - 5 m2</b>							
No Asbestos							
<b>B00H - M0002 - Performing Arts Store - 13.11 m2</b>							
No Asbestos							
<b>B00H - M0004 - Performing Arts Chair Store - 13.11 m2</b>							
No Asbestos							
<b>B00H - R0001 - Sport Equipment Store - 8.98 m2</b>							
No Asbestos							
<b>B00H - R0002 - Multi-Purpose Space - 429.71 m2</b>							
No Asbestos							
<b>B00H - R0003 - Staff Kitchen - 8.93 m2</b>							
No Asbestos							
<b>B00H - R0005 - Control Room - 4.59 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00H - R0006 - Pupil Entry - 18.16 m2</b>							
No Asbestos							
<b>B00H - R0007 - Stairs - 6.91 m2</b>							

No Asbestos							
<b>B00H - R0008 - Stairs - 7.02 m2</b>							
No Asbestos							
<b>B00H - R0010 - External Movement - 5.57 m2</b>							
No Asbestos							
<b>B00H - R0011 - External Movement - 5.81 m2</b>							
No Asbestos							
<b>B00H - R0012 - Store - 4.23 m2</b>							
No Asbestos							
<b>B00H - R0013 - Stage - 108.2 m2</b>							
No Asbestos							
<b>B00H - R9001 - Shower/Change - 32.7 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R9002 - Movement - 3.89 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00H - R9003 - Shower/Change - 38.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R9004 - General Storeroom - 7.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00H - R9005 - Movement - 3.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00H - R9006 - Sport Equipment Store - 21.21 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00H - R9007 - Sport Equipment Store - 6.98 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00H - R9008 - Stairs - 4.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00H - R9009 - Stairs - 7.98 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>B00J - Various - 1966 - Brick/Block</b>							
<b>Exterior</b>							

Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00J - R0001 - Art Learning Space - 59.63 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00J - R0002 - Careers Advisers Office - 12.82 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00J - R0003 - Staff Study - 25.71 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00J - R0004 - Cleaning Store - Distributed - 1.88 m2</b>								
No Asbestos								
<b>B00J - R0005 - Laboratory L.S. - 85.94 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
<b>B00J - R0008 - Laboratory L.S. - 91.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
<b>B00J - R0009 - Computer Resource - 25.64 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00J - R0010 - General Learning Space - 52.22 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00J - R0011 - Staff Study - 27.56 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00J - R0012 - Secure Storeroom - 4.85 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00J - R0013 - Staff - Toilet - 6.09 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00J - R0014 - Distribution Board Cupboard - .98 m2</b>								
						<b>Note: No inspection of live electrical installation</b>		
Electrical - Backing Board	Resinous Board	1	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00J - R0015 - Staff Study - 25.9 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00J - R0016 - Cleaning Store - Distributed - 1.52 m2</b>								
No Asbestos								
<b>B00J - R0017 - Art Learning Space - 66.39 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							



<b>B00J - R0018 - Resources Store - 21.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R0019 - Movement - 4.12 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R0020 - Kiln Space - 63.43 m2</b>							
No Asbestos							
<b>B00J - R0021 - Art Learning Space - 58.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R0022 - Resources Store - 6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0023 - Resources Store - 6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0024 - Art Learning Space - 52.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0025 - Darkroom Space - 25.5 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R0026 - General Storeroom - 1.21 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R0028 - Distribution Board Cupboard - .84 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board	1	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00J - R0029 - Stairs - 6.91 m2</b>							
No Asbestos							
<b>B00J - R0030 - Stairs - 6.91 m2</b>							
No Asbestos							
<b>B00J - R0031 - Preparation - Science - 38.95 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R0032 - Movement - 2.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R0033 - Movement - 262.35 m2</b>							
No Asbestos							
<b>B00J - R0034 - Movement - 1.55 m2</b>							
No Asbestos							
<b>B00J - R0035 - Movement - 1.74 m2</b>							
No Asbestos							
<b>B00J - R0036 - Movement - .92 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						

<b>B00J - R1001 - General Learning Space - 59.39 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1002 - Staff Study - 18.45 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R1003 - General Learning Space - 52.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1004 - General Learning Space - 52.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1005 - Staff Study - 19.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R1006 - General Learning Space - 52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1007 - General Learning Space - 52.87 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1008 - Staff Study - 25.71 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R1009 - Distribution Board Cupboard - .82 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board	1	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00J - R1010 - Staff - Toilet - 6.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Plant / Equipment - Flue	Fibre Cement Pipe	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00J - R1011 - Cleaning Store - Distributed - 4.23 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00J - R1012 - General Storeroom - 2.42 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R1013 - Staff Study - 16.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R1014 - General Storeroom - 9.4 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00J - R1015 - General Learning Space - 52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1016 - General Storeroom - 6.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R1017 - General Storeroom - 5.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						

<b>B00J - R1018 - General Learning Space - 52.29 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1019 - General Learning Space - 52.29 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Plant / Equipment - Flue	Fibre Cement Pipe	4	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00J - R1020 - General Learning Space - 52.44 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Plant / Equipment - Flue	Fibre Cement Pipe	4	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00J - R1021 - General Learning Space - 59.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00J - R1022 - Staff Study - 25.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00J - R1023 - Staff - Toilet - 6.12 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R1024 - Distribution Board Cupboard - .84 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board	1	East	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00J - R1025 - General Storeroom - 5.59 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00J - R1026 - Movement - 241.26 m2</b>							
No Asbestos							
<b>B00J - R1027 - General Storeroom - 6.31 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00J - R1028 - Cleaning Store - Distributed - 1.52 m2</b>							
No Asbestos							
<b>B00J - R1029 - Stairs - 13.52 m2</b>							
No Asbestos							
<b>B00J - R1030 - Stairs - 13.92 m2</b>							
No Asbestos							
<b>B00K - Various - 1966 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00K - M9003 - Stairs - 3.73 m2</b>							
No Asbestos							
<b>B00K - M9004 - Movement - 3.08 m2</b>							
No Asbestos							
<b>B00K - M9005 - Movement - 3.06 m2</b>							
No Asbestos							
<b>B00K - M9006 - Stairs - .89 m2</b>							
No Asbestos							

<b>B00K - R0002 - Movement - 46.73 m2</b>								
No Asbestos								
<b>B00K - R0006 - Staff Study - 34.64 m2</b>								
No Asbestos								
<b>B00K - R0007 - Distribution Board Cupboard - .59 m2</b>							<b>Note: No inspection of live electrical installation</b>	
No Asbestos								
<b>B00K - R0009 - External Movement - 1.98 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )							
<b>B00K - R0010 - Cleaning Store - Distributed - 1.07 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )							
<b>B00K - R0011 - Laboratory L.S. - 98.55 m2</b>								
No Asbestos								
<b>B00K - R0012 - Preparation - 32.64 m2</b>								
No Asbestos								
<b>B00K - R0013 - Stairs - 11.07 m2</b>								
No Asbestos								
<b>B00K - R0014 - Stairs - 4.45 m2</b>								
No Asbestos								
<b>B00K - R1002 - Movement - 46.71 m2</b>								
No Asbestos								
<b>B00K - R1003 - General Learning Space - 52.14 m2</b>								
No Asbestos								
<b>B00K - R1004 - General Learning Space - 52.14 m2</b>								
No Asbestos								
<b>B00K - R1005 - General Learning Space - 52.22 m2</b>								
No Asbestos								
<b>B00K - R1006 - General Storeroom - 9.44 m2</b>								
No Asbestos								
<b>B00K - R1007 - Distribution Board Cupboard - .52 m2</b>							<b>Note: No inspection of live electrical installation</b>	
No Asbestos								
<b>B00K - R1008 - External Movement - 1.98 m2</b>								
No Asbestos								
<b>B00K - R1009 - Stairs - 15.42 m2</b>								
No Asbestos								
<b>B00K - R1010 - Cleaning Store - Distributed - 1.06 m2</b>								
No Asbestos								
<b>B00K - R9001 - Shower/Change - 53.09 m2</b>								
Partition Walls (Cubides)	Compressed AC Sheet	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00K - R9002 - Shower/Change - 53.65 m2</b>								
Partition Walls (Cubides)	Compressed AC Sheet	30m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00K - R9003 - Movement - 79.16 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
Wall Linings Internal	Flat AC Sheeting							

<b>B00K - R9006 - Cleaning Store - Distributed - .89 m2</b>		
No Asbestos		
<b>B00K - R9007 - No Access - 4.29 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R9008 - General Assistants - 8.95 m2</b>		
No Asbestos		
<b>B00K - R9009 - External Movement - 2.08 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R9010 - Stairs - .9 m2</b>		
No Asbestos		
<b>B00K - R9011 - Plant - 2.06 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00K - R9012 - Movement - 21.8 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	

**Demountables**

**OS 971 80069 - Shed - Container (Garden/Sports/Bulk) - Placement Date : 30-JUN-1995**

No Asbestos Found