

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Kingsgrove High School (8247)
Region:	Sydney AMU
State Electorate:	Kogarah
Local Government Area:	Georges River

Last Reviewed By:	Greencap 13-AUG-2014
Last Revised By:	WSP 28-AUG-2020

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

8247 - Kingsgrove High School
Site Plan (12585)

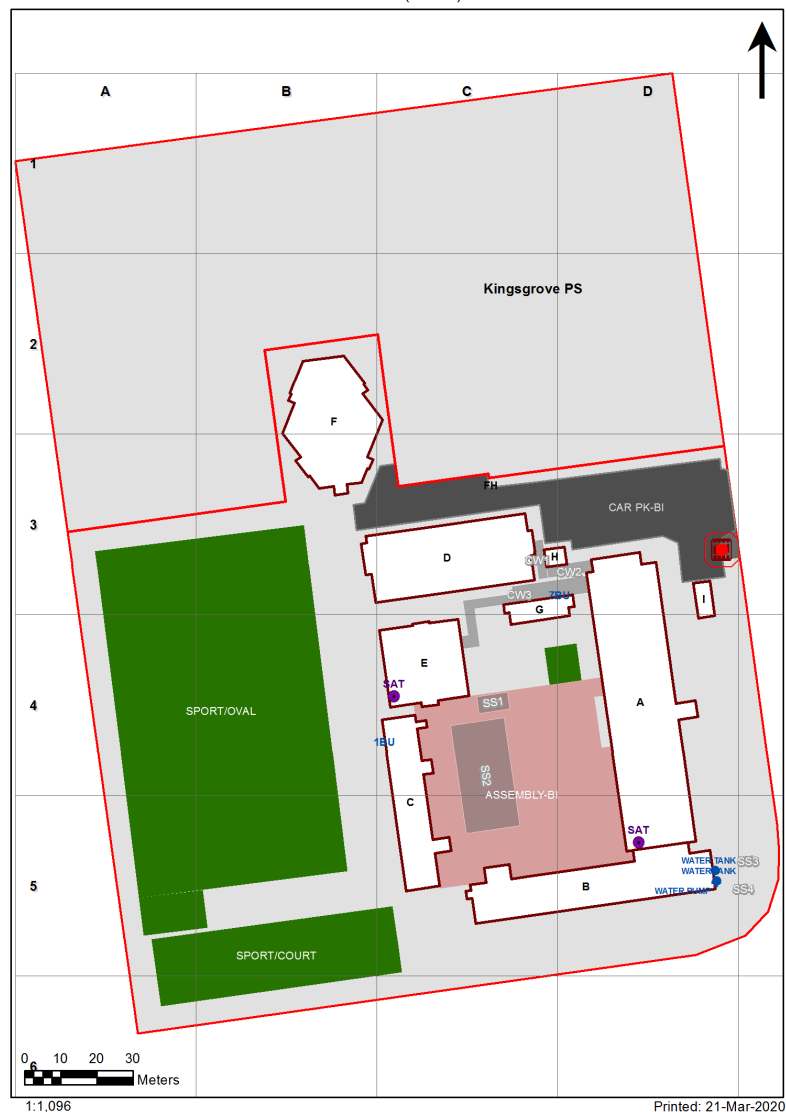

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Administration - 1960 - Concrete Framed							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	6m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Computer Learning Space - 37.42 m2							
No Asbestos							
B00A - R0002 - Computer Learning Space - 35.82 m2							
No Asbestos							
B00A - R0003 - Laboratory L.S. - 91.33 m2							
No Asbestos							
B00A - R0004 - Preparation - 30.16 m2							
No Asbestos							
B00A - R0005 - General Storeroom - 6.05 m2							
No Asbestos							
B00A - R0006 - Distribution Board Cupboard - .74 m2							
No Asbestos							
B00A - R0007 - Tiered Learning Area - 51.98 m2							
No Asbestos							
B00A - R0008 - Cleaning Supplies Store - 7.13 m2							
No Asbestos							
B00A - R0009 - Chemical Store - 6.23 m2							
No Asbestos							
B00A - R0010 - General Storeroom - 5.26 m2							
No Asbestos							
B00A - R0011 - Movement - 137.85 m2							
No Asbestos							
B00A - R0012 - Staff - Toilet - 3.24 m2							
No Asbestos							
B00A - R0013 - External Movement - 116.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - Staff Kitchen - 11.22 m2							
No Asbestos							
B00A - R0016 - General Learning Space - 41.12 m2							
No Asbestos							
B00A - R0018 - Interview/Office - Type 1 - 8.28 m2							
No Asbestos							
B00A - R0019 - Principal Office - 14.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0020 - Staff - Toilet - 3.82 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00A - R0021 - General Storeroom - 3.65 m2							
No Asbestos							
B00A - R0022 - Movement - 12.73 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
B00A - R0023 - Distribution Board Cupboard - 1.03 m2								Note: No inspection of live electrical installation
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0024 - Staff - Toilet - 4.98 m2								
Partition Walls (Cubicles)	Compressed AC Sheet							
B00A - R0025 - Movement - 18.82 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
B00A - R0026 - Cleaning Supplies Store - 2.11 m2								
No Asbestos								
B00A - R0027 - Staff - Toilet - 5.04 m2								
Partition Walls (Cubicles)	Compressed AC Sheet							
B00A - R0028 - Deputy Principal Office - 14.3 m2								
No Asbestos								
B00A - R0029 - Duplicating Workroom - 7.56 m2								
No Asbestos								
B00A - R0030 - Administration - Clerical - 6.93 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
B00A - R0031 - Administration - Clerical - 10.01 m2								
No Asbestos								
B00A - R0032 - Administration - Clerical - 65.56 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0033 - Secure Storeroom - 12.95 m2								
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0034 - Movement - 20.11 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
B00A - R0035 - Movement - 2.42 m2								
No Asbestos								
B00A - R0036 - General Storeroom - 5.26 m2								
No Asbestos								
B00A - R0037 - Duplicating Workroom - 16.42 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
B00A - R0038 - Pupil Entry - 11.82 m2								
Floor Coverings Res/Textile	Vinyl Tiles							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0039 - Movement - 77.5 m2								
Ceiling Structures/Linings	Flat AC Sheeting	78m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R0040 - Clinic - Boys - 13.61 m2								
No Asbestos								

B00A - R0041 - Clinic-Toilets - 2.23 m2							
No Asbestos							
B00A - R0042 - Clinic-Waiting - 4.66 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0043 - Staff - Toilet - 2.23 m2							
No Asbestos							
B00A - R0044 - Deputy Principal Office - 13.94 m2							
No Asbestos							
B00A - R0045 - Leading Teacher - 16.46 m2							
No Asbestos							
B00A - R0046 - General Storeroom - 5.77 m2							
No Asbestos							
B00A - R0047 - Apparatus Store - 3.11 m2							
No Asbestos							
B00A - R0048 - General Storeroom - 4.06 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0049 - Staff Study - 20.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R0051 - Preparation - 19.72 m2							
No Asbestos							
B00A - R0052 - Apparatus Store - 7.88 m2							
No Asbestos							
B00A - R0053 - Laboratory L.S. - 88.33 m2							
No Asbestos							
B00A - R0056 - Stairs - 9.21 m2							
No Asbestos							
B00A - R0057 - Stairs - 5.97 m2							
No Asbestos							
B00A - R0058 - External Movement - 18.94 m2							
No Asbestos							
B00A - R0059 - Stairs - 2.63 m2							
No Asbestos							
B00A - R0060 - Commonroom - 40.18 m2							
No Asbestos							
B00A - R0061 - Staff Kitchen - 11.66 m2							
No Asbestos							
B00A - R0062 - Commonroom - 104.8 m2							
No Asbestos							
B00A - R0063 - Movement - 7.95 m2							
No Asbestos							
B00A - R0065 - Movement - 12.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0066 - Movement - 23.44 m2							
No Asbestos							
B00A - R0067 - Stairs - 2.97 m2							
No Asbestos							
B00A - R0068 - Stairs - 6.58 m2							
No Asbestos							

B00A - R1001 - General Learning Space - 51.9 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1002 - General Learning Space - 65.73 m2		
No Asbestos		
B00A - R1003 - General Storeroom - 4.31 m2		
No Asbestos		
B00A - R1004 - General Storeroom - 7.8 m2		
No Asbestos		
B00A - R1005 - Resources Store - 6.07 m2		
No Asbestos		
B00A - R1006 - KIn Space - 6.04 m2		
No Asbestos		
B00A - R1007 - Art Learning Space - 64.95 m2		
No Asbestos		
B00A - R1008 - General Learning Space - 38.85 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1009 - Staff Study - 38.8 m2		
No Asbestos		
B00A - R1011 - General Storeroom - 6.67 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1012 - Cleaning Store - Distributed - 3.61 m2		
Floor Coverings Res/Textile	Vinyl Sheet	
B00A - R1013 - General Learning Space - 64.87 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1014 - General Learning Space - 52.05 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1015 - General Learning Space - 51.77 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1016 - General Learning Space - 51.77 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1017 - General Learning Space - 52.05 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1018 - Cleaning Store - Distributed - .72 m2		
No Asbestos		
B00A - R1019 - Toilets-Girls - 10.01 m2		
No Asbestos		
B00A - R1020 - General Learning Space - 52.28 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1021 - General Learning Space - 51.91 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1022 - General Learning Space - 51.84 m2		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00A - R1023 - General Learning Space - 51.98 m2		

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R1024 - General Learning Space - 65.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R1025 - Distribution Board Cupboard - 3.56 m2							
Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Sheet						
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R1026 - Staff Study - 16.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R1027 - General Storeroom - 6.6 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R1028 - General Storeroom - 14.35 m2							
No Asbestos							
B00A - R1029 - General Learning Space - 49.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R1030 - General Learning Space - 51.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R1031 - General Storeroom - 14 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00A - R1032 - General Learning Space - 51.26 m2							
No Asbestos							
B00A - R1033 - Movement - 201.06 m2							
No Asbestos							
B00A - R1035 - Stairs - 8.43 m2							
No Asbestos							
B00A - R1036 - Stairs - 8.38 m2							
No Asbestos							
B00A - R1037 - Stairs - 8.45 m2							
No Asbestos							
B00A - R1038 - Movement - 14.31 m2							
No Asbestos							
B00A - R1041 - Staff Kitchen - 3.69 m2							
No Asbestos							
B00A - R1042 - Commonroom - 12.4 m2							
No Asbestos							
B00A - R9001 - Student Canteen - 39.98 m2							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9002 - Main Switchroom - 3.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9003 - Staff - Toilet - 3.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9004 - Cleaning Supplies Store - 5.86 m2							

No Asbestos							
B00A - R9005 - General Assistants - 12.1 m2							
No Asbestos							
B00A - R9006 - Maintenance Bulk Store - 76.78 m2							
No Asbestos							
B00A - R9007 - Movement - 156.06 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9008 - Cleaning Supplies Store - 6.52 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9009 - No Access - 6.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9010 - Stairs - 6.21 m2							
No Asbestos							
B00A - R9011 - External Movement - 4.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9012 - Movement - 12.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - General Learning/Art - 1965 - Concrete Framed							
Exterior							
Eaves Linings	Flat AC Sheeting	12m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00B - R0001 - Music Learning Space - 64.46 m2							
No Asbestos							
B00B - R0002 - Music Store - 6.11 m2							
No Asbestos							
B00B - R0003 - Pupil Entry - 2.96 m2							
No Asbestos							
B00B - R0004 - Computer Store - 5.76 m2							
No Asbestos							
B00B - R0005 - Computer Learning Space - 51.91 m2							
No Asbestos							
B00B - R0006 - General Storeroom - 12.44 m2							
No Asbestos							
B00B - R0007 - General Learning Space - 52.06 m2							
No Asbestos							
B00B - R0009 - General Storeroom - 4.26 m2							
No Asbestos							
B00B - R0011 - Cleaning Store - Distributed - .88 m2							
No Asbestos							
B00B - R0012 - Main Switchroom - 8.33 m2							

Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Compressed AC Sheet						
B00B - R0013 - General Storeroom - 2.96 m2							
No Asbestos							
B00B - R0014 - Pantry - 10.5 m2							
No Asbestos							
B00B - R0015 - Food Technology L.S. - 65.05 m2							
No Asbestos							
B00B - R0020 - Movement - 137.67 m2							
No Asbestos							
B00B - R0021 - External Movement - 6.15 m2							
No Asbestos							
B00B - R0022 - Cleaning Store - Distributed - 1.03 m2							
No Asbestos							
B00B - R0023 - External Movement - 6.13 m2							
No Asbestos							
B00B - R0024 - Stairs - 14.05 m2							
No Asbestos							
B00B - R0025 - External Movement - 28.35 m2							
No Asbestos							
B00B - R0026 - Stairs - 6.8 m2							
No Asbestos							
B00B - R0029 - Preparation - 24.65 m2							
No Asbestos							
B00B - R0030 - Food Technology L.S. - 90.65 m2							
No Asbestos							
B00B - R0031 - Laundry - .86 m2							
No Asbestos							
B00B - R0032 - Commonroom - 45.36 m2							
No Asbestos							
B00B - R1001 - General Learning Space - 69.35 m2							
No Asbestos							
B00B - R1002 - Materials Store - 6.07 m2							
No Asbestos							
B00B - R1003 - General Storeroom - 6.94 m2							
No Asbestos							
B00B - R1004 - Design L.S. - 69.55 m2							
No Asbestos							
B00B - R1005 - General Storeroom - 3.53 m2							
No Asbestos							
B00B - R1006 - General Storeroom - 3.3 m2							
No Asbestos							
B00B - R1007 - Materials Store - 6.09 m2							
No Asbestos							
B00B - R1008 - Design L.S. - 69.78 m2							
No Asbestos							
B00B - R1009 - Cleaning Store - Distributed - 3.3 m2							
No Asbestos							
B00B - R1010 - Distribution Board Cupboard - .96 m2							
							Note: No inspection of live electrical installation

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1012 - Art Learning Space - 55.51 m2							
No Asbestos							
B00B - R1013 - Art Learning Space - 56.29 m2							
No Asbestos							
B00B - R1014 - Staff Study - 27.71 m2							
No Asbestos							
B00B - R1015 - Darkroom Space - 11.55 m2							
No Asbestos							
B00B - R1016 - Kiln Space - 12.78 m2							
No Asbestos							
B00B - R1017 - Art Learning Space - 55.73 m2							
No Asbestos							
B00B - R1018 - Cleaning Store - Distributed - .84 m2							
No Asbestos							
B00B - R1019 - Movement - 131.03 m2							
No Asbestos							
B00B - R1020 - Cleaning Store - Distributed - .87 m2							
No Asbestos							
B00B - R1021 - Stairs - 14.92 m2							
No Asbestos							
B00B - R1022 - Stairs - 15.78 m2							
No Asbestos							
B00B - R1023 - Commonroom - 16.38 m2							
No Asbestos							
B00B - R1024 - Staff Kitchen - 3.59 m2							
No Asbestos							
B00B - R9001 - Toilets-Boys - 100.38 m2							
No Asbestos							
B00B - R9002 - Staff - Toilet - 8.92 m2							
No Asbestos							
B00B - R9003 - Movement - 13.1 m2							
No Asbestos							
B00B - R9004 - Stairs - 6.26 m2							
No Asbestos							
B00B - R9005 - External Movement - 28.35 m2							
No Asbestos							
B00B - R9006 - External Movement - 3.72 m2							
No Asbestos							
B00C - Technological & Applied Studies/Staff Facilities - 1962 - Concrete Framed							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00C - R0001 - Staff - Toilet - 5.87 m2							

No Asbestos							
B00C - R0005 - Materials Technology L.S. - 78.45 m2							
No Asbestos							
B00C - R0007 - Movement - 6.07 m2							
No Asbestos							
B00C - R0012 - Materials Technology L.S. - 71.81 m2							
No Asbestos							
B00C - R0013 - Materials Store - 10.21 m2							
No Asbestos							
B00C - R0016 - External Movement - 8.66 m2							
No Asbestos							
B00C - R0017 - External Movement - 7.87 m2							
No Asbestos							
B00C - R0018 - External Movement - 3.91 m2							
No Asbestos							
B00C - R0019 - Distribution Board Cupboard - 1.19 m2							
							Note: No inspection of live electrical installation
No Asbestos							
B00C - R0020 - Movement - 4.03 m2							
No Asbestos							
B00C - R0021 - Staff Kitchen - 4.55 m2							
No Asbestos							
B00C - R0022 - Commonroom - 14.19 m2							
No Asbestos							
B00C - R0023 - Project Store - Type 1 - 21.5 m2							
No Asbestos							
B00C - R0024 - Plant - 5.78 m2							
No Asbestos							
B00C - R0025 - Plant - 4.85 m2							
No Asbestos							
B00C - R0026 - Materials Technology L.S. - 149.04 m2							
No Asbestos							
B00C - R0027 - Movement - 8.26 m2							
No Asbestos							
B00C - R0028 - Seminar - Type 2 - 21.17 m2							
No Asbestos							
B00C - R0029 - Metal Technology Bay - 10.52 m2							
No Asbestos							
B00D - General Learning/Physical Education - 1965 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	120m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Material - Stored / Debris Material	Flat AC Sheeting	4	under void throughout	Mnimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	176	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00D - R0001 - Laboratory L.S. - 86.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						

B00D - R0002 - Preparation - 28.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Variable positions	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00D - R0003 - Staff Study - 9.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0004 - Laboratory L.S. - 86.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0005 - General Learning Space - 52.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0006 - Staff Study - 26.06 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0007 - General Learning Space - 52.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0008 - General Learning Space - 52.56 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0009 - Distribution Board Cupboard - .82 m2							
Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0010 - General Storeroom - 2.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0011 - General Storeroom - 6.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0012 - General Learning Space - 52.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0016 - Movement - 152.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						

Floor Coverings Res/Textile	Vinyl Tiles	10m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0017 - General Storeroom - 6.33 m2							
No Asbestos							
B00D - R0019 - Stairs - 9.3 m2							
No Asbestos							
B00D - R0020 - Stairs - 4.11 m2							
No Asbestos							
B00D - R0021 - External Movement - 3.15 m2							
No Asbestos							
B00D - R0022 - External Movement - 3.15 m2							
No Asbestos							
B00D - R0023 - Plant - .84 m2							
Ceiling Structures/Linings	No Asbestos Found						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0024 - General Learning Space - 53.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0025 - Commonroom - 39.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0026 - Staff Study - 17.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0027 - Staff Kitchen - 8.68 m2							
No Asbestos							
B00D - R1002 - General Learning Space - 52.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1003 - Preparation - 23.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1004 - Apparatus Store - 7.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1005 - Laboratory L.S. - 86.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R1006 - General Storeroom - 3.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1007 - General Storeroom - 9.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1008 - General Learning Space - 66.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1009 - General Storeroom - 21.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1010 - General Learning Space - 61.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1011 - General Learning Space - 52.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1012 - Staff Study - 12.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1013 - General Storeroom - 6.14 m2							
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1014 - Cleaning Store - Distributed - .45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1015 - Distribution Board Cupboard - .92 m2							
Note: No inspection of live electrical installation							
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1016 - General Learning Space - 52.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1018 - General Learning Space - 52.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1019 - Movement - 146.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1020 - Staff - Toilet - 6.77 m2							
No Asbestos							
B00D - R1021 - Stairs - 16.59 m2							
No Asbestos							
B00D - R1022 - Stairs - 4.92 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1023 - G.L.S. Store - 2.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1024 - G.L.S. Store - 9.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1025 - Commonroom - 36.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1026 - Staff Kitchen - 2.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R9001 - Staff Shower - 9.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R9002 - Shower/Change - 54.78 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R9003 - Shower/Change - 54.73 m2							
No Asbestos							
B00D - R9004 - Staff Shower - 9.96 m2							
No Asbestos							
B00D - R9005 - General Storeroom - 9.87 m2							
No Asbestos							
B00D - R9006 - General Storeroom - 6.21 m2							
Plant / Equipment - Flue	Fibre Cement Pipe	2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plumbing / Pipework	Lagging						
B00D - R9007 - Sport Equipment Store - 20 m2							
No Asbestos							
B00D - R9008 - Sport Equipment Store - 27.67 m2							
No Asbestos							
B00D - R9010 - Secure Storeroom - 3.75 m2							
No Asbestos							
B00D - R9011 - External Movement - 4.38 m2							
No Asbestos							
B00D - R9012 - External Movement - 4.35 m2							
No Asbestos							
B00D - R9013 - Stairs - 5.62 m2							
No Asbestos							
B00D - R9014 - Movement - 39.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

B00D - R9015 - Movement - 18.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - Library - 1984 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	4m2	East facing, West facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - M1001 - Plant - 23.92 m2							
Plant / Equipment - Air Conditioning Unit	Gasket Material						
B00E - M1002 - Plant - 26.5 m2							
Reinspect / Delete	Insulation Material						
B00E - R0001 - Librarian - 16.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0002 - Staff - Toilet - 3.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0004 - Staff - Toilet - 3.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0005 - General Storeroom - 4.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0006 - Audio Visual Workroom - 3.07 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0007 - Distribution Board Cupboard - 1.03 m2							
							Note: No inspection of live electrical installation
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0009 - Audio Visual Workroom - 49.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0010 - General Storeroom - 4.61 m2							
No Asbestos							
B00E - R0012 - Movement - 49.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0013 - Movement - 3.43 m2							
No Asbestos							
B00E - R0014 - Stairs - 3 m2							
No Asbestos							
B00E - R0015 - Lift - 1.34 m2							
No Asbestos							
B00E - R0016 - Main Area - 207.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00E - R0017 - Tiered Learning Area - 8.66 m2							
No Asbestos							
B00E - R0018 - Senior Study - 13.64 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0019 - Librarian - 38.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0020 - Library Administration - 9.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0021 - Stairs - 1.37 m2							
No Asbestos							
B00E - R1002 - Cleaning Store - Distributed - 1.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R1003 - Seminar - 16.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1004 - Seminar - 16.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1005 - Seminar - 16.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1006 - Interview/Office - Type 1 - 16.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1007 - Seminar - 16.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1008 - Distribution Board Cupboard - 1.4 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R1009 - Schools As Community Centres Program - 3 m2							
No Asbestos							
B00E - R1010 - Stairs - 3 m2							
No Asbestos							
B00E - R1011 - Main Area - 239.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00F - Multi Purpose Facilities - 1970 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Interior							
B00F - M0001 - Control Room - 6.74 m2							
Electrical - Backing Board	Resinous Board	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - M0002 - Control Room - 6.85 m2							
No Asbestos							
B00F - R0001 - Stage - 96.19 m2							

No Asbestos							
B00F - R0002 - Multi-Purpose Space - 454.35 m2							
No Asbestos							
B00F - R0003 - Toilets-Boys - 9.6 m2							
No Asbestos							
B00F - R0005 - Toilets-Girls - 7.22 m2							
No Asbestos							
B00F - R0006 - Public Entry - 17.71 m2							
No Asbestos							
B00F - R0007 - Distribution Board Cupboard - .64 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R0008 - Student Canteen - 17.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00F - R0009 - Movement - 4.76 m2							
No Asbestos							
B00F - R0010 - External Movement - 8.54 m2							
No Asbestos							
B00F - R0011 - Movement - 4.76 m2							
No Asbestos							
B00F - R0012 - Movement - 4.72 m2							
No Asbestos							
B00F - R0013 - Movement - 4.4 m2							
No Asbestos							
B00F - R9001 - Toilets-Girls - 5.9 m2							
No Asbestos							
B00F - R9002 - Chair Store - 11.18 m2							
No Asbestos							
B00F - R9003 - Chair Store - 11.09 m2							
No Asbestos							
B00F - R9004 - Toilets-Boys - 5.85 m2							
No Asbestos							
B00F - R9005 - Chair Store - 63.85 m2							
No Asbestos							
B00G - Pupil Facilities/Other - 1960 - Concrete Framed							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00G - R0002 - Toilets-Boys - 7.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00G - R0003 - Movement - 2.16 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00G - R0004 - Toilets-Girls - 61.18 m2							
No Asbestos							
B00G - R0005 - Cleaning Store - Distributed - 12.14 m2							
No Asbestos							
B00H - Building Services/Pupil Facilities - 2010 - Brick/Veneer							
Exterior							
No Asbestos							
Interior							
B00H - R0001 - Movement - 5.03 m2							
No Asbestos							
B00H - R0002 - Lift - 2.24 m2							
No Asbestos							
B00H - R0003 - External Movement - 14.84 m2							
No Asbestos							
B00H - R1001 - Movement - 5.03 m2							
No Asbestos							
B00H - R9001 - Movement - 5.39 m2							
No Asbestos							
B00H - R9002 - Access Student Shower/Toilet/Change - 8.29 m2							
No Asbestos							
B00H - R9003 - External Movement - 4.07 m2							
No Asbestos							
B00I - Other - 2010 - Metal Shed							
Exterior							
No Asbestos							
Interior							
B00I - R0001 - Other - 41.22 m2							
No Asbestos							

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020