

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Killarney Heights High School (8422)
Region:	Northern Sydney AMU
State Electorate:	Wakehurst
Local Government Area:	Northern Beaches

Last Reviewed By:	AECOM 07-OCT-2014
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

8422 - Killarney Heights High School
Site Plan (13173)

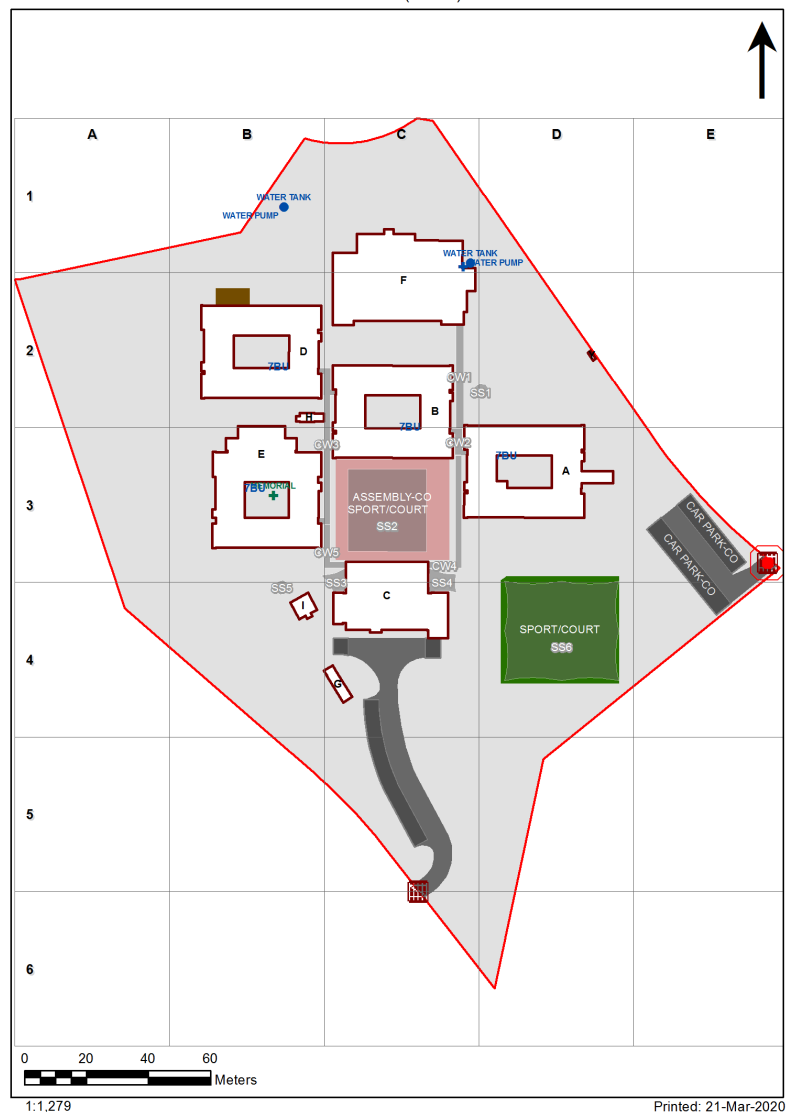

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning/Science Learning - 1967 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Flat Roof	Non Accessible Area						
Interior							
B00A - R0021 - General Learning Space - 58.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0022 - Cleaning Store - Distributed - 2.77 m2							
No Asbestos							
B00A - R0025 - General Learning Space - 52.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0026 - Resources Store - 11.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0028 - Resources Store - 25.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0031 - Preparation - Science - 30.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - Performance Workshop - 85.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0034 - Lift - 1.26 m2							
No Asbestos							
B00A - R0043 - External Stairs - 2.76 m2							
No Asbestos							
B00A - R0044 - External Stairs - 2.41 m2							
No Asbestos							
B00A - R0051 - General Storeroom - 8.23 m2							
No Asbestos							
B00A - R0052 - Toilet - Lobby - 4.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0053 - Toilets-Disabled - 3.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0054 - Access Student Shower/Toilet/Change - 16.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0055 - Laboratory L.S. - 93.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0058 - Performance Store - 7.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0059 - External Movement - 156.14 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)	
B00A - R0060 - Plant - .22 m2		
No Asbestos		
B00A - R0061 - Public Entry - 15.43 m2		
Require Inspection		
B00A - R0062 - Movement - 13.72 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00A - R0063 - Movement - 20.97 m2		
Require Inspection		
B00A - R0064 - Student Waiting - 6.38 m2		
Require Inspection		
B00A - R0065 - Clinic - 7.63 m2		
Require Inspection		
B00A - R0066 - Staff Study - 15.58 m2		
Require Inspection		
B00A - R0067 - Movement - 3.38 m2		
Require Inspection		
B00A - R0068 - Handwashing Facilities - 2.42 m2		
Require Inspection		
B00A - R0069 - Toilets-Unisex - 1.79 m2		
Require Inspection		
B00A - R0070 - Handwashing Facilities - 2.41 m2		
Require Inspection		
B00A - R0071 - Staff - Toilet - 1.79 m2		
Require Inspection		
B00A - R0072 - Tea Room - 8.89 m2		
Require Inspection		
B00A - R0073 - Deputy Principal Office - 12.57 m2		
Require Inspection		
B00A - R0074 - Administration - Clerical - 19.66 m2		
Require Inspection		
B00A - R0075 - Store - 8.63 m2		
Require Inspection		
B00A - R0076 - Administration - Clerical - 37.55 m2		
Require Inspection		
B00A - R0077 - Interview/Meeting - 10.4 m2		
Require Inspection		
B00A - R0078 - Principal Office - 19.02 m2		
Require Inspection		
B00A - R0079 - General Storeroom - 2.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0080 - Handwashing Facilities - 1.38 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0081 - Staff - Toilet - 1.38 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00A - R0082 - Deputy Principal Office - 12.5 m2		
Require Inspection		
B00A - R0083 - Seminar Space - 58.11 m2		

Require Inspection							
B00A - R0084 - Movement - 14.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0085 - Staff - Toilet - 2.96 m2							
Require Inspection							
B00A - R0086 - External Movement - 39.15 m2							
Require Inspection							
B00A - R1001 - Staff - Toilet - 2.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1002 - Distribution Board Cupboard - 1.11 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00A - R1003 - General Learning Space - 52.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1004 - Resources Store - 5.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1005 - Interview/Office - Type 1 - 12.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1006 - General Learning Space - 58.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1007 - Resources Store - 6.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1008 - Computer Learning Space - 52.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1009 - Computer Room - 5.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1010 - General Learning Space - 65.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1011 - Resources Store - 6.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1012 - Resources Store - 2.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1013 - Textiles Technology LS. - 71.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R1014 - Resources Store - 2.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R1015 - Performance Store - 2.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1016 - Distribution Board Cupboard - 1.21 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00A - R1017 - General Learning Space - 52.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1018 - Resources Store - 5.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1019 - Resources Store - 5.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1021 - Art Learning Space - 52.73 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1022 - General Learning Space - 52.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1024 - External Movement - 169.86 m2							
No Asbestos							
B00A - R1026 - External Stairs - 6.05 m2							
No Asbestos							
B00A - R1027 - External Stairs - 6.14 m2							
No Asbestos							
B00A - R1028 - Darkroom Space - 6.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1029 - Dark Room - 20.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1030 - Commonroom - 123.1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R1031 - Staff Kitchen - 13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1032 - Chair Store - 1.79 m2							
No Asbestos							
B00A - R1033 - Handwashing Facilities - .16 m2							
No Asbestos							
B00B - Technological & Applied Studies/Music/Art - 1967 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00B - R0001 - General Storeroom - 2.8 m2							
No Asbestos							
B00B - R0004 - Music Learning Space - 52.51 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0005 - Music Store - 5.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0006 - Resources Store - 5.6 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0008 - Metal Technology Bay - 39.2 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0009 - Materials Technology L.S. - 92.73 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00B - R0010 - Design/Technology L.S. - 58.36 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	12m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Plant / Equipment - Flue	Fibre Cement Pipe	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0011 - Staff - Toilet - 2.79 m2								
No Asbestos								
B00B - R0015 - General Storeroom - 6.04 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0016 - Design L.S. - 51.85 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0017 - Resources Store - 6.22 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0020 - Food Technology L.S. - 65.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0021 - Preparation - Materials - 12.68 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0022 - Pantry - 12.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0025 - Resources Store - 3.6 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0027 - Laundry - 3.6 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0029 - External Stairs - 2.76 m2								
Expansion Joint	Mastic							
B00B - R0030 - External Stairs - 2.46 m2								
Expansion Joint	Mastic							
B00B - R0031 - General Storeroom - 8.19 m2								
No Asbestos								
B00B - R0032 - Class Tools Storage - 12.4 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0033 - Food Technology L.S. - 117.48 m2								
No Asbestos								
B00B - R0034 - Staff Study - 40.93 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0035 - Tea Room - 3.84 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0036 - Metal Technology L.S. - 77.21 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00B - R0037 - Welding Area - 7.78 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0038 - Handwashing Facilities - .16 m2								
No Asbestos								
B00B - R0039 - General Storeroom - 7.82 m2								
No Asbestos								
B00B - R0040 - External Movement - 177.26 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
B00B - R1001 - Cleaning Store - Distributed - 2.77 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1002 - Distribution Board Cupboard - 1.19 m2								
						Note: No inspection of live electrical installation		
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1003 - Music Learning Space - 51.78 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1004 - Music Store - 5.75 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1005 - Resources Store - 5.61 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1006 - Wood Technology L.S. - 85.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Floor Coverings Res/Textile	Vinyl Tiles	85m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1008 - Wood Technology Bay - 33.98 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1009 - Wood Technology L.S. - 79.35 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00B - R1010 - Design L.S. - 58.43 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1011 - Staff - Toilet - 2.79 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1012 - Distribution Board Cupboard - 1.13 m2								
						Note: No inspection of live electrical installation		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos	

B00B - R1013 - Music Learning Space - 52.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1014 - Resources Store - 11.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	12m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R1016 - Resources Store - 12.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1018 - Resources Store - 11.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1019 - Kiln Space - 27.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1021 - Resources Store - 6.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1022 - Art Learning Space - 71.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1023 - Resources Store - 6.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1024 - External Movement - 175.94 m2							
No Asbestos							
B00B - R1025 - External Stairs - 6.11 m2							
No Asbestos							
B00B - R1026 - External Stairs - 6.07 m2							
No Asbestos							
B00B - R1027 - Project Store - Type 1 - 4.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1028 - Project Store - Type 1 - 4.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1029 - Dust Extraction Space - 5.99 m2							
No Asbestos							
B00B - R1030 - Staff Study - 29.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1031 - Tea Room - 1.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1032 - Handwashing Facilities - .16 m2							
No Asbestos							
B00B - R1033 - Art Learning Space - 106.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00C - Pupil Facilities/Physical Education - 1967 - Brick/Block							

Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00C - R0001 - General Storeroom - 10.75 m2							
No Asbestos							
B00C - R0003 - Main Switchroom - 11.2 m2							
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0004 - Class Tools Storage - 12.92 m2							
No Asbestos							
B00C - R0005 - General Storeroom - 6.16 m2							
No Asbestos							
B00C - R0006 - Multi-Purpose Space - 316.85 m2							
No Asbestos							
B00C - R0008 - Student Canteen - 56.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - Pantry - 2.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0010 - Staff - Toilet - 3.76 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0011 - Distribution Board Cupboard - .56 m2 Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0012 - Materials Store - 13.29 m2							
No Asbestos							
B00C - R0013 - Sport Equipment Store - 14.39 m2							
No Asbestos							
B00C - R0014 - Sport Equipment Store - 21.3 m2							
No Asbestos							
B00C - R0015 - Movement - 14.12 m2							
No Asbestos							
B00C - R0016 - Cleaning Store - Distributed - 1.45 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0017 - Staff - Toilet - 4.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0018 - Sport Equipment Store - 10.67 m2							
No Asbestos							
B00C - R0019 - General Storeroom - 11.17 m2							
No Asbestos							
B00C - R0020 - External Movement - 53.09 m2							
No Asbestos							
B00C - R0021 - Movement - 14.01 m2							
No Asbestos							
B00C - R0022 - Movement - 3.89 m2							

No Asbestos								
B00C - R0023 - Movement - 10.36 m2								
No Asbestos								
B00C - R0024 - Stairs - 3.88 m2								
No Asbestos								
B00C - R0025 - Stairs - 3.82 m2								
No Asbestos								
B00C - R0026 - External Movement - 53.42 m2								
No Asbestos								
B00C - R0027 - Movement - 10.98 m2								
No Asbestos								
B00C - R0028 - Class Tools Storage - 2.91 m2								
No Asbestos								
B00C - R1001 - General Storeroom - 11.2 m2								
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1002 - Staff Shower - 6.53 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1003 - General Storeroom - 1.16 m2								
Wall Linings Internal	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1005 - Change - 38.12 m2								
Ceiling Structures/Linings	Flat AC Sheeting	39m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1006 - Movement - 12.21 m2								
No Asbestos								
B00C - R1007 - General Storeroom - 11.22 m2								
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1008 - Staff Shower - 6.53 m2								
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1009 - General Storeroom - 1.16 m2								
Wall Linings Internal	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1012 - Movement - 12.22 m2								
No Asbestos								
B00C - R1013 - Stairs - 15.4 m2								
Window	Mastic							
B00C - R1014 - Stairs - 15.37 m2								
Window	Mastic							
B00C - R1015 - Change - 34.17 m2								
No Asbestos								
B00C - R1016 - Plant - 4.21 m2								

No Asbestos							
B00C - R1017 - Toilets-Girls - 34.16 m2							
No Asbestos							
B00C - R1018 - Plant - 4.21 m2							
No Asbestos							
B00C - R1019 - Toilets-Boys - 34.19 m2							
No Asbestos							
B00C - R1020 - Plant - 4.21 m2							
No Asbestos							
B00D - General Learning/Science Learning - 1967 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00D - R0001 - Staff - Toilet - 2.79 m2							
No Asbestos							
B00D - R0004 - General Learning Space - 52.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0005 - Resources Store - 11.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0006 - Toilets-Boys - 40 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0007 - Chemical Store - 25.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0013 - Toilets-Girls - 40.06 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0014 - Cleaning Store - Distributed - 2.79 m2							
No Asbestos							
B00D - R0017 - General Learning Space - 52.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0020 - General Learning Space - 58.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0021 - Laboratory L.S. - 91.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Thermocon Heater	Encapsulated Asbestos material within unit	3	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0024 - Laboratory L.S. - 85.39 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	3	North facing, South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0027 - External Stairs - 3.07 m2							
Expansion Joint	Mastic						
B00D - R0028 - External Stairs - 2.31 m2							
No Asbestos							
B00D - R0029 - Staff Study - 36.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0030 - Tea Room - 3.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0031 - General Storeroom - 8.2 m2							
No Asbestos							
B00D - R0032 - General Storeroom - 18.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0033 - Preparation - Science - 39.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0034 - Cleaning Supplies Store - 8.3 m2							
No Asbestos							
B00D - R0035 - Handwashing Facilities - .16 m2							
No Asbestos							
B00D - R0036 - External Movement - 170.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00D - R0037 - Science Laboratory - 92.67 m2							
Require Inspection							
B00D - R0038 - Science Laboratory - 24.96 m2							
Require Inspection							
B00D - R1001 - Staff - Toilet - 2.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1002 - Distribution Board Cupboard - 1.15 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1003 - General Learning Space - 52.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1004 - General Storeroom - 11.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	12m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1005 - General Learning Space - 58.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1006 - General Learning Space - 52.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1007 - Multi Media Workshop - 11.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	13m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos

B00D - R1008 - Staff Study - 25.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1009 - Staff Study - 12.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1011 - Resources Store - 12.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1012 - Computer Room - 12.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1013 - Computer Learning Space - 58.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1014 - General Storeroom - 2.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1015 - Distribution Board Cupboard - 1.3 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1016 - General Learning Space - 52.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1017 - Resources Store - 5.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1018 - Office/Store - 13.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1019 - General Learning Space - 58.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1020 - General Learning Space - 52.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1021 - General Learning Space - 52.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1022 - Resources Store - 12.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1024 - Resources Store - 12.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1025 - General Learning Space - 58.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Door entry	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1026 - External Movement - 169.25 m2							
No Asbestos							
B00D - R1027 - External Stairs - 5.98 m2							
No Asbestos							
B00D - R1028 - External Stairs - 6.12 m2							
No Asbestos							
B00D - R1029 - Handwashing Facilities - .16 m2							
No Asbestos							
B00D - R1030 - Tea Room - 4.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1031 - Staff Study - 21.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1032 - Tea Room - 5.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1033 - Staff Study - 19.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - Library/General Learning/Science Learning - 1994 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00E - R0001 - Other-Vacant - .52 m2							
No Asbestos							
B00E - R0002 - Plant - .44 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Conduit	Fibre Cement Pipe						
B00E - R0003 - Staff - Toilet - 10.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0004 - Cleaning Store - Distributed - 2.68 m2							
No Asbestos							
B00E - R0005 - General Storeroom - 5.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0006 - General Learning Space - 49.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0007 - General Learning Space - 57.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0009 - Staff Study - 20.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0010 - Resources Store - 12.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0011 - Printing/Photocopying - 25.57 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0015 - General Assistants - 10.73 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0016 - General Assistants - 2.69 m2								
No Asbestos								
B00E - R0017 - Resources Store - 18.1 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0018 - Main Area - 51.79 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0021 - Librarian - 12.68 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R0023 - System Administrators Office - 24.56 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0024 - General Storeroom - 7.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0026 - Resources Store - 6.62 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0027 - External Movement - 165.88 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
Expansion Joint	Mastic							
Expansion Joint	Mastic							
B00E - R0028 - External Stairs - 4.61 m2								
Expansion Joint	Mastic							
B00E - R0029 - External Stairs - 4.72 m2								
Expansion Joint	Mastic							
B00E - R0030 - Senior Study - 14.75 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0031 - Senior Study - 15.95 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0033 - Tea Room - 7.04 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0034 - Staff Study - 18.28 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0035 - Commonroom - 84.99 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R0036 - Staff Kitchen - 12.52 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0037 - Library Administration - 27.15 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R0038 - Tea Room - 2.61 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0039 - Main Entry - 5.64 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0040 - Main Area - 288.54 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)							
B00E - R0041 - General Assistants - 4.77 m2								
No Asbestos								
B00E - R1001 - Staff - Toilet - 2.69 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R1002 - Handwashing Facilities - .44 m2								
No Asbestos								
B00E - R1003 - Distribution Board Cupboard - .73 m2								
Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Mounting Board	Resinous Board	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R1004 - General Learning Space - 50.99 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R1005 - Resources Store - 10.34 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1007 - Fitness Laboratory - 92.06 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R1008 - Resources Store - 12.42 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1009 - Preparation - Science - 22.56 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1010 - Chemical Store - 2.54 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R1011 - Laboratory L.S. - 84.28 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R1012 - Staff - Toilet - 2.72 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R1013 - Handwashing Facilities - .44 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	1m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R1014 - Distribution Board Cupboard - .67 m2								
Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Electrical - Mounting Board	Resinous Board	1	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R1015 - General Learning Space - 50.99 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R1016 - Resources Store - 5.49 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							

B00E - R1018 - General Learning Space - 57.5 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1019 - General Learning Space - 52.01 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1020 - General Learning Space - 52.08 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1022 - Computer Learning Space - 57.95 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1024 - External Stairs - 7.63 m2		
Expansion Joint	Mastic	
B00E - R1025 - External Stairs - 7.64 m2		
Expansion Joint	Mastic	
B00E - R1026 - Tea Room - 5.81 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1027 - Staff Study - 25.04 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1028 - Tea Room - 4.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1029 - Staff Study - 20.45 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1030 - Resources Store - 3.43 m2		
No Asbestos		
B00E - R1031 - Careers Advisers Office - 12.82 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1032 - External Movement - 167.51 m2		
No Asbestos		
B00F - Multi Purpose Facilities - 2002 - Brick/Veneer		
Exterior		
No Asbestos		
Interior		
B00F - R0001 - Movement - 68.53 m2		
No Asbestos		
B00F - R0002 - Multi-Purpose Space - 494.56 m2		
No Asbestos		
B00F - R0003 - Sport Equipment Store - 20.49 m2		
No Asbestos		
B00F - R0004 - General Storeroom - 25.41 m2		
No Asbestos		
B00F - R0005 - General Storeroom - 25.41 m2		
No Asbestos		
B00F - R0006 - Chair Store - 21.91 m2		
No Asbestos		
B00F - R0007 - Movement - 10.22 m2		
No Asbestos		
B00F - R0008 - General Storeroom - 4.5 m2		

No Asbestos		
B00F - R0009 - Stage - 109.79 m2		
No Asbestos		
B00F - R0010 - Movement - 9.85 m2		
No Asbestos		
B00F - R0012 - Lift - 1.98 m2		
No Asbestos		
B00F - R0013 - Staff - Toilet - 9.22 m2		
No Asbestos		
B00F - R0015 - Distribution Board Cupboard - .74 m2		Note: No inspection of live electrical installation
No Asbestos		
B00F - R0016 - Movement - 25.27 m2		
No Asbestos		
B00F - R0017 - Cleaning Store - Distributed - 2.65 m2		
No Asbestos		
B00F - R0020 - Office/Store - 12.76 m2		
No Asbestos		
B00F - R0021 - Staff Kitchen - 7.42 m2		
No Asbestos		
B00F - R0022 - Access Student Shower/Toilet/Change - 4.73 m2		
No Asbestos		
B00F - R0023 - Movement - 10.47 m2		
No Asbestos		
B00F - R0024 - Control Room - 1 m2		
No Asbestos		
B00F - R0025 - External Movement - 119.32 m2		
No Asbestos		
B00F - R0026 - Toilets-Girls - 6.97 m2		
No Asbestos		
B00F - R0027 - Change - 18.56 m2		
No Asbestos		
B00F - R0028 - Change - 20.12 m2		
No Asbestos		
B00F - R0029 - Toilets-Boys - 6.25 m2		
No Asbestos		
B00F - R0030 - Toilet - Lobby - 1.96 m2		
No Asbestos		
B00F - R0031 - Toilets-Boys - 19.49 m2		
No Asbestos		
B00F - R0032 - Toilet - Lobby - 1.96 m2		
No Asbestos		
B00F - R0033 - Toilets-Girls - 24.77 m2		
No Asbestos		
B00F - R9001 - Practice/Seminar - 114.98 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00F - R9002 - External Movement - 4.82 m2		
No Asbestos		
B00G - Student Services - 2008 - Steel		
Exterior		
Ceiling Voids - Flat Roof	Non Accessible Area	
Underfloor Voids	Non Accessible Area	

Interior	
B00G - R0001 - External Movement - 5.63 m2	
No Asbestos	
B00G - R0002 - Uniform Shop - 26.26 m2	
No Asbestos	
B00G - R0003 - Uniform Shop - 6.06 m2	
No Asbestos	
B00H - Student Services - 2009 - Brick/Block	
Exterior	
No Asbestos	
Interior	
B00H - R0001 - External Movement - 7.93 m2	
No Asbestos	
B00H - R0002 - Movement - 4.62 m2	
No Asbestos	
B00H - R0003 - Lift - 2.27 m2	
No Asbestos	
B00H - R0004 - External Movement - 2.09 m2	
No Asbestos	
B00H - R1001 - External Movement - 7.9 m2	
No Asbestos	
B00H - R1002 - Movement - 4.57 m2	
No Asbestos	
B00I - Storage - 2012 - Timber	
Exterior	
No Asbestos	
Interior	
B00I - R0001 - General Storeroom - 38.6 m2	
No Asbestos	
B00Y - Building Services - 2012 - Brick/Block	
Exterior	
No Asbestos	
Interior	
B00Y - R0001 - Plant - 2.01 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020