


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kotara High School (8423)
Region:	Hunter/Central Coast AMU
State Electorate:	Charlestown
Local Government Area:	Newcastle

Last Reviewed By:	WSP 30-JUN-2017
Last Revised By:	AECOM 25-JUN-2020

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

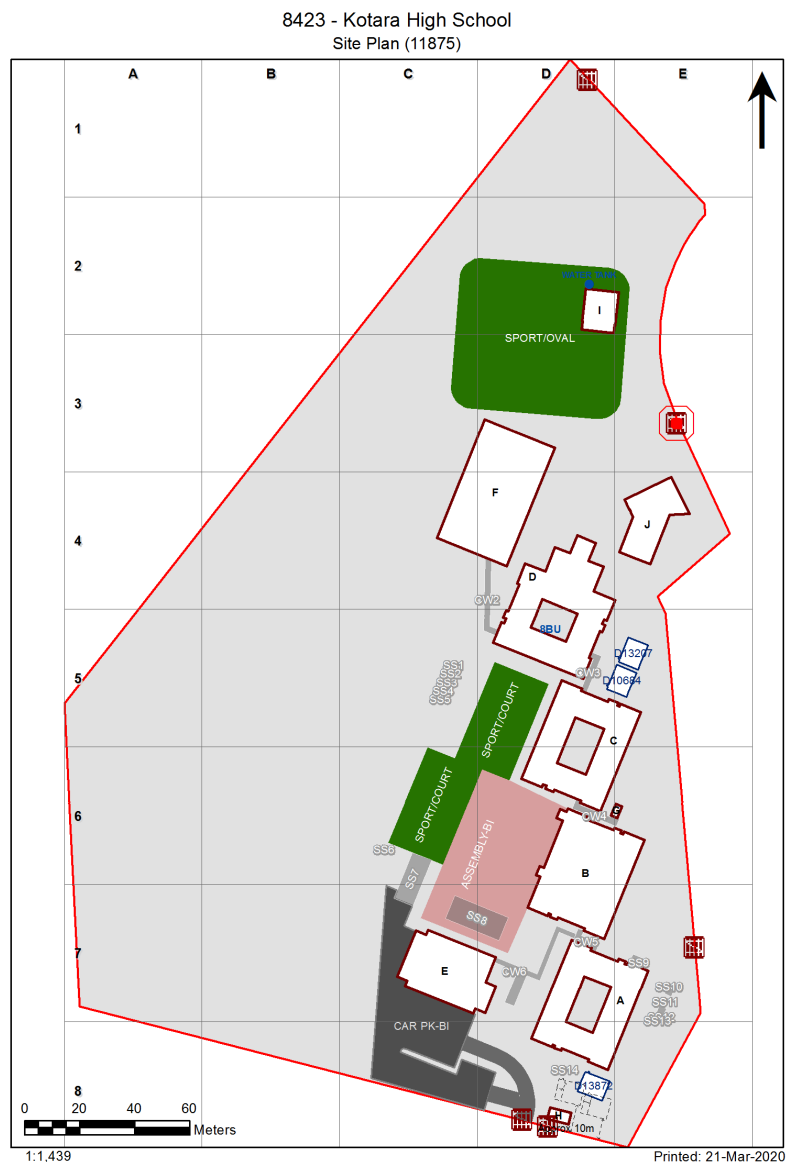

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Various - 1968 - Brick/Block							
Exterior							
Eaves Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Expansion Joint - Wall	Mastic						
Interior							
B00A - R0001 - General Learning Space - 58.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0002 - Staff Study - 39.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0003 - Movement - 9.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0004 - Staff - Toilet - 3.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0020 - Staff - Toilet - 2.92 m2							
No Asbestos							
B00A - R0023 - Laboratory L.S. - 85.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Furniture / Fixtures	Compressed AC Sheet	1	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0024 - Growing/Breeding - 8.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0025 - Preparation - 29.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0026 - Laboratory L.S. - 93.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0027 - Apparatus Store - 25.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0028 - Toilets-Boys - 26.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubides)	Compressed AC Sheet	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0029 - Cleaning Store - Distributed - 11.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0030 - General Learning Space - 53.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0031 - Cleaning Store - Distributed - 2.84 m2							
No Asbestos							
B00A - R0032 - General Storeroom - 1.2 m2							
No Asbestos							
B00A - R0033 - General Storeroom - 1.7 m2							
No Asbestos							
B00A - R0035 - Stairs - 3.72 m2							
No Asbestos							
B00A - R0036 - Stairs - 4.05 m2							
No Asbestos							
B00A - R0037 - General Storeroom - 5.8 m2							
No Asbestos							
B00A - R0038 - Movement - 170.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R0039 - Administration - Clerical - 60.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0040 - Staff Kitchen - 2.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0041 - General Learning Space - 52.24 m2							
No Asbestos							
B00A - R0042 - Staff Study - 26.01 m2							
No Asbestos							
B00A - R0043 - Staff Study - 15.45 m2							
No Asbestos							
B00A - R0044 - Staff Study - 15.13 m2							
No Asbestos							
B00A - R0045 - Computer Room - 31.05 m2							
No Asbestos							
B00A - R0046 - Movement - 33.17 m2							
No Asbestos							
B00A - R1001 - Textiles Technology L.S. - 78.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R1002 - Materials Store - 6.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1003 - Computer Learning Space - 66.26 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1005 - Computer Store - 6.22 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1007 - Computer Learning Space - 58.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1008 - Computer Resource - 13.11 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1009 - General Storeroom - 5.58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1010 - General Learning Space - 52.09 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1011 - Staff - Toilet - 2.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1012 - Distribution Board Cupboard - 1.2 m2 Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1015 - General Learning Space - 52.81 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1016 - General Learning Space - 52.45 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1017 - Toilets-Girls - 26.59 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Partition Walls (Cubicles)	Compressed AC Sheet	14m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1018 - General Storeroom - 5.59 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1019 - General Storeroom - 5.78 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1020 - General Learning Space - 52.81 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1021 - Cleaning Store - Distributed - 2.79 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1022 - Distribution Board Cupboard - 1.2 m2 Note: No inspection of live electrical installation								

Wall Linings Internal	Flat AC Sheeting	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R1023 - Movement - 170.23 m2							
No Asbestos							
B00A - R1024 - Stairs - 5.58 m2							
No Asbestos							
B00A - R1025 - Stairs - 5.35 m2							
No Asbestos							
B00A - R1026 - General Learning Space - 59.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1027 - Staff Kitchen - 15.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1028 - Staff Study - 15.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1029 - Staff Lounge - 79.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R1030 - Interview/Meeting - 17.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1031 - Interview/Meeting - 8.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - Various - 1968 - Brick/Block							
Exterior							
Eaves Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Expansion Joint - Wall	Mastic						
Interior							
B00B - R0001 - Food/Research Space - 22.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00B - R0002 - Materials Store - 3.67 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0003 - Cleaning Store - Distributed - 3.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0004 - Laundry - 14.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0005 - Food Technology L.S. - 79.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0006 - Pantry - 25.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Food Technology L.S. - 65.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0010 - General Learning Space - 52.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B00B - R0011 - Materials Store - 6.3 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0012 - Materials Store - 6.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0013 - Staff - Toilet - 2.87 m2							
No Asbestos							
B00B - R0014 - General Learning Space - 58.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0019 - Materials Store - 5.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0020 - Materials Store - 5.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0021 - General Learning Space - 52.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0022 - Cleaning Store - Distributed - 2.81 m2							
No Asbestos							
B00B - R0024 - General Storeroom - 1.2 m2							
No Asbestos							
B00B - R0025 - General Storeroom - 1.8 m2							

No Asbestos							
B00B - R0026 - General Storeroom - 1.2 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00B - R0027 - General Storeroom - 1.8 m2							
No Asbestos							
B00B - R0028 - Stairs - 3.84 m2							
No Asbestos							
B00B - R0029 - Stairs - 3.85 m2							
No Asbestos							
B00B - R0030 - Dust Extraction Space - 8.35 m2							
No Asbestos							
B00B - R0031 - Dust Extraction Space - 4.87 m2							
No Asbestos							
B00B - R0033 - Project Store - Type 1 - 7.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0034 - Project Store - Type 1 - 12.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0035 - Materials Store - 22.95 m2							
No Asbestos							
B00B - R0036 - Outdoor Workshop - 82.8 m2							
No Asbestos							
B00B - R0037 - Movement - 243.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00B - R0038 - Staff Study - 59.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0039 - General Learning Space - 142.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00B - R0040 - General Learning Space - 75.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R1001 - Art Learning Space - 72.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1002 - Resources Store - 6.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1003 - Resources Store - 6.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1004 - Art Learning Space - 53.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1005 - Art Learning Space - 52.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1006 - Resources Store - 9.04 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1007 - Kiln Space - 27.46 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1008 - Staff Study - 45.2 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1009 - General Storeroom - 5.7 m2								
No Asbestos								
B00B - R1010 - Music Store - 5.94 m2								
No Asbestos								
B00B - R1011 - Music Learning Space - 52.53 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R1012 - Staff - Toilet - 2.93 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1013 - Distribution Board Cupboard - 1.2 m2								
							Note: No inspection of live electrical installation	
No Asbestos								
B00B - R1015 - Workshop - 17.45 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1021 - Materials Store - 5.55 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1022 - Music Store - 5.83 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1023 - Music Learning Space - 52.53 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1024 - Cleaning Store - Distributed - 2.77 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1025 - Distribution Board Cupboard - 1.2 m2								
							Note: No inspection of live electrical installation	
No Asbestos								
B00B - R1026 - Movement - 185.5 m2								
No Asbestos								
B00B - R1027 - Stairs - 4.37 m2								
No Asbestos								
B00B - R1028 - Stairs - 4.8 m2								
No Asbestos								
B00B - R1029 - Materials Technology L.S. - 124.35 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
B00B - R1030 - Welding Area - 7.55 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1031 - Materials Store - 8.74 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1032 - Design L.S. - 75.38 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00B - R1033 - Movement - 4.43 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1034 - Music Store - 13.85 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1035 - Practice/Seminar - 21.01 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - Various - 1968 - Brick/Block								
Exterior								
Eaves Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Expansion Joint - Wall	Mastic							
Interior								
B00C - R0001 - Toilets-Boys - 31.89 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0002 - Darkroom Space - 25.93 m2								
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0003 - Staff Study - 39.38 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0004 - General Storeroom - 5.87 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0005 - Duplicating Workroom - 17.95 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0006 - Laboratory L.S. - 93.08 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0007 - Chemical Store - 25.94 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0008 - Toilets-Girls - 28.05 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R0009 - General Learning Space - 53.03 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0010 - Staff - Toilet - 3.65 m2								
No Asbestos								
B00C - R0011 - Distribution Board Cupboard - .52 m2								
Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0012 - Cleaning Store - Distributed - 3.38 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00C - R0013 - Laboratory L.S. - 85.42 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0016 - Laboratory L.S. - 92.43 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R0017 - General Learning Space - 58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0018 - General Learning Space - 52.83 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0019 - General Storeroom - 10.08 m2								
No Asbestos								
B00C - R0020 - Distribution Board Cupboard - .7 m2								
Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R0021 - Movement - 217.43 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
B00C - R0022 - Stairs - 7.13 m2								
No Asbestos								
B00C - R0023 - Stairs - 6.69 m2								
No Asbestos								
B00C - R0024 - Preparation - 39.3 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R1001 - General Learning Space - 58.85 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1002 - Performance Store - 25.97 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1003 - General Learning Space - 53.26 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00C - R1004 - Performance Workshop - 53.4 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00C - R1005 - Stage - 24.73 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00C - R1006 - Performing Arts Changeroom - 6.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R1007 - Performing Arts Changeroom - 6.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R1010 - Performing Arts Store - 11.62 m2								
No Asbestos								
B00C - R1011 - General Learning Space - 51.88 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
B00C - R1012 - Distribution Board Cupboard - .65 m2								
						Note: No inspection of live electrical installation		
Wall Linings Internal	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1013 - Staff - Toilet - 3.72 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R1020 - General Learning Space - 53.19 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1021 - General Learning Space - 53.18 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	No Asbestos Found							
B00C - R1022 - General Learning Space - 58.76 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	No Asbestos Found							
B00C - R1023 - General Storeroom - 5.82 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6.00m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)	
B00C - R1024 - General Storeroom - 5.55 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)	
B00C - R1025 - General Learning Space - 52.82 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1026 - Cleaning Store - Distributed - 4.5 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00C - R1027 - Distribution Board Cupboard - .75 m2						Note: No inspection of live electrical installation		
Wall Linings Internal	Flat AC Sheeting	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00C - R1028 - Movement - 189.04 m2								
No Asbestos								
B00C - R1029 - Stairs - 7.13 m2								
No Asbestos								
B00C - R1030 - Stairs - 6.69 m2								
No Asbestos								
B00C - R1031 - Staff Study - 45.78 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00C - R1034 - General Learning Space - 58.39 m2								
Floor Coverings Res/Textile	Textile	58.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R1035 - Staff Study - 52.88 m2								
Floor Coverings Res/Textile	Textile	53.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - Various - 1968 - Brick/Block								
Exterior								
Expansion Joint - Wall	Mastic							
Eaves Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00D - R0001 - Seminar - 13.4 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0002 - Seminar - 13.22 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0003 - Main Area - 351.29 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)							
B00D - R0004 - Librarian - 12.11 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0005 - Entry - 14.69 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0006 - Workroom - 30.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0007 - Seminar - 13.29 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0008 - Audio Visual Workroom - 25.35 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0009 - General Storeroom - 18.15 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0010 - Toilets-Girls - 10.06 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00D - R0011 - Cleaning Store - Distributed - 2.37 m2								
No Asbestos								
B00D - R0012 - Seminar - 30.8 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0016 - General Storeroom - 12.53 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0017 - Careers Advisers Office - 19.89 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00D - R0018 - Staff Study - 25.69 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0019 - General Learning Space - 58.36 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0020 - General Learning Space - 50.21 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0021 - General Storeroom - 5.41 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00D - R0022 - Materials Store - 10.23 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00D - R0023 - Cleaning Store - Distributed - 2.37 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00D - R0024 - Movement - 190.59 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
B00D - R0025 - Stairs - 4.75 m2								
No Asbestos								
B00D - R0026 - Stairs - 4.75 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00D - R0027 - Special Learning Space - 47.54 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0028 - Computer Room - 44.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00D - R0029 - Outdoor Learning Area - 48.32 m2								
No Asbestos								

B00D - R1001 - General Learning Space - 57.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1002 - Staff Study - 25.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1003 - General Learning Space - 52.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1004 - General Learning Space - 52.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1005 - General Learning Space - 57.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1006 - Resources Store - 12.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1007 - Entry - 3.23 m2							
No Asbestos							
B00D - R1008 - General Storeroom - 5.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1009 - General Learning Space - 50.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1010 - Staff - Toilet - 2.86 m2							
No Asbestos							
B00D - R1011 - Distribution Board Cupboard - .8 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Mounting Board	Resinous Board	3.00	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Sample Result(s) to be recorded
B00D - R1012 - Laboratory L.S. - 84.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1013 - Preparation - 22.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1014 - General Storeroom - 2.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1015 - Apparatus Store - 12.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R1016 - Laboratory L.S. - 92.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1019 - General Storeroom - 4.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

B00D - R1020 - General Storeroom - 5.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1021 - General Learning Space - 50.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1022 - Distribution Board Cupboard - .83 m2						Note: No inspection of live electrical installation	
Wall Linings Internal	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical	Resinous Board	3.00	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Sample Result(s) to be recorded
B00D - R1023 - Staff - Toilet - 3.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1024 - Movement - 177.55 m2							
No Asbestos							
B00D - R1025 - Stairs - 7.41 m2							
No Asbestos							
B00D - R1026 - Stairs - 7.41 m2							
No Asbestos							
B00D - R1027 - General Learning Space - 31.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - Pupil Facilities - 1968 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00E - R0001 - Sport Equipment Store - 29.36 m2							
No Asbestos							
B00E - R0002 - General Storeroom - 7.01 m2							
No Asbestos							
B00E - R0003 - Maintenance Bulk Store - 11.31 m2							
No Asbestos							
B00E - R0004 - Cleaning Store - Distributed - 4.57 m2							
No Asbestos							
B00E - R0005 - Cleaning Store - Distributed - 1.38 m2							
No Asbestos							
B00E - R0006 - General Assistants - 22.05 m2							
No Asbestos							
B00E - R0007 - General Storeroom - 14.38 m2							
No Asbestos							
B00E - R0008 - Movement - 7.25 m2							
No Asbestos							
B00E - R0011 - Staff - Toilet - 3.62 m2							
No Asbestos							
B00E - R0014 - General Storeroom - 6.14 m2							
No Asbestos							
B00E - R0015 - Main Switchroom - 11.3 m2							
No Asbestos							
B00E - R0018 - Distribution Board Cupboard - .61 m2						Note: No inspection of live electrical installation	

Electrical - Backing Board	Resinous Board	1.00	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0019 - Movement - 47.7 m2							
No Asbestos							
B00E - R0020 - Stairs - 11.27 m2							
No Asbestos							
B00E - R0021 - Stairs - 11.27 m2							
No Asbestos							
B00E - R0022 - Student Canteen - 25.83 m2							
No Asbestos							
B00E - R0023 - Office/Store - 7.9 m2							
No Asbestos							
B00E - R0024 - Student Canteen - 39.58 m2							
No Asbestos							
B00E - R0025 - Movement - 327.83 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	35m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0026 - Movement - 10.54 m2							
No Asbestos							
B00E - R0027 - Movement - 16.85 m2							
No Asbestos							
B00E - R0028 - Sport Equipment Store - 15.54 m2							
No Asbestos							
B00E - R1001 - Movement - 12.44 m2							
No Asbestos							
B00E - R1002 - Sport Equipment Store - 11.3 m2							
No Asbestos							
B00E - R1003 - Staff Change - 6.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1004 - Plant - 4.37 m2							
No Asbestos							
B00E - R1005 - Toilets-Girls - 23.24 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	45.00m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1006 - Change - 10.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1007 - Plant - 4.63 m2							
No Asbestos							
B00E - R1008 - Shower - 34.15 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1009 - Change - 38.42 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1010 - Toilets-Boys - 23.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1011 - Change - 10.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1012 - Plant - 4.74 m2							

No Asbestos							
B00E - R1013 - Staff Shower - 6.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7.00m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	
Ceiling Structures/Linings	Flat AC Sheeting						
B00E - R1014 - Movement - 12.5 m2							
No Asbestos							
B00E - R1015 - General Storeroom - 11.13 m2							
No Asbestos							
B00E - R1016 - Stairs - 15.57 m2							
No Asbestos							
B00E - R1017 - Stairs - 15.57 m2							
No Asbestos							
B00E - R1018 - Store - 1.05 m2							
No Asbestos							
B00E - R1019 - Store - 1.05 m2							
No Asbestos							
B00F - Multi Purpose Facilities - 1997 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - M0001 - Control Room - 5.43 m2							
No Asbestos							
B00F - M0002 - Movement - 5.38 m2							
No Asbestos							
B00F - M0003 - Movement - 5.34 m2							
No Asbestos							
B00F - R0001 - Shower/Change - 27.7 m2							
No Asbestos							
B00F - R0002 - Toilets-Girls - 5.88 m2							
No Asbestos							
B00F - R0003 - Sport Equipment Store - 18.68 m2							
No Asbestos							
B00F - R0004 - Distribution Board Cupboard - 2.56 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R0005 - Student Canteen - 15.25 m2							
No Asbestos							
B00F - R0006 - Cleaning Store - Distributed - 3.87 m2							
No Asbestos							
B00F - R0007 - Toilets-Boys - 24.2 m2							
No Asbestos							
B00F - R0008 - Toilets-Girls - 18.34 m2							
No Asbestos							
B00F - R0009 - Disabled Toilet - 9.81 m2							
No Asbestos							
B00F - R0010 - Sport Equipment Store - 29.04 m2							
No Asbestos							
B00F - R0011 - Chair Store - 24.54 m2							
No Asbestos							

B00F - R0012 - Chair Store - 21.33 m2		
No Asbestos		
B00F - R0013 - Toilets-Boys - 5.13 m2		
No Asbestos		
B00F - R0014 - Shower - 27.74 m2		
No Asbestos		
B00F - R0015 - Movement - 9.64 m2		
No Asbestos		
B00F - R0016 - Movement - 9.53 m2		
No Asbestos		
B00F - R0017 - Stage - 109.16 m2		
No Asbestos		
B00F - R0018 - Multi-Purpose Space - 600.56 m2		
No Asbestos		
B00F - R0019 - Movement - 214.89 m2		
No Asbestos		
B00F - R0020 - Sport Equipment Store - 18.41 m2		
No Asbestos		
B00F - R0021 - Control Room - 1.29 m2		
No Asbestos		
B00F - R0022 - Movement - 1.64 m2		
No Asbestos		
B00F - R0023 - Movement - 1.64 m2		
No Asbestos		
B00G - Mechanical Services - 2007 - Brick/Block		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids - Flat Roof	No Asbestos Found	
Interior		
B00G - R0001 - Lift - 4.35 m2		
No Asbestos		
B00G - R0002 - Lift - 2.1 m2		
No Asbestos		
B00G - R1001 - Lift - 4.35 m2		
No Asbestos		
B00H - Other - 2008 - Brick/Block		
Exterior		
Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00H - R0001 - General Assistant/Bulk Store - 31.64 m2		
No Asbestos		
B00I - General Learning - 2014 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00I - R0001 - Sport Equipment Store - 137.58 m2		

No Asbestos	
B00I - R0002 - External Movement - 34.57 m2	
No Asbestos	
B00J - Administration - 2018 - Brick/Veneer	
Exterior	
No Asbestos	
Interior	
B00J - R0001 - Public Reception - 22.72 m2	
No Asbestos	
B00J - R0002 - Interview/Meeting - 17.89 m2	
No Asbestos	
B00J - R0003 - Principal Office - 19.67 m2	
No Asbestos	
B00J - R0004 - Deputy Principal Office - 12.23 m2	
No Asbestos	
B00J - R0005 - Deputy Principal Office - 12.82 m2	
No Asbestos	
B00J - R0006 - Interview/Meeting - 12.85 m2	
No Asbestos	
B00J - R0007 - Movement - 58.67 m2	
No Asbestos	
B00J - R0008 - Printing/Photocopying - 9.51 m2	
No Asbestos	
B00J - R0009 - Secure Storeroom - 12.01 m2	
No Asbestos	
B00J - R0010 - External Movement - 44.33 m2	
No Asbestos	
B00J - R0011 - Administration - Clerical - 61.03 m2	
No Asbestos	
B00J - R0012 - Student Reception - 26.42 m2	
No Asbestos	
B00J - R0013 - Interview/Meeting - 12.92 m2	
No Asbestos	
B00J - R0014 - Administration - Executive - 12.36 m2	
No Asbestos	
B00J - R0015 - Toilets-Unisex - 5.85 m2	
No Asbestos	
B00J - R0016 - Clinic - 12.3 m2	
No Asbestos	
B00J - R0017 - Cleaning Store - Distributed - 3.97 m2	
No Asbestos	
B00J - R0018 - Staff - Toilet - 1.69 m2	
No Asbestos	
B00J - R0019 - Staff - Toilet - 1.69 m2	
No Asbestos	
B00J - R0020 - Distribution Board Cupboard - .88 m2	
No Asbestos	Note: No inspection of live electrical installation
B00J - R0021 - Communications Cupboard - 2.48 m2	
No Asbestos	
B00J - R0022 - External Movement - 1.22 m2	
No Asbestos	

B00J - R0023 - Staff Kitchen - 3.89 m2	
No Asbestos	
B00J - R0024 - External Movement - 2.38 m2	
No Asbestos	

Demountables

OS 601 10684 - Learning Unit - Standard/Withdrawal - Placement Date : 03-OCT-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 13207 - Learning Unit - Standard/Withdrawal - Placement Date : 03-OCT-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 13872 - Learning Unit - Standard/Withdrawal - Placement Date : 10-DEC-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found