


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Killara High School (8457)
Region:	Northern Sydney AMU
State Electorate:	Davidson
Local Government Area:	Ku-Ring-Gai

Last Reviewed By:	Greencap 13-AUG-2014
Last Revised By:	Greencap 02-AUG-2020

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

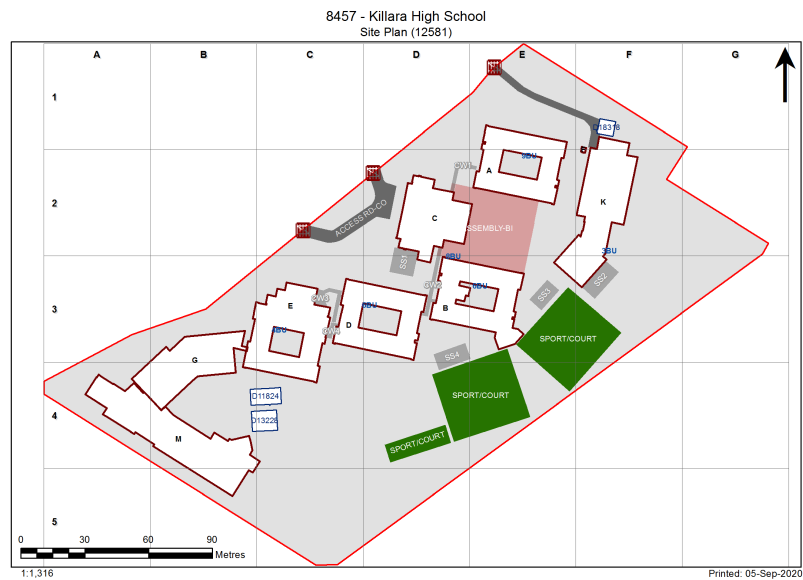

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning - 1968 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0003 - Staff - Toilet - 4.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0004 - Staff - Toilet - 4.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0008 - Administration - Clerical - 23.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0010 - Principal Office - 20.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - General Storeroom - 3.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0012 - Staff - Toilet - 3.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0014 - Administration - Clerical - 34.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - General Learning Space - 57.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0016 - Cleaning Supplies Store - 2.97 m2							
No Asbestos							
B00A - R0017 - Distribution Board Cupboard - 1.26 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0018 - General Storeroom - 2.55 m2							
No Asbestos							
B00A - R0020 - General Storeroom - 10.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0021 - Movement - 168.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						

B00A - R0022 - Toilets-Boys - 32.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0023 - Staff Study - 25.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0024 - Laboratory L.S. - 91.49 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00A - R0025 - Preparation - 29.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0026 - Apparatus Store - 8.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0027 - Laboratory L.S. - 83.23 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Non Accessible							
B00A - R0028 - Staff - Toilet - 5.02 m2							
No Asbestos							
B00A - R0029 - Distribution Board Cupboard - .99 m2							
							Note: No inspection of live electrical installation
B00A - R0030 - General Storeroom - 2.55 m2							
No Asbestos							
B00A - R0031 - Duplicating Workroom - 37.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - Administration - Clerical - 9.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0033 - Staff Study - 14.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0034 - Clinic-Waiting - 15.73 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0035 - Staff Study - 14.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0036 - Staff Study - 15.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0037 - Entry - 48.06 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0038 - Administration - Clerical - 7.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0039 - Staff Study - 15.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0040 - Stairs - 3.14 m2							
No Asbestos							
B00A - R0041 - Stairs - 3.28 m2							
No Asbestos							
B00A - R0042 - Staff Study - 36.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0043 - Deputy Principal - 13.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1001 - Toilets-Girls - 31.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1002 - General Learning Space - 51.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1004 - Distribution Board Cupboard - 1.04 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	4.00	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1009 - Staff - Toilet - 3.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R1010 - General Learning Space - 50.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1011 - Staff Study - 12.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1012 - General Storeroom - 5.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00A - R1014 - General Learning Space - 57.72 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1015 - General Storeroom - 6.46 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1016 - General Storeroom - 5.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1017 - General Learning Space - 52.07 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1018 - General Learning Space - 65.25 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1019 - General Storeroom - 5.88 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1020 - General Storeroom - 2.92 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1021 - General Storeroom - 2.83 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1022 - Staff Lounge - 66.8 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1023 - Distribution Board Cupboard - 1.26 m2								
Note: No inspection of live electrical installation								
Door - Lining	Flat AC Sheeting	4	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1024 - Cleaning Store - Distributed - 2.97 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1025 - General Learning Space - 50.87 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1026 - General Storeroom - 5.26 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1027 - General Storeroom - 4.88 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00A - R1028 - Movement - 167.32 m2								
No Asbestos								
B00A - R1031 - General Learning Space - 51.86 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1032 - Staff Study - 13.21 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1033 - Commonroom - 123.02 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	123m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00A - R1034 - Stairs - 5.91 m2								
No Asbestos								
B00A - R1035 - Stairs - 5.77 m2								
No Asbestos								
B00B - Various - 1968 - Brick/Block								
Exterior								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B00B - R0003 - Movement - 164.19 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
B00B - R0004 - Toilets-Disabled - 11.83 m2								
No Asbestos								
B00B - R0005 - Lift - 2.1 m2								
No Asbestos								
B00B - R0036 - Textiles Technology L.S. - 65.1 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0037 - Art Learning Space - 57.49 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0038 - Staff - Toilet - 4.06 m2								
No Asbestos								
B00B - R0039 - Distribution Board Cupboard - 1.15 m2								
Note: No inspection of live electrical installation								
Door - Lining	Flat AC Sheeting	4.00	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0042 - General Storeroom - 5.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0043 - Resources Store - 6.09 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0044 - Art Learning Space - 49.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							

Floor Coverings Res/Textile	Vinyl Tiles	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0050 - Food Technology L.S. - 93.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0051 - Materials Store - 8.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0052 - Materials Store - 6.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Plant / Equipment - Flue		3.00	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0053 - Cleaning Store - Distributed - 4.02 m2							
No Asbestos							
B00B - R0054 - Cleaning Store - Distributed - 1.26 m2							
Door - Lining	Flat AC Sheeting	2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0055 - General Storeroom - 2.55 m2							
No Asbestos							
B00B - R0057 - Textiles Technology L.S. - 51.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0058 - Music Store - 5.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0059 - Materials Store - 4.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	4.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0060 - Stairs - 2.78 m2							
No Asbestos							
B00B - R0061 - Stairs - 4.11 m2							
No Asbestos							
B00B - R0062 - General Storeroom - 13.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0063 - Movement - .75 m2							
No Asbestos							
B00B - R0065 - Preparation - Materials - 25.35 m2							
No Asbestos							
B00B - R0066 - Food Technology L.S. - 95.28 m2							
No Asbestos							
B00B - R0067 - Change - 9.62 m2							
No Asbestos							
B00B - R0068 - Plant - 1.06 m2							
No Asbestos							
B00B - R0069 - Project Store - Type 1 - 7.64 m2							
No Asbestos							
B00B - R0070 - Food Technology L.S. - 120.66 m2							
No Asbestos							

B00B - R0071 - Student Change - Type 2 - .86 m2							
No Asbestos							
B00B - R0072 - Student Change - Type 2 - 4.98 m2							
No Asbestos							
B00B - R0073 - Distribution Board Cupboard - .76 m2						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0074 - Seminar - Type 1 - 27.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0075 - Handwashing Facilities - 1.77 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00B - R0076 - No Access - 8.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1001 - Movement - 166.97 m2							
No Asbestos							
B00B - R1002 - Lift - 2.1 m2							
No Asbestos							
B00B - R1059 - Resources Store - 10.41 m2							
No Asbestos							
B00B - R1065 - Staff - Toilet - 3.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1066 - Distribution Board Cupboard - 1.26 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00B - R1068 - Materials Technology L.S. - 50.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1078 - Distribution Board Cupboard - 1.32 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00B - R1079 - Music Store - 3.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1080 - Music Learning Space - 50.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1081 - Music Store - 16.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1082 - Materials Store - 4.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1084 - Stairs - 5.58 m2							
No Asbestos							
B00B - R1085 - Stairs - 5.61 m2							
No Asbestos							
B00B - R1088 - General Learning Space - 70.2 m2							
No Asbestos							

B00B - R1089 - General Learning Space - 64.92 m2								
No Asbestos								
B00B - R1090 - General Learning Space - 64.81 m2								
No Asbestos								
B00B - R1091 - General Learning Space - 70.13 m2								
No Asbestos								
B00B - R1092 - General Learning Space - 70.49 m2								
No Asbestos								
B00B - R1093 - General Learning Space - 65.19 m2								
No Asbestos								
B00B - R1094 - General Assistants - 65.19 m2								
No Asbestos								
B00B - R1095 - Staff Lounge - 66.01 m2								
No Asbestos								
B00B - R1096 - Student Kitchen - 4.21 m2								
No Asbestos								
B00B - R9001 - Movement - 9.28 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00B - R9002 - Materials Store - 38.81 m2								
No Asbestos								
B00C - Other - 1968 - Brick/Block								
Exterior								
Ceiling Voids	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00C - R0002 - Cleaning Supplies Store - 11.38 m2								
No Asbestos								
B00C - R0005 - Sport Equipment Store - 6.25 m2								
No Asbestos								
B00C - R0006 - Staff - Toilet - 3.88 m2								
Ceiling Structures/Linings	Flat AC Sheeting	4.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0007 - Student Canteen - 57.02 m2								
No Asbestos								
B00C - R0008 - General Storeroom - 13.6 m2								
No Asbestos								
B00C - R0009 - Maintenance Bulk Store - 14.27 m2								
No Asbestos								
B00C - R0010 - Sport Equipment Store - 22.11 m2								
No Asbestos								
B00C - R0011 - Cleaning Store - Distributed - 1.43 m2								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0012 - Staff - Toilet - 4.65 m2								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00C - R0013 - Main Switchroom - 11.22 m2								
No Asbestos								
B00C - R0014 - Sport Equipment Store - 14.42 m2								
No Asbestos								
B00C - R0015 - Sport Equipment Store - 42.12 m2								

Ceiling Structures/Linings	Flat AC Sheeting	43m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0016 - Movement - 316.94 m2							
No Asbestos							
B00C - R0017 - Movement - 10.77 m2							
No Asbestos							
B00C - R0018 - Movement - 5.37 m2							
No Asbestos							
B00C - R0019 - Movement - 6.23 m2							
No Asbestos							
B00C - R0020 - Movement - 13.41 m2							
No Asbestos							
B00C - R0021 - Distribution Board Cupboard - .64 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	3	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0022 - General Storeroom - 2.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles	m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0023 - Stairs - 3.28 m2							
No Asbestos							
B00C - R0024 - Stairs - 3.28 m2							
No Asbestos							
B00C - R0025 - Movement - 233.28 m2							
No Asbestos							
B00C - R0026 - Movement - 10.68 m2							
No Asbestos							
B00C - R0027 - Sports Store - 11.04 m2							
No Asbestos							
B00C - R0028 - General Assistants - 16.43 m2							
No Asbestos							
B00C - R1000 - Chair Store - 11.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Boiler	Fibre Cement Pipe	4.00	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	
B00C - R1002 - Staff Change - 6.93 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1003 - General Storeroom - 5.61 m2							
No Asbestos							
B00C - R1004 - Toilets-Boys - 34.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1005 - Shower/Change - 37.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1006 - Shower/Change - 39.44 m2							
Partition Walls (Cubicles)	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1008 - Toilets-Girls - 34.19 m2							

Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1009 - General Storeroom - 5.02 m2							
No Asbestos							
B00C - R1010 - Staff Study - 6.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1011 - Sport Equipment Store - 11.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R1012 - Stairs - 13.8 m2							
No Asbestos							
B00C - R1014 - Stairs - 13.82 m2							
No Asbestos							
B00C - R1017 - Movement - 37.4 m2							
No Asbestos							
B00C - R1018 - Staff Kitchen - 6.83 m2							
No Asbestos							
B00C - R1019 - Staff Study - 32.06 m2							
No Asbestos							
B00C - R1020 - Shared Learning Space - 76.42 m2							
No Asbestos							
B00C - R1021 - Practice/Seminar - 77.06 m2							
No Asbestos							
B00C - R1022 - Performance Workshop - 77.9 m2							
No Asbestos							
B00C - R1023 - Movement - 13.6 m2							
No Asbestos							
B00C - R1024 - Movement - 13.12 m2							
No Asbestos							
B00D - Various - 1968 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0097 - Staff Study - 65.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0098 - Stairs - 6.89 m2							
No Asbestos							
B00D - R0099 - Stairs - 6.95 m2							
No Asbestos							
B00D - R0100 - Movement - 192.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00D - R0101 - Laboratory L.S. - 84.01 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00D - R0102 - Apparatus Store - 9.1 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					

B00D - R0103 - Preparation - 28.9 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00D - R0104 - Laboratory L.S. - 91.16 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00D - R0105 - General Learning Space - 57.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0106 - General Storeroom - 4.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0107 - General Storeroom - 4.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0108 - General Learning Space - 50.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0109 - General Storeroom - 9.74 m2							
No Asbestos							
B00D - R0110 - Distribution Board Cupboard - .74 m2				Note: No inspection of live electrical installation			
Door - Lining	Flat AC Sheeting	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0111 - Toilets-Boys - 29.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubicles)	Flat AC Sheeting						
B00D - R0115 - Preparation - 19.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0116 - Preparation - 5.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0117 - Laboratory L.S. - 91.64 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00D - R0118 - Apparatus Store - 25.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0119 - Toilets-Girls - 31.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubicles)	Flat AC Sheeting						
B00D - R0120 - Computer Learning Space - 50.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0121 - Cleaning Store - Distributed - 3.73 m2							
No Asbestos							
B00D - R0122 - Staff - Toilet - 3.85 m2							
No Asbestos							
B00D - R0123 - Distribution Board Cupboard - .74 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	4	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1199 - Stairs - 6.89 m2							
No Asbestos							
B00D - R1200 - Stairs - 6.95 m2							
No Asbestos							
B00D - R1201 - General Learning Space - 57.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1207 - General Learning Space - 51.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1208 - General Learning Space - 52.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1209 - Computer Learning Space - 57.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1210 - Music Store - 5.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1211 - General Storeroom - 5.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1212 - General Learning Space - 51.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1213 - General Storeroom - 5.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1214 - Distribution Board Cupboard - .74 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	4.00	East	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1215 - General Learning Space - 57.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1216 - Staff Study - 25.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1217 - General Learning Space - 52.05 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1218 - General Learning Space - 52.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1219 - General Storeroom - 10.74 m2							
No Asbestos							
B00D - R1220 - Staff Study - 38.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1221 - General Learning Space - 51.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1222 - General Learning Space - 44.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B00D - R1223 - Staff - Toilet - 3.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1224 - Movement - 186.25 m2							
No Asbestos							
B00D - R1225 - Distribution Board Cupboard - .72 m2							
Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	4	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1226 - Movement - 2.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R1227 - Staff Study - 37.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1228 - Staff Study - 9.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - Library/General Learning - 1972 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior							
B00E - R0001 - Computer Learning Space - 49.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0002 - Computer Learning Space - 48.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0003 - Computer Store - 8.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0004 - Staff Study - 56.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0005 - Computer Learning Space - 52.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0006 - General Storeroom - 32.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0007 - General Storeroom - 4.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0008 - Toilets-Girls - 13.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubicles)	Flat AC Sheeting						
Plant / Equipment - Incinerator	Fibre Cement Pipe	6.00	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0009 - Duplicating Workroom - 17.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0010 - Seminar - 12.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0011 - Workroom - 12.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0014 - Librarian - 12.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0015 - Administration - Clerical - 44.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0016 - Audio Visual Workroom - 46.87 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0017 - Toilets-Boys - 13.83 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Partition Walls (Cubicles)	Flat AC Sheeting							
B00E - R0018 - General Storeroom - 5.59 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0019 - General Learning Space - 54.38 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0020 - Movement - 148.32 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)							
B00E - R0021 - Distribution Board Cupboard - .24 m2 Note: No inspection of live electrical installation								
Door - Lining	Flat AC Sheeting	2.00	South	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)	
B00E - R0022 - Cleaning Store - Distributed - 4.25 m2								
Floor Coverings Res/Textile	Vinyl Tiles	5.00m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0023 - Maintenance Bulk Store - 3.22 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4.00m2	All surfaces	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)	
B00E - R0024 - Maintenance Bulk Store - 3.22 m2								
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0025 - Distribution Board Cupboard - .22 m2 Note: No inspection of live electrical installation								
Door - Lining	Flat AC Sheeting	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0026 - Main Area - 429 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)							
B00E - R0027 - Stairs - 3.38 m2								
No Asbestos								
B00E - R0028 - Stairs - 3.41 m2								
No Asbestos								
B00E - R1000 - Chemical Store - 32.74 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R1001 - Laboratory L.S. - 92.1 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00E - R1002 - Preparation - 24.33 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R1003 - Apparatus Store - .97 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1004 - Laboratory L.S. - 86.29 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00E - R1005 - Staff - Toilet - 3.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R1006 - General Learning Space - 51.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1007 - Staff Study - 13.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1008 - General Storeroom - 6.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1009 - Computer Learning Space - 59.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1010 - General Learning Space - 52.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1011 - General Learning Space - 54.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1012 - Staff Study - 26.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1013 - General Learning Space - 61.16 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1014 - Staff - Toilet - 3.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R1015 - General Learning Space - 52.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1016 - General Storeroom - 5.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1017 - Staff Study - 5.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1018 - Staff Study - 15.49 m2							
No Asbestos							
B00E - R1020 - Distribution Board Cupboard - 1.18 m2 Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1021 - Apparatus Store - 12.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1022 - Movement - 152.13 m2							
No Asbestos							
B00E - R1023 - Distribution Board Cupboard - 1.18 m2 Note: No inspection of live electrical installation							
Door - Lining	Flat AC Sheeting	6	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1024 - Stairs - 7.58 m2							
No Asbestos							
B00E - R1025 - Stairs - 7.54 m2							
No Asbestos							
B00F - Pupil Facilities - 2006 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - Lift - 2.09 m2							
No Asbestos							
B00F - R1001 - Lift - 2.09 m2							
No Asbestos							
B00G - Technological & Applied Studies - 2014 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00G - R0001 - External Movement - 267.34 m2							
No Asbestos							
B00G - R0002 - Project Store - Type 1 - 38.71 m2							
No Asbestos							
B00G - R0003 - Dust Extraction Space - 12.2 m2							
No Asbestos							
B00G - R0004 - Dark Room - 22.26 m2							
No Asbestos							
B00G - R0005 - General Learning Space - 58.88 m2							

No Asbestos	
B00G- R0006 - General Learning Space - Type 9 - 58.32 m2	
No Asbestos	
B00G- R0007 - Distribution Board Cupboard - 1.62 m2	Note: No inspection of live electrical installation
No Asbestos	
B00G- R0009 - Stairs - 15.57 m2	
No Asbestos	
B00G- R0010 - Materials Workshop - Type 2 - 113.12 m2	
No Asbestos	
B00G- R0011 - Materials Workshop - Type 2 - 113.37 m2	
No Asbestos	
B00G- R0012 - External Stairs - 11.75 m2	
No Asbestos	
B00G- R0013 - General Learning Space - Type 8 - 58.83 m2	
No Asbestos	
B00G- R0014 - General Learning Space - Type 8 - 58.91 m2	
No Asbestos	
B00G- R0015 - Project Store - Type 1 - 39.66 m2	
No Asbestos	
B00G- R0016 - Welding Area - 13.03 m2	
No Asbestos	
B00G- R0017 - L.P.G Store - 1.08 m2	
No Asbestos	
B00G- R0018 - Distribution Board Cupboard - 2.3 m2	Note: No inspection of live electrical installation
No Asbestos	
B00G- R0019 - Darkroom Space - 2.22 m2	
No Asbestos	
B00G- R0020 - External Movement - 2.66 m2	
No Asbestos	
B00G- R0021 - External Stairs - 8.61 m2	
No Asbestos	
B00G- R1001 - External Movement - 253.71 m2	
No Asbestos	
B00G- R1002 - External Stairs - 9.95 m2	
No Asbestos	
B00G- R1003 - Staff Study - 51.47 m2	
No Asbestos	
B00G- R1004 - Visual Arts Store - 25.99 m2	
No Asbestos	
B00G- R1005 - Project Store - Type 3 - 26.84 m2	
No Asbestos	
B00G- R1006 - Visual Arts Workshop - 117.1 m2	
No Asbestos	
B00G- R1007 - General Learning Space - 56.68 m2	
No Asbestos	
B00G- R1008 - General Learning Space - Type 5 - 56.88 m2	
No Asbestos	
B00G- R1009 - Distribution Board Cupboard - 1.61 m2	Note: No inspection of live electrical installation
No Asbestos	
B00G- R1011 - External Stairs - 11.99 m2	
No Asbestos	
B00G- R1012 - Visual Arts Workshop - 97.41 m2	

No Asbestos		
B00G - R1013 - General Learning Space - Type 4 - 58.88 m2		
No Asbestos		
B00G - R1014 - General Learning Space - Type 4 - 58.88 m2		
No Asbestos		
B00G - R1015 - Access Staff Shower/Toilet - 7.99 m2		
No Asbestos		
B00G - R1016 - Project Store - Type 3 - 29.95 m2		
No Asbestos		
B00G - R1017 - Kiln Space - 15.56 m2		
No Asbestos		
B00G - R1018 - Visual Arts Store - 19.1 m2		
No Asbestos		
B00G - R9001 - Outdoor Workshop - 162.25 m2		
No Asbestos		
B00G - R9002 - Dust Extraction Space - 3.05 m2		
No Asbestos		
B00G - R9003 - Distribution Board Cupboard - 2.05 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00G - R9005 - Cleaning Store - Distributed - 5.86 m2		
No Asbestos		
B00G - R9006 - Stairs - 17.76 m2		
No Asbestos		
B00G - R9007 - Materials Store - 24.07 m2		
No Asbestos		
B00G - R9009 - Lift - 2.27 m2		
No Asbestos		
B00K - Multi Purpose Facilities - 1972 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00K - R0001 - Multi-Purpose Space - 654.18 m2		
No Asbestos		
B00K - R0002 - Movement - 22.19 m2		
No Asbestos		
B00K - R0003 - Staff Study - 16.12 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0004 - Tiered Learning Area - 277.28 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0005 - General Storeroom - 76.4 m2		
No Asbestos		
B00K - R0006 - Control Room - 4.93 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0007 - Ramp - 3.4 m2		
No Asbestos		
B00K - R0008 - Public Entry - 61.11 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0009 - Administration - Clerical - 5.88 m2		

No Asbestos		
B00K - R0010 - Staff Kitchen - 9.24 m2		
No Asbestos		
B00K - R0011 - Shower/Change - 22.05 m2		
No Asbestos		
B00K - R0020 - Main Switchroom - 2.02 m2		
No Asbestos		
B00K - R0021 - Shower/Change - 21.81 m2		
No Asbestos		
B00K - R0022 - Sport Equipment Store - 20.34 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0023 - Chair Store - 22.65 m2		
No Asbestos		
B00K - R9006 - Movement - 1.23 m2		
No Asbestos		
B00K - R9007 - Ramp - 1.32 m2		
No Asbestos		
B00K - R9008 - Movement - 11.19 m2		
No Asbestos		
B00K - R9009 - Tiered Learning Store - 35.84 m2		
No Asbestos		
B00K - R9010 - Staff Toilet - 1.68 m2		
No Asbestos		
B00K - R9013 - Movement - 37.07 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R9014 - Toilets-Girls - 8.77 m2		
No Asbestos		
B00K - R9016 - Toilets-Disabled - 2.77 m2		
No Asbestos		
B00K - R9017 - Toilets-Boys - 9.36 m2		
No Asbestos		
B00K - R9020 - Tiered Learning Store - 27.94 m2		
No Asbestos		
B00K - R9021 - Tiered Learning Store - 23.77 m2		
No Asbestos		
B00M - General Learning - 2020 - Concrete Framed		
Exterior		
Require Inspection		
Interior		
B00M - R0001 - External Movement - 400.57 m2		
Require Inspection		
B00M - R0002 - External Stairs - 6.66 m2		
Require Inspection		
B00M - R0003 - Distribution Board Cupboard - 1.86 m2		
Note: No inspection of live electrical installation		
Require Inspection		
B00M - R0004 - General Learning Space - 59.42 m2		
Require Inspection		
B00M - R0005 - General Learning Space - 59.03 m2		
Require Inspection		
B00M - R0006 - Staff Kitchen - 2.7 m2		

Require Inspection
B00M - R0007 - Staff Study - 44.78 m2
Require Inspection
B00M - R0008 - Movement - 18.88 m2
Require Inspection
B00M - R0009 - Collaboration Space - 10.93 m2
Require Inspection
B00M - R0010 - Special Education Support Centre - 26.67 m2
Require Inspection
B00M - R0011 - Cleaning Store - Distributed - 2.99 m2
Require Inspection
B00M - R0012 - Staff - Toilet - 2.5 m2
Require Inspection
B00M - R0013 - Toilets-Boys - 11.1 m2
Require Inspection
B00M - R0014 - Toilets-Girls - 11.16 m2
Require Inspection
B00M - R0015 - Toilets-Disabled - 5.94 m2
Require Inspection
B00M - R0016 - External Stairs - 12.12 m2
Require Inspection
B00M - R0017 - Apparatus Storage - 11.78 m2
Require Inspection
B00M - R0018 - Movement - 5.37 m2
Require Inspection
B00M - R0019 - Communications Cupboard - 7.89 m2
Require Inspection
B00M - R0020 - Preparation - 29.34 m2
Require Inspection
B00M - R0021 - Science Laboratory - 99.71 m2
Require Inspection
B00M - R0022 - General Learning Space - Type 10 - 59.17 m2
Require Inspection
B00M - R0023 - General Learning Space - Type 10 - 58.56 m2
Require Inspection
B00M - R0024 - Shared Learning Space - 66.01 m2
Require Inspection
B00M - R0025 - Seminar Space - 23.35 m2
Require Inspection
B00M - R0026 - General Learning Space - Type 10 - 58.54 m2
Require Inspection
B00M - R0027 - General Learning Space - Type 10 - 58.9 m2
Require Inspection
B00M - R0028 - Science Laboratory - 96.13 m2
Require Inspection
B00M - R0029 - Seminar Space - 21.21 m2
Require Inspection
B00M - R0030 - External Stairs - 12.38 m2
Require Inspection
B00M - R0031 - Chemical Store - 11.75 m2
Require Inspection
B00M - R0032 - Preparation - 28.22 m2

Require Inspection
B00M - R0033 - Apparatus Storage - 13.41 m2
Require Inspection
B00M - R0035 - External Movement - 40.36 m2
Require Inspection
B00M - R0036 - Lift - 4.59 m2
Require Inspection
B00M - R0037 - Plant - .75 m2
Require Inspection
B00M - R0038 - Plant - .49 m2
Require Inspection
B00M - R0039 - Toilet - Lobby - 2.3 m2
Require Inspection
B00M - R0040 - Toilet - Lobby - 2.58 m2
Require Inspection
B00M - R0041 - Staff - Toilet - 2.53 m2
Require Inspection
B00M - R0042 - External Stairs - 6.15 m2
Require Inspection
B00M - R0043 - Distribution Board Cupboard - .55 m2
Note: No inspection of live electrical installation
Require Inspection
B00M - R1001 - External Stairs - 7.7 m2
Require Inspection
B00M - R1002 - Distribution Board Cupboard - 1.25 m2
Note: No inspection of live electrical installation
Require Inspection
B00M - R1003 - General Learning Space - 59.01 m2
Require Inspection
B00M - R1004 - Shared Learning Space - 95.26 m2
Require Inspection
B00M - R1005 - Seminar Space - 26.23 m2
Require Inspection
B00M - R1006 - Staff Study - 101.24 m2
Require Inspection
B00M - R1007 - Store - 15.58 m2
Require Inspection
B00M - R1008 - General Learning Space - 58.41 m2
Require Inspection
B00M - R1009 - General Learning Space - 57.78 m2
Require Inspection
B00M - R1010 - Toilets-Boys - 11.03 m2
Require Inspection
B00M - R1011 - Toilets-Disabled - 5.79 m2
Require Inspection
B00M - R1012 - Toilets-Girls - 11.31 m2
Require Inspection
B00M - R1013 - Movement - 7.05 m2
Require Inspection
B00M - R1014 - Toilets-Disabled - 2.65 m2
Require Inspection
B00M - R1015 - Communications Cupboard - 7.91 m2
Require Inspection
B00M - R1016 - External Stairs - 12.64 m2

Require Inspection
B00M - R1017 - External Movement - 202.31 m2
Require Inspection
B00M - R1018 - Store - 21.8 m2
Require Inspection
B00M - R1019 - Cleaning Store - Distributed - 2.74 m2
Require Inspection
B00M - R1020 - Shared Learning Space - 46.52 m2
Require Inspection
B00M - R1021 - Seminar Space - 21.87 m2
Require Inspection
B00M - R1022 - General Learning Space - 58.99 m2
Require Inspection
B00M - R1023 - General Learning Space - 59.44 m2
Require Inspection
B00M - R1024 - General Learning Space - 57.77 m2
Require Inspection
B00M - R1025 - General Learning Space - 58.57 m2
Require Inspection
B00M - R1026 - Shared Learning Space - 62.37 m2
Require Inspection
B00M - R1027 - Seminar Space - 24.11 m2
Require Inspection
B00M - R1028 - General Learning Space - 59.83 m2
Require Inspection
B00M - R1029 - General Learning Space - 59.82 m2
Require Inspection
B00M - R1030 - External Stairs - 17.1 m2
Require Inspection
B00M - R1031 - Distribution Board Cupboard - .45 m2
Note: No inspection of live electrical installation
Require Inspection
B00M - R1032 - External Movement - 10.78 m2
Require Inspection
B00M - R1033 - Staff - Toilet - 7.75 m2
Require Inspection
B00M - R1034 - Plant - .48 m2
Require Inspection
B00M - R1035 - Plant - .81 m2
Require Inspection
B00M - R1036 - Toilet - Lobby - 2.61 m2
Require Inspection
B00M - R1037 - Toilet - Lobby - 2.61 m2
Require Inspection
B00M - R1038 - Practical Activities - 5.4 m2
Require Inspection
B00M - R1040 - Staff Kitchen - 3.62 m2
Require Inspection
B00M - R1041 - Practical Activities - 11.74 m2
Require Inspection
B00M - R1042 - Practical Activities - 6.27 m2
Require Inspection

B00M - R1043 - External Movement - 29.41 m2	
Require Inspection	
B00M - R1044 - Plant - .37 m2	
Require Inspection	
B00M - R1045 - Plant - .34 m2	
Require Inspection	
B00M - R9001 - Plant - 8.46 m2	
Require Inspection	
B00M - R9002 - Store - 26.74 m2	
Require Inspection	
B00M - R9003 - Covered Vehicle Area/Porte Cochere - 191.12 m2	
Require Inspection	
B00M - R9004 - Covered Area - 542.71 m2	
Require Inspection	
B00M - R9005 - External Stairs - 16.72 m2	
Require Inspection	
B00M - R9006 - External Movement - 32.74 m2	
Require Inspection	
B00M - R9007 - Distribution Board Cupboard - 1.21 m2	Note: No inspection of live electrical installation
Require Inspection	
B00M - R9008 - Store - 33.95 m2	
Require Inspection	
B00M - R9009 - External Movement - 96.07 m2	
Require Inspection	

Demountables

OS 720 11824 - Science Laboratory/Prep Room - Placement Date : 30-MAY-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

NS 220 13228 - Science Learning/Preparation Space - Placement Date : 03-JAN-2007

No Asbestos Found

OS 600 18318 - Learning Unit - Small - Placement Date : 12-OCT-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found