

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Kingswood High School (8458)
Region:	Western Sydney AMU
State Electorate:	Penrith
Local Government Area:	Penrith

Last Reviewed By:	WSP 26-FEB-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

8458 - Kingswood High School
Site Plan (12403)

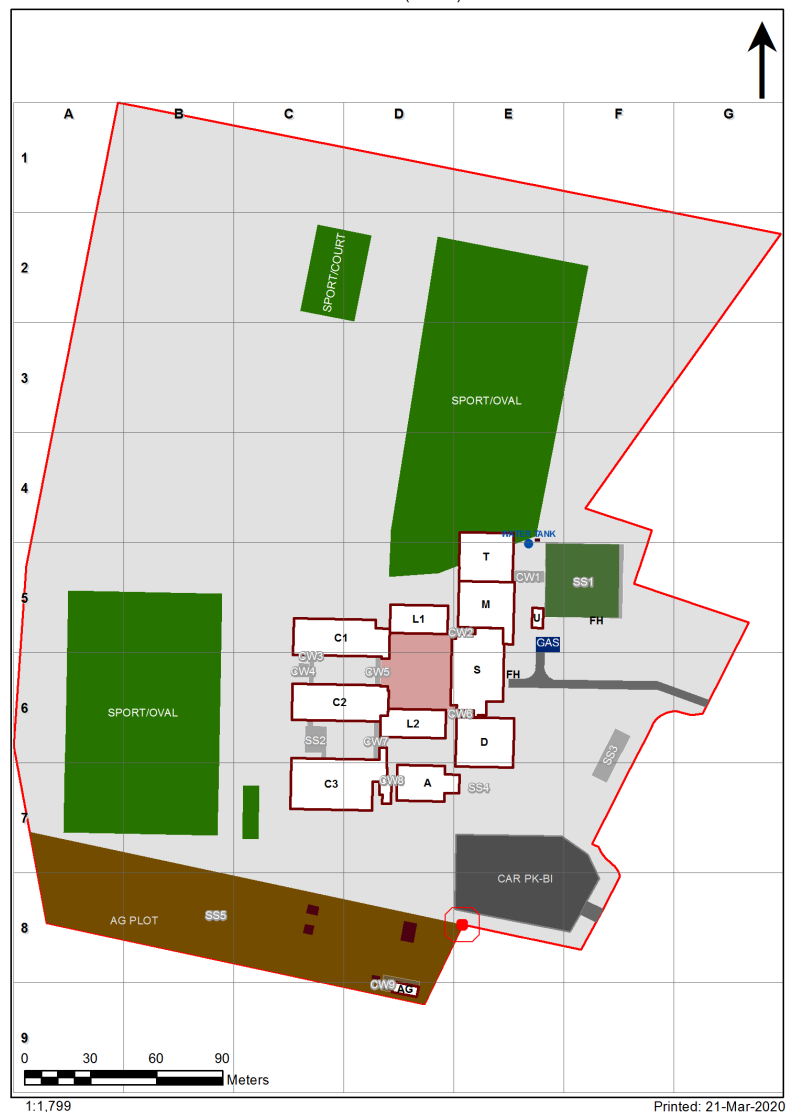

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1970 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - Movement - 1.35 m2							
No Asbestos							
B00A - R0002 - Administration - Clerical - 28.51 m2							
No Asbestos							
B00A - R0003 - Administration - Clerical - 13.4 m2							
No Asbestos							
B00A - R0004 - Principal Office - 16.38 m2							
No Asbestos							
B00A - R0005 - Staff - Toilet - 3.42 m2							
No Asbestos							
B00A - R0006 - General Storeroom - 3.22 m2							
No Asbestos							
B00A - R0007 - Interview/Office - Type 1 - 13.69 m2							
No Asbestos							
B00A - R0008 - Movement - 1.37 m2							
No Asbestos							
B00A - R0009 - Administration - Clerical - 12.59 m2							
No Asbestos							
B00A - R0010 - Movement - 1.37 m2							
No Asbestos							
B00A - R0011 - Deputy Principal Office - 16.59 m2							
No Asbestos							
B00A - R0012 - Staff - Toilet - 8.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0013 - Cleaning Store - Distributed - 1.53 m2							
No Asbestos							
B00A - R0014 - Staff - Toilet - 10.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - Clinic - Boys - 13.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0016 - Clinic - Boys - 6.77 m2							
No Asbestos							
B00A - R0017 - Duplicating Workroom - 6.83 m2							
No Asbestos							
B00A - R0018 - Interview/Office - Type 1 - 14 m2							
No Asbestos							
B00A - R0019 - Movement - 1.35 m2							
No Asbestos							
B00A - R0020 - Distribution Board Cupboard - .81 m2							
No Asbestos							Note: No inspection of live electrical installation
B00A - R0021 - General Storeroom - 2.37 m2							
No Asbestos							

B00A - R0022 - Administration - Clerical - 11.48 m2							
No Asbestos							
B00A - R0023 - Movement - 104.42 m2							
No Asbestos							
B00A - R0024 - External Movement - 55.86 m2							
No Asbestos							
B00D - Technological & Applied Studies - 1970 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Food Technology L.S. - 84.19 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0002 - Food/Research Space - 15.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0003 - Pantry - 15.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0004 - Food Technology L.S. - 83.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0005 - Laundry - 15.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0006 - General Storeroom - 6.55 m2							
No Asbestos							
B00D - R0007 - General Storeroom - 4.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0008 - Cleaning Store - Distributed - 4.55 m2							
Ceiling Structures/Linings	No Asbestos Found						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0009 - Commonroom - 66.44 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00D - R0010 - Commonroom - 7.01 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00D - R0011 - General Storeroom - 10.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0012 - Staff Study - 30.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0013 - Shower/Change - 21.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0014 - Distribution Board Cupboard - 1.36 m2							
							Note: No inspection of live electrical installation

Ceiling Structures/Linings	No Asbestos Found						
Electrical - Backing Board	Resinous Board	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0015 - Toilets-Girls - 66.62 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0016 - Movement - 1.25 m2							
No Asbestos							
B00D - R0017 - Movement - 85.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0018 - Movement - 1.29 m2							
No Asbestos							
B00D - R1001 - Art Learning Space - 66.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1002 - Bulk Store - 13.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1003 - Art Learning Space - 66.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1004 - Distribution Board Cupboard - 1.56 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R1005 - Cleaning Store - Distributed - .9 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1006 - Design L.S. - 66.76 m2							
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1007 - Materials Store - 4.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1008 - General Storeroom - 10.18 m2							
No Asbestos							
B00D - R1009 - Design L.S. - 67.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1010 - Staff Study - 32.03 m2							
No Asbestos							
B00D - R1011 - Music Learning Space - 66.25 m2							
No Asbestos							
B00D - R1012 - Music Learning Space - 66.8 m2							
No Asbestos							
B00D - R1013 - Movement - 63.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - Art/Technological & Applied Studies - 1970 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Interior							
B00M - R0001 - Toilets-Boys - 68.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R0002 - Cleaning Store - Distributed - 1.8 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00M - R0003 - Distribution Board Cupboard - 2.75 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00M - R0004 - No Access - 82.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00M - R0008 - General Storeroom - 15.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00M - R0009 - Art Learning Space - 64.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00M - R0010 - Bulk Store - 7.52 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00M - R0011 - Kiln Space - 13.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00M - R0013 - Movement - 26.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00M - R0014 - Metal Technology Bay - 106.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00M - R0015 - Welding/Hot Metals Area - 5.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00M - R0016 - Welding/Hot Metals Area - 5.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00M - R0017 - General Storeroom - 11.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00M - R0018 - External Movement - 87.77 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00M - R1001 - Wood Technology Bay - 83.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R1002 - Dust Extraction Space - 3.84 m2							
No Asbestos							
B00M - R1003 - Dust Extraction Space - 5.94 m2							
No Asbestos							
B00M - R1004 - Materials Store - 21.42 m2							
No Asbestos							
B00M - R1005 - Materials Technology L.S. - 83.63 m2							
No Asbestos							
B00M - R1006 - Wood Technology Bay - .68 m2							
No Asbestos							
B00M - R1007 - General Storeroom - 12.78 m2							

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R1008 - Design L.S. - 53.87 m2							
No Asbestos							
B00M - R1009 - Staff Study - 25.94 m2							
No Asbestos							
B00M - R1010 - General Learning Space - 53.49 m2							
No Asbestos							
B00M - R1011 - Materials Store - 13.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00M - R1012 - Distribution Board Cupboard - 1.03 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Material - Stored / Debris Material	Flat AC Sheeting						
B00M - R1013 - Movement - 57.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - Multi Purpose Facilities - 1970 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00S - R0001 - Darkroom Space - 19.26 m2							
No Asbestos							
B00S - R0002 - Cleaning Store - Distributed - 1.06 m2							
No Asbestos							
B00S - R0003 - General Storeroom - 16.57 m2							
No Asbestos							
B00S - R0004 - Distribution Board Cupboard - .74 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00S - R0005 - Staff - Toilet - 3.37 m2							
No Asbestos							
B00S - R0006 - Cleaning Supplies Store - 6.41 m2							
No Asbestos							
B00S - R0007 - Staff - Toilet - 3.39 m2							
No Asbestos							
B00S - R0008 - Movement - 79.73 m2							
No Asbestos							
B00S - R0009 - Student Canteen - 50.23 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles						
B00S - R0010 - General Storeroom - 1.02 m2							
No Asbestos							
B00S - R0011 - General Storeroom - 6.54 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00S - R0012 - Main Switchroom - 10.2 m2							
No Asbestos							
B00S - R0013 - Sport Equipment Store - 16.25 m2							
No Asbestos							
B00S - R0014 - Sport Equipment Store - 18.67 m2							

No Asbestos							
B00S - R0015 - Multi-Purpose Space - 309.07 m2							
No Asbestos							
B00S - R0016 - External Stairs - 1.02 m2							
No Asbestos							
B00S - R0017 - General Storeroom - 13.07 m2							
No Asbestos							
B00S - R0018 - Chair Store - 17 m2							
No Asbestos							
B00S - R0019 - General Storeroom - 17 m2							
No Asbestos							
B00S - R0020 - Materials Store - 13.07 m2							
No Asbestos							
B00S - R0021 - External Stairs - 2.38 m2							
No Asbestos							
B00S - R0022 - External Movement - 37.37 m2							
No Asbestos							
B00S - R0024 - External Movement - 91.55 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00S - R1001 - Cleaning Store - Distributed - 3.39 m2							
No Asbestos							
B00S - R1002 - Staff Change - 9.66 m2							
No Asbestos							
B00S - R1003 - Staff - Toilet - 9.18 m2							
No Asbestos							
B00S - R1004 - Shower/Change - 61.83 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R1005 - Shower/Change - 61.49 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00S - R1006 - Staff - Toilet - 8.55 m2							
No Asbestos							
B00S - R1007 - General Storeroom - 9.66 m2							
No Asbestos							
B00S - R1008 - Cleaning Store - Distributed - 3.39 m2							
No Asbestos							
B00S - R1009 - Movement - 70.71 m2							
No Asbestos							
B00S - R1010 - External Stairs - 14.23 m2							
No Asbestos							
B00S - R1011 - External Movement - 37.37 m2							
No Asbestos							
B00S - R1012 - External Stairs - 14.45 m2							
No Asbestos							
B00S - R1013 - External Movement - 39 m2							
No Asbestos							
B00T - Technological & Applied Studies - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						

Underfloor Voids - Slab on Ground	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00T - R0001 - Materials Technology L.S. - 233.36 m2		
No Asbestos		
B00T - R0002 - Toilets-Disabled - 3.9 m2		
No Asbestos		
B00T - R0003 - Materials Store - 6.47 m2		
No Asbestos		
B00T - R0004 - Materials Store - 9.32 m2		
No Asbestos		
B00T - R0005 - Welding/Hot Metals Area - 3.7 m2		
No Asbestos		
B00T - R0006 - Welding/Hot Metals Area - 3.74 m2		
No Asbestos		
B00T - R0007 - Welding/Hot Metals Area - 3.85 m2		
No Asbestos		
B00T - R0008 - Welding/Hot Metals Area - 3.85 m2		
No Asbestos		
B00T - R0009 - Computer Room - 40.02 m2		
No Asbestos		
B00T - R0010 - General Storeroom - 13.9 m2		
No Asbestos		
B00T - R0011 - Plant - .39 m2		
No Asbestos		
B00T - R0012 - Staff Study - 14.47 m2		
No Asbestos		
B00T - R0013 - External Movement - 179.07 m2		
No Asbestos		
B00U - Physical Education - 2007 - Metal Shed		
Exterior		
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00U - R0001 - Sport Equipment Store - 42.3 m2		
No Asbestos		
B0AG - Agricultural Science - 1970 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B0AG - R0001 - Shower/Change - 8.42 m2		
No Asbestos		
B0AG - R0002 - General Assistants - 12.69 m2		
No Asbestos		
B0AG - R0003 - Machine Storage - 20.61 m2		

No Asbestos								
B0AG - R0004 - Shower/Change - 8.42 m2								
No Asbestos								
B0C1 - General Learning - 1970 - Brick/Block								
Exterior								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B0C1 - R0001 - General Learning Space - 53.65 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B0C1 - R0002 - General Learning Space - 53.07 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B0C1 - R0003 - General Storeroom - 12.04 m2								
Ceiling Structures/Linings	No Asbestos Found							
B0C1 - R0004 - General Learning Space - 53.07 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B0C1 - R0005 - Staff Study - 25.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B0C1 - R0006 - General Learning Space - 53.65 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B0C1 - R0007 - General Learning Space - 53.58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B0C1 - R0008 - General Storeroom - 11.4 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B0C1 - R0009 - Staff Study - 50.79 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B0C1 - R0010 - Cleaning Store - Distributed - 3.31 m2								
Ceiling Structures/Linings	No Asbestos Found							
B0C1 - R0011 - Interview/Office - Type 1 - 10.92 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B0C1 - R0012 - Distribution Board Cupboard - .93 m2								
						Note: No inspection of live electrical installation		
Wall Linings Internal - Infill	Flat AC Sheeting	<1m2	South	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)	Chrysotile (white asbestos)	
B0C1 - R0013 - General Storeroom - 32.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B0C1 - R0014 - Staff - Toilet - 7.56 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B0C1 - R0015 - Staff - Toilet - 5.25 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B0C1 - R0016 - General Storeroom - 5.12 m2							
Ceiling Structures/Linings	No Asbestos Found						
B0C1 - R0017 - External Movement - 2.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B0C1 - R0018 - Movement - 85.31 m2							
Floor Coverings Res/Textile	Vinyl Tiles	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B0C1 - R0019 - External Movement - .96 m2							
No Asbestos							
B0C1 - R0020 - External Movement - .96 m2							
No Asbestos							
B0C1 - R0021 - Stairs - 5.72 m2							
No Asbestos							
B0C1 - R0022 - External Movement - 51.72 m2							
No Asbestos							
B0C1 - R0023 - General Storeroom - 10.85 m2							
No Asbestos							
B0C1 - R0024 - External Stairs - 16.9 m2							
No Asbestos							
B0C1 - R1001 - Staff Study - 39.67 m2							
No Asbestos							
B0C1 - R1002 - Interview/Office - Type 1 - 10.8 m2							
No Asbestos							
B0C1 - R1003 - Cleaning Store - Distributed - 3.71 m2							
No Asbestos							
B0C1 - R1004 - Distribution Board Cupboard - 1.19 m2							
No Asbestos						Note: No inspection of live electrical installation	
B0C1 - R1005 - Movement - 28.35 m2							
No Asbestos							
B0C1 - R1006 - Movement - 2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C1 - R1007 - General Learning Space - 53.73 m2							
No Asbestos							
B0C1 - R1008 - General Storeroom - 19 m2							
No Asbestos							
B0C1 - R1009 - General Learning Space - 53.51 m2							
No Asbestos							
B0C1 - R1010 - General Learning Space - 53.51 m2							
No Asbestos							
B0C1 - R1011 - General Learning Space - 53.51 m2							
No Asbestos							
B0C1 - R1012 - General Learning Space - 53.51 m2							
No Asbestos							
B0C1 - R1013 - Staff Study - 19 m2							
No Asbestos							
B0C1 - R1014 - General Learning Space - 53.5 m2							
No Asbestos							

B0C1 - R1015 - General Learning Space - 53.5 m2							
No Asbestos							
B0C1 - R1016 - Movement - 17.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C1 - R1019 - Stairs - 9.24 m2							
No Asbestos							
B0C1 - R1020 - External Movement - 52.19 m2							
No Asbestos							
B0C1 - R1021 - External Stairs - 23.47 m2							
No Asbestos							
B0C2 - General Learning - 1970 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0C2 - R0001 - General Learning Space - 53.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B0C2 - R0002 - General Learning Space - 52.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B0C2 - R0003 - Duplicating Workroom - 39.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B0C2 - R0004 - General Learning Space - 52.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B0C2 - R0005 - General Learning Space - 53.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B0C2 - R0006 - General Learning Space - 53.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B0C2 - R0007 - General Storeroom - 11.22 m2							
Ceiling Structures/Linings	No Asbestos Found						
B0C2 - R0008 - General Learning Space - 49.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B0C2 - R0009 - Cleaning Store - Distributed - 3.24 m2							
Ceiling Structures/Linings	No Asbestos Found						
B0C2 - R0010 - Staff Study - 11.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C2 - R0011 - Distribution Board Cupboard - .86 m2							
Note: No inspection of live electrical installation							
Material - Stored / Debris Material	Flat AC Sheeting	<1	Throughout	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Throughout	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	<1	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C2 - R0012 - General Storeroom - 32.24 m2							
Ceiling Structures/Linings	No Asbestos Found						
B0C2 - R0013 - Staff - Toilet - 7.16 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B0C2 - R0014 - Sport Equipment Store - 5.19 m2								
Ceiling Structures/Linings	No Asbestos Found							
B0C2 - R0015 - Staff - Toilet - 5.24 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B0C2 - R0016 - External Movement - 2.45 m2								
No Asbestos								
B0C2 - R0017 - Movement - 85.51 m2								
Floor Coverings Res/Textile	Vinyl Tiles	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B0C2 - R0018 - External Movement - .96 m2								
No Asbestos								
B0C2 - R0019 - External Movement - .96 m2								
No Asbestos								
B0C2 - R0020 - Stairs - 5.68 m2								
No Asbestos								
B0C2 - R0021 - External Movement - 62.18 m2								
No Asbestos								
B0C2 - R0022 - Cleaning Store - Distributed - 10.85 m2								
No Asbestos								
B0C2 - R0023 - External Stairs - 16.33 m2								
No Asbestos								
B0C2 - R1001 - General Learning Space - 53.87 m2								
No Asbestos								
B0C2 - R1002 - General Storeroom - 18.83 m2								
No Asbestos								
B0C2 - R1003 - Distribution Board Cupboard - 1.19 m2								
						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B0C2 - R1004 - Cleaning Store - Distributed - 3.71 m2								
No Asbestos								
B0C2 - R1005 - General Storeroom - 10.79 m2								
No Asbestos								
B0C2 - R1006 - Staff Study - 39.56 m2								
No Asbestos								
B0C2 - R1007 - Movement - 28.54 m2								
Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B0C2 - R1008 - External Movement - 2.01 m2								
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B0C2 - R1009 - General Learning Space - 53.06 m2								
No Asbestos								
B0C2 - R1010 - General Learning Space - 53.06 m2								
No Asbestos								
B0C2 - R1011 - General Learning Space - 53.21 m2								
No Asbestos								
B0C2 - R1012 - General Learning Space - 53.21 m2								
No Asbestos								
B0C2 - R1013 - Movement - 17.73 m2								

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C2 - R1014 - Staff Study - 18.85 m2							
No Asbestos							
B0C2 - R1015 - Special Learning Space - 53.58 m2							
No Asbestos							
B0C2 - R1016 - Special Learning Space - 53.58 m2							
No Asbestos							
B0C2 - R1017 - Stairs - 9.22 m2							
No Asbestos							
B0C2 - R1018 - External Movement - 62.18 m2							
No Asbestos							
B0C2 - R1019 - External Stairs - 22.57 m2							
No Asbestos							
B0C3 - General Learning/Library - 1970 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B0C3 - R0001 - Seminar - 12.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0002 - Seminar - 11.73 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0003 - Senior Study - 81.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B0C3 - R0004 - Seminar - 17.73 m2							
No Asbestos							
B0C3 - R0005 - Seminar - 15.31 m2							
No Asbestos							
B0C3 - R0007 - Security Store - 6.59 m2							
No Asbestos							
B0C3 - R0008 - Librarian - 11.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0009 - Computer Room - 29.76 m2							
No Asbestos							
B0C3 - R0010 - Workroom - 45.61 m2							
No Asbestos							
B0C3 - R0012 - Distribution Board Cupboard - 1.06 m2							
No Asbestos							Note: No inspection of live electrical installation
B0C3 - R0016 - Toilets-Boys - 14.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0017 - General Storeroom - 4.25 m2							
No Asbestos							
B0C3 - R0018 - Toilets-Girls - 13.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0019 - Cleaning Store - Distributed - 1.43 m2							
No Asbestos							

B0C3 - R0020 - Stairs - 7.69 m2							
No Asbestos							
B0C3 - R0021 - Movement - 17.72 m2							
No Asbestos							
B0C3 - R0022 - Computer Room - 51.84 m2							
No Asbestos							
B0C3 - R0023 - Computer Room - 35.98 m2							
No Asbestos							
B0C3 - R0024 - Entry - 25.97 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0025 - Main Area - 257.02 m2							
Ceiling Structures/Linings - Decorative Coating	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B0C3 - R0026 - External Movement - 51 m2							
No Asbestos							
B0C3 - R0027 - General Assistants - 10.85 m2							
No Asbestos							
B0C3 - R0028 - External Stairs - 17.17 m2							
No Asbestos							
B0C3 - R0029 - Toilets-Disabled - 11.73 m2							
No Asbestos							
B0C3 - R0030 - Lift - 2.1 m2							
No Asbestos							
B0C3 - R0031 - External Movement - 23.65 m2							
No Asbestos							
B0C3 - R0032 - Movement - 24.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0033 - Computer Room - 39.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R0034 - Movement - 31.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0C3 - R1001 - General Learning Space - 53.72 m2							
No Asbestos							
B0C3 - R1002 - General Learning Space - 53.72 m2							
No Asbestos							
B0C3 - R1003 - Careers Advisers Office - 19.25 m2							
No Asbestos							
B0C3 - R1004 - Movement - 16.65 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C3 - R1005 - General Learning Space - 68.02 m2							
No Asbestos							
B0C3 - R1006 - General Learning Space - 51 m2							
No Asbestos							
B0C3 - R1007 - General Learning Space - 54.53 m2							
No Asbestos							
B0C3 - R1008 - General Storeroom - 6.55 m2							
No Asbestos							
B0C3 - R1009 - Cleaning Store - Distributed - 6.64 m2							
No Asbestos							

B0C3 - R1010 - Staff Study - 40.11 m2							
No Asbestos							
B0C3 - R1011 - Distribution Board Cupboard - 1.15 m2							Note: No inspection of live electrical installation
No Asbestos							
B0C3 - R1012 - General Storeroom - 18.05 m2							
No Asbestos							
B0C3 - R1013 - General Learning Space - 53.43 m2							
No Asbestos							
B0C3 - R1014 - General Learning Space - 53.5 m2							
No Asbestos							
B0C3 - R1015 - Movement - 19.66 m2							
No Asbestos							
B0C3 - R1016 - Stairs - 4.48 m2							
No Asbestos							
B0C3 - R1017 - External Movement - 50.54 m2							
No Asbestos							
B0C3 - R1018 - External Stairs - 22.81 m2							
No Asbestos							
B0C3 - R1019 - Lift - 2.1 m2							
No Asbestos							
B0C3 - R1020 - External Movement - 12.21 m2							
No Asbestos							
B0L1 - Science Learning - 1970 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0L1 - R0001 - Laboratory L.S. - 91.84 m2							
Ceiling Structures/Linings	No Asbestos Found						
B0L1 - R0002 - Preparation - 30.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0L1 - R0003 - General Storeroom - 3.5 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B0L1 - R0004 - Preparation - 13.72 m2							
No Asbestos							
B0L1 - R0005 - Lift - .26 m2							
No Asbestos							
B0L1 - R0006 - Laboratory L.S. - 92.03 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B0L1 - R0007 - Cleaning Store - Distributed - .91 m2							
No Asbestos							
B0L1 - R0008 - Distribution Board Cupboard - .91 m2							Note: No inspection of live electrical installation
No Asbestos							
B0L1 - R0009 - Movement - 67.05 m2							
No Asbestos							

B0L1 - R1001 - Laboratory L.S. - 91.46 m2							
No Asbestos							
B0L1 - R1003 - General Storeroom - 3.5 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0L1 - R1004 - Darkroom Space - 13.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0L1 - R1005 - Lift - .27 m2							
No Asbestos							
B0L1 - R1006 - Performance Workspace - 91.72 m2							
No Asbestos							
B0L1 - R1007 - Cleaning Store - Distributed - .99 m2							
No Asbestos							
B0L1 - R1008 - Distribution Board Cupboard - .99 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Compressed AC Sheet	1m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (brown asbestos)
B0L1 - R1009 - Movement - 62.88 m2							
Wall Linings Internal - Infill	Compressed AC Sheet	4m2	Above brick boxing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0L1 - R1010 - Staff Kitchen - 21.02 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B0L1 - R1011 - Performing Arts Changeroom - 8.86 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B0L1 - R1012 - Plant - .8 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B0L2 - Science Learning - 1970 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B0L2 - R0001 - Cleaning Supplies Store - 12.39 m2							
No Asbestos							
B0L2 - R0002 - Movement - 2.34 m2							
No Asbestos							
B0L2 - R0003 - General Storeroom - 12.06 m2							
No Asbestos							
B0L2 - R0004 - Laboratory L.S. - 91.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B0L2 - R0005 - Preparation - 30.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B0L2 - R0006 - Lift - .26 m2							
No Asbestos							
B0L2 - R0007 - Apparatus Store - 3.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B0L2 - R0008 - Preparation - 13.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B0L2 - R0009 - Laboratory L.S. - 91.75 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B0L2 - R0010 - Distribution Board Cupboard - .6 m2 Note: No inspection of live electrical installation								
Electrical - Backing Board	Resinous Board	1	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B0L2 - R0011 - Cleaning Store - Distributed - .6 m2								
No Asbestos								
B0L2 - R0012 - Movement - 67.73 m2								
No Asbestos								
B0L2 - R1001 - Plant Space - 11.67 m2								
No Asbestos								
B0L2 - R1002 - Movement - 2.38 m2								
No Asbestos								
B0L2 - R1003 - General Storeroom - 12.17 m2								
No Asbestos								
B0L2 - R1004 - Laboratory L.S. - 91.75 m2								
No Asbestos								
B0L2 - R1005 - Preparation - 30.53 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
Floor Coverings Res/Textile	Vinyl Tiles	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B0L2 - R1006 - Lift - .26 m2								
No Asbestos								
B0L2 - R1007 - Chemical Store - 3.74 m2								
Ceiling Structures/Linings	No Asbestos Found							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B0L2 - R1008 - Apparatus Store - 13.17 m2								
Ceiling Structures/Linings	No Asbestos Found							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B0L2 - R1009 - Laboratory L.S. - 91.75 m2								
Ceiling Structures/Linings	No Asbestos Found							
B0L2 - R1010 - Distribution Board Cupboard - .6 m2 Note: No inspection of live electrical installation								
Ceiling Structures/Linings	Compressed AC Sheet	1m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B0L2 - R1011 - Lift - .6 m2								
No Asbestos								
B0L2 - R1012 - Movement - 63.53 m2								
Wall Linings Internal - Infill	Compressed AC Sheet	4m2	Above brick boxing	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020