


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kanahooka High School (8489)
Region:	Southern NSW AMU
State Electorate:	Shellharbour
Local Government Area:	Wollongong

Last Reviewed By:	Greencap 26-AUG-2014
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

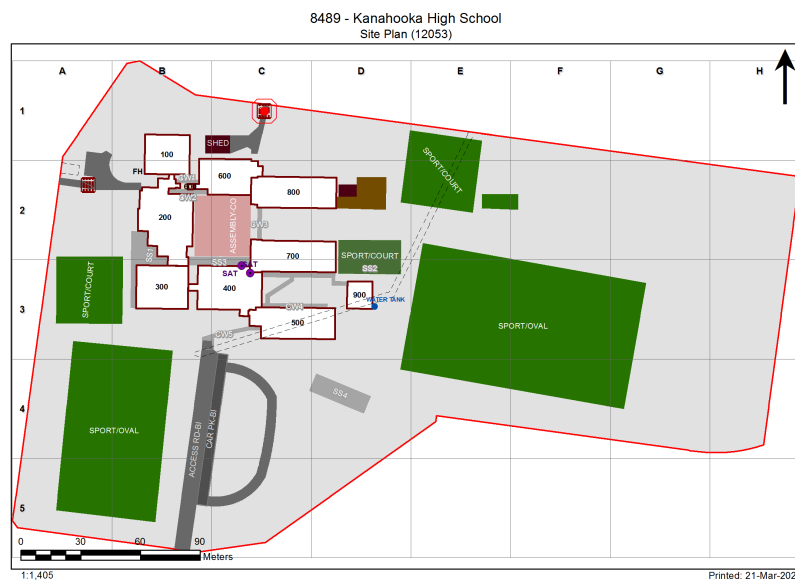

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B100 - Technological & Applied Studies/Art - 1974 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B100 - R0001 - Materials Technology L.S. - 82.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles	82.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B100 - R0002 - Toilets-Boys - 67.01 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B100 - R0003 - Distribution Board Cupboard - 2.61 m2						Note: No inspection of live electrical installation	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B100 - R0004 - Cleaning Store - Distributed - 1.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B100 - R0005 - Movement - 37.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B100 - R0006 - Art Learning Space - 77.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B100 - R0007 - Resources Store - 7.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B100 - R0008 - General Storeroom - 18.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B100 - R0009 - Materials Technology L.S. - 82.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B100 - R0010 - Materials Store - 20.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles	20.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B100 - R0011 - Welding Area - 10.4 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B100 - R0012 - External Movement - 1.61 m2							
No Asbestos							
B100 - R0013 - External Movement - 6.4 m2							
No Asbestos							
B100 - R1001 - Materials Technology L.S. - 82.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B100 - R1002 - Distribution Board Cupboard - .88 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B100 - R1003 - Materials Store - 12.93 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B100 - R1004 - Design L.S. - 52.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B100 - R1005 - Movement - 51.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B100 - R1006 - External Movement - 1.58 m2							
No Asbestos							
B100 - R1007 - Staff Study - 25.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	25.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B100 - R1008 - Design L.S. - 52.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B100 - R1009 - Materials Store - 12.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B100 - R1010 - Cleaning Store - Distributed - .71 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B100 - R1011 - Materials Technology L.S. - 82.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B100 - R1012 - Materials Store - 21.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

B100 - R1013 - Materials Store - 10.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B200 - Multi Purpose Facilities/Pupil Facilities - 1974 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B200 - R0001 - Multi-Purpose Space - 309.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B200 - R0002 - Movement - 74.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B200 - R0003 - Sport Equipment Store - 34.11 m2							
No Asbestos							
B200 - R0004 - Main Switchroom - 10.26 m2							
No Asbestos							
B200 - R0005 - Office/Store - 6.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R0006 - General Storeroom - .95 m2							
No Asbestos							
B200 - R0007 - Student Canteen - 53.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B200 - R0008 - Staff - Toilet - 3.96 m2							
No Asbestos							
B200 - R0009 - Cleaning Supplies Store - 5.64 m2							
No Asbestos							
B200 - R0010 - Cleaning Store - Distributed - 3.2 m2							
No Asbestos							
B200 - R0011 - Distribution Board Cupboard - .78 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R0012 - Sport Equipment Store - 15.7 m2							
No Asbestos							
B200 - R0013 - Cleaning Store - Distributed - 1.06 m2							
No Asbestos							
B200 - R0014 - General Storeroom - 19.8 m2							
No Asbestos							
B200 - R0015 - Stairs - 3.23 m2							
No Asbestos							
B200 - R0016 - General Storeroom - 3.23 m2							
No Asbestos							
B200 - R0017 - Movement - 51.99 m2							
No Asbestos							
B200 - R0018 - General Storeroom - 3.76 m2							
No Asbestos							
B200 - R0019 - Stairs - 3.76 m2							
No Asbestos							

B200 - R0020 - External Movement - 62.54 m2							
No Asbestos							
B200 - R0021 - External Movement - 50.99 m2							
No Asbestos							
B200 - R0022 - External Movement - 111.66 m2							
No Asbestos							
B200 - R0023 - External Stairs - 4.95 m2							
No Asbestos							
B200 - R1001 - Movement - 65.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B200 - R1002 - Cleaning Store - Distributed - 3.42 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3.42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Flue	Fibre Cement Pipe	2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B200 - R1003 - Staff Study - 9.17 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	9.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R1004 - Staff - Toilet - 8.43 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R1005 - Shower/Change - 62.84 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	60m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	62.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R1006 - Shower/Change - 62.98 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	62.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	10m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R1007 - Staff - Toilet - 7.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R1008 - Cleaning Supplies Store - 9.06 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	9.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	9.06m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B200 - R1009 - Cleaning Store - Distributed - 3.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	336m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Flue	Fibre Cement Pipe	3	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B200 - R1010 - Stairs - 6.94 m2							
No Asbestos							
B200 - R1011 - Stairs - 7.94 m2							
No Asbestos							
B200 - R1012 - External Movement - 49.79 m2							
No Asbestos							
B200 - R1013 - External Movement - 45.37 m2							
No Asbestos							
B300 - Technological & Applied Studies - 1974 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	No Asbestos Found						
Interior							
B300 - R0001 - Toilets-Girls - 65.74 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	52m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B300 - R0002 - Movement - 73.25 m2							

Floor Coverings Res/Textile	Vinyl Tiles	74m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B300 - R0003 - Food Technology L.S. - 82.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles	83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B300 - R0004 - External Movement - 2.41 m2							
No Asbestos							
B300 - R0011 - Computer Learning Space - 65.5 m2							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R0012 - General Storeroom - 10.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
B300 - R0013 - Cleaning Store - Distributed - 5.36 m2							
No Asbestos							
B300 - R0014 - Staff Study - 32.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B300 - R0015 - General Storeroom - 4.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B300 - R0016 - General Storeroom - 18.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B300 - R0017 - Distribution Board Cupboard - .78 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B300 - R0018 - External Movement - 1.86 m2							
No Asbestos							
B300 - R0019 - Laundry - 7.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B300 - R0020 - Other - 27.16 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B300 - R0021 - Food Technology L.S. - 89.44 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B300 - R0022 - Pantry - 12.98 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					

B300 - R0023 - Food/Research Space - 17.87 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B300 - R1001 - Design L.S. - 65.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R1002 - Shower/Change - 4.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B300 - R1003 - Design L.S. - 65.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R1004 - General Storeroom - 10.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B300 - R1005 - Music Learning Space - 64.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R1006 - Music Store - 32.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B300 - R1007 - General Learning Space - 65.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R1008 - Resources Store - 13.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B300 - R1009 - Art Learning Space - 65.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R1010 - Art Learning Space - 69.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R1011 - Distribution Board Cupboard - .92 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B300 - R1012 - Movement - 61.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B300 - R1013 - External Movement - 1.88 m2							
No Asbestos							
B400 - Science/Library - 1974 - Brick/Block							
Exterior							
Underfloor Voids	Non Accessible Area						
Ceiling Voids	Non Accessible Area						

Interior							
B400 - M1001 - Main Area - 160.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B400 - M1002 - Seminar - 29.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - M1003 - Seminar - 23.94 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - M1004 - Stairs - 4.14 m2							
No Asbestos							
B400 - M1005 - Stairs - 4.14 m2							
No Asbestos							
B400 - R0003 - Preparation - 49.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B400 - R0005 - Distribution Board Cupboard - 1.09 m2						Note: No inspection of live electrical installation	
No Asbestos							
B400 - R0006 - Movement - 58.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B400 - R0011 - Plant - 14.38 m2							
No Asbestos							
B400 - R0013 - Movement - 11.94 m2							
No Asbestos							
B400 - R0014 - Stairs - .58 m2							
No Asbestos							
B400 - R0015 - General Storeroom - 6.77 m2							
No Asbestos							
B400 - R0016 - Lift - 2.25 m2							
Non Accessible							
B400 - R0017 - External Movement - 72.54 m2							
No Asbestos							
B400 - R0018 - External Movement - 17.86 m2							
No Asbestos							
B400 - R0019 - Preparation - Science - 47.89 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Non Accessible Area	m2					
B400 - R0020 - Laboratory L.S. - 87.11 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Non Accessible Area	m2					
B400 - R0021 - Laboratory L.S. - 86.73 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Non Accessible Area	m2					
B400 - R0022 - Laboratory L.S. - 85.85 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Non Accessible Area	m2					

B400 - R0023 - Laboratory L.S. - 85.65 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Non Accessible Area	m2					
B400 - R1001 - General Storeroom - 8.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B400 - R1002 - Staff Kitchen - 13.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - R1003 - Staff Toilet - 4.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B400 - R1004 - Entry - 6.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B400 - R1005 - External Movement - 1.89 m2							
No Asbestos							
B400 - R1006 - Staff Toilet - 4.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B400 - R1007 - Main Area - 370.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B400 - R1008 - Seminar - 12.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - R1009 - Seminar - 14.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - R1010 - Distribution Board Cupboard - .3 m2							
							Note: No inspection of live electrical installation
No Asbestos							
B400 - R1011 - Cleaning Store - Distributed - 1.98 m2							
No Asbestos							
B400 - R1012 - Distribution Board Cupboard - .94 m2							
							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B400 - R1013 - Seminar - 13.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - R1014 - Seminar - 14.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - R1015 - Seminar - 12.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - R1016 - Audio Visual Workroom - 35.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B400 - R1017 - Librarian - 9.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B400 - R1018 - Stairs - 7.8 m2							
No Asbestos							

B400 - R1019 - Lift - 2.25 m2							
Non Accessible							
B400 - R1020 - Stairs - .4 m2							
No Asbestos							
B400 - R1021 - Stairs - .4 m2							
No Asbestos							
B400 - R1022 - External Movement - 83.04 m2							
No Asbestos							
B400 - R1023 - External Movement - 5.59 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B400 - R1024 - External Movement - 14.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B500 - Administration/General Learning - 1974 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B500 - R0001 - Leading Teacher - 13.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13.38m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R0002 - Study Space - 11.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	11.96m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R0003 - General Learning Space - 82.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles	82.48m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R0004 - Commonroom - 76.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B500 - R0005 - General Storeroom - 14.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	1428m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R0008 - Interview/Office - Type 1 - 9.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	9.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R0009 - Cleaning Store - Distributed - 2.59 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B500 - R0010 - Distribution Board Cupboard - .71 m2								Note: No inspection of live electrical installation
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B500 - R0011 - Duplicating Workroom - 15.77 m2								
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B500 - R0012 - General Storeroom - 2.19 m2								
Floor Coverings Res/Textile	Vinyl Tiles	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B500 - R0013 - Principal Office - 23.17 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	23.16m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B500 - R0016 - Interview/Office - Type 1 - 20.2 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	20.2m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B500 - R0018 - Sick Bay - 16.19 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	16.19m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B500 - R0019 - Staff - Toilet - 9.31 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	9.31m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B500 - R0020 - Staff - Toilet - 10.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B500 - R0021 - Toilets-Girls - 10.08 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B500 - R0022 - Toilets-Boys - 9.27 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B500 - R0024 - Stairs - 8.21 m2								
No Asbestos								
B500 - R0025 - External Movement - 59.13 m2								
No Asbestos								
B500 - R0026 - Printing/Photocopying - 24.2 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	24.19m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B500 - R0028 - Movement - 11.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	11.02m2	North, East, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R0029 - Administration - Clerical - 13.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B500 - R0030 - Administration - Clerical - 5.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B500 - R0031 - Administration - Clerical - 39.35 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B500 - R0032 - Movement - 90.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	91m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B500 - R1001 - General Learning Space - 53.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1002 - General Learning Space - 53.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1003 - General Storeroom - 22.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	22.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1004 - General Storeroom - 6.91 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B500 - R1005 - Cleaning Store - Distributed - 3.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B500 - R1006 - General Learning Space - 59.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	59.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1007 - General Learning Space - 59.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles	59.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1008 - General Learning Space - 53.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1012 - Study Space - 40.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	40.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1013 - Staff Study - 18.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	18.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1014 - Distribution Board Cupboard - .68 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1015 - General Learning Space - 40.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	40.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B500 - R1016 - Movement - 57.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B500 - R1018 - Stairs - 6.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B500 - R1019 - External Movement - 52.3 m2							
No Asbestos							
B500 - R1020 - General Learning Space - 40.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	40.33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B600 - Science/Performing Arts - 1974 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B600 - R0001 - Cleaning Supplies Store - 22.87 m2							
No Asbestos							
B600 - R0002 - Laboratory L.S. - 90.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						

B600 - R0003 - Preparation - 48.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B600 - R0005 - Cleaning Store - Distributed - 1.34 m2							
No Asbestos							
B600 - R0006 - Distribution Board Cupboard - .72 m2							
No Asbestos							
B600 - R0007 - External Movement - 12.61 m2							
No Asbestos							
B600 - R0008 - External Movement - 209.51 m2							
No Asbestos							
B600 - R0009 - Lift - 2.26 m2							
Non Accessible							
B600 - R0010 - Laboratory L.S. - 84.48 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Wall Linings Internal	Flat AC Sheeting						
B600 - R1001 - Performance Workspace - 90.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B600 - R1003 - Dust Extraction Space - .94 m2							
No Asbestos							
B600 - R1004 - Growing/Breeding - 11.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B600 - R1005 - Chemical Store - 11.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B600 - R1007 - Distribution Board Cupboard - .73 m2							
No Asbestos							
B600 - R1008 - Cleaning Store - Distributed - .73 m2							
No Asbestos							
B600 - R1009 - Laboratory L.S. - 90.22 m2							
Floor Coverings Res/Textile	Vinyl Tiles	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B600 - R1010 - Plant - .9 m2							
No Asbestos							
B600 - R1011 - External Movement - 64.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B600 - R1012 - External Movement - 12.61 m2							
No Asbestos							
B600 - R1013 - Music Learning Space - 48.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B700 - General Learning/Computer Learning - 1974 - Brick/Block							
Exterior							

Ceiling Voids	Non Accessible Area							
Underfloor Voids - Slab on Ground	Non Accessible Area							
Interior								
B700 - R0001 - Special Learning Space - 53.14 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B700 - R0002 - Special Learning Space - 53.44 m2								
Floor Coverings Res/Textile	Vinyl Tiles	51.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B700 - R0003 - Darkroom Space - 11.89 m2								
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B700 - R0004 - Cleaning Supplies Store - 13.36 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	13.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B700 - R0006 - Cleaning Store - Distributed - 2.3 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B700 - R0007 - Teachers Aides - 10.81 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B700 - R0008 - Distribution Board Cupboard - .9 m2								
						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B700 - R0010 - Staff - Toilet - 8.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B700 - R0011 - General Storeroom - 4.57 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B700 - R0013 - General Learning Space - 52.93 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	52.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B700 - R0014 - General Learning Space - 53.73 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	53.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B700 - R0015 - Special Learning Space - 37.94 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	37.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B700 - R0016 - Staff Room - 52.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles	52.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B700 - R0017 - Movement - 89.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B700 - R0018 - Staff Toilet - 5.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B700 - R0019 - Stairs - 5.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B700 - R0020 - External Stairs - 5.45 m2							
No Asbestos							
B700 - R0021 - External Movement - 80.54 m2							
No Asbestos							
B700 - R0022 - Deputy Principal Office - 18.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B700 - R0023 - Deputy Principal Office - 18.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	18.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B700 - R0024 - Chemical Store - 12.57 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B700 - R0025 - Apparatus Storage - 17.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B700 - R1001 - Computer Learning Space - 53.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B700 - R1002 - General Learning Space - 54.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	54.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B700 - R1003 - Movement - 18.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B700 - R1004 - General Learning Space - 54.54 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	54.54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B700 - R1005 - General Learning Space - 54.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	54.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B700 - R1006 - Distribution Board Cupboard - 1.46 m2				Note: No inspection of live electrical installation			
Electrical - Backing Board	Resinous Board	1.46	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B700 - R1007 - Cleaning Store - Distributed - 3.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B700 - R1008 - Interview/Office - Type 1 - 11.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B700 - R1009 - Staff Study - 40.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles	40.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B700 - R1010 - Movement - 25.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B700 - R1011 - Computer Learning Space - 52.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	52.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B700 - R1012 - General Storeroom - 18.17 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B700 - R1013 - General Learning Space - 53.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles	53.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B700 - R1014 - General Learning Space - 53.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles	53.43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B700 - R1015 - Staff Study - 18.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	18.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B700 - R1016 - Stairs - 7.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B700 - R1017 - External Movement - 53.18 m2							
No Asbestos							
B700 - R1018 - Stairs - 4.73 m2							
No Asbestos							
B800 - Physical Education/General Learning - 1974 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B800 - R0001 - General Learning Space - 53.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B800 - R0002 - General Learning Space - 53.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B800 - R0003 - Staff Study - 24.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B800 - R0004 - General Learning Space - 53.58 m2							
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B800 - R0005 - General Storeroom - 10.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0006 - General Learning Space - 53.73 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B800 - R0007 - General Learning Space - 53.15 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0009 - General Storeroom - 4.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4.48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0010 - Staff - Toilet - 4.87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						

B800 - R0011 - Staff - Toilet - 7.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B800 - R0012 - Bulk Store - 32.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles	32.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0013 - Distribution Board Cupboard - .85 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	0.5	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0014 - Staff Study - 11.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B800 - R0015 - Cleaning Store - Distributed - 2.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	2.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0016 - General Learning Space - 50.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	50.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0017 - Sport Equipment Store - 9.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	9.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0018 - Sport Equipment Store - 5.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0019 - Sport Equipment Store - 5.1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	5.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R0020 - Movement - 77.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B800 - R0021 - Stairs - 5.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B800 - R0022 - General Storeroom - 7.25 m2							
No Asbestos							
B800 - R0023 - Stairs - .62 m2							
No Asbestos							
B800 - R0024 - External Movement - 70.35 m2							
No Asbestos							
B800 - R1001 - General Learning Space - 53.95 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1002 - General Learning Space - 53.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1003 - General Storeroom - 18.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	18.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1004 - General Learning Space - 53.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1005 - General Learning Space - 53.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1006 - General Storeroom - 18.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	18.29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1007 - General Learning Space - 53.07 m2							
Floor Coverings Res/Textile	Vinyl Tiles	53.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B800 - R1008 - Movement - 27.2 m2							
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B800 - R1010 - Staff Study - 39.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	39.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1011 - Clinic-Waiting - 10.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	10.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1012 - Cleaning Store - Distributed - 3.65 m2							

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B800 - R1013 - Distribution Board Cupboard - 1.54 m2				Note: No inspection of live electrical installation			
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1014 - General Learning Space - 54.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	54.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1015 - General Learning Space - 54.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	54.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B800 - R1016 - Movement - 18.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B800 - R1017 - Stairs - 13.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B800 - R1018 - Stairs - 8.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B800 - R1019 - External Movement - 68.11 m2							
No Asbestos							
B900 - Computer Learning - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B900 - R0001 - External Movement - 26.88 m2							
No Asbestos							
B900 - R0002 - Computer Learning Space - 91.81 m2							
No Asbestos							
B900 - R0003 - Computer Resource - 19.08 m2							
No Asbestos							
B900 - R0004 - Computer Store - 10.12 m2							
No Asbestos							
B900 - R0005 - Printing/Photocopying - 9 m2							
No Asbestos							

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020