


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Karabar High School (8524)</b>
<b>Region:</b>	<b>Southern NSW AMU</b>
<b>State Electorate:</b>	<b>Monaro</b>
<b>Local Government Area:</b>	<b>Queanbeyan-Palerang</b>

<b>Last Reviewed By:</b>	<b>Greencap 27-AUG-2014</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

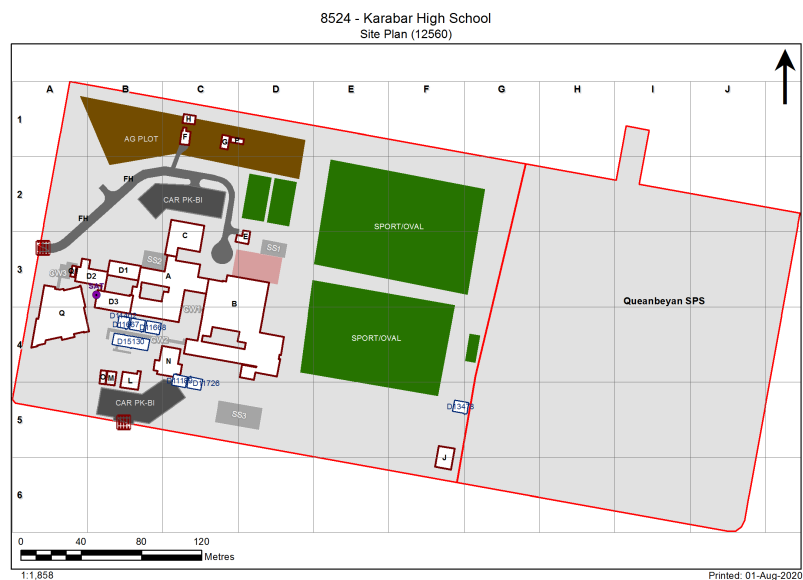

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning/Administration - 1977 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	60	To windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	50m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Electrical - Communications Pit	Fibre Cement Moulded	2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00A - R0002 - Interview/Office - Type 1 - 16.1 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0007 - Administration - Clerical - 28.83 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0008 - Duplicating Workroom - 23.87 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0009 - Main Switchroom - 13.5 m2</b>							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - General Storeroom - 12.84 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0011 - Commonroom - 117.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0012 - Staff - Toilet - 8.21 m2</b>							
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0013 - Staff - Toilet - 8.21 m2</b>							
No Asbestos							
<b>B00A - R0014 - Careers Advisers Office - 25.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0015 - Gymnasium - 92.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00A - R0016 - Staff - Toilet - 2.43 m2</b>							
No Asbestos							
<b>B00A - R0017 - Cleaning Store - Distributed - 2.61 m2</b>							
No Asbestos							
<b>B00A - R0022 - Interview/Office - Type 1 - 12.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0023 - Clinic - Boys - 12.95 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0025 - Movement - 5.31 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0026 - General Storeroom - 2.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0027 - General Storeroom - 10.39 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
<b>B00A - R0028 - Movement - 12.98 m2</b>							
No Asbestos							
<b>B00A - R0032 - Darkroom Space - 31.62 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0033 - No Access - 27.6 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0034 - Distribution Board Cupboard - .88 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00A - R0036 - Lift - .74 m2</b>							
No Asbestos							
<b>B00A - R0038 - Stairs - 5.91 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0039 - Stairs - 5.43 m2</b>							
No Asbestos							
<b>B00A - R0040 - Entry - 18 m2</b>							
No Asbestos							
<b>B00A - R0041 - Movement - 1.98 m2</b>							
No Asbestos							
<b>B00A - R0042 - Pupil Entry - 7.89 m2</b>							
No Asbestos							
<b>B00A - R0043 - Administration - Clerical - 52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - ( X5 )						
<b>B00A - R0044 - Tea Room - 4.47 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R0045 - Deputy Principal Office - 18.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
<b>B00A - R0046 - Movement - 58.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - ( X5 )						
<b>B00A - R0047 - Principal Office - 24.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
<b>B00A - R0048 - Movement - 25.59 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - ( X3 )						
<b>B00A - R0049 - Movement - 67.7 m2</b>							
No Asbestos							
<b>B00A - R0050 - Cleaning Store - Distributed - 2.29 m2</b>							
No Asbestos							
<b>B00A - R0051 - Stairs - 2.86 m2</b>							

No Asbestos							
<b>B00A - R0052 - Movement - 82.86 m2</b>							
No Asbestos							
<b>B00A - R0053 - Movement - 2.52 m2</b>							
No Asbestos							
<b>B00A - R0054 - Chemical Store - 7.18 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R0055 - Preparation - Science - 39.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0056 - Toilets-Disabled - 8.83 m2</b>							
No Asbestos							
<b>B00A - R0057 - Laboratory L.S. - 84.95 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Wall Linings Internal	Flat AC Sheeting						
<b>B00A - R0058 - Laboratory L.S. - 84.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Wall Linings Internal	Flat AC Sheeting						
<b>B00A - R1001 - General Learning Space - 53.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1002 - General Learning Space - 52.59 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1004 - Staff Study - 33.62 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1005 - General Learning Space - 52.84 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1006 - General Learning Space - 52.75 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1007 - Staff Study - 26.01 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1008 - Computer Learning Space - 53.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1009 - Computer Learning Space - 52.43 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1010 - General Learning Space - 52.76 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1011 - General Learning Space - 52.82 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R1012 - Distribution Board Cupboard - .65 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00A - R1014 - Cleaning Store - Distributed - 4.24 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1015 - General Storeroom - 4.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1016 - General Storeroom - 2.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1018 - Preparation - 46.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1020 - Staff Study - 8.24 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R1021 - Staff Study - 22.27 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	22.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	22.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1022 - Distribution Board Cupboard - .88 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R1023 - Staff Study - 30.36 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	30.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1025 - Plant - .86 m2</b>							
No Asbestos							
<b>B00A - R1026 - Lift - .74 m2</b>							
No Asbestos							
<b>B00A - R1027 - Stairs - 8.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1029 - Stairs - 6.11 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1030 - Staff Study - 21.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1031 - Movement - 180.27 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	181m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	16m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1032 - Movement - 93.13 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	93.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1033 - Stairs - 2.85 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1034 - Laboratory L.S. - 85.12 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - ( X8 )						
<b>B00A - R1035 - Laboratory L.S. - 85.02 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - ( X8 )						
<b>B00B - Technological &amp; Applied Studies - 1977 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	100	To windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Multi-Purpose Space - 453.37 m2</b>							
No Asbestos							
<b>B00B - R0002 - Shower/Change - 82.36 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00B - R0003 - Staff Study - 11.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Staff Study - 11.21 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - Shower/Change - 78.74 m2</b>							
No Asbestos							
<b>B00B - R0006 - Movement - 14.2 m2</b>							
No Asbestos							
<b>B00B - R0007 - Materials Store - 37.15 m2</b>							
No Asbestos							
<b>B00B - R0008 - Chair Store - 51.09 m2</b>							
No Asbestos							
<b>B00B - R0009 - Cleaning Store - Distributed - 15.36 m2</b>							
Plant / Equipment - Flue	Fibre Cement Pipe	5	East	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00B - R0010 - Distribution Board Cupboard - .67 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00B - R0011 - Staff Study - 20.02 m2</b>							
No Asbestos							
<b>B00B - R0013 - Staff - Toilet - 7.69 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0014 - Office/Store - 11.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						

<b>B00B - R0018 - Welding Area - 9.77 m2</b>							
No Asbestos							
<b>B00B - R0019 - Welding Area - 3.97 m2</b>							
No Asbestos							
<b>B00B - R0020 - Resources Store - 15.14 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0021 - Art Learning Space - 62.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0022 - Art Learning Space - 64.99 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0024 - Toilets-Girls - 25.76 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	12m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0025 - Toilets-Boys - 25.91 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	12m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0026 - Staff - Toilet - 10.47 m2</b>							
No Asbestos							
<b>B00B - R0027 - Staff - Toilet - 10.47 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0028 - Cleaning Store - Distributed - 2.37 m2</b>							
No Asbestos							
<b>B00B - R0029 - Distribution Board Cupboard - .91 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00B - R0030 - Movement - 3.92 m2</b>							
No Asbestos							
<b>B00B - R0031 - Cleaning Store - Distributed - 2.47 m2</b>							
No Asbestos							
<b>B00B - R0032 - General Storeroom - 3.73 m2</b>							
No Asbestos							
<b>B00B - R0033 - Staff Study - 34.77 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0034 - Distribution Board Cupboard - .72 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00B - R0036 - Stairs - 14.61 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0037 - Stairs - 15.37 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0038 - Covered Area - 205.27 m2</b>							
No Asbestos							
<b>B00B - R0039 - Movement - 98.79 m2</b>							



Wall Linings Internal - Infill	Flat AC Sheeting	6m2	Southwest	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0040 - Movement - 209.66 m2</b>							
No Asbestos							
<b>B00B - R0041 - Movement - 29.16 m2</b>							
No Asbestos							
<b>B00B - R0044 - Computer Room - 9.47 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0045 - Resource/Project Store - 18.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0046 - Art Learning Space - 64.61 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R0047 - KIn Space - 5.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0048 - Movement - 13.17 m2</b>							
No Asbestos							
<b>B00B - R0049 - Other-Vacant - 8.65 m2</b>							
No Asbestos							
<b>B00B - R0050 - Materials Store - 23.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0051 - Other-Vacant - 18.86 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0052 - Movement - 10.32 m2</b>							
No Asbestos							
<b>B00B - R0053 - Workshop Area - 119.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00B - R0054 - External Movement - 12.89 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0055 - General Learning Space - Type 6 - 73.62 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0056 - Metal Technology Bay - 107.82 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00B - R0057 - Covered Outdoor Space - 80.72 m2</b>							
No Asbestos							
<b>B00B - R0058 - Student Canteen - 49.24 m2</b>							
No Asbestos							
<b>B00B - R0059 - No Access - 24.99 m2</b>							

No Asbestos							
<b>B00B - R1001 - Food Technology L.S. - 100.49 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	101m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R1006 - Food Technology L.S. - 99.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1007 - Music Learning Space - 77.99 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00B - R1008 - Distribution Board Cupboard - .69 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R1009 - Cleaning Store - Distributed - .68 m2</b>							
Plant / Equipment - Flue	Fibre Cement Pipe	1	East	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R1010 - Distribution Board Cupboard - .7 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R1011 - Music Learning Space - 80.38 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00B - R1012 - Toilets-Boys - 22.44 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1013 - Cleaning Store - Distributed - 2.79 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2.79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1014 - Toilets-Girls - 23.71 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1017 - Dust Extraction Space - 6.01 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1019 - Design L.S. - 66.15 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R1020 - Distribution Board Cupboard - .72 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00B - R1021 - Resource/Project Store - 8.29 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R1022 - Darkroom Space - 10.74 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1023 - Movement - 2.76 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1024 - Design L.S. - 66.16 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00B - R1025 - General Storeroom - 25.97 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1026 - Staff Study - 39.86 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1027 - Cleaning Store - Distributed - 2.16 m2</b>								
No Asbestos								
<b>B00B - R1028 - Design L.S. - 52.76 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1029 - Study Space - 17.95 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1030 - Distribution Board Cupboard - 2.18 m2</b>								
						<b>Note: No inspection of live electrical installation</b>		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00B - R1031 - Design L.S. - 53.33 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1032 - Materials Technology L.S. - 177.26 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )							
<b>B00B - R1033 - Stairs - 10.71 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1034 - Stairs - 10.46 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1035 - Movement - 11.94 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1036 - Movement - 304.09 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	305m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	20m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1037 - Movement - 28.52 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1038 - Movement - 7.4 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00B - R1039 - Resource/Project Store - 5.63 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							

<b>B00B - R1040 - Materials Store - 7.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1041 - Movement - 5.57 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1042 - Preparation - 23.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R1043 - Food/Research Space - 14.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R1044 - Movement - 4.16 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R1045 - Pantry - 5.41 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - Library - 1977 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
<b>Interior</b>							
<b>B00C - M0003 - Stairs - 5.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - M0004 - Stairs - 5.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - M0005 - Main Area - 92.27 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - M0006 - Computer Room - 95.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - M0007 - Computer Room - 48.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00C - M0008 - Computer Store - 15.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0002 - Seminar - 12.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0004 - General Storeroom - 10.92 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0005 - General Storeroom - 10.84 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0006 - Audio Visual Workroom - 24.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0007 - Workroom - 22.53 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0008 - Distribution Board Cupboard - .9 m2</b>							<b>Note: No inspection of live electrical installation</b>	
No Asbestos								
<b>B00C - R0009 - Toilets-Boys - 5.81 m2</b>								
No Asbestos								
<b>B00C - R0010 - Toilets-Girls - 5.81 m2</b>								
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0011 - Librarian - 13.13 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00C - R0013 - Seminar - 8.86 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00C - R0016 - Computer Room - 47.4 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00C - R0017 - Main Area - 234.95 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )							
<b>B00C - R0018 - Stairs - .18 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00C - R0019 - Stairs - .18 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00E - Building Services - 1977 - Brick/Block</b>								
<b>Exterior</b>								
Ceiling Voids - Raked Ceiling	Non Accessible Area							
Underfloor Voids - Slab on Ground	Non Accessible Area							
<b>Interior</b>								
<b>B00E - R0001 - Chair Store - 11.22 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	11.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00E - R0002 - General Assistants - 16.78 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00E - R0003 - General Storeroom - 14.16 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00E - R0004 - External Movement - 5.02 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00F - Agricultural Science - 2004 - Steel</b>								
<b>Exterior</b>								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00F - R0001 - Agriculture Covered Area - 4.73 m2</b>								
No Asbestos								
<b>B00F - R0002 - Machine Storage - 52.67 m2</b>								

No Asbestos							
<b>B00G - Agricultural Science - 2004 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
<b>Interior</b>							
<b>B00G - R0001 - Machine Storage - 27.77 m2</b>							
Wall Linings Internal	Flat AC Sheeting	8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0002 - Animal Space - 14.25 m2</b>							
Wall Linings Internal	Flat AC Sheeting	8m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - Agricultural Science - 2004 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0001 - Animal Space - 45.8 m2</b>							
No Asbestos							
<b>B00J - Support Unit - 2004 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00J - R0001 - Study Space - 23.99 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00J - R0003 - Cleaning Supplies Store - 3.79 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00J - R0004 - Staff - Toilet - 2.81 m2</b>							
No Asbestos							
<b>B00J - R0005 - Toilets-Disabled - 2.78 m2</b>							
No Asbestos							
<b>B00J - R0006 - Commonroom - 8.29 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00J - R0007 - Home Base Store - S - 5.13 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00J - R0008 - Home Base Store - S - 3.08 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00J - R0009 - Movement - 55.88 m2</b>							
No Asbestos							
<b>B00J - R0010 - Movement - 23.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00J - R0011 - Distribution Board Cupboard - .34 m2</b>							
							<b>Note: No inspection of live electrical installation</b>

Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	----------------	---	-------	--------------------	---------	--------------------	-----------------------------

### B00L - Senior Learning - 2008 - Fibre Cement Clad

#### Exterior

Ceiling Voids - Flat Roof	Non Accessible Area	
---------------------------	---------------------	--

Underfloor Voids	No Asbestos Found	
------------------	-------------------	--

#### Interior

##### B00L - R0001 - Student Kitchen - 13.49 m2

No Asbestos

##### B00L - R0002 - Senior Study - 13.94 m2

No Asbestos

##### B00L - R0003 - Computer Resource - 13.42 m2

No Asbestos

##### B00L - R0004 - Computer Resource - 17.37 m2

No Asbestos

##### B00L - R0005 - Computer Learning Space - 35.9 m2

No Asbestos

##### B00L - R0006 - Covered Outdoor Space - 28.72 m2

No Asbestos

### B00M - Storage - 2007 - Steel

#### Exterior

Ceiling Voids - Flat Roof	Non Accessible Area	
---------------------------	---------------------	--

Underfloor Voids	No Asbestos Found	
------------------	-------------------	--

#### Interior

##### B00M - R0001 - Machine Storage - 32.88 m2

No Asbestos

##### B00M - R0002 - General Storeroom - 16.21 m2

No Asbestos

### B00N - Performing Arts - 2018 - Brick/Veneer

#### Exterior

Require Inspection

#### Interior

##### B00N - R0001 - Performance Workshop - 159.81 m2

Require Inspection

##### B00N - R0002 - Communication Space - 9.4 m2

Require Inspection

##### B00N - R0003 - Control Room - 6.64 m2

Require Inspection

##### B00N - R0004 - General Learning Space - Type 13 - 46.5 m2

Require Inspection

##### B00N - R0005 - Performing Arts Changeroom - 5.25 m2

Require Inspection

##### B00N - R0006 - Access Student Shower/Toilet/Change - 6.54 m2

Require Inspection

##### B00N - R0007 - Toilet - Lobby - 4.11 m2

Require Inspection

##### B00N - R0008 - Student Kitchen - 6.69 m2

Require Inspection

### B00O - Building Services - 2016 - Metal Shed

<b>Exterior</b>	
Require Inspection	
<b>Interior</b>	
<b>B00O - R0001 - Store - 33.92 m2</b>	
Require Inspection	
<b>B00P - Storage - 2019 - Steel</b>	
<b>Exterior</b>	
Require Inspection	
<b>Interior</b>	
<b>B00P - R0001 - Chemical Store - 10.33 m2</b>	
Require Inspection	
<b>B00P - R0002 - Garden Store Room - 20.99 m2</b>	
Require Inspection	
<b>B00Q - General Learning - 2020 - Steel Framed</b>	
<b>Exterior</b>	
Require Inspection	
<b>Interior</b>	
<b>B00Q - R0001 - General Learning Space - 60.83 m2</b>	
Require Inspection	
<b>B00Q - R0002 - Staff Study - 57.29 m2</b>	
Require Inspection	
<b>B00Q - R0003 - Pupil Entry - 11.11 m2</b>	
Require Inspection	
<b>B00Q - R0004 - Isolation Space - 61.65 m2</b>	
Require Inspection	
<b>B00Q - R0005 - Audio Visual Workroom - .45 m2</b>	
Require Inspection	
<b>B00Q - R0006 - Toilets-Disabled - 3.04 m2</b>	
Require Inspection	
<b>B00Q - R0007 - Toilets-Disabled - 2.96 m2</b>	
Require Inspection	
<b>B00Q - R0008 - Movement - 22.14 m2</b>	
Require Inspection	
<b>B00Q - R0009 - Distribution Board Cupboard - .97 m2</b>	<b>Note: No inspection of live electrical installation</b>
Require Inspection	
<b>B00Q - R0011 - Toilets-Disabled - 5.66 m2</b>	
Require Inspection	
<b>B00Q - R0013 - Cleaning Store - Distributed - 3.36 m2</b>	
Require Inspection	
<b>B00Q - R0014 - Communications Cupboard - 8.17 m2</b>	
Require Inspection	
<b>B00Q - R0015 - General Learning Space - 58.73 m2</b>	
Require Inspection	
<b>B00Q - R0016 - General Learning Space - 58.89 m2</b>	
Require Inspection	
<b>B00Q - R0017 - Movement - 33.98 m2</b>	
Require Inspection	
<b>B00Q - R0018 - Seminar - Type 1 - 28.33 m2</b>	
Require Inspection	
<b>B00Q - R0019 - Study Space - 8.17 m2</b>	
Require Inspection	



<b>B00Q - R0020 - Store - 32.83 m2</b>		
Require Inspection		
<b>B00Q - R0021 - Movement - 14.97 m2</b>		
Require Inspection		
<b>B00Q - R0022 - Movement - 98.42 m2</b>		
Require Inspection		
<b>B00Q - R0023 - General Learning Space - 69.39 m2</b>		
Require Inspection		
<b>B00Q - R0024 - Movement - 16.79 m2</b>		
Require Inspection		
<b>B00Q - R0025 - General Learning Space - 62.78 m2</b>		
Require Inspection		
<b>B00Q - R0026 - General Learning Space - 57.8 m2</b>		
Require Inspection		
<b>B00Q - R0027 - General Learning Space - 59.89 m2</b>		
Require Inspection		
<b>B00Q - R0028 - External Movement - 5.16 m2</b>		
Require Inspection		
<b>B00Q - R0029 - Stairs - 23.23 m2</b>		
Require Inspection		
<b>B00Q - R0031 - Tiered Learning Area - 80.8 m2</b>		
Require Inspection		
<b>B00Q - R0032 - Communications Cupboard - .79 m2</b>		
Require Inspection		
<b>B00Q - R1001 - Tiered Learning Area - 104.7 m2</b>		
Require Inspection		
<b>B00Q - R1002 - Stairs - 9.64 m2</b>		
Require Inspection		
<b>B0D1 - General Learning - 1980 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids - Raked Ceiling	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	
<b>Interior</b>		
<b>B0D1 - R0001 - Interview/Office - Type 1 - 12.67 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B0D1 - R0002 - Interview/Office - Type 1 - 12.27 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B0D1 - R0003 - Distribution Board Cupboard - .7 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B0D1 - R0004 - Toilets-Boys - 21.11 m2</b>		
No Asbestos		
<b>B0D1 - R0005 - General Learning Space - 47.56 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B0D1 - R0006 - General Learning Space - 47.84 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
<b>B0D1 - R0007 - Movement - 39.86 m2</b>		
No Asbestos		

<b>B0D1 - R1001 - Staff Study - 25.84 m2</b>							
No Asbestos							
<b>B0D1 - R1002 - Distribution Board Cupboard - .7 m2</b>							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B0D1 - R1003 - Toilets-Girls - 20.89 m2</b>							
No Asbestos							
<b>B0D1 - R1004 - Staff Study - 48.79 m2</b>							
No Asbestos							
<b>B0D1 - R1005 - General Learning Space - 46.18 m2</b>							
No Asbestos							
<b>B0D1 - R1006 - Movement - 36.57 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D2 - General Learning - 1980 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	60	To windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Gable Verge Lining	Flat AC Sheeting	15m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B0D2 - R0001 - General Learning Space - 48.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B0D2 - R0002 - Secure Storeroom - 4.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D2 - R0003 - Staff Study - 42.72 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B0D2 - R0004 - Staff Study - 30.16 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Adjacent to sink	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D2 - R0006 - Stairs - 11.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D2 - R0008 - Movement - 56.03 m2</b>							
Wall Linings Internal	Compressed AC Sheet	12m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D2 - R0009 - Movement - 4.93 m2</b>							
No Asbestos							
<b>B0D2 - R1001 - General Learning Space - 50.8 m2</b>							
No Asbestos							
<b>B0D2 - R1002 - General Learning Space - 45.62 m2</b>							
No Asbestos							
<b>B0D2 - R1003 - Secure Storeroom - 4.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B0D2 - R1004 - Staff Study - 24.95 m2</b>							
No Asbestos							
<b>B0D2 - R1006 - Stairs - 11.98 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D2 - R1008 - Movement - 60.21 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	15m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D3 - Science - 1980 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
<b>Interior</b>							
<b>B0D3 - R0003 - Distribution Board Cupboard - .58 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B0D3 - R0005 - Cleaning Store - Distributed - 4.45 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D3 - R0006 - Movement - 42.15 m2</b>							
No Asbestos							
<b>B0D3 - R0007 - Laboratory L.S. - 77.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B0D3 - R0008 - Preparation - Science - 48.94 m2</b>							
Door - Insulation	Insulation Material						
Plant / Equipment - Oven	Millboard	0.1	Within	Friable Asbestos (5)	Low (1)	High Priority (6-8)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B0D3 - R0009 - Laboratory L.S. - 77.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B0D3 - R1001 - Secure Storeroom - 24.2 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	24.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B0D3 - R1002 - Distribution Board Cupboard - .58 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B0D3 - R1003 - General Learning Space - 47.35 m2</b>							
No Asbestos							
<b>B0D3 - R1004 - General Learning Space - 47.35 m2</b>							
No Asbestos							
<b>B0D3 - R1005 - General Learning Space - 48.21 m2</b>							
No Asbestos							
<b>B0D3 - R1006 - Teachers Aides - 8.46 m2</b>							
No Asbestos							
<b>B0D3 - R1007 - Movement - 80.78 m2</b>							
Wall Linings Internal	Compressed AC Sheet	40m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

**B0Q1 - Building Services - 2020 - Concrete Framed**

**Exterior**

Require Inspection

**Interior**

**B0Q1 - R0001 - Plant - 17.49 m2**

Require Inspection

**Demountables****OS 602 11189 - Learning Unit - Standard With P.A.A. - Placement Date : 16-JUL-2013****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Learning space/withdrawal/entry**

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**R2- Home Base Store**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

**OS 600 11402 - Learning Unit - Small - Placement Date : 23-AUG-1996****Exterior**

Eaves Linings	Flat AC Sheeting	8.64m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- General Learning Space**

End Wall Panel	Flat AC Sheeting	50m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

**OS 601 11667 - Learning Unit - Standard/Withdrawal - Placement Date : 23-AUG-1996****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

**R2- General Learning Space**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

**R3- Store**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**OS 601 11668 - Learning Unit - Standard/Withdrawal - Placement Date : 23-AUG-1996****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

**R2- General Learning Space**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

**R3- Store**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**OS 601 11726 - Learning Unit - Standard/Withdrawal - Placement Date : 26-NOV-2012**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

**OS 601 13478 - Learning Unit - Standard/Withdrawal - Placement Date : 10-MAY-2000****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

**R2- General Learning Space**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

**R3- Store**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**OS 601 13672 - Learning Unit - Standard/Withdrawal - Placement Date : 23-APR-2009****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

**R2- General Learning Space**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

**R3- Store**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**OS 535 15130 - Library/Group Study/Office/A V Store - Placement Date : 23-AUG-1996****Exterior**

Eaves Linings	Flat AC Sheeting	28.8m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Clerical Office**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

**R2- Staff Room**

Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**R3- Security Store**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

**R4- Principal**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**R5- Staff Toilet**

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Assumed Asbestos

**R6- Staff Toilet**

Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Assumed Asbestos
<b>R7 - Reading Area</b>			
Ceiling Structures/Linings	Flat AC Sheeting	90m2	Assumed Asbestos
<b>R8 - Entry</b>			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Assumed Asbestos