


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Leura Public School (2391)
Region:	Western Sydney AMU
State Electorate:	Blue Mountains
Local Government Area:	Blue Mountains

Last Reviewed By:	Greencap 18-DEC-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

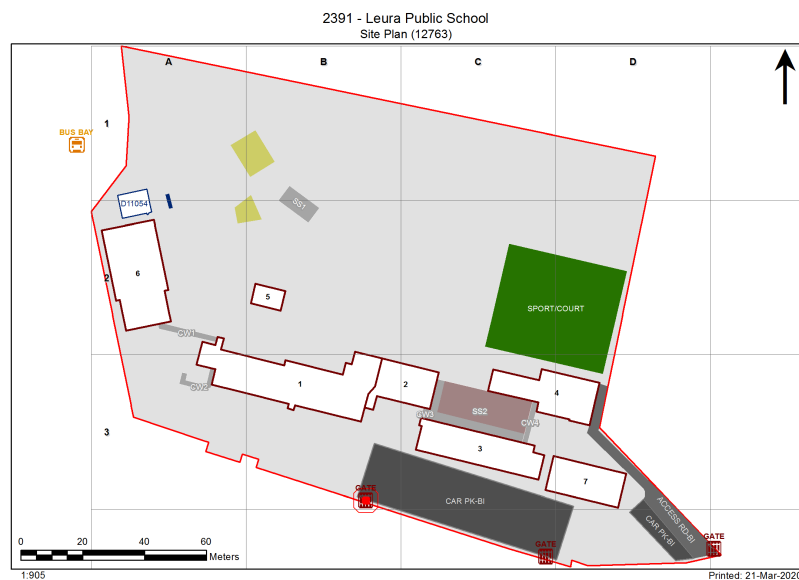

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B001 - General Learning/Support Unit - 1958 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	East & North-west	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B001 - R0001 - Movement - 53.69 m2							
No Asbestos							
B001 - R0002 - Home Base - 67.9 m2							
No Asbestos							
B001 - R0003 - Home Base Store - 7.83 m2							
No Asbestos							
B001 - R0004 - Security Store - 3.8 m2							
No Asbestos							
B001 - R0005 - Movement - 7.53 m2							
No Asbestos							
B001 - R0006 - Security Store - 3.8 m2							
No Asbestos							
B001 - R0007 - Home Base Store - 7.81 m2							
No Asbestos							
B001 - R0008 - Home Base - 65.89 m2							
No Asbestos							
B001 - R0009 - Community Clinic - 16.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0010 - General Storeroom - 2.04 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	2.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0011 - General Storeroom - 1.9 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	1.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0012 - Movement - 2.54 m2							
No Asbestos							
B001 - R0013 - Movement - 3.49 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0014 - Movement - 12.11 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0015 - General Storeroom - 1.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	1.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0016 - Interview - 20.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0017 - Home Base Store - 3.82 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0018 - Home Base Store - 7.81 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0019 - Movement - 24.05 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0020 - Home Base - 66.16 m2							
No Asbestos							
B001 - R0021 - Home Base - 92.32 m2							
No Asbestos							
B001 - R0022 - Home Base Store - 6.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0023 - Staff Toilet - 1.65 m2							
No Asbestos							
B001 - R0024 - Movement - 7.46 m2							
No Asbestos							
B001 - R0025 - Personal Effects Storage - 6.61 m2							
No Asbestos							
B001 - R0026 - Main Switch Board - .58 m2							
Electrical - Mounting Board	Resinous Membrane	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B001 - R0027 - Movement - 75.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	75.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	South-west exit	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0028 - Toilets - Boys - 9.11 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0029 - Staff Toilet - 5.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0030 - Toilets - Girls - 7.75 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0031 - Cleaning Distributed Store - 3.54 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0033 - Movement - 2.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R9001 - Cleaning Distributed Store - 7.17 m2							
External Roof Structure - Packing	AC Fragments/Debris - Flat AC Sheet	0.1	East & west	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B001 - R9002 - Movement - 4.24 m2							
No Asbestos							
B001 - R9004 - Canteen Office/Store - 2.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

Ceiling Structures/Linings	Flat AC Sheeting	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R9005 - Canteen - 24.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B001 - R9006 - Canteen Office/Store - 1.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1.94m2	Southern part of ceiling.	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R9007 - Staff Toilet - 2.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R9008 - Movement - 7.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R9009 - Movement - 64.23 m2							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	North half of ceiling.	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Southern part of ceiling.	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R9010 - Staff Room - 70.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	70.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - Library - 1963 - Concrete							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B002 - R0005 - Movement - 54.07 m2							
Wall Linings Internal	Flat AC Sheeting	15m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B002 - R0006 - Movement - 10.33 m2							
Wall Linings Internal	Flat AC Sheeting	3m2	East lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10.33m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B002 - R0007 - Home Base - 68.07 m2							
No Asbestos							
B002 - R0008 - Withdrawal Space - 2hb - 6.2 m2							
No Asbestos							
B002 - R0009 - Movement - 2.45 m2							
No Asbestos							
B002 - R0010 - Movement - 2.42 m2							
No Asbestos							
B002 - R0011 - Home Base Store - 4.95 m2							
No Asbestos							

B002 - R0012 - Home Base Store - 4.96 m2							
No Asbestos							
B002 - R0013 - Personal Effects Storage - 10.15 m2							
No Asbestos							
B002 - R0014 - Home Base - 58.48 m2							
No Asbestos							
B002 - R0015 - Home Base Store - 8.94 m2							
No Asbestos							
B003 - Administration - 1963 - Concrete Framed							
Exterior							
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	Non Accessible Area						
Gable Verge Lining	Flat AC Sheeting	4m2	East & west ends of movement R0022	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B003 - R0001 - Home Base Store - 5.78 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0002 - Deputy Principal - 16.07 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0003 - Movement - 3.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0004 - Personal Effects Storage - 5.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
B003 - R0005 - Movement - 3.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3.51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0006 - Home Base Store - 5.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0007 - Home Base - 57.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0008 - Home Base - 57.03 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0009 - Home Base Store - 5.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0010 - Personal Effects Storage - 4.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0011 - Movement - 45.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0012 - Distribution Board - .28 m2							
Note: No inspection of live electrical installation							
Electrical - Mounting Board	Fibrous Membrane	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B003 - R0013 - Principal - 17.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0014 - Duplicating Workroom - 22.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0015 - General Storeroom - 2.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	2.89m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0016 - General Storeroom - 6.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6.02m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B003 - R0017 - Sick Bay - 8.7 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						
B003 - R0018 - Staff Toilet - 3.6 m2							
No Asbestos							
B003 - R0019 - Staff Toilet - 3.49 m2							
No Asbestos							
B003 - R0020 - Staff Room - 25.22 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) - Adhesive						

B003 - R0021 - Cleaning Distributed Store - 2.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles	2.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B003 - R0022 - Movement - 81.46 m2							
Ceiling Structures/Linings	Flat AC Sheeting	82m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	6m2	East & west ends of movement above walkway	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	3m2	South-west corner of movement on southern wall	Good Condition (1)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - General Learning/Pupil Facilities - 1963 - Concrete Framed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting	20m2	East	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B004 - R0001 - Practical Activities - 1hb - 20.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0002 - Home Base - 52.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B004 - R0003 - General Storeroom - 7.78 m2							
No Asbestos							
B004 - R0004 - Movement - 31.63 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0005 - Distribution Board - 22 m2							
Note: No inspection of live electrical installation							
Electrical - Mounting Board	Resinous Membrane	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B004 - R0006 - Movement - 36.53 m2							
No Asbestos							
B004 - R0007 - Home Base - 52.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B004 - R0008 - Practical Activities - 1hb - 20.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0009 - Special Programs Room - 73.35 m2							
No Asbestos							
B004 - R1001 - Practical Activities - 1hb - 19.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R1002 - Home Base - 52.78 m2							
No Asbestos							

B004 - R1003 - Movement - 23.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1.5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - R1004 - Home Base - 52.93 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R1005 - Practical Activities - 1hb - 20.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R1006 - Movement - 7.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1.5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - R1007 - Movement - 33.7 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	West upper & lower portions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - R1008 - Toilets - Boys - 33.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - R1009 - Cleaning Supplies - 5.86 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - R1010 - Toilets - Girls - 31.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - R9001 - Sports Store - 37.5 m2							
No Asbestos							
B005 - Pupil Facilities - 1958 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Flat Roof	No Asbestos Found						
Interior							
B005 - R0001 - Toilets - Girls - 26.25 m2							
No Asbestos							
B005 - R0002 - Toilets - Boys - 26.36 m2							
No Asbestos							
B006 - Communal Facilities - 1994 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Interior		
B006 - R0001 - Movement - 204.29 m2		
No Asbestos		
B006 - R0002 - Toilets - Boys - 5.83 m2		
No Asbestos		
B006 - R0003 - Staff Kitchen - 6.47 m2		
No Asbestos		
B006 - R0004 - Communal Space - 146.55 m2		
No Asbestos		
B006 - R0005 - Communal Space - 45.09 m2		
No Asbestos		
B006 - R0006 - No Access - 1.09 m2		
No Asbestos		
B006 - R0007 - Plant - .82 m2		
No Asbestos		
B006 - R0008 - General Storeroom - 6.49 m2		
No Asbestos		
B006 - R0009 - Distribution Board - .78 m2		Note: No inspection of live electrical installation
No Asbestos		
B006 - R0010 - Cleaning Supplies - 9.24 m2		
No Asbestos		
B006 - R0011 - Hall Chair Store - 9.97 m2		
No Asbestos		
B006 - R0012 - Plant - .67 m2		
No Asbestos		
B006 - R0013 - P.E Store - 12.78 m2		
No Asbestos		
B006 - R0014 - General Assistant/Bulk Store - 17.38 m2		
No Asbestos		
B006 - R0015 - Sports Store - 12.75 m2		
No Asbestos		
B006 - R0016 - Cleaning Distributed Store - 5.81 m2		
No Asbestos		
B006 - R0017 - Toilets - Girls - 8.34 m2		
No Asbestos		
B006 - R0018 - Disabled Toilet - 5.55 m2		
No Asbestos		
B007 - Library - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B007 - R0001 - Reading Area - 166.45 m2		
No Asbestos		
B007 - R0002 - Library Office/Workroom - 22.72 m2		
No Asbestos		
B007 - R0003 - Communications Room - 7.68 m2		
No Asbestos		
B007 - R0004 - K.L.A. Store - 14.6 m2		
No Asbestos		
B007 - R0005 - Staff Toilet - 4.61 m2		

No Asbestos	
B007 - R0006 - Toilet - Lobby - 2.44 m2	
No Asbestos	
B007 - R0007 - Cleaning Distributed Store - 3.23 m2	
No Asbestos	
B007 - R0008 - Distribution Board - .73 m2	Note: No inspection of live electrical installation
No Asbestos	
B007 - R0009 - External Movement - 23.27 m2	
No Asbestos	

Demountables

OS 603 11054 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 31-MAR-2007

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found