


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lidcombe Public School (2394)
Region:	South Western Sydney AMU
State Electorate:	Auburn
Local Government Area:	Cumberland

Last Reviewed By:	WSP 07-DEC-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

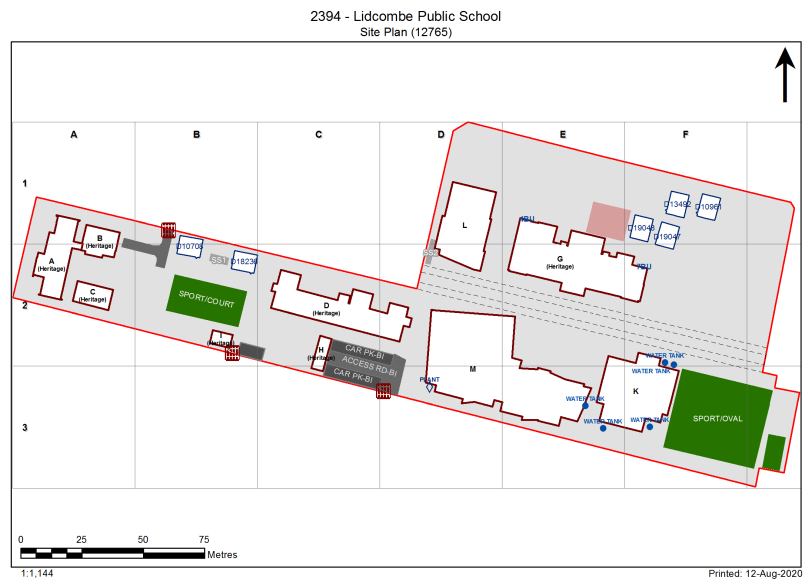

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Support Unit - 1962 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	80m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0001 - Home Base - M - 56.44 m2							
No Asbestos							
B00A - R0002 - Home Base Store - M - 7.4 m2							
No Asbestos							
B00A - R0003 - Movement - 22.23 m2							
No Asbestos							
B00A - R0004 - Home Base - M - 56.39 m2							
No Asbestos							
B00A - R0005 - Home Base Store - M - 7.34 m2							
No Asbestos							
B00A - R0006 - Main Switch Board - 2.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0007 - Entry Vestibule - 9.3 m2							
No Asbestos							
B00A - R0008 - Movement - 6.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0009 - Toilet - M - 10.37 m2							
No Asbestos							
B00A - R0010 - Staff Shower/Change - 3.55 m2							
No Asbestos							
B00A - R0011 - Cleaning Distributed Store - 2.74 m2							
Non Accessible							
B00A - R0012 - Movement - 11.94 m2							
No Asbestos							
B00A - R0013 - Toilet - M - 10.12 m2							
No Asbestos							
B00A - R0014 - Staff Shower/Change - 3.63 m2							
No Asbestos							
B00A - R0015 - General Storeroom - 2.54 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0016 - Home Base Store - M - 7.35 m2							
No Asbestos							
B00A - R0017 - Home Base - M - 56.59 m2							
No Asbestos							
B00A - R0018 - Special Programs Room - 27.28 m2							
No Asbestos							
B00A - R0019 - Movement - 10.65 m2							
No Asbestos							

B00B - Other-Community Use/Pupil Facilities - 1879 - Brick/Block

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
--------------------	------------------	------	--------------------------	--------------------	---------	--------------------	--

Ceiling Voids	Non Accessible Area
---------------	---------------------

Underfloor Voids	Non Accessible Area
------------------	---------------------

Interior

B00B - R0001 - Special Programs Room - 72.29 m2

Furniture / Fixtures - Blackboard	Compressed AC Sheet	4	South facing, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
-----------------------------------	---------------------	---	------------------------------	--------------------	---------	--------------------	--

Wall Linings Internal	Flat AC Sheeting
-----------------------	------------------

B00B - R0002 - Movement - 1.92 m2

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	--------------	--------------------	---------	--------------------	-----------------------------

B00B - R0003 - Movement - 8.31 m2

No Asbestos

B00B - R0004 - Movement - 7.64 m2

No Asbestos

B00B - R0005 - Special Programs Room - 20.86 m2

No Asbestos

B00B - R0006 - Raised Platform - 21.09 m2

No Asbestos

B00C - General Learning - 1962 - Concrete

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
-----------------------------------	-------------------

Eaves Linings	Flat AC Sheeting	20m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
---------------	------------------	------	--------------	--------------------	---------	--------------------	-----------------------------

Ceiling Voids	Non Accessible Area
---------------	---------------------

Interior

B00C - R0001 - Movement - 25.63 m2

Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------	-----------------------------

B00C - R0002 - Home Base - 47.28 m2

Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------	--

Wall Linings Internal	Flat AC Sheeting	4m2	North, South & East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
-----------------------	------------------	-----	------------------------------------	--------------------	---------	--------------------	--

B00C - R0003 - Home Base - 47.16 m2

Floor Coverings Res/Textile	Vinyl Tiles
-----------------------------	-------------

Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------	--

Wall Linings Internal	Flat AC Sheeting	4m2	North, South & West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
-----------------------	------------------	-----	------------------------------------	--------------------	---------	--------------------	--

B00D - General Learning/Library - 1922 - Brick/Block

Exterior

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids	No Asbestos Found	
Interior		
B00D - R0001 - Movement - 5.74 m2		
No Asbestos		
B00D - R0002 - Movement - 8.61 m2		
No Asbestos		
B00D - R0005 - Home Base - 46.85 m2		
No Asbestos		
B00D - R0006 - Home Base - 47.77 m2		
No Asbestos		
B00D - R0007 - Home Base - 48.41 m2		
No Asbestos		
B00D - R0008 - Home Base - 49.4 m2		
No Asbestos		
B00D - R0009 - Home Base - 50.24 m2		
No Asbestos		
B00D - R0010 - Home Base - 49.04 m2		
No Asbestos		
B00D - R0011 - Movement - 2.78 m2		
No Asbestos		
B00D - R0012 - Withdrawal Space - 2hb - 12.7 m2		
No Asbestos		
B00D - R0013 - Movement - 12.93 m2		
No Asbestos		
B00D - R0014 - Movement - 2.06 m2		
No Asbestos		
B00D - R0015 - General Storeroom - 5.25 m2		
No Asbestos		
B00D - R0016 - Movement - 123.89 m2		
No Asbestos		
B00D - R0017 - Special Programs Room - 10.23 m2		
No Asbestos		
B00D - R0018 - Movement - 12.81 m2		
No Asbestos		
B00D - R0019 - Movement - 3.95 m2		
No Asbestos		
B00D - R0020 - Cleaning Distributed Store - 2.74 m2		
No Asbestos		
B00D - R0021 - Withdrawal Space - 2hb - 12.62 m2		
No Asbestos		
B00D - R0022 - Staff Toilet - 1.73 m2		
No Asbestos		
B00D - R0023 - Staff Toilet - 1.75 m2		
No Asbestos		
B00D - R0024 - General Storeroom - 4.74 m2		
Floor Coverings Res/Textile	Vinyl Tiles	
B00D - R0025 - Interview - 15.43 m2		
No Asbestos		
B00D - R0026 - Stairs - 6.94 m2		
No Asbestos		

B00D - R0027 - Stairs - 8.08 m2							
No Asbestos							
B00D - R0028 - Home Base - 46.92 m2							
No Asbestos							
B00D - R1001 - Security Store - 16.52 m2							
No Asbestos							
B00D - R1002 - Movement - 41.03 m2							
No Asbestos							
B00D - R1003 - Home Base - 47.99 m2							
No Asbestos							
B00D - R1004 - Home Base - 48.01 m2							
No Asbestos							
B00D - R1005 - Library Office/Workroom - 21.85 m2							
No Asbestos							
B00D - R1006 - Reading Area - 107.53 m2							
No Asbestos							
B00D - R1007 - Reading Area - 48.15 m2							
No Asbestos							
B00D - R1008 - Reading Area - 50.38 m2							
No Asbestos							
B00D - R1009 - Home Base - 48.82 m2							
No Asbestos							
B00D - R1010 - Kiln Room - 2.02 m2							
No Asbestos							
B00D - R1011 - Movement - 50.07 m2							
No Asbestos							
B00D - R1012 - Home Base Store - 8.63 m2							
No Asbestos							
B00D - R1013 - Movement - 13.15 m2							
No Asbestos							
B00D - R1014 - Special Programs Room - 10.31 m2							
No Asbestos							
B00D - R1015 - Library Office/Workroom - 8.21 m2							
No Asbestos							
B00D - R1016 - Movement - 4.3 m2							
No Asbestos							
B00D - R1017 - Movement - 3.69 m2							
No Asbestos							
B00D - R1018 - Staff Toilet - 3.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1019 - Craft Store - 6.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1020 - Stairs - 10.58 m2							
No Asbestos							
B00D - R1021 - Stairs - 12.04 m2							
No Asbestos							
B00D - R9002 - Movement - 4.62 m2							
No Asbestos							
B00D - R9003 - Staff Toilet - 3.45 m2							
No Asbestos							
B00D - R9004 - Cleaning Distributed Store - 2.55 m2							

No Asbestos							
B00D - R9005 - Movement - 4.26 m2							
No Asbestos							
B00D - R9006 - General Storeroom - 1.23 m2							
No Asbestos							
B00D - R9007 - General Storeroom - 1.23 m2							
No Asbestos							
B00D - R9008 - Toilets - Girls - 73.51 m2							
No Asbestos							
B00G - General Learning - 1922 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting						
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00G - R0001 - Security Store - 16.05 m2							
No Asbestos							
B00G - R0002 - Staff Toilet - 3.09 m2							
No Asbestos							
B00G - R0003 - Staff Toilet - 3.07 m2							
No Asbestos							
B00G - R0004 - Home Base - 49.53 m2							
No Asbestos							
B00G - R0005 - Home Base - 47.66 m2							
No Asbestos							
B00G - R0006 - Home Base - 48.1 m2							
No Asbestos							
B00G - R0007 - Interview - 13.36 m2							
No Asbestos							
B00G - R0008 - General Storeroom - 5.55 m2							
No Asbestos							
B00G - R0009 - Entry Vestibule - 16.33 m2							
No Asbestos							
B00G - R0010 - Movement - 33.12 m2							
No Asbestos							
B00G - R0011 - Interview - 19.26 m2							
No Asbestos							
B00G - R0012 - Home Base - 48.16 m2							
No Asbestos							
B00G - R0013 - Home Base - 47.82 m2							
No Asbestos							
B00G - R0016 - Toilets - Boys - 4.18 m2							
No Asbestos							
B00G - R0017 - Toilets - Girls - 4.17 m2							
No Asbestos							
B00G - R0018 - Movement - 2.48 m2							
No Asbestos							
B00G - R0019 - Cleaning Supplies - 8.16 m2							

No Asbestos							
B00G - R0020 - Toilets - Girls - 27.6 m2							
No Asbestos							
B00G - R0021 - Movement - 6.79 m2							
No Asbestos							
B00G - R0022 - Personal Effects Storage - 7.32 m2							
No Asbestos							
B00G - R0024 - External Movement - 2.08 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0025 - Home Base - 65.91 m2							
Furniture / Fixtures - Blackboard	Compressed AC Sheet	6	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0026 - General Storeroom - 17.94 m2							
No Asbestos							
B00G - R0027 - Movement - 26.53 m2							
No Asbestos							
B00G - R0031 - Movement - 2.45 m2							
No Asbestos							
B00G - R0032 - Movement - 90.09 m2							
No Asbestos							
B00G - R0033 - Movement - 2.47 m2							
No Asbestos							
B00G - R0035 - General Storeroom - 3.38 m2							
No Asbestos							
B00G - R0036 - Staff Toilet - 9.05 m2							
No Asbestos							
B00G - R0037 - Home Base - 47.31 m2							
No Asbestos							
B00G - R0038 - Movement - 28.19 m2							
No Asbestos							
B00G - R0039 - Movement - 7.12 m2							
No Asbestos							
B00G - R0042 - Practical Activities - 10.64 m2							
No Asbestos							
B00G - R0043 - Special Programs Room - 17.07 m2							
No Asbestos							
B00G - R0044 - Communal Space - 171.25 m2							
No Asbestos							
B00G - R0045 - Movement - 11.62 m2							
No Asbestos							
B00G - R0046 - Home Base - 49.65 m2							
No Asbestos							
B00G - R9001 - Toilets - Boys - 31.17 m2							
No Asbestos							
B00G - R9002 - Sports Store - 48.42 m2							
No Asbestos							
B00H - Pupil Facilities - 1962 - Brick/Block							
Exterior							
Ceiling Voids	Non Accessible Area						

Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00H - R0001 - Drinking Facilities - 16.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0002 - Toilets - Boys - 36.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0003 - Cleaning Distributed Store - 2.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - Building Services - 1962 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00I - R0001 - General Assistant/Bulk Store - 36.57 m2							
No Asbestos							
B00K - Communal Facilities - 2007 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00K - R0001 - Access Shower/Toilet - 7.02 m2							
No Asbestos							
B00K - R0002 - Sound Cupboard - 2.67 m2							
No Asbestos							
B00K - R0003 - Sports Store - 13.9 m2							
No Asbestos							
B00K - R0004 - Toilets - Girls - 14.17 m2							
No Asbestos							
B00K - R0005 - General Storeroom - 7.22 m2							
No Asbestos							
B00K - R0006 - Cleaning Distributed Store - 3.06 m2							
No Asbestos							
B00K - R0007 - Communal/Performance Store - 11.39 m2							
No Asbestos							
B00K - R0008 - Communal Space - 208.45 m2							
No Asbestos							
B00K - R0009 - Raised Platform - 51.78 m2							
No Asbestos							
B00K - R0010 - Movement - 13.08 m2							
No Asbestos							
B00K - R0011 - Ramp - 13.34 m2							
No Asbestos							

B00K - R0012 - Movement - 14.84 m2		
No Asbestos		
B00K - R0013 - Hall Chair Store - 10.73 m2		
No Asbestos		
B00K - R0014 - Main Switch Board - 3.53 m2		
No Asbestos		
B00K - R0015 - Toilets - Boys - 9.7 m2		
No Asbestos		
B00K - R0016 - Garden Store - 16.81 m2		
No Asbestos		
B00K - R0017 - P.E Store - 16.37 m2		
No Asbestos		
B00K - R0018 - General Assistant/Bulk Store - 15.44 m2		
No Asbestos		
B00K - R0019 - Stairs - 2.42 m2		
No Asbestos		
B00K - R0020 - Canteen - 44.78 m2		
No Asbestos		
B00K - R0021 - Canteen Office/Store - 10.8 m2		
No Asbestos		
B00K - R0022 - Covered Outdoor Learning Area - 225.96 m2		
No Asbestos		
B00L - Administration - 2019 - Brick/Veneer		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00L - R0001 - External Movement - 8.01 m2		
No Asbestos		
B00L - R0002 - Entry Vestibule - 25.31 m2		
No Asbestos		
B00L - R0003 - Movement - 26.82 m2		
No Asbestos		
B00L - R0004 - Clerical Office - 62.84 m2		
No Asbestos		
B00L - R0005 - Interview - 17.93 m2		
No Asbestos		
B00L - R0006 - Entry Vestibule - 12.56 m2		
No Asbestos		
B00L - R0007 - External Movement - 23.37 m2		
No Asbestos		
B00L - R0008 - Movement - 27.55 m2		
No Asbestos		
B00L - R0009 - Distribution Board - .99 m2		
No Asbestos		Note: No inspection of live electrical installation
B00L - R0010 - Deputy Principal - 25.15 m2		
No Asbestos		

B00L - R0011 - Deputy Principal - 14.16 m2	
No Asbestos	
B00L - R0012 - General Storeroom - 13.55 m2	
No Asbestos	
B00L - R0013 - Staff Room - 88 m2	
No Asbestos	
B00L - R0014 - Toilets - Girls - 3.29 m2	
No Asbestos	
B00L - R0015 - Communications Cupboard - 10.72 m2	
No Asbestos	
B00L - R0016 - Toilets - Boys - 3.28 m2	
No Asbestos	
B00L - R0017 - Toilets-Unisex - 7.45 m2	
No Asbestos	
B00L - R0018 - Sick Bay - 8.98 m2	
No Asbestos	
B00L - R0019 - Clerical Office/Workroom - 14.72 m2	
No Asbestos	
B00L - R0020 - Toilets - Girls - 3.8 m2	
No Asbestos	
B00L - R0021 - Cleaning Distributed Store - 3.04 m2	
No Asbestos	
B00L - R0022 - Toilets - Boys - 3.74 m2	
No Asbestos	
B00L - R0023 - Staff Room Annexe - 44.17 m2	
No Asbestos	
B00L - R0024 - External Movement - 42.46 m2	
No Asbestos	
B00L - R0025 - Deputy Principal - 14.1 m2	
No Asbestos	
B00L - R0026 - Principal - 15.97 m2	
No Asbestos	
B00L - R0027 - Interview - 13.68 m2	
No Asbestos	
B00L - R0028 - Interview - 12.09 m2	
No Asbestos	
B00L - R0029 - Staff Kitchen - 11.49 m2	
No Asbestos	
B00M - General Learning/Pupil Facilit - 2020 - Concrete Framed	
Exterior	
Require Inspection	
Interior	
B00M - R0001 - Movement - 230.33 m2	
Require Inspection	
B00M - R0002 - Practical Activities - 2hb - 25.09 m2	
Require Inspection	
B00M - R0003 - Distribution Board - 1.51 m2	Note: No inspection of live electrical installation
Require Inspection	
B00M - R0004 - Stairs - 14.68 m2	
Require Inspection	
B00M - R0005 - Toilets - Girls - 2.99 m2	

Require Inspection
B00M - R0006 - Toilets - Boys - 2.98 m2
Require Inspection
B00M - R0007 - Disabled Shower/Toilet - 6.39 m2
Require Inspection
B00M - R0008 - Communications Room - 12.33 m2
Require Inspection
B00M - R0009 - Home Base - 62.54 m2
Require Inspection
B00M - R0010 - Withdrawal Space - 2hb - 13.66 m2
Require Inspection
B00M - R0011 - Home Base - 63.22 m2
Require Inspection
B00M - R0012 - Withdrawal Space - 1hb - 21.04 m2
Require Inspection
B00M - R0013 - Home Base - 65.75 m2
Require Inspection
B00M - R0014 - Practical Activities - 2hb - 28.57 m2
Require Inspection
B00M - R0015 - Covered Outdoor Learning Area - 27.86 m2
Require Inspection
B00M - R0016 - Home Base - 65.83 m2
Require Inspection
B00M - R0017 - Withdrawal Space - 1hb - 12.56 m2
Require Inspection
B00M - R0018 - Stairs - 15.12 m2
Require Inspection
B00M - R0019 - Cleaning Distributed Store - 3.33 m2
Require Inspection
B00M - R0020 - General Storeroom - 11.41 m2
Require Inspection
B00M - R0021 - Home Base - 64.84 m2
Require Inspection
B00M - R0022 - Withdrawal Space - 2hb - 13.05 m2
Require Inspection
B00M - R0023 - Home Base - 63.61 m2
Require Inspection
B00M - R0024 - Practical Activities - 2hb - 19.55 m2
Require Inspection
B00M - R0025 - Home Base - 65.89 m2
Require Inspection
B00M - R0026 - General Storeroom - 9.19 m2
Require Inspection
B00M - R0027 - Lift - 5.26 m2
Require Inspection
B00M - R0028 - Reading Area - 208.02 m2
Require Inspection
B00M - R0029 - Library Office/Workroom - 23.52 m2
Require Inspection
B00M - R0030 - K.L.A. Store - 19.83 m2
Require Inspection
B00M - R0031 - K.L.A. Store - 19.3 m2

Require Inspection
B00M - R0032 - Stairs - 6.85 m2
Require Inspection
B00M - R0033 - External Movement - 19.59 m2
Require Inspection
B00M - R0034 - Toilets - Girls - 11.79 m2
Require Inspection
B00M - R0035 - Toilets - Boys - 13.85 m2
Require Inspection
B00M - R0036 - Plant - 3.18 m2
Require Inspection
B00M - R0037 - Tiered Learning Space - 16.61 m2
Require Inspection
B00M - R0038 - External Movement - 18.88 m2
Require Inspection
B00M - R0039 - External Movement - 346.58 m2
Require Inspection
B00M - R1001 - Movement - 231.88 m2
Require Inspection
B00M - R1002 - Practical Activities - 2hb - 22.84 m2
Require Inspection
B00M - R1003 - Distribution Board - 1.03 m2
Note: No inspection of live electrical installation
Require Inspection
B00M - R1004 - Toilets - Girls - 3.06 m2
Require Inspection
B00M - R1005 - Toilets - Boys - 3.05 m2
Require Inspection
B00M - R1006 - Disabled Shower/Toilet - 6.45 m2
Require Inspection
B00M - R1007 - Communications Room - 12.55 m2
Require Inspection
B00M - R1008 - Home Base - 63.11 m2
Require Inspection
B00M - R1009 - Withdrawal Space - 2hb - 13.25 m2
Require Inspection
B00M - R1010 - Home Base - 63.55 m2
Require Inspection
B00M - R1011 - Withdrawal Space - 2hb - 21.14 m2
Require Inspection
B00M - R1012 - Home Base - 66.69 m2
Require Inspection
B00M - R1013 - Practical Activities - 2hb - 28.54 m2
Require Inspection
B00M - R1014 - Covered Outdoor Learning Area - 27.16 m2
Require Inspection
B00M - R1015 - Home Base - 65.82 m2
Require Inspection
B00M - R1016 - Withdrawal Space - 1hb - 14 m2
Require Inspection
B00M - R1017 - Toilets - Girls - 12.62 m2
Require Inspection
B00M - R1018 - Toilets - Boys - 12.86 m2

Require Inspection
B00M - R1019 - Cleaning Distributed Store - 3.25 m2
Require Inspection
B00M - R1020 - General Storeroom - 15.45 m2
Require Inspection
B00M - R1021 - Home Base - 64.02 m2
Require Inspection
B00M - R1022 - Withdrawal Space - 2hb - 13.54 m2
Require Inspection
B00M - R1023 - Home Base - 63.4 m2
Require Inspection
B00M - R1024 - Practical Activities - 2hb - 20.29 m2
Require Inspection
B00M - R1025 - Covered Outdoor Learning Area - 23.9 m2
Require Inspection
B00M - R1026 - Home Base - 65.95 m2
Require Inspection
B00M - R1027 - General Storeroom - 8.29 m2
Require Inspection
B00M - R1028 - Covered Outdoor Learning Area - 36.33 m2
Require Inspection
B00M - R1029 - Special Programs Room - 28.75 m2
Require Inspection
B00M - R1030 - Reading Area - 65.61 m2
Require Inspection
B00M - R1031 - Tiered Learning Space - 16.56 m2
Require Inspection
B00M - R1033 - Communications Cupboard - 1.46 m2
Require Inspection
B00M - R1034 - Stairs - 24.54 m2
Require Inspection
B00M - R1035 - Stairs - 23.37 m2
Require Inspection
B00M - R1036 - Stairs - 7.91 m2
Require Inspection

Demountables

OS 602 10708 - Learning Unit - Standard With P.A.A. - Placement Date : 29-OCT-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 10961 - Learning Unit - Standard With P.A.A. - Placement Date : 27-JAN-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13492 - Learning Unit - Standard With P.A.A. - Placement Date : 22-JAN-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 18236 - Learning Unit - Standard With P.A.A. - Placement Date : 27-JAN-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 606 19047 - Learning Unit - Standard With P.A.A A/C - Placement Date : 21-DEC-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 606 19048 - Learning Unit - Standard With P.A.A A/C - Placement Date : 22-DEC-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found