


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lindfield East Public School (2404)
Region:	Northern Sydney AMU
State Electorate:	Davidson
Local Government Area:	Ku-Ring-Gai

Last Reviewed By:	AECOM 28-JUN-2016
Last Revised By:	Greencap 25-JUL-2020

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

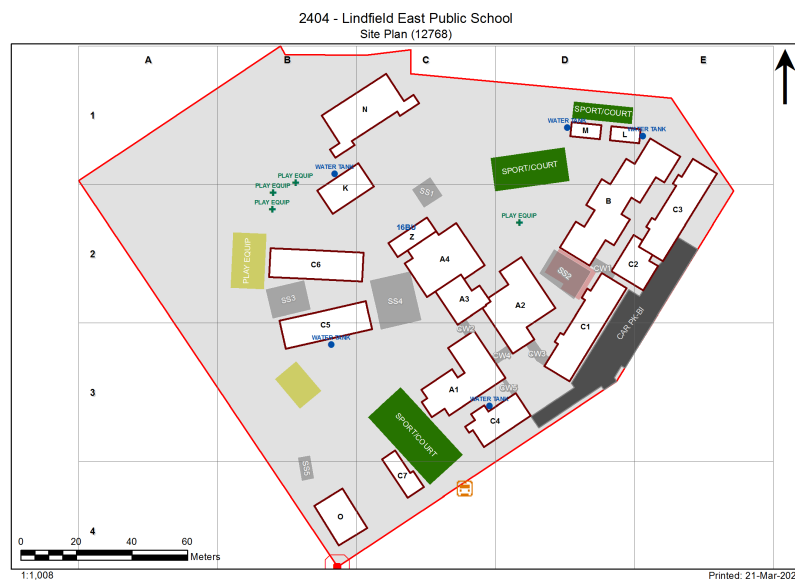

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00B - General Learning - 1929 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Interior							
B00B - R0001 - Home Base - 46.76 m2							
No Asbestos							
B00B - R0002 - Practical Activities - 1hb - 27.21 m2							
No Asbestos							
B00B - R0003 - Home Base - 46.76 m2							
No Asbestos							
B00B - R0004 - Practical Activities - 1hb - 27.21 m2							
No Asbestos							
B00B - R0005 - Home Base - 46.76 m2							
No Asbestos							
B00B - R0006 - Practical Activities - 1hb - 27.21 m2							
No Asbestos							
B00B - R0007 - Cleaning Distributed Store - 2.24 m2							
No Asbestos							
B00B - R0008 - Distribution Board - .38 m2							
No Asbestos							Note: No inspection of live electrical installation
B00B - R0009 - General Storeroom - 5.76 m2							
No Asbestos							
B00B - R0010 - Home Base - 46.76 m2							
No Asbestos							
B00B - R0011 - Practical Activities - 1hb - 27.21 m2							
No Asbestos							
B00B - R0012 - Home Base - 46.76 m2							
No Asbestos							
B00B - R0013 - Practical Activities - 1hb - 27.21 m2							
No Asbestos							
B00B - R0014 - Movement - 234.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	235m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - General Learning - 1929 - Timber							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00K - R0001 - Uniform Shop - 10.66 m2							
No Asbestos							
B00K - R0002 - Special Programs Room - 52.84 m2							
No Asbestos							
B00K - R0003 - Home Base - 52.84 m2							
No Asbestos							
B00K - R0004 - Home Base Store - 10.57 m2							
No Asbestos							

B00K - R0005 - Staff Room Annexe - 10.69 m2							
No Asbestos							
B00K - R0006 - Movement - 30.44 m2							
No Asbestos							
B00L - Pupil Facilities - 1929 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00L - R0001 - Toilets - Boys - 45.22 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - Pupil Facilities - 1929 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00M - R0001 - Toilets - Girls - 45.22 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00N - General Learning - 2010 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Interior							
B00N - R0001 - Home Base - 58.6 m2							
No Asbestos							
B00N - R0002 - Home Base - 60.64 m2							
No Asbestos							
B00N - R0003 - Home Base - 60.54 m2							
No Asbestos							
B00N - R0004 - Practical Activities - 20.37 m2							
No Asbestos							
B00N - R0005 - Withdrawal Space - 1hb - 9.52 m2							
No Asbestos							
B00N - R0006 - Home Base Store - 6.06 m2							
No Asbestos							
B00N - R0007 - Home Base Store - 6.35 m2							
No Asbestos							
B00N - R0008 - Practical Activities - 19.89 m2							
No Asbestos							

B00N - R0009 - Withdrawal Space - 2hb - 11.71 m2		
No Asbestos		
B00N - R0010 - Practical Activities - 19.79 m2		
No Asbestos		
B00N - R0011 - Home Base Store - 6.32 m2		
No Asbestos		
B00N - R0012 - External Movement - 78.13 m2		
No Asbestos		
B00N - R0013 - External Stairs - 15.82 m2		
No Asbestos		
B00N - R0014 - External Stairs - 15.82 m2		
No Asbestos		
B00N - R1001 - Home Base - 58.6 m2		
No Asbestos		
B00N - R1002 - Home Base - 60.64 m2		
No Asbestos		
B00N - R1003 - Home Base - 60.54 m2		
No Asbestos		
B00N - R1004 - Practical Activities - 20.37 m2		
No Asbestos		
B00N - R1005 - Withdrawal Space - 1hb - 9.52 m2		
No Asbestos		
B00N - R1006 - Home Base Store - 6.06 m2		
No Asbestos		
B00N - R1007 - Home Base Store - 6.35 m2		
No Asbestos		
B00N - R1008 - Practical Activities - 19.89 m2		
No Asbestos		
B00N - R1009 - Withdrawal Space - 2hb - 11.71 m2		
No Asbestos		
B00N - R1010 - Practical Activities - 19.79 m2		
No Asbestos		
B00N - R1011 - Home Base Store - 6.32 m2		
No Asbestos		
B00N - R1012 - External Movement - 66.18 m2		
No Asbestos		
B00N - R1013 - External Stairs - 16.01 m2		
No Asbestos		
B00N - R1014 - External Stairs - 16.01 m2		
No Asbestos		
B00O - Other-After School Care - 2006 - Steel		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00O - R0001 - Other-After School Care - 12.31 m2		
No Asbestos		
B00O - R0002 - Other-After School Care - 5.12 m2		
No Asbestos		
B00O - R0003 - Other-After School Care - 6.06 m2		
No Asbestos		

B00O - R0004 - Other-After School Care - 3.03 m2							
No Asbestos							
B00O - R0005 - Other-After School Care - 6.06 m2							
No Asbestos							
B00O - R0006 - Other-After School Care - 5.86 m2							
No Asbestos							
B00O - R0007 - Other-After School Care - 65.35 m2							
No Asbestos							
B00O - R0008 - Other-After School Care - 8.26 m2							
No Asbestos							
B00O - R0009 - Other-After School Care - 25.81 m2							
No Asbestos							
B00O - R0010 - Other-After School Care - 29.32 m2							
No Asbestos							
B00O - R0011 - Other-After School Care - 4.96 m2							
No Asbestos							
B00O - R0012 - Other-After School Care - 20.96 m2							
No Asbestos							
B00Z - Pupil Facilities - 1975 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Gable Ends	Flat AC Sheeting	8.00m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	
Interior							
B00Z - R0001 - Toilets - Girls - 24.13 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00Z - R0002 - Drinking Facilities - 14.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00Z - R0003 - Drinking Facilities - 14.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00Z - R0004 - Toilets - Boys - 29.81 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B0A1 - Administration - 1929 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B0A1 - R0001 - Interview - 12.78 m2							
No Asbestos							
B0A1 - R0002 - Sick Bay - 14.87 m2							
No Asbestos							
B0A1 - R0003 - General Storeroom - 12.78 m2							

No Asbestos							
B0A1 - R0004 - Staff Toilet - 5.89 m2							
No Asbestos							
B0A1 - R0005 - Staff Toilet - 3.12 m2							
No Asbestos							
B0A1 - R0006 - Cleaning Distributed Store - .74 m2							
No Asbestos							
B0A1 - R0007 - Toilets - Boys/Girls - 2.33 m2							
No Asbestos							
B0A1 - R0008 - Community Clinic - 14.84 m2							
No Asbestos							
B0A1 - R0009 - Movement - 21.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting	22.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	
B0A1 - R0010 - Main Switch Board - 7.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0011 - Toilets - Boys/Girls - 2.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A1 - R0012 - Toilets - Boys/Girls - 2.87 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2.87m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	
B0A1 - R0013 - Staff Room - 90.24 m2							
No Asbestos							
B0A1 - R0014 - Movement - 20.09 m2							
No Asbestos							
B0A1 - R0015 - Duplicating Workroom - 26.92 m2							
No Asbestos							
B0A1 - R0016 - General Storeroom - 1.87 m2							
No Asbestos							
B0A1 - R0017 - Principal - 19.1 m2							
No Asbestos							
B0A1 - R0018 - Deputy Principal - 11.14 m2							
No Asbestos							
B0A1 - R0019 - General Storeroom - 1.43 m2							
No Asbestos							
B0A1 - R0020 - Movement - 9.42 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	
B0A1 - R0021 - Cleaning Supplies - 12.03 m2							
No Asbestos							
B0A1 - R0022 - Deputy Principal - 11.46 m2							
No Asbestos							
B0A1 - R0023 - Clerical Office - 12.06 m2							
No Asbestos							
B0A1 - R0024 - Entry Vestibule - 16.83 m2							
No Asbestos							
B0A1 - R0025 - Entry Vestibule - 18.55 m2							
No Asbestos							
B0A1 - R0026 - Movement - 31.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	32.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	

B0A2 - Library - 1929 - Brick/Block

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	

Interior

B0A2 - R0001 - Entry Vestibule - 14.63 m2

Floor Coverings Res/Textile	Vinyl Tiles	15.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	---------	--------------	--------------------	---------	--------------------	-----------------------------

B0A2 - R0002 - Toilets - Boys/Girls - 3.81 m2

No Asbestos

B0A2 - R0003 - Staff Toilet - 3.2 m2

No Asbestos

B0A2 - R0004 - Distribution Board - .81 m2

Note: No inspection of live electrical installation

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	-----	--------------	--------------------	---------	--------------------	-----------------------------

B0A2 - R0005 - Cleaning Distributed Store - 1.25 m2

Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	-----	--------------	--------------------	---------	--------------------	-----------------------------

B0A2 - R0006 - Library Office/Workroom - 9.08 m2

No Asbestos

B0A2 - R0007 - Library Office/Workroom - 21.64 m2

No Asbestos

B0A2 - R0008 - Communications Room - 12.15 m2

No Asbestos

B0A2 - R0009 - Reading Area - 38.81 m2

No Asbestos

B0A2 - R0011 - Movement - 41.83 m2

Ceiling Structures/Linings	Flat AC Sheeting	42.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	---------	--------------	--------------------	---------	--------------------	-----------------------------

B0A2 - R0012 - Movement - 13.33 m2

Ceiling Structures/Linings	Flat AC Sheeting	14.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	---------	--------------	--------------------	---------	--------------------	-----------------------------

B0A2 - R0013 - Reading Area - 198.09 m2

No Asbestos

B0A2 - R0014 - Reading Area - 58.56 m2

No Asbestos

B0A3 - Pupil Facilities - 1929 - Brick/Block

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	

Interior

B0A3 - R0001 - Movement - 82.49 m2

Ceiling Structures/Linings	Flat AC Sheeting	83.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	
----------------------------	------------------	---------	--------------	--------------------	---------	--------------------	--

B0A3 - R0002 - Cleaning Supplies - 5.97 m2

Floor Coverings Res/Textile	Vinyl Tiles	6.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	
-----------------------------	-------------	--------	--------------	--------------------	---------	--------------------	--

B0A3 - R0003 - Canteen Office/Store - 8.95 m2

Floor Coverings Res/Textile	Vinyl Tiles	9.00m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	--------	--------------	--------------------	---------	--------------------	-----------------------------

B0A3 - R0005 - Staff Toilet - 4.39 m2

No Asbestos							
B0A3 - R0006 - Canteen Office/Store - 4.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5.00m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A3 - R0007 - General Assistant/Bulk Store - 12.29 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A3 - R0008 - Canteen - 39.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles	40.00m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A3 - R0009 - General Storeroom - 5.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	
B0A4 - Communal Facilities - 1929 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B0A4 - R0001 - Hall Chair Store - 15.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A4 - R0002 - Movement - 8.8 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A4 - R0003 - Movement - 20.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A4 - R0004 - Raised Platform - 49.72 m2							
No Asbestos							
B0A4 - R0005 - Communal Space - 199.26 m2							
No Asbestos							
B0A4 - R0006 - Movement - 29.22 m2							
Ceiling Structures/Linings	Flat AC Sheeting	30.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A4 - R0007 - Music Store - 9.43 m2							
No Asbestos							
B0A4 - R0008 - P.E Store - 8.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0A4 - R0009 - P.E Store - 10.02 m2							
No Asbestos							
Ceiling Structures/Linings	Flat AC Sheeting	9.00m2	All Surface	Minimal Damage (2)	Low (1)	Low Priority (2-3)	
B0A4 - R0010 - General Assistant/Bulk Store - 11.09 m2							
No Asbestos							
B0A4 - R0011 - Distribution Board - .6 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B0A4 - R0012 - Movement - 18.53 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C1 - General Learning - 1963 - Brick/Veneer							
Exterior							

Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B0C1 - R0001 - Home Base - 57.35 m2							
No Asbestos							
B0C1 - R0002 - Home Base Store - 4.6 m2							
No Asbestos							
B0C1 - R0003 - Practical Activities - 1hb - 14.62 m2							
No Asbestos							
B0C1 - R0004 - General Storeroom - .56 m2							
No Asbestos							
B0C1 - R0005 - Movement - 1.67 m2							
No Asbestos							
B0C1 - R0006 - General Storeroom - .56 m2							
No Asbestos							
B0C1 - R0007 - Home Base Store - 4.6 m2							
No Asbestos							
B0C1 - R0008 - Home Base - 57.12 m2							
No Asbestos							
B0C1 - R0009 - Home Base - 57.04 m2							
No Asbestos							
B0C1 - R0010 - Home Base Store - 4.6 m2							
No Asbestos							
B0C1 - R0011 - Practical Activities - 1hb - 14.7 m2							
No Asbestos							
B0C1 - R0012 - General Storeroom - .56 m2							
No Asbestos							
B0C1 - R0013 - Movement - 1.67 m2							
No Asbestos							
B0C1 - R0014 - General Storeroom - .56 m2							
No Asbestos							
B0C1 - R0015 - Home Base Store - 4.6 m2							
No Asbestos							
B0C1 - R0016 - Home Base - 57.2 m2							
No Asbestos							
B0C1 - R0017 - Personal Effects Storage - 4.58 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C1 - R0018 - Personal Effects Storage - 4.58 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C1 - R0019 - Movement - 92.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Clerical Error - No Sample Taken
B0C2 - General Learning - 1929 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						

Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	16m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B0C2 - R0001 - Home Base - 65.96 m2							
No Asbestos							
B0C2 - R0002 - Movement - 1.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C2 - R0003 - Staff Room Annexe - 13.61 m2							
No Asbestos							
B0C2 - R0004 - Movement - 2.45 m2							
No Asbestos							
B0C2 - R0005 - Distribution Board - .39 m2							
Note: No inspection of live electrical installation							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C2 - R0006 - Toilets - Boys/Girls - 5.79 m2							
No Asbestos							
B0C2 - R0007 - Security Store - 12.66 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C2 - R0008 - Movement - 39.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C2 - R0009 - Access Shower/Toilet - 8.38 m2							
No Asbestos							
B0C3 - General Learning - 1975 - Brick/Veneer							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	32.00m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B0C3 - R0001 - Home Base - 57.35 m2							
No Asbestos							
B0C3 - R0002 - Home Base Store - 4.56 m2							
No Asbestos							
B0C3 - R0003 - Practical Activities - 1hb - 14.37 m2							
No Asbestos							
B0C3 - R0004 - General Storeroom - .6 m2							
No Asbestos							
B0C3 - R0005 - Movement - 1.67 m2							
No Asbestos							
B0C3 - R0006 - General Storeroom - .6 m2							
No Asbestos							
B0C3 - R0007 - Home Base Store - 4.56 m2							
No Asbestos							
B0C3 - R0008 - Home Base - 57.35 m2							
No Asbestos							
B0C3 - R0009 - Home Base - 57.35 m2							
No Asbestos							
B0C3 - R0010 - Home Base Store - 4.61 m2							

No Asbestos							
B0C3 - R0011 - Practical Activities - 1hb - 14.37 m2							
No Asbestos							
B0C3 - R0012 - General Storeroom - .6 m2							
No Asbestos							
B0C3 - R0013 - Movement - 1.67 m2							
No Asbestos							
B0C3 - R0014 - General Storeroom - .6 m2							
No Asbestos							
B0C3 - R0015 - Home Base Store - 4.61 m2							
No Asbestos							
B0C3 - R0016 - Home Base - 57.35 m2							
No Asbestos							
B0C3 - R0017 - Personal Effects Storage - 4.84 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C3 - R0018 - Personal Effects Storage - 4.84 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C3 - R0019 - Movement - 60.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C4 - General Learning - 1975 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids	AC Fragments/Debris	1	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B0C4 - R0001 - Movement - 17.22 m2							
No Asbestos							
B0C4 - R0002 - Home Base - 48.12 m2							
No Asbestos							
B0C4 - R0003 - Movement - 20.77 m2							
No Asbestos							
B0C4 - R0004 - Special Programs Room - 47.52 m2							
No Asbestos							
B0C4 - R0005 - Practical Activities - 1hb - 23.38 m2							
No Asbestos							
B0C4 - R0006 - Withdrawal Space - 1hb - 16.33 m2							
No Asbestos							
B0C4 - R0007 - Movement - 5.47 m2							
No Asbestos							
B0C4 - R0009 - Movement - 3.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C5 - General Learning - 1963 - Brick/Veneer							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Compressed AC Sheet	16	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Interior							
B0C5 - R0001 - Home Base - 57.43 m2							
No Asbestos							
B0C5 - R0002 - Home Base Store - 6.58 m2							
No Asbestos							
B0C5 - R0003 - Practical Activities - 1hb - 14.88 m2							
No Asbestos							
B0C5 - R0005 - Home Base Store - 6.58 m2							
No Asbestos							
B0C5 - R0006 - Home Base - 56.88 m2							
No Asbestos							
B0C5 - R0007 - Home Base - 86.03 m2							
No Asbestos							
B0C5 - R0008 - Toilets - Boys/Girls - 3.36 m2							
Wall Linings Internal	Flat AC Sheeting	10.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5.00m2	All surface	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B0C5 - R0009 - Home Base Store - 4.25 m2							
Wall Linings Internal	Flat AC Sheeting	10.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B0C5 - R0010 - Practical Activities - 1hb - 9.67 m2							
No Asbestos							
B0C5 - R0011 - Movement - 52.3 m2							
Wall Linings Internal - Infill	Compressed AC Sheet	14m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Corrugated AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B0C5 - R9001 - Home Base - 57.38 m2							
No Asbestos							
B0C5 - R9002 - Practical Activities - 1hb - 25.61 m2							
No Asbestos							
B0C5 - R9003 - Movement - 19.6 m2							
No Asbestos							
B0C5 - R9004 - Toilets - Boys/Girls - 3.16 m2							
No Asbestos							
B0C5 - R9005 - Sports Store - 3.96 m2							
No Asbestos							
B0C5 - R9006 - Sports Store - 4.71 m2							
No Asbestos							
B0C6 - General Learning - 1975 - Brick/Veneer							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	40m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	16	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B0C6 - R0001 - General Storeroom - 3.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	4.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C6 - R0002 - Toilets - Boys/Girls - 5.81 m2							

Wall Linings Internal	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B0C6 - R0003 - General Storeroom - 13.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C6 - R0004 - Movement - 5.04 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.00m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Sample Result(s) to be recorded
B0C6 - R0005 - Staff Room Annexe - 12.78 m2							
No Asbestos							
B0C6 - R0006 - Practical Activities - 1hb - 14.77 m2							
No Asbestos							
B0C6 - R0007 - Home Base - 52.39 m2							
No Asbestos							
B0C6 - R0008 - Home Base - 56.9 m2							
No Asbestos							
B0C6 - R0009 - Home Base Store - 4.47 m2							
No Asbestos							
B0C6 - R0010 - Practical Activities - 1hb - 18.11 m2							
No Asbestos							
B0C6 - R0011 - Home Base Store - 4.47 m2							
No Asbestos							
B0C6 - R0012 - Home Base - 57.13 m2							
No Asbestos							
B0C6 - R0013 - Movement - 60.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	20m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C6 - R0014 - Home Base Store - 1.15 m2							
No Asbestos							
B0C6 - R0015 - Cleaning Distributed Store - 2.99 m2							
No Asbestos							
B0C6 - R9001 - Home Base - 74.34 m2							
No Asbestos							
B0C6 - R9002 - Practical Activities - 1hb - 25.33 m2							
No Asbestos							
B0C6 - R9003 - Toilets - Boys/Girls - 4.69 m2							
No Asbestos							
B0C6 - R9004 - Home Base Store - 1.61 m2							
No Asbestos							
B0C6 - R9005 - Movement - 22.04 m2							
No Asbestos							
B0C7 - Other-After School Care - 1953 - Timber							
Exterior							
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	15m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	East facing, West facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Interior							
B0C7 - R0001 - Movement - 10.05 m2							

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0C7 - R0002 - General Storeroom - 1.24 m2							
No Asbestos							
B0C7 - R0003 - Staff Toilet - 1.89 m2							
No Asbestos							
B0C7 - R0004 - Out Of School Hours Care Centre - 70.5 m2							
No Asbestos							
B0C7 - R0005 - Special Programs Room - 11.07 m2							
No Asbestos							
B0C7 - R0006 - Kiln Room - 1.61 m2							
No Asbestos							

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020