

# Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Lisarow Public School (2407)
Region:	Hunter/Central Coast AMU
State Electorate:	The Entrance
Local Government Area:	Central Coast

Last Reviewed By:	AECOM 28-JUN-2016
Last Revised By:	Greencap 12-AUG-2020

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

2407 - Lisarow Public School  
Site Plan (12769)

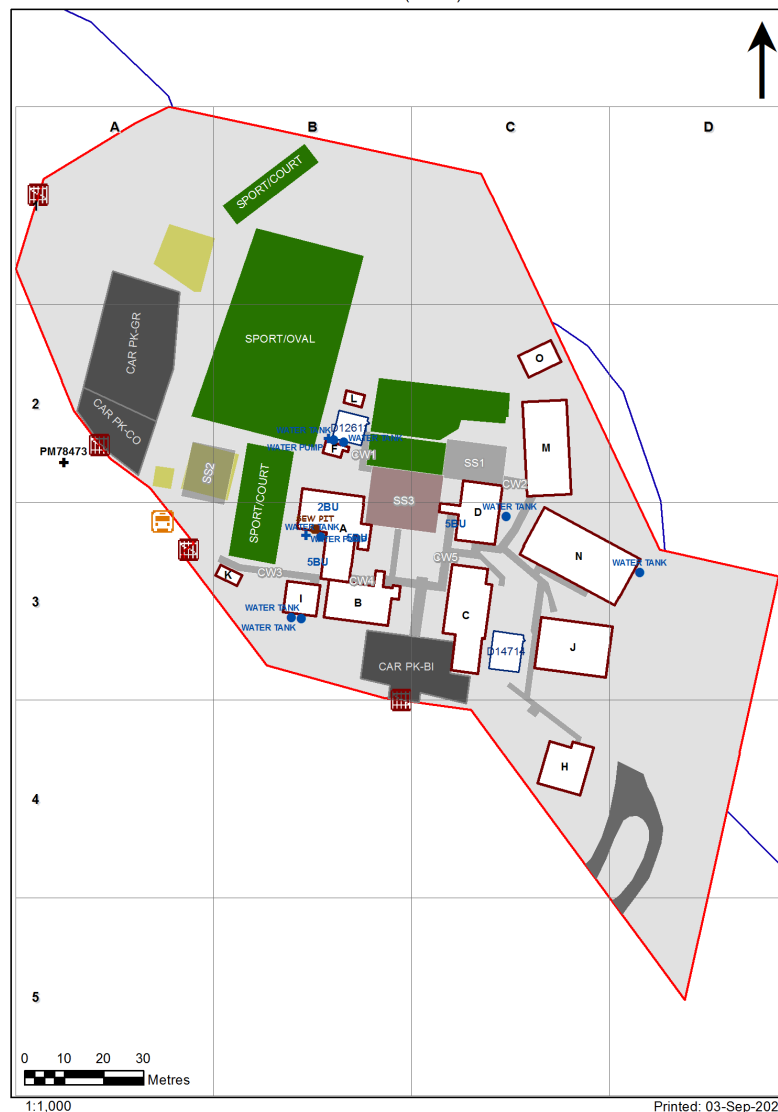

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Communal Facilities - 1928 - Timber</b>							
<b>Exterior</b>							
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0002 - Cleaning Distributed Store - 8.83 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0003 - Disabled Toilet - 4.96 m2</b>							
No Asbestos							
<b>B00A - R0004 - Toilets - Boys - 11.7 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	15.00m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Toilets - Girls - 11.71 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	15.00m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0007 - External Movement - 14.81 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0008 - Movement - 43.54 m2</b>							
No Asbestos							
<b>B00A - R0009 - Communal Space - 123.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0010 - Communal/Performance Store - 13.23 m2</b>							
No Asbestos							
<b>B00A - R0011 - Communal/Performance Store - 15.15 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - General Learning - 1928 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00B - R0001 - Home Base Store - 5.89 m2</b>							
No Asbestos							
<b>B00B - R0002 - Practical Activities - 1hb - 10.25 m2</b>							
No Asbestos							
<b>B00B - R0003 - Home Base - 45.25 m2</b>							
No Asbestos							
<b>B00B - R0004 - Special Programs Room - 44.23 m2</b>							
No Asbestos							
<b>B00B - R0005 - Home Base Store - 5.69 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R0006 - General Storeroom - 10.54 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00B - R0007 - Staff Toilet - 3.38 m2</b>								
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0008 - Movement - 6.63 m2</b>								
No Asbestos								
<b>B00B - R0009 - Practical Activities - 1hb - 12.01 m2</b>								
No Asbestos								
<b>B00B - R0010 - External Movement - 8.86 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00B - R0011 - Shelter - 6.27 m2</b>								
No Asbestos								
<b>B00C - Administration - 1928 - Timber</b>								
<b>Exterior</b>								
Ceiling Voids - Flat Roof	Non Accessible Area							
Underfloor Voids	No Asbestos Found							
Gable Verge Lining	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>Interior</b>								
<b>B00C - R0001 - External Movement - 12.26 m2</b>								
No Asbestos								
<b>B00C - R0008 - Staff Kitchen - 12.15 m2</b>								
No Asbestos								
<b>B00C - R0009 - Principal - 21.14 m2</b>								
Floor Coverings Res/Textile	Vinyl Sheet							
<b>B00C - R0010 - Staff Toilet - 2.77 m2</b>								
No Asbestos								
<b>B00C - R0011 - General Storeroom - 1.38 m2</b>								
No Asbestos								
<b>B00C - R0015 - Sick Bay - 5.5 m2</b>								
No Asbestos								
<b>B00C - R0016 - Clerical/Printing - 16.57 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	16.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0018 - Movement - 5.04 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00C - R0019 - Study Annexe - 17.68 m2</b>								
No Asbestos								
<b>B00C - R0020 - Staff Room - 51.92 m2</b>								
No Asbestos								
<b>B00C - R0021 - Staff Kitchen - 6.92 m2</b>								
No Asbestos								
<b>B00C - R0023 - Interview - 26.83 m2</b>								
Require Inspection								
<b>B00C - R0024 - Entry Vestibule - 18.5 m2</b>								
Require Inspection								

<b>B00C - R0025 - Clerical Office - 13.74 m2</b>							
Require Inspection							
<b>B00C - R0026 - Movement - 8.6 m2</b>							
Require Inspection							
<b>B00D - General Learning - 1928 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	20.00m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00D - R0001 - Home Base Store - 6.89 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0002 - Home Base - 55.87 m2</b>							
No Asbestos							
<b>B00D - R0003 - Home Base - 50.76 m2</b>							
No Asbestos							
<b>B00D - R0004 - Home Base Store - 6.62 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00D - R0005 - Practical Activities - 1hb - 11.74 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0006 - Personal Effects Storage - 7.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0008 - External Movement - 11.62 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - Building Services - 1928 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00F - R0001 - General Assistant/Bulk Store - 14.72 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - General Learning - 1998 - Timber</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	120m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Ends	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Electrical Backing Board		1.00m2			Low (1)		
<b>Interior</b>							
<b>B00H - R0001 - Other-Community Use - 12.19 m2</b>							
No Asbestos							
<b>B00H - R0002 - General Storeroom - 12.54 m2</b>							
No Asbestos							
<b>B00H - R0003 - General Storeroom - 5.51 m2</b>							
No Asbestos							
<b>B00H - R0004 - Toilets - Boys/Girls - 5.53 m2</b>							
No Asbestos							
<b>B00H - R0005 - Uniform Shop - 6.11 m2</b>							
No Asbestos							
<b>B00H - R0008 - External Movement - 35.46 m2</b>							
No Asbestos							
<b>B00H - R0009 - Other-Community Use - 46.03 m2</b>							
No Asbestos							
<b>B00I - Pupil Facilities - 2001 - Timber</b>							
<b>Exterior</b>							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00I - R0001 - Toilets - Boys - 14.66 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00I - R0002 - Toilets - Girls - 19.27 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00I - R0003 - Access Shower/Toilet - 5.18 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00I - R0004 - Movement - 17.94 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00J - General Learning - 2004 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00J - R0001 - Home Base - 59.94 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00J - R0002 - Home Base Store - 5.9 m2</b>							

Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0003 - Practical Activity Area - 19.14 m2</b>		
No Asbestos		
<b>B00J - R0004 - Withdrawal Space - 1hb - 11.63 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0005 - Home Base - 59.39 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0006 - Home Base Store - 5.9 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B00J - R0007 - Practical Activity Area - 19.14 m2</b>		
No Asbestos		
<b>B00J - R0008 - Distribution Board - .31 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00J - R0009 - Movement - 40.59 m2</b>		
No Asbestos		
<b>B00K - Pupil Facilities - 2007 - Steel</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00K - R0001 - Interview - 16.31 m2</b>		
No Asbestos		
<b>B00L - Pupil Facilities - 2005 - Metal Shed</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00L - R0001 - Sports Store - 13.24 m2</b>		
No Asbestos		
<b>B00M - Library/Staff Facilities - 2010 - Steel</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00M - R0001 - Reading Area - 168.41 m2</b>		
No Asbestos		
<b>B00M - R0002 - Library Office/Workroom - 24.25 m2</b>		
No Asbestos		
<b>B00M - R0003 - Communications Room - 8.02 m2</b>		
No Asbestos		
<b>B00M - R0004 - K.L.A. Store - 14.74 m2</b>		
No Asbestos		
<b>B00M - R0005 - External Movement - 22.27 m2</b>		
No Asbestos		

<b>B00M - R0006 - Movement - 2.5 m2</b>		
No Asbestos		
<b>B00M - R0007 - Cleaning Distributed Store - 3.85 m2</b>		
No Asbestos		
<b>B00M - R0008 - Staff Toilet - 4.87 m2</b>		
No Asbestos		
<b>B00M - R0009 - Distribution Board - .43 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00N - General Learning - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00N - R0001 - Practical Activities - 1hb - 15.86 m2</b>		
No Asbestos		
<b>B00N - R0002 - Personal Effects Storage - 4.99 m2</b>		
No Asbestos		
<b>B00N - R0003 - Home Base - 58.59 m2</b>		
No Asbestos		
<b>B00N - R0004 - Withdrawal Space - 1hb - 9.26 m2</b>		
No Asbestos		
<b>B00N - R0005 - Home Base Store - 5.96 m2</b>		
No Asbestos		
<b>B00N - R0006 - Practical Activities - 1hb - 15.32 m2</b>		
No Asbestos		
<b>B00N - R0007 - Personal Effects Storage - 3.3 m2</b>		
No Asbestos		
<b>B00N - R0008 - Home Base Store - 6.17 m2</b>		
No Asbestos		
<b>B00N - R0009 - Home Base - 61.34 m2</b>		
No Asbestos		
<b>B00N - R0010 - Withdrawal Space - 2hb - 11.78 m2</b>		
No Asbestos		
<b>B00N - R0011 - Home Base - 61.35 m2</b>		
No Asbestos		
<b>B00N - R0012 - Home Base Store - 6.17 m2</b>		
No Asbestos		
<b>B00N - R0013 - Personal Effects Storage - 4.73 m2</b>		
No Asbestos		
<b>B00N - R0014 - Practical Activities - 1hb - 14.58 m2</b>		
No Asbestos		
<b>B00N - R0015 - Distribution Board - .43 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00N - R0016 - External Movement - 69.14 m2</b>		
No Asbestos		
<b>B00O - Building Services/Communal Facilities - 2009 - Steel</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	



Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B000 - R0001 - P.E. Store - 18.01 m2</b>		
No Asbestos		
<b>B000 - R0002 - General Assistant/Bulk Store - 18.1 m2</b>		
No Asbestos		
<b>B000 - R0003 - General Storeroom - 18.01 m2</b>		
No Asbestos		

## Demountables

### OS 801 12611 - FSU - Placement Date : 30-JUN-1995

#### Exterior

Eaves Linings	Flat AC Sheeting	8.64m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

#### Interior

##### R1- Canteen

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Assumed Asbestos

##### R2- Covered Area

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos

### OS 602 14714 - Learning Unit - Standard With P.A.A. - Placement Date : 17-JAN-2011

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found