


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lithgow Public School (2410)
Region:	North Western NSW AMU
State Electorate:	Bathurst
Local Government Area:	Lithgow

Last Reviewed By:	Greencap 17-APR-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

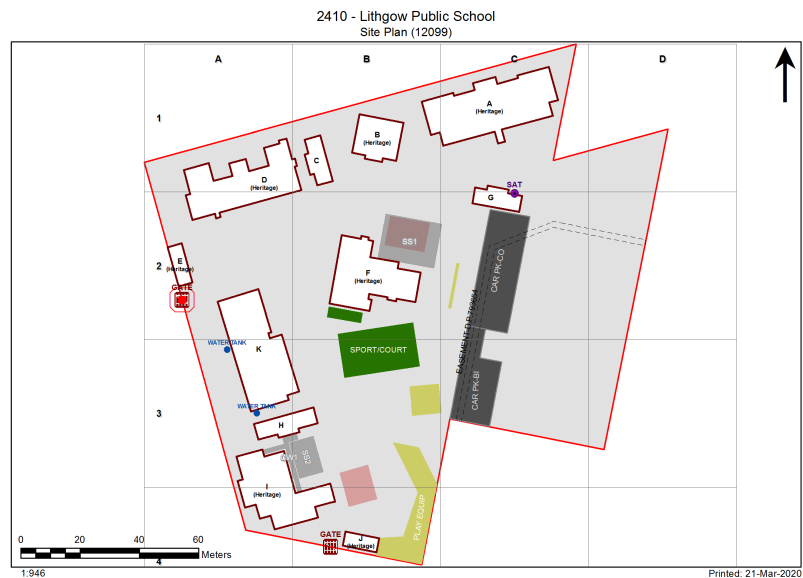

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/Library - 1928 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - Movement - 4.8 m2							
No Asbestos							
B00A - R0002 - Cleaning Distributed Store - 5.3 m2							
No Asbestos							
B00A - R0003 - Movement - 19.3 m2							
No Asbestos							
B00A - R0005 - Movement - 3.77 m2							
No Asbestos							
B00A - R0006 - Home Base - 47.8 m2							
No Asbestos							
B00A - R0007 - Home Base - 47.66 m2							
No Asbestos							
B00A - R0009 - Seminar/Study - 12.46 m2							
No Asbestos							
B00A - R0010 - Seminar/Study - 12.46 m2							
No Asbestos							
B00A - R0011 - Library Office/Workroom - 25.69 m2							
No Asbestos							
B00A - R0012 - Reading Area - 147.96 m2							
No Asbestos							
B00A - R0013 - K.L.A. Store - 12.7 m2							
No Asbestos							
B00A - R0014 - Movement - 3.77 m2							
No Asbestos							
B00A - R0015 - Movement - 21.18 m2							
No Asbestos							
B00A - R0016 - Movement - 4.91 m2							
No Asbestos							
B00A - R0017 - Movement - 12.3 m2							
No Asbestos							
B00A - R0018 - Entry Vestibule - 18.21 m2							
No Asbestos							
B00A - R0022 - Deputy Principal - 18.73 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00A - R0023 - Duplicating Workroom - 12.24 m2							
No Asbestos							
B00A - R0024 - Movement - 51.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						

Wall Linings Internal	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0025 - Movement - 8.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0026 - Movement - .91 m2							
No Asbestos							
B00A - R0027 - Stairs - 4.54 m2							
No Asbestos							
B00A - R0028 - Stairs - 5.72 m2							
No Asbestos							
B00A - R0029 - Stairs - 10.19 m2							
No Asbestos							
B00A - R0030 - General Assistant/Bulk Store - 10.1 m2							
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0031 - Principal - 26.91 m2							
Wall Linings Internal	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - Other - 9.28 m2							
No Asbestos							
B00A - R0033 - Sick Bay - 7.09 m2							
No Asbestos							
B00A - R0034 - Movement - 12.39 m2							
No Asbestos							
B00A - R0035 - Clerical Office - 16.82 m2							
No Asbestos							
B00A - R1001 - Staff Toilet - 8.47 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1003 - Movement - 21.29 m2							
No Asbestos							
B00A - R1004 - Home Base - 49.49 m2							
No Asbestos							
B00A - R1005 - Home Base - 49.5 m2							
No Asbestos							
B00A - R1006 - Home Base - 49.5 m2							
No Asbestos							
B00A - R1007 - Home Base - 49.56 m2							
No Asbestos							
B00A - R1008 - Home Base - 49.43 m2							
No Asbestos							
B00A - R1009 - Movement - 21.93 m2							
No Asbestos							
B00A - R1011 - Staff Toilet - 8.43 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1012 - Movement - 6.59 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1013 - Cleaning Distributed Store - 2.09 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1014 - General Storeroom - 20.11 m2							

No Asbestos							
B00A - R1015 - Communal Space - 140.76 m2							
No Asbestos							
B00A - R1016 - Raised Platform - 16.2 m2							
No Asbestos							
B00A - R1017 - Staff Room Annexe - 19.19 m2							
No Asbestos							
B00A - R1018 - Movement - 8.78 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1019 - Stairs - 12.39 m2							
No Asbestos							
B00A - R1020 - Stairs - 12.28 m2							
No Asbestos							
B00A - R9001 - General Storeroom - 61.95 m2							
No Asbestos							
B00A - R9002 - Stairs - 1.15 m2							
No Asbestos							
B00B - Support Unit - 1879 - Sandstone							
Exterior							
Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00B - R0001 - Movement - 11.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0002 - Withdrawal Space - 1hb - 16.54 m2							
No Asbestos							
B00B - R0003 - Home Base - E - 20.84 m2							
No Asbestos							
B00B - R0004 - Practical Activities - E - 9.82 m2							
No Asbestos							
B00B - R0010 - Staff Toilet - 1.4 m2							
No Asbestos							
B00B - R0011 - Toilet - P - 5.81 m2							
No Asbestos							
B00B - R0012 - Practical Activities - P - 1hb - 17.13 m2							
No Asbestos							
B00B - R0013 - Home Base - P - 28.77 m2							
No Asbestos							
B00B - R0014 - Staff Room Annexe - 14.07 m2							
No Asbestos							
B00B - R0015 - General Storeroom - 14.17 m2							
No Asbestos							
B00B - R0016 - Movement - 2.17 m2							
No Asbestos							
B00B - R0017 - Movement - 20.58 m2							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

B00C - Pupil Facilities - 1975 - Brick/Block**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior**B00C - R0001 - Drinking Facilities - 2.91 m2**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B00C - R0002 - Toilets - Boys - 32.8 m2

Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0003 - Toilets - Girls - 29.06 m2

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0004 - Drinking Facilities - 3.02 m2

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B00C - R0005 - Staff Toilet - 2.92 m2

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos

B00C - R0006 - Movement - 3.48 m2

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B00C - R0007 - Movement - 3.46 m2

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B00C - R0008 - Staff Toilet - 2.97 m2

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	-----------------------------

B00D - General Learning/Support Unit - 1884 - Brick/Veneer**Exterior**

Underfloor Voids	Non Accessible Area						
Ceiling Voids	No Asbestos Found						

Interior**B00D - R0001 - Cleaning Distributed Store - 4.98 m2**

No Asbestos							
-------------	--	--	--	--	--	--	--

B00D - R0002 - Movement - 20.97 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B00D - R0003 - Sports Store - 12.5 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B00D - R0004 - Home Base - 49.14 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B00D - R0005 - Home Base - 50.07 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

B00D - R0006 - Home Base - 50.16 m2							
No Asbestos							
B00D - R0007 - Home Base - M - 49.26 m2							
No Asbestos							
B00D - R0009 - Toilet - S - 12.03 m2							
No Asbestos							
B00D - R0010 - Home Base Store - M - 4.7 m2							
No Asbestos							
B00D - R0011 - Movement - 4.04 m2							
No Asbestos							
B00D - R0012 - Staff Room Annexe - 18.19 m2							
No Asbestos							
B00D - R0014 - Movement - 96.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0015 - Movement - 2.1 m2							
No Asbestos							
B00D - R0016 - Stairs - 9.72 m2							
No Asbestos							
B00D - R0017 - Stairs - 9.65 m2							
No Asbestos							
B00D - R0018 - Practical Activities - S - 1hb - 6.71 m2							
No Asbestos							
B00D - R0019 - Home Base - S - 42.42 m2							
No Asbestos							
B00D - R1001 - Movement - 9.04 m2							
No Asbestos							
B00D - R1002 - Staff Room Annexe - 13.27 m2							
No Asbestos							
B00D - R1003 - Home Base - 52.9 m2							
No Asbestos							
B00D - R1004 - Home Base - 52.7 m2							
No Asbestos							
B00D - R1005 - Home Base - 52.89 m2							
No Asbestos							
B00D - R1006 - Home Base - 52.76 m2							
No Asbestos							
B00D - R1007 - General Storeroom - 19.64 m2							
No Asbestos							
B00D - R1008 - Home Base - 54.43 m2							
No Asbestos							
B00D - R1010 - Movement - 9.21 m2							
No Asbestos							
B00D - R1011 - Staff Room Annexe - 8.79 m2							
No Asbestos							
B00D - R1012 - Staff Room Annexe - 20.1 m2							
No Asbestos							
B00D - R1013 - Movement - 59.49 m2							
No Asbestos							
B00D - R1014 - Stairs - 11.66 m2							
No Asbestos							
B00D - R1015 - Stairs - 11.3 m2							

No Asbestos							
B00E - Building Services - 1950 - Brick/Veneer							
Exterior							
Wall Cladding	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00E - R0001 - Movement - 41.21 m2							
No Asbestos							
B00E - R0002 - General Storeroom - 11.46 m2							
No Asbestos							
B00E - R0003 - Garden Store - 8.76 m2							
No Asbestos							
B00F - Communal Facilities/Pupil Facilities - 1909 - Brick/Block							
Exterior							
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00F - M0001 - General Assistant/Bulk Store - 8.86 m2							
No Asbestos							
B00F - M0002 - Movement - 3.74 m2							
No Asbestos							
B00F - M0003 - Stairs - 2.31 m2							
No Asbestos							
B00F - M0004 - Stairs - 2.31 m2							
No Asbestos							
B00F - R0001 - Canteen - 47.54 m2							
No Asbestos							
B00F - R0002 - Staff Toilet - 8.62 m2							
No Asbestos							
B00F - R0003 - Canteen Office/Store - 2.83 m2							
No Asbestos							
B00F - R0004 - Movement - 51.58 m2							
No Asbestos							
B00F - R0005 - Movement - 3.29 m2							
No Asbestos							
B00F - R0006 - General Storeroom - 8.89 m2							
No Asbestos							
B00F - R0007 - Cleaning Supplies - 9.49 m2							
No Asbestos							
B00F - R0008 - Special Programs Room - 47.09 m2							
No Asbestos							
B00F - R0009 - Special Programs Room - 32.77 m2							
No Asbestos							
B00F - R0010 - Craft Store - 13.48 m2							
No Asbestos							
B00F - R0011 - Practical Activities - 1hb - 46.94 m2							
No Asbestos							
B00F - R0012 - Movement - 13.53 m2							

No Asbestos		B00F - R0013 - Cleaning Distributed Store - 3.05 m2						
No Asbestos		B00F - R0014 - Communal Space - 68.49 m2						
No Asbestos		B00F - R0015 - Movement - 1.9 m2						
No Asbestos		B00F - R0016 - Movement - 18.87 m2						
Ceiling Structures/Linings	Flat AC Sheeting							
B00F - R0017 - Movement - 2.11 m2								
No Asbestos								
B00F - R0018 - Stairs - 3.22 m2								
No Asbestos								
B00F - R0019 - Stairs - 3.22 m2								
No Asbestos								
B00F - R1001 - Other-Community Use - 48.47 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
B00F - R1002 - Staff Toilet - 3.07 m2								
No Asbestos								
B00F - R1003 - Movement - 68.82 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
B00F - R1005 - Cleaning Distributed Store - 11.82 m2								
No Asbestos								
B00F - R1006 - Staff Room - 57.28 m2								
No Asbestos								
B00F - R1007 - Stairs - 16.83 m2								
No Asbestos								
B00F - R1008 - Stairs - 3.47 m2								
No Asbestos								
B00F - R1009 - Home Base/Practical Activities - 46.75 m2								
No Asbestos								
B00F - R1010 - Home Base/Practical Activities - 48.44 m2								
No Asbestos								
B00F - R1011 - Home Base/Practical Activities - 48.95 m2								
No Asbestos								
B00G - Pupil Facilities - 1975 - Brick/Block								
Exterior								
Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Interior								
B00G - R0001 - Drinking Facilities - 2.92 m2								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00G - R0002 - Toilets - Boys - 32.36 m2								
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0003 - Staff Toilet - 2.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0004 - Movement - 3.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0005 - Movement - 3.48 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0006 - Cleaning Distributed Store - 2.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0007 - Toilets - Girls - 29.17 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0008 - Drinking Facilities - 2.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - Pupil Facilities - 1975 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00H - R0001 - Drinking Facilities - 2.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0002 - Toilets - Girls - 39.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0003 - General Storeroom - 3.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0004 - General Storeroom - 1.66 m2							
No Asbestos							
B00H - R0005 - Movement - 4.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0006 - Movement - 4.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0007 - Staff Toilet - 2.87 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00H - R0008 - Toilets - Boys - 41.9 m2							

Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0009 - Drinking Facilities - 2.91 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - General Learning - 1916 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00I - R0001 - Movement - 10.13 m2							
No Asbestos							
B00I - R0002 - General Storeroom - 4.93 m2							
No Asbestos							
B00I - R0003 - General Storeroom - 9.46 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0004 - Movement - 3.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0006 - General Storeroom - 15.93 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0007 - Staff Toilet - 2.87 m2							
No Asbestos							
B00I - R0008 - Sick Bay - 11.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0009 - Clerical Office/Workroom - 13.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0010 - Home Base - 45.2 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R0011 - Staff Room Annexe - 15.86 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0012 - Home Base - 62.18 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	63m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R0013 - General Storeroom - 11.16 m2							
No Asbestos							
B00I - R0014 - General Storeroom - 5.17 m2							
No Asbestos							
B00I - R0015 - Movement - 18.15 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0017 - Home Base - 45.01 m2							
Furniture / Fixtures - Blackboard	Flat AC Sheeting	11	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0018 - Home Base - 44.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R0019 - Movement - 67.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0020 - Movement - 4.19 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R0021 - Stairs - 9.88 m2							
No Asbestos							
B00I - R0022 - Stairs - 6.19 m2							
No Asbestos							
B00I - R1001 - Movement - 17.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00I - R1002 - Home Base - 46.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R1003 - Home Base - 46.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00I - R1004 - Staff Room - 16.19 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00I - R1005 - Home Base - 60.84 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	61m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00I - R1007 - Withdrawal Space - 1hb - 6.74 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	7m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00I - R1008 - Home Base - 46.28 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00I - R1009 - Home Base - 46.39 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00I - R1010 - Movement - 77.78 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	78m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00I - R1011 - Stairs - 12.4 m2								
No Asbestos								
B00I - R1012 - Stairs - 11.03 m2								
No Asbestos								
B00J - Storage - 1916 - Timber								
Exterior								
Eaves Linings	Flat AC Sheeting							
Ceiling Voids - Flat Roof	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00J - R0001 - Movement - 41.08 m2								
No Asbestos								
B00J - R0002 - Sports Store - 10.28 m2								
No Asbestos								
B00K - Communal Facilities - 2011 - Brick/Veneer								

Exterior	
Ceiling Voids - Raked Ceiling	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found
Interior	
B00K - R0001 - Communal Space - 214.78 m2	
No Asbestos	
B00K - R0002 - Raised Platform - 46.7 m2	
No Asbestos	
B00K - R0003 - Movement - 5.54 m2	
No Asbestos	
B00K - R0004 - Covered Outdoor Learning Area - 218.12 m2	
No Asbestos	
B00K - R0005 - Ramp - 13.02 m2	
No Asbestos	
B00K - R0006 - Movement - 11.95 m2	
No Asbestos	
B00K - R0007 - Hall Chair Store - 12.72 m2	
No Asbestos	
B00K - R0008 - Communal/Performance Store - 10.35 m2	
No Asbestos	
B00K - R0009 - P.E Store - 16.32 m2	
No Asbestos	
B00K - R0010 - Toilets - Girls - 7.23 m2	
No Asbestos	
B00K - R0011 - Movement - 2.52 m2	
No Asbestos	
B00K - R0012 - Toilets - Boys - 5.73 m2	
No Asbestos	
B00K - R0013 - Movement - 3.49 m2	
No Asbestos	
B00K - R0014 - Sound Cupboard - 2.06 m2	
No Asbestos	
B00K - R0015 - Cleaning Distributed Store - 3.56 m2	
No Asbestos	
B00K - R0016 - Other - 1.62 m2	
No Asbestos	
B00K - R0017 - Main Switch Board Cupboard - 3.29 m2	
No Asbestos	
B00K - R0018 - Access Shower/Toilet/Change - 6.78 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020