


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lockhart Central School (2418)
Region:	Southern NSW AMU
State Electorate:	Wagga Wagga
Local Government Area:	Lockhart

Last Reviewed By:	WSP 07-FEB-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

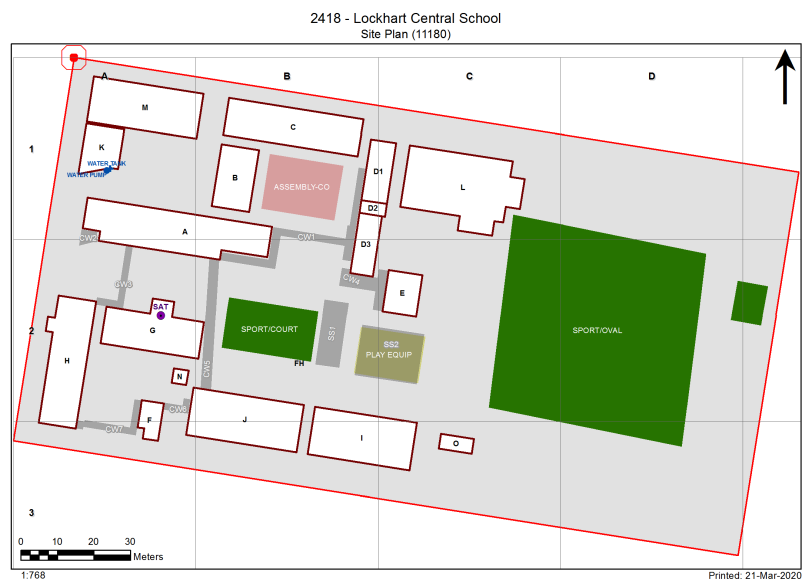

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning - 1964 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Ends	Flat AC Sheeting	6m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	36m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0002 - Clerical Office/Workroom - 21.8 m2							
No Asbestos							
B00A - R0003 - Staff Toilet - 2.62 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0005 - Staff Room - 50.74 m2							
Material - Stored / Debris Material	Flat AC Sheeting	2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - General Learning Space - 57.87 m2							
No Asbestos							
B00A - R0007 - General Storeroom - 5.29 m2							
No Asbestos							
B00A - R0008 - General Storeroom - 5.29 m2							
No Asbestos							
B00A - R0009 - General Learning Space - 57.34 m2							
No Asbestos							
B00A - R0010 - Staff Room Annexe - 11.91 m2							
No Asbestos							
B00A - R0011 - Staff Room Annexe - 6.5 m2							
No Asbestos							
B00A - R0012 - Food Technology L.S. - 70.33 m2							
No Asbestos							
B00A - R0013 - Laundry - 12.4 m2							
No Asbestos							
B00A - R0014 - Food/Research Space - 10.37 m2							
No Asbestos							
B00A - R0015 - Movement - 98.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	99m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0017 - Movement - 4.76 m2							
No Asbestos							
B00A - R0018 - Movement - 4.41 m2							
No Asbestos							
B00A - R0019 - General Storeroom - 7.78 m2							
No Asbestos							
B00A - R0020 - No Access - 1.16 m2							
No Asbestos							
B00A - R0021 - Movement - 4.77 m2							
No Asbestos							

B00A - R0022 - Movement - 2.56 m2							
No Asbestos							
B00A - R0026 - Movement - 1.98 m2							
No Asbestos							
B00A - R0027 - Staff - Toilet - 2.38 m2							
No Asbestos							
B00A - R0028 - Entry Vestibule - 4.54 m2							
No Asbestos							
B00A - R0029 - Principal - 28.64 m2							
No Asbestos							
B00B - Art - 1970 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	32m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Wall Linings Internal - Infill	Flat AC Sheeting	7	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00B - R0002 - Movement - 31.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0003 - Materials Store - 17.97 m2							
No Asbestos							
B00B - R0004 - Welding Area - 2.74 m2							
Floor Coverings Res/Textile	Compressed AC Sheet						
B00B - R0005 - General Learning Space - 54.73 m2							
No Asbestos							
B00B - R0006 - General Learning Space - 51.65 m2							
No Asbestos							
B00C - Science - 1970 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	22m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	30	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - Movement - 67.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0007 - General Storeroom - 25.02 m2							
No Asbestos							

B00C - R0008 - Interview - 13.13 m2							
No Asbestos							
B00C - R0009 - Staff Room Annexe - 9.43 m2							
No Asbestos							
B00C - R0010 - Special Programs Room - 90.68 m2							
No Asbestos							
B00C - R0011 - Distribution Board - 1.91 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00C - R0012 - Laboratory L.S. - 56.31 m2							
No Asbestos							
B00C - R0013 - Staff Study - 21.59 m2							
No Asbestos							
B00C - R0014 - Chemical Store - 6.41 m2							
No Asbestos							
B00C - R0015 - Laboratory L.S. - 56.47 m2							
No Asbestos							
B00E - Pupil Facilities - 1964 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	7m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0001 - Shower/Change - 39.47 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0002 - No Access - 6.83 m2							
Non Accessible							
B00E - R0003 - Shower/Change - 37.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0004 - Movement - 8.87 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - Pupil Facilities - 1970 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - Movement - 20.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0002 - Toilets - Girls - 14.34 m2							

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0003 - Toilets - Boys - 16.23 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - General Learning - 1903 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G - R0002 - Interview - 9.08 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0003 - Seminar - Type 1 - 22.49 m2							
No Asbestos							
B00G - R0004 - Movement - 53.91 m2							
No Asbestos							
B00G - R0005 - Darkroom Space - 19.42 m2							
No Asbestos							
B00G - R0006 - Home Base - 51 m2							
No Asbestos							
B00G - R0007 - Music Learning Space - 47.07 m2							
No Asbestos							
B00G - R0008 - Home Base - 46.9 m2							
No Asbestos							
B00G - R0012 - Movement - 5.9 m2							
No Asbestos							
B00G - R0013 - Staff Room - 9.73 m2							
No Asbestos							
B00H - General Learning/Administration - 1970 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	15m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	22	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00H - R0001 - Staff Room Annexe - 29.57 m2							
No Asbestos							
B00H - R0002 - Movement - 64.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Wall Linings Internal - Infill	Flat AC Sheeting	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0003 - Sick Bay - 9.19 m2							
No Asbestos							
B00H - R0004 - No Access - 1.94 m2							
No Asbestos							
B00H - R0005 - Movement - 18.77 m2							
No Asbestos							
B00H - R0006 - Staff Room Annexe - 15.37 m2							
No Asbestos							
B00H - R0007 - Personal Effects Storage - 9.65 m2							
No Asbestos							
B00H - R0008 - Home Base - 56.63 m2							
No Asbestos							
B00H - R0009 - Home Base - 85.55 m2							
No Asbestos							
B00H - R0010 - Personal Effects Storage - 6.58 m2							
No Asbestos							
B00H - R0011 - General Storeroom - 2.96 m2							
No Asbestos							
B00H - R0013 - Home Base Store - 3.5 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00H - R0015 - Duplicating Workroom - 8.13 m2							
No Asbestos							
B00H - R0016 - Movement - 7.15 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0017 - General Storeroom - 8.63 m2							
No Asbestos							
B00H - R0018 - Distribution Board - .34 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	3m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0019 - Movement - 1.34 m2							
No Asbestos							
B00H - R0020 - Staff - Toilet - 1.94 m2							
No Asbestos							
B00H - R0021 - Movement - 2.12 m2							
No Asbestos							
B00H - R0022 - Toilets-Unisex - 1.54 m2							
No Asbestos							
B00I - General Learning - 1997 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - General Learning Space - 79.7 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00I - R0002 - General Learning Space - 80.11 m2							

Floor Coverings Res/Textile	No Asbestos Found	
B00I - R0003 - General Learning Space - 78.65 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00I - R0004 - Distribution Board - .77 m2		Note: No inspection of live electrical installation
No Asbestos		
B00I - R0005 - Movement - 5.19 m2		
No Asbestos		
B00I - R0006 - Movement - 2.67 m2		
No Asbestos		
B00I - R0007 - Movement - 58.58 m2		
No Asbestos		
B00I - R0008 - Movement - 5.16 m2		
No Asbestos		
B00I - R001A - General Storeroom - 5.63 m2		
No Asbestos		
B00I - R001B - Withdrawal Space - 1hb - 10.76 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00I - R002A - General Storeroom - 6.6 m2		
No Asbestos		
B00I - R003A - General Storeroom - 5.18 m2		
No Asbestos		
B00I - R003B - Clerical Office/Workroom - 5.14 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - Library - 1997 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00J - R0001 - Reading Area - 164.73 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0002 - Seminar/Study - 13.07 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0003 - Seminar/Study - 13 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0004 - Library Office/Workroom - 23.59 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0005 - Communications Room - 12.08 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0006 - General Learning Space - 33.08 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0007 - Home Base Store - 2.5 m2		
Floor Coverings Res/Textile	No Asbestos Found	

B00J - R0008 - Home Base Store - 8.72 m2		
No Asbestos		
B00J - R0009 - Plant - 4.58 m2		
No Asbestos		
B00J - R0010 - Distribution Board - .69 m2		Note: No inspection of live electrical installation
No Asbestos		
B00J - R0011 - Movement - 99.23 m2		
No Asbestos		
B00K - Music - 1997 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00K - R0001 - Music Learning Space - 60.31 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0002 - Music Store - 10.35 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0003 - Practice/Seminar - 18.96 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00K - R0004 - Cleaning Distributed Store - .47 m2		
No Asbestos		
B00K - R0005 - Distribution Board - 3.8 m2		Note: No inspection of live electrical installation
No Asbestos		
B00K - R0006 - Movement - 22.1 m2		
No Asbestos		
B00L - Communal Facilities - 1997 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00L - R0001 - Sports Store - 30.93 m2		
No Asbestos		
B00L - R0002 - Distribution Board - .34 m2		Note: No inspection of live electrical installation
No Asbestos		
B00L - R0003 - Multi-Purpose Space - 496.41 m2		
No Asbestos		
B00M - Technological & Applied Studies - 1997 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00M - R0001 - Metal Technology Bay - 152 m2		
No Asbestos		

B00M - R0002 - Materials Store - 32.14 m2							
No Asbestos							
B00M - R0003 - Dust Extraction Space - 6.95 m2							
No Asbestos							
B00M - R0004 - No Access - 48.25 m2							
No Asbestos							
B00M - R0005 - Movement - 60.67 m2							
No Asbestos							
B00M - R0006 - Movement - 60.65 m2							
No Asbestos							
B00N - Other/Storage - 2000 - Metal Shed							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00N - R0001 - Sports Store - 15.6 m2							
No Asbestos							
B00O - Storage - 2013 - Metal Shed							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00O - R0001 - Garage/Carport - 34.57 m2							
No Asbestos							
B0D1 - Pupil Facilities - 1964 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	26m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B0D1 - R0001 - Canteen - 18.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D1 - R0002 - General Storeroom - 3.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B0D1 - R0003 - Staff Shower/Change - 2.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D1 - R0004 - Staff Toilet - 2.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D1 - R0005 - Movement - 52.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D1 - R0006 - Kiln Room - 7.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D1 - R0007 - General Storeroom - 6.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D1 - R0008 - General Assistant/Bulk Store - 6.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D2 - Building Services - 1972 - Metal Shed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B0D2 - R0007 - Garden Store - 23.64 m2							
No Asbestos							
B0D3 - Pupil Facilities - 1964 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Ends	Flat AC Sheeting	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	16m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B0D3 - R0008 - Toilets - Boys - 17.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D3 - R0009 - Toilets - Girls - 15.67 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B0D3 - R0013 - Cleaning Distributed Store - 2.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B0D3 - R0014 - Cleaning Distributed Store - 4.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0D3 - R0015 - Movement - 11.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0D3 - R0016 - Toilets-Girls - 9.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0D3 - R0017 - Toilets-Girls - 2.75 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0D3 - R0018 - Toilets-Girls - 1.06 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0D3 - R0019 - Movement - 11.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0D3 - R0020 - Toilets-Boys - 11 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0D3 - R0021 - Toilets-Boys - 2.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020