


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Lugarno Public School (3796)</b>
<b>Region:</b>	<b>Sydney AMU</b>
<b>State Electorate:</b>	<b>Oatley</b>
<b>Local Government Area:</b>	<b>Georges River</b>

<b>Last Reviewed By:</b>	<b>AECOM 29-OCT-2014</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>Yes</b>
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

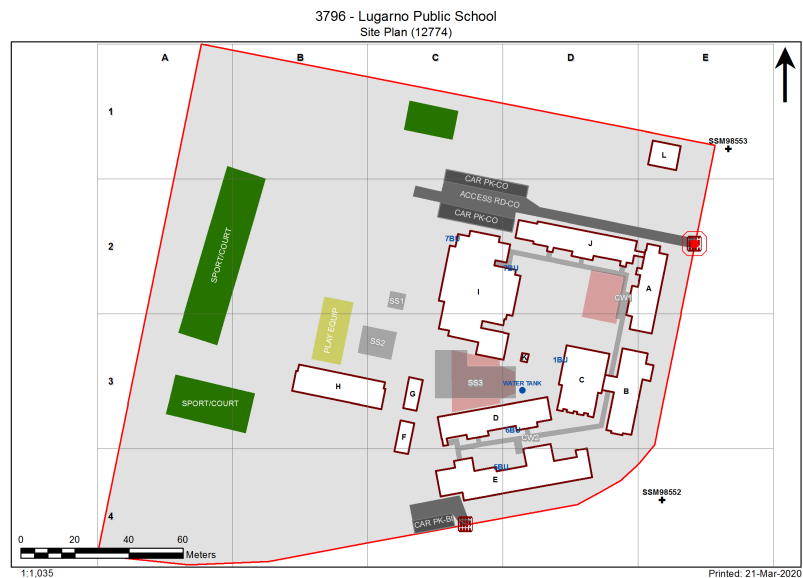

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning - 1976 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	18m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - External Movement - 10.42 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - External Movement - 23.37 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0011 - Home Base - 71.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00A - R0012 - Distribution Board - 10.02 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Electrical - Backing Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0013 - External Movement - 3.3 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet						
<b>B00A - R0014 - Home Base - 56.42 m2</b>							
No Asbestos							
<b>B00A - R0015 - Home Base Store - 3.37 m2</b>							
No Asbestos							
<b>B00A - R0016 - Home Base Store - 10.33 m2</b>							
No Asbestos							
<b>B00A - R0017 - Withdrawal Space - 2hb - 9.93 m2</b>							
No Asbestos							
<b>B00A - R0018 - Practical Activities - 2hb - 6.67 m2</b>							
No Asbestos							
<b>B00A - R0019 - Home Base - 56.43 m2</b>							
No Asbestos							
<b>B00B - Administration/Staff Facilities - 1974 - Brick/Block</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	18m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Interview - 12.02 m2</b>							

No Asbestos							
<b>B00B - R0002 - Movement - 13.91 m2</b>							
No Asbestos							
<b>B00B - R0003 - Entry Vestibule - 19.7 m2</b>							
No Asbestos							
<b>B00B - R0004 - Principal - 20.74 m2</b>							
No Asbestos							
<b>B00B - R0005 - Deputy Principal - 12.15 m2</b>							
No Asbestos							
<b>B00B - R0006 - Staff Room Annexe - 12.18 m2</b>							
No Asbestos							
<b>B00B - R0007 - Staff Room - 74.17 m2</b>							
No Asbestos							
<b>B00B - R0008 - Movement - 26.23 m2</b>							
No Asbestos							
<b>B00B - R0009 - Duplicating Workroom - 12.18 m2</b>							
No Asbestos							
<b>B00B - R0010 - Staff Toilet - 4.44 m2</b>							
No Asbestos							
<b>B00B - R0011 - Staff Toilet - 3.87 m2</b>							
No Asbestos							
<b>B00B - R0012 - Distribution Board - 1.51 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00B - R0013 - Toilets - Boys/Girls - 3.02 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0014 - Movement - 27.34 m2</b>							
No Asbestos							
<b>B00B - R0015 - Staff Toilet - 3.01 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0016 - Cleaning Distributed Store - 2.67 m2</b>							
No Asbestos							
<b>B00B - R0017 - Sick Bay - 7.93 m2</b>							
No Asbestos							
<b>B00B - R0018 - Clerical Office/Workroom - 11.69 m2</b>							
No Asbestos							
<b>B00B - R0019 - Duplicating Workroom - 12.61 m2</b>							
No Asbestos							
<b>B00B - R0020 - Distribution Board - 2.19 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00B - R0021 - General Storeroom - 12.32 m2</b>							
No Asbestos							
<b>B00C - Library - 1974 - Brick/Veneer</b>							
<b>Exterior</b>							
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	18m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
<b>Interior</b>								
<b>B00C - R0001 - Communications Room - 23.65 m2</b>								
No Asbestos								
<b>B00C - R0002 - Distribution Board - .63 m2</b>						<b>Note: No inspection of live electrical installation</b>		
Non Accessible								
<b>B00C - R0003 - Reading Area - 255.83 m2</b>								
No Asbestos								
<b>B00C - R0004 - Seminar/Study - 13.64 m2</b>								
No Asbestos								
<b>B00C - R0005 - K.L.A. Store - 13.54 m2</b>								
No Asbestos								
<b>B00C - R0006 - Library Office/Workroom - 8.47 m2</b>								
No Asbestos								
<b>B00C - R0007 - Library Office/Workroom - 13.46 m2</b>								
No Asbestos								
<b>B00D - General Learning - 1979 - Brick/Block</b>								
<b>Exterior</b>								
Eaves Linings	Flat AC Sheeting	50m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	18m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00D - R0001 - Home Base - 57.22 m2</b>								
No Asbestos								
<b>B00D - R0016 - Withdrawal Space - 1hb - 20.27 m2</b>								
No Asbestos								
<b>B00D - R0017 - Movement - 4.13 m2</b>								
No Asbestos								
<b>B00D - R0018 - External Movement - 2.71 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2.71m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00D - R0019 - Home Base Store - 9.36 m2</b>								
No Asbestos								
<b>B00D - R0020 - Withdrawal Space - 2hb - 10.22 m2</b>								
No Asbestos								
<b>B00D - R0021 - Practical Activities - 2hb - 7.58 m2</b>								
No Asbestos								
<b>B00D - R0022 - Home Base - 57.06 m2</b>								
No Asbestos								
<b>B00D - R0023 - External Movement - 11.98 m2</b>								

Ceiling Structures/Linings	Compressed AC Sheet	11.98m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00D - R0024 - External Movement - 11.78 m2</b>							
Ceiling Structures/Linings	Corrugated AC Sheeting	11.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00D - R0025 - Home Base - 56.97 m2</b>							
No Asbestos							
<b>B00D - R0026 - Home Base Store - 9.13 m2</b>							
No Asbestos							
<b>B00D - R0027 - Withdrawal Space - 2hb - 9.73 m2</b>							
No Asbestos							
<b>B00D - R0028 - Practical Activities - 2hb - 8.18 m2</b>							
No Asbestos							
<b>B00D - R0029 - Home Base - 56.03 m2</b>							
No Asbestos							
<b>B00D - R0030 - Home Base Store - 4.14 m2</b>							
No Asbestos							
<b>B00E - General Learning - 1955 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	18m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	18m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - External Movement - 9.06 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00E - R0002 - Cleaning Distributed Store - 2.89 m2</b>							
No Asbestos							
<b>B00E - R0009 - External Movement - 60.56 m2</b>							
No Asbestos							
<b>B00E - R0010 - External Movement - 1.47 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
<b>B00E - R0022 - Home Base - 55.5 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00E - R0023 - Practical Activities - 1hb - 13.51 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00E - R0024 - Outdoor Learning Area - 38.64 m2</b>							
No Asbestos							
<b>B00E - R0025 - Practical Activities - 1hb - 23.4 m2</b>							
No Asbestos							
<b>B00E - R0026 - Home Base Store - 4.81 m2</b>							
No Asbestos							

<b>B00E - R0027 - Withdrawal Space - 1hb - 8.51 m2</b>		
No Asbestos		
<b>B00E - R0028 - Home Base - 58.36 m2</b>		
No Asbestos		
<b>B00E - R0029 - Home Base - 50.6 m2</b>		
No Asbestos		
<b>B00E - R0030 - Home Base Store - 4.53 m2</b>		
No Asbestos		
<b>B00E - R0031 - Withdrawal Space - 1hb - 7.42 m2</b>		
No Asbestos		
<b>B00E - R0032 - Practical Activities - 1hb - 25.72 m2</b>		
No Asbestos		
<b>B00E - R0033 - External Movement - 11.65 m2</b>		
No Asbestos		
<b>B00E - R0034 - Practical Activities - 1hb - 16.38 m2</b>		
No Asbestos		
<b>B00E - R0035 - Home Base - 75.4 m2</b>		
No Asbestos		
<b>B00E - R0036 - Home Base Store - 7.7 m2</b>		
No Asbestos		
<b>B00E - R0037 - Withdrawal Space - 2hb - 9.36 m2</b>		
No Asbestos		
<b>B00E - R0038 - Practical Activities/Movement - 2hb - 9.57 m2</b>		
No Asbestos		
<b>B00E - R0039 - Home Base - 56.47 m2</b>		
No Asbestos		
<b>B00F - Pupil Facilities - 1976 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00F - R0001 - Drinking Facilities - 8.45 m2</b>		
No Asbestos		
<b>B00F - R0002 - Toilets - Boys - 39.39 m2</b>		
No Asbestos		
<b>B00F - R0003 - Cleaning Distributed Store - 1.57 m2</b>		
No Asbestos		
<b>B00G - Pupil Facilities - 1976 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00G - R0003 - Drinking Facilities - 8.42 m2</b>		
No Asbestos		
<b>B00G - R0004 - Toilets - Girls - 41.28 m2</b>		
No Asbestos		
<b>B00H - Other-After School Care/Community Use - 1976 - Timber</b>		
<b>Exterior</b>		

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0001 - Cleaning Distributed Store - 4.6 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0002 - General Storeroom - 9.26 m2</b>							
No Asbestos							
<b>B00H - R0003 - General Storeroom - 13.18 m2</b>							
No Asbestos							
<b>B00H - R0004 - Movement - 3.2 m2</b>							
No Asbestos							
<b>B00H - R0005 - Out Of School Hours Care Centre - 53.36 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R0006 - Out Of School Hours Care Centre - 53.15 m2</b>							
No Asbestos							
<b>B00H - R0007 - General Storeroom - 53.51 m2</b>							
No Asbestos							
<b>B00H - R0008 - Sports Store - 52.42 m2</b>							
No Asbestos							
<b>B00H - R0009 - External Movement - 72.08 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	73m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - General Learning/Communal Facilities - 1974 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	60m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00I - R0001 - Cleaning Supplies - 11.56 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0002 - Interview - 12.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0003 - Movement - 52.45 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0004 - Practical Activities - 1hb - 11.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00I - R0005 - Home Base - 57.64 m2</b>							



Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B001 - R0006 - Home Base - 57.45 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B001 - R0007 - Practical Activities - 1hb - 11.68 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B001 - R0008 - Distribution Board - .44 m2</b>								
<b>Note: No inspection of live electrical installation</b>								
No Asbestos								
<b>B001 - R0009 - Cleaning Distributed Store - 7.09 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B001 - R0010 - External Movement - 31.02 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B001 - R0011 - Movement - 17.48 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B001 - R0012 - Craft Store - 73.21 m2</b>								
No Asbestos								
<b>B001 - R0013 - External Movement - 34.22 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B001 - R0014 - Toilets - Girls - 33.87 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B001 - R0015 - Toilets - Boys - 35.15 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B001 - R0016 - External Movement - 41.45 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B001 - R0017 - Raised Platform - 35.34 m2</b>								
No Asbestos								
<b>B001 - R0018 - Hall Chair Store - 4.47 m2</b>								
No Asbestos								
<b>B001 - R0019 - General Storeroom - 4.18 m2</b>								
No Asbestos								
<b>B001 - R0020 - Communal Space - 246.81 m2</b>								
No Asbestos								
<b>B001 - R0021 - P.E Store - 12.88 m2</b>								
No Asbestos								
<b>B001 - R0022 - Canteen - 43.58 m2</b>								
No Asbestos								
<b>B001 - R0023 - Canteen Office/Store - 7.08 m2</b>								
No Asbestos								
<b>B001 - R0024 - Staff Toilet - 3.58 m2</b>								
No Asbestos								
<b>B001 - R0025 - Canteen Office/Store - 2.71 m2</b>								
No Asbestos								

B00I - R0026 - Distribution Board - .75 m2							Note: No inspection of live electrical installation
No Asbestos							
B00I - R0027 - Kiln Room - 6.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0028 - External Movement - 22.15 m2							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0029 - Stairs - 7.04 m2							
No Asbestos							
B00I - R1001 - Practical Activities - 1hb - 11.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
B00I - R1002 - Home Base - 57.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
B00I - R1003 - Home Base - 57.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
B00I - R1004 - Practical Activities - 1hb - 11.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
B00I - R1005 - Distribution Board - .41 m2							Note: No inspection of live electrical installation
No Asbestos							
B00I - R1006 - Movement - 40.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R1007 - Stairs - 14.42 m2							
No Asbestos							
B00J - General Learning/Pupil Facilities - 1966 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	18m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0001 - Movement - 4.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00J - R0005 - Home Base - 56.75 m2							
No Asbestos							
B00J - R0006 - Home Base - 58.56 m2							
No Asbestos							
B00J - R0008 - Personal Effects Storage - 8.04 m2							
No Asbestos							
B00J - R0016 - Home Base - 57.22 m2							
No Asbestos							
B00J - R0017 - Toilets - Girls - 17.23 m2							

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0018 - Cleaning Distributed Store - 1.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0019 - Toilets - Boys - 19.45 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0021 - External Movement - 2.88 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	2.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0022 - Home Base Store - 4.87 m2</b>							
No Asbestos							
<b>B00J - R0023 - Practical Activities - 1hb - 8.73 m2</b>							
No Asbestos							
<b>B00J - R0026 - Home Base Store - 9.75 m2</b>							
No Asbestos							
<b>B00J - R0028 - Practical Activities - 2hb - 9.75 m2</b>							
No Asbestos							
<b>B00J - R0029 - Home Base - 56.36 m2</b>							
No Asbestos							
<b>B00J - R0030 - External Movement - 11.73 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	11.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0031 - External Movement - 2.88 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	2.88m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0032 - Practical Activities - 1hb - 8.77 m2</b>							
No Asbestos							
<b>B00J - R0033 - Home Base Store - 4.69 m2</b>							
No Asbestos							
<b>B00K - Administration - 1976 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00K - R0001 - General Assistant/Bulk Store - 6.21 m2</b>							
No Asbestos							
<b>B00L - Administration - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - External Movement - 12.9 m2</b>							

No Asbestos	
<b>B00L - R0002 - Dental Clinic - 14.48 m2</b>	
No Asbestos	
<b>B00L - R0003 - Distribution Board - .23 m2</b>	<b>Note: No inspection of live electrical installation</b>
No Asbestos	
<b>B00L - R0004 - Cleaning Distributed Store - 3.64 m2</b>	
No Asbestos	
<b>B00L - R0005 - Toilets - Boys/Girls - 2.75 m2</b>	
No Asbestos	
<b>B00L - R0006 - Staff Toilet - 2.88 m2</b>	
No Asbestos	
<b>B00L - R0007 - Dental Clinic - 8.24 m2</b>	
No Asbestos	
<b>B00L - R0008 - Dental Clinic - 9.57 m2</b>	
No Asbestos	
<b>B00L - R0009 - Dental Clinic - 5.09 m2</b>	
No Asbestos	
<b>B00L - R0010 - Dental Clinic - 19.83 m2</b>	
No Asbestos	

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020