


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lane Cove West Public School (3908)
Region:	Northern Sydney AMU
State Electorate:	Lane Cove
Local Government Area:	Lane Cove

Last Reviewed By:	AECOM 28-JUN-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

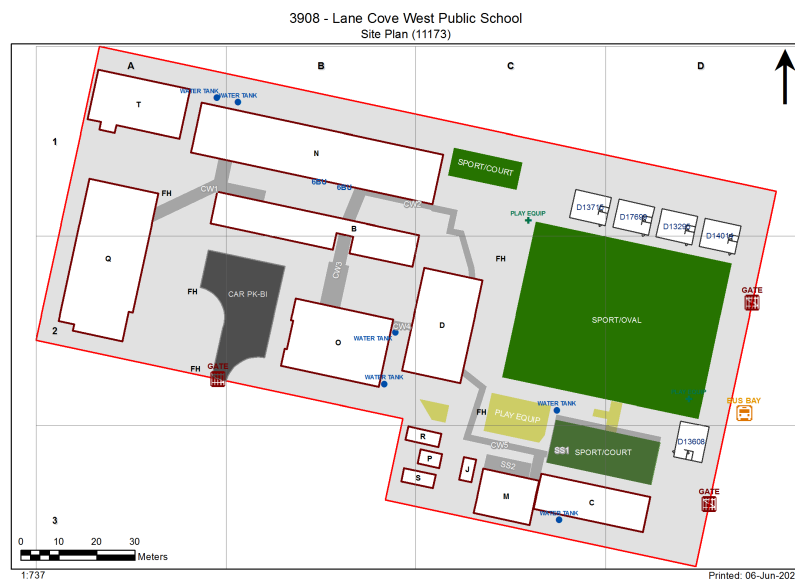

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00B - General Learning - 1951 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	80m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Ends	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>Interior</b>							
<b>B00B - R0001 - General Storeroom - 6.15 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0002 - Staff Room Annexe - 13.06 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0003 - General Storeroom - 3.55 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0004 - Home Base - 46.93 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0005 - General Storeroom - 15.59 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	16m2	South facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0006 - Home Base - 46.93 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0007 - Home Base - 46.93 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0008 - Home Base - 46.93 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0009 - Home Base - 46.93 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0010 - Home Base - 41.64 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0011 - Practical Activities - 1hb - 5.29 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	64m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00B - R0012 - General Storeroom - 11.75 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00B - R0013 - Movement - 88.01 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	180m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	88m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - General Learning - 1951 - Concrete</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00C - R0002 - Home Base - 47.98 m2</b>							
No Asbestos							
<b>B00C - R0003 - Practical Activities - 1hb - 5.6 m2</b>							
No Asbestos							
<b>B00C - R0004 - Practical Activities - 1hb - 5.91 m2</b>							
No Asbestos							

<b>B00C - R0005 - Home Base - 47.67 m2</b>							
No Asbestos							
<b>B00C - R0006 - Home Base - 53.58 m2</b>							
No Asbestos							
<b>B00C - R0007 - General Storeroom - 6.64 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00C - R0008 - Interview - 13.66 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00C - R0009 - Sports Store - 11.1 m2</b>							
No Asbestos							
<b>B00C - R0010 - Craft Store - 10.47 m2</b>							
No Asbestos							
<b>B00C - R0011 - General Storeroom - 6.71 m2</b>							
No Asbestos							
<b>B00C - R0013 - Personal Effects Storage - 3.5 m2</b>							
No Asbestos							
<b>B00C - R0015 - Movement - 41.7 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0016 - Movement - 5.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0017 - Toilets - Boys/Girls - 2.02 m2</b>							
Wall Linings Internal	Flat AC Sheeting	2.2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	2.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - Library - 1961 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal	Flat AC Sheeting						
<b>Interior</b>							
<b>B00D - R0001 - Reading Area - 158.34 m2</b>							
No Asbestos							
<b>B00D - R0004 - Distribution Board - 1.66 m2</b>							
No Asbestos							
<b>B00D - R0005 - Movement - 2.9 m2</b>							
No Asbestos							
<b>B00D - R0006 - Special Programs Room - 43.74 m2</b>							
No Asbestos							
<b>B00D - R0007 - K.L.A. Store - 5.2 m2</b>							
No Asbestos							

Note: No inspection of live electrical installation

<b>B00D - R0008 - Plant - 1.8 m2</b>							
Non Accessible	Resinous Board	1	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0009 - Toilets - Boys - 6.94 m2</b>							
Partition Walls (Cubicles)	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0010 - Toilets - Girls - 6.53 m2</b>							
Partition Walls (Cubicles)	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0011 - Movement - 139.21 m2</b>							
No Asbestos							
<b>B00D - R0012 - Special Programs Room - 38.13 m2</b>							
No Asbestos							
<b>B00J - Pupil Facilities - 1951 - Brick/Block</b>							
<b>Exterior</b>							
Gable Ends	Flat AC Sheeting	6m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
<b>Interior</b>							
<b>B00J - R0001 - Handwashing Facilities - 9.08 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00J - R0002 - Handwashing Facilities - 8.9 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00M - Other-After School Care - 2002 - Steel</b>							
<b>Exterior</b>							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00M - R0001 - Out Of School Hours Care Centre - 132.45 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00M - R0002 - Out Of School Hours Care Centre - 8.78 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00M - R0003 - Out Of School Hours Care Centre - 8.78 m2</b>							
No Asbestos							
<b>B00M - R0004 - Out Of School Hours Care Centre - 6.02 m2</b>							
No Asbestos							
<b>B00M - R0005 - Out Of School Hours Care Centre - 3.2 m2</b>							
No Asbestos							
<b>B00M - R0006 - Out Of School Hours Care Centre - 4.94 m2</b>							
No Asbestos							

<b>B00M - R0007 - Out Of School Hours Care Centre - 10.8 m2</b>		
No Asbestos		
<b>B00N - Pupil Facilities - 2008 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00N - R0001 - Home Base - 61.38 m2</b>		
No Asbestos		
<b>B00N - R0002 - Practical Activities - 19.24 m2</b>		
No Asbestos		
<b>B00N - R0003 - Home Base Store - 6.21 m2</b>		
No Asbestos		
<b>B00N - R0004 - Withdrawal Space - 2hb - 11.77 m2</b>		
No Asbestos		
<b>B00N - R0005 - Home Base - 60.76 m2</b>		
No Asbestos		
<b>B00N - R0006 - Practical Activities - 19.18 m2</b>		
No Asbestos		
<b>B00N - R0007 - Home Base Store - 6.23 m2</b>		
No Asbestos		
<b>B00N - R0008 - Home Base Store - 6.21 m2</b>		
No Asbestos		
<b>B00N - R0009 - Home Base - 60.54 m2</b>		
No Asbestos		
<b>B00N - R0010 - Practical Activities - 19.27 m2</b>		
No Asbestos		
<b>B00N - R0011 - Withdrawal Space - 2hb - 11.77 m2</b>		
No Asbestos		
<b>B00N - R0012 - Home Base - 60.72 m2</b>		
No Asbestos		
<b>B00N - R0013 - Practical Activities - 19.19 m2</b>		
No Asbestos		
<b>B00N - R0014 - Home Base Store - 6.23 m2</b>		
No Asbestos		
<b>B00N - R0015 - Home Base Store - 6.19 m2</b>		
No Asbestos		
<b>B00N - R0016 - Home Base - 61.05 m2</b>		
No Asbestos		
<b>B00N - R0017 - Practical Activities - 19.19 m2</b>		
No Asbestos		
<b>B00N - R0018 - Withdrawal Space - 2hb - 11.81 m2</b>		
No Asbestos		
<b>B00N - R0019 - Home Base - 61.73 m2</b>		
No Asbestos		
<b>B00N - R0020 - Practical Activities - 19.17 m2</b>		
No Asbestos		
<b>B00N - R0021 - Home Base Store - 6.19 m2</b>		
No Asbestos		

<b>B00N - R0022 - Laundry - Type 2 - 29.65 m2</b>		
No Asbestos		
<b>B00N - R0025 - Toilets - Girls - 31.65 m2</b>		
No Asbestos		
<b>B00N - R0026 - Kiln Room - 6.56 m2</b>		
No Asbestos		
<b>B00N - R0027 - Toilets - Boys - 26.88 m2</b>		
No Asbestos		
<b>B00N - R0028 - External Movement - 166.79 m2</b>		
No Asbestos		
<b>B00N - R0029 - Distribution Board - .28 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00N - R0030 - Distribution Board - .29 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00O - Administration - 2008 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00O - R0001 - Entry Vestibule - 24.94 m2</b>		
No Asbestos		
<b>B00O - R0002 - Clerical Office - 36.55 m2</b>		
No Asbestos		
<b>B00O - R0003 - Clerical/Printing - 22.83 m2</b>		
No Asbestos		
<b>B00O - R0004 - Sick Bay - 8.64 m2</b>		
No Asbestos		
<b>B00O - R0005 - Access Shower/Toilet - 5.19 m2</b>		
No Asbestos		
<b>B00O - R0006 - Deputy Principal - 16.74 m2</b>		
No Asbestos		
<b>B00O - R0007 - Distribution Board - 2.21 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00O - R0008 - Cleaning Distributed Store - 2.25 m2</b>		
No Asbestos		
<b>B00O - R0009 - Staff Room - 47.81 m2</b>		
No Asbestos		
<b>B00O - R0010 - Staff Room - 19.26 m2</b>		
No Asbestos		
<b>B00O - R0011 - Deputy Principal - 12.91 m2</b>		
No Asbestos		
<b>B00O - R0012 - Staff Toilet - 5.21 m2</b>		
No Asbestos		
<b>B00O - R0013 - Staff Toilet - 5.15 m2</b>		
No Asbestos		
<b>B00O - R0014 - Staff Toilet - 5.1 m2</b>		
No Asbestos		
<b>B00O - R0015 - Movement - 53.08 m2</b>		
No Asbestos		



<b>B00O - R0016 - Security Store - 14.57 m2</b>		
No Asbestos		
<b>B00O - R0017 - Principal - 17.03 m2</b>		
No Asbestos		
<b>B00O - R0018 - Interview - 12.91 m2</b>		
No Asbestos		
<b>B00O - R0019 - External Movement - 83.71 m2</b>		
No Asbestos		
<b>B00O - R0020 - External Movement - 40.53 m2</b>		
No Asbestos		
<b>B00P - Building Services - 2008 - Metal Shed</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00P - R0001 - General Assistant/Bulk Store - 19.38 m2</b>		
No Asbestos		
<b>B00Q - Communal Facilities - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00Q - R0001 - Covered Outdoor Learning Area - 234.49 m2</b>		
No Asbestos		
<b>B00Q - R0002 - Communal Space - 198.54 m2</b>		
No Asbestos		
<b>B00Q - R0003 - Raised Platform - 53.67 m2</b>		
No Asbestos		
<b>B00Q - R0004 - Hall Chair Store - 11.09 m2</b>		
No Asbestos		
<b>B00Q - R0005 - Communal/Performance Store - 10.96 m2</b>		
No Asbestos		
<b>B00Q - R0006 - P.E. Store - 16.4 m2</b>		
No Asbestos		
<b>B00Q - R0007 - Toilet - Lobby - 2.52 m2</b>		
No Asbestos		
<b>B00Q - R0008 - Toilets - Girls - 7.49 m2</b>		
No Asbestos		
<b>B00Q - R0009 - Sound Cupboard - 2.07 m2</b>		
No Asbestos		
<b>B00Q - R0010 - Toilet - Lobby - 3.44 m2</b>		
No Asbestos		
<b>B00Q - R0011 - Toilets - Boys - 5.81 m2</b>		
No Asbestos		
<b>B00Q - R0012 - Cleaning Distributed Store - 3.56 m2</b>		
No Asbestos		
<b>B00Q - R0013 - Plant - 1.6 m2</b>		

No Asbestos		
<b>B00Q - R0014 - Main Switch Board - 3.1 m2</b>		
No Asbestos		
<b>B00Q - R0015 - Disabled Shower/Toilet - 7.03 m2</b>		
No Asbestos		
<b>B00Q - R0016 - External Movement - 35.18 m2</b>		
No Asbestos		
<b>B00Q - R0017 - Movement - 5.05 m2</b>		
No Asbestos		
<b>B00Q - R0018 - Movement - 16.56 m2</b>		
No Asbestos		
<b>B00Q - R0019 - Ramp - 18.45 m2</b>		
No Asbestos		
<b>B00Q - R0020 - Canteen - 41.62 m2</b>		
No Asbestos		
<b>B00Q - R0021 - Canteen Office/Store - 10.21 m2</b>		
No Asbestos		
<b>B00R - Storage - 2014 - Metal Shed</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00R - R0001 - Sports Store - 30.72 m2</b>		
No Asbestos		
<b>B00S - Administration - 2014 - Metal Shed</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00S - R0001 - Uniform Shop - 28.24 m2</b>		
No Asbestos		
<b>B00T - General Learning/Building Services - 2014 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00T - R0001 - Practical Activities - 1hb - 18.16 m2</b>		
No Asbestos		
<b>B00T - R0002 - Practical Activities - 1hb - 18.15 m2</b>		
No Asbestos		
<b>B00T - R0003 - Home Base - 56.5 m2</b>		
No Asbestos		
<b>B00T - R0004 - Home Base Store - 5.99 m2</b>		
No Asbestos		

<b>B00T - R0005 - Home Base Store - 5.99 m2</b>	
No Asbestos	
<b>B00T - R0006 - Home Base - 56.5 m2</b>	
No Asbestos	
<b>B00T - R0007 - Withdrawal Space - 2hb - 10.6 m2</b>	
No Asbestos	
<b>B00T - R0008 - General Storeroom - 15.33 m2</b>	
No Asbestos	
<b>B00T - R0009 - Garden Store - 16.17 m2</b>	
No Asbestos	
<b>B00T - R0010 - General Storeroom - 10.43 m2</b>	
No Asbestos	
<b>B00T - R0011 - General Storeroom - 10.43 m2</b>	
No Asbestos	
<b>B00T - R0012 - Stairs - 7.65 m2</b>	
No Asbestos	
<b>B00T - R0013 - Stairs - 7.65 m2</b>	
No Asbestos	
<b>B00T - R0014 - Distribution Board - .58 m2</b>	<b>Note: No inspection of live electrical installation</b>
No Asbestos	
<b>B00T - R0015 - Lift - 1.6 m2</b>	
No Asbestos	
<b>B00T - R0016 - External Movement - 55.8 m2</b>	
No Asbestos	
<b>B00T - R1001 - Practical Activities - 1hb - 18.28 m2</b>	
No Asbestos	
<b>B00T - R1002 - Practical Activities - 1hb - 18.28 m2</b>	
No Asbestos	
<b>B00T - R1003 - Home Base - 56.59 m2</b>	
No Asbestos	
<b>B00T - R1004 - Home Base Store - 6.01 m2</b>	
No Asbestos	
<b>B00T - R1005 - Home Base Store - 6.01 m2</b>	
No Asbestos	
<b>B00T - R1006 - Home Base - 56.59 m2</b>	
No Asbestos	
<b>B00T - R1007 - Withdrawal Space - 2hb - 10.95 m2</b>	
No Asbestos	
<b>B00T - R1008 - Distribution Board - .8 m2</b>	<b>Note: No inspection of live electrical installation</b>
No Asbestos	
<b>B00T - R1009 - External Movement - 62.63 m2</b>	
No Asbestos	
<b>B00T - R1010 - Stairs - 17.55 m2</b>	
No Asbestos	
<b>B00T - R1011 - Stairs - 19.07 m2</b>	
No Asbestos	

## Demountables

### OS 602 13295 - Learning Unit - Standard With P.A.A. - Placement Date : 17-NOV-2010

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 603 13608 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 25-OCT-2007

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 603 13715 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 25-NOV-2008

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 602 14014 - Learning Unit - Standard With P.A.A. - Placement Date : 17-NOV-2010

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 602 17699 - Learning Unit - Standard With P.A.A. - Placement Date : 16-DEC-2009

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found