


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Loftus Public School (4221)</b>
<b>Region:</b>	<b>Sydney AMU</b>
<b>State Electorate:</b>	<b>Heathcote</b>
<b>Local Government Area:</b>	<b>Sutherland</b>

<b>Last Reviewed By:</b>	<b>WSP 01-NOV-2016</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

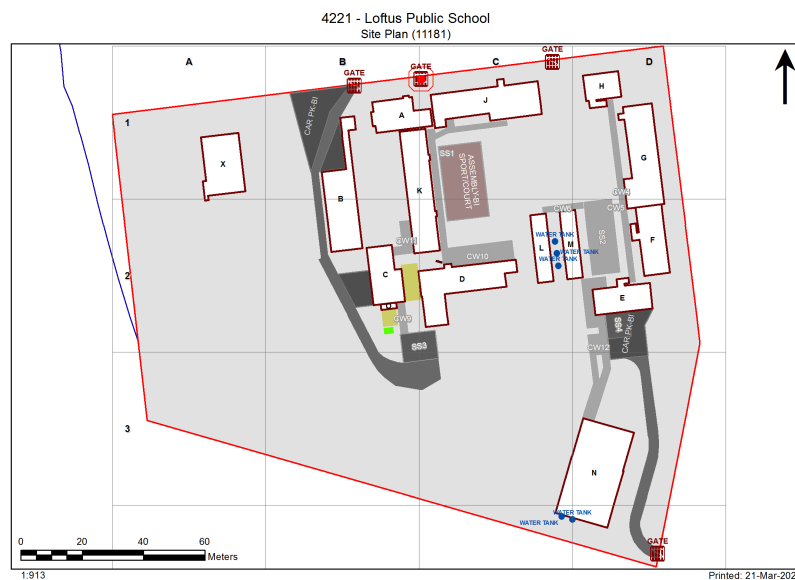

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/Staff Facilities - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	15m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Duplicating Workroom - 16.64 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0002 - Clerical Office - 11.79 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0003 - Entry Vestibule - 10.27 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0006 - Sick Bay - 13.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0007 - Movement - 3.15 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0008 - Principal - 16.03 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0009 - Staff Toilet - 3.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0010 - Distribution Board - .51 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0011 - External Movement - 56.67 m2</b>							
No Asbestos							
<b>B00A - R0012 - Principal - 17.44 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R9001 - External Movement - 1.17 m2</b>							
No Asbestos							
<b>B00A - R9002 - Security Store - 28.76 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R9003 - Special Programs Room - 44.36 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R9004 - Staff Kitchen - 8.38 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9005 - Staff Toilet - 5.27 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R9006 - Cleaning Distributed Store - 1.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R9007 - Movement - 4.13 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R9008 - Staff Toilet - 3.41 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
<b>B00A - R9009 - External Movement - 3.72 m2</b>							
No Asbestos							
<b>B00B - General Learning/Communal Facilities - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	24	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Movement - 79.6 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	7m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Communal Space - 55.55 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - Toilets - Boys - 22.17 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0006 - Cleaning Distributed Store - 3.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0007 - Distribution Board - 2.48 m2</b>							
No Asbestos							Note: No inspection of live electrical installation
<b>B00B - R0008 - Stairs - 5.82 m2</b>							
No Asbestos							
<b>B00B - R0009 - Home Base - 58.59 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R0010 - Home Base - 56.88 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R1001 - Movement - 65.16 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting	9m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1002 - Home Base - 57.11 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R1003 - Home Base - 56.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R1004 - Home Base - 55.84 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00B - R1005 - Toilets - Girls - 22.5 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1006 - Cleaning Distributed Store - 2.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R1007 - Distribution Board - 2.51 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00B - R1008 - Stairs - 14.86 m2</b>							
No Asbestos							
<b>B00C - Support Unit/Library - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Home Base - E - 44.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00C - R0002 - Practical Activities - E - 10.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0003 - Home Base Store - E - 4.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0004 - Toilet - E - 9.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0005 - Home Base Store - E - 4.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Wall Linings Internal	Flat AC Sheeting						
<b>B00C - R0006 - Home Base - E - 55.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00C - R0007 - Movement - 5.97 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0009 - Movement - 18.31 m2</b>							
No Asbestos							
<b>B00C - R1001 - Reading Area - 111.51 m2</b>							
No Asbestos							

<b>B00C - R1002 - Movement - 6 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1003 - Library Office/Workroom - 20.98 m2</b>							
No Asbestos							
<b>B00D - General Learning/Other-After School Care - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0002 - Personal Effects Storage - 3.11 m2</b>							
No Asbestos							
<b>B00D - R0003 - Toilets - Boys/Girls - 3.1 m2</b>							
No Asbestos							
<b>B00D - R0004 - General Storeroom - 6.98 m2</b>							
No Asbestos							
<b>B00D - R0005 - Home Base - 56.82 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0006 - Home Base - 57.05 m2</b>							
No Asbestos							
<b>B00D - R0007 - General Storeroom - 7.41 m2</b>							
No Asbestos							
<b>B00D - R0008 - Personal Effects Storage - 2.99 m2</b>							
No Asbestos							
<b>B00D - R0009 - Movement - 5.77 m2</b>							
No Asbestos							
<b>B00D - R0011 - Personal Effects Storage - 2.99 m2</b>							
No Asbestos							
<b>B00D - R0012 - Home Base Store - 7.41 m2</b>							
No Asbestos							
<b>B00D - R0013 - Home Base - 57.47 m2</b>							
No Asbestos							
<b>B00D - R0015 - Access Shower/Toilet/Change - 12.64 m2</b>							
Require Inspection							
<b>B00D - R9001 - Craft Store - 3.2 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R9002 - General Storeroom - 23.51 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R9003 - Special Programs Room - 56.63 m2</b>							
No Asbestos							
<b>B00D - R9004 - Movement - 3.68 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R9005 - General Storeroom - 1.58 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R9006 - General Storeroom - .73 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R9007 - Covered Outdoor Learning Area - 73.7 m2</b>							
Require Inspection							
<b>B00E - General Learning - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Home Base - 56.95 m2</b>							
No Asbestos							
<b>B00E - R0002 - Home Base Store - 6.32 m2</b>							
No Asbestos							
<b>B00E - R0003 - Personal Effects Storage - 7.67 m2</b>							
No Asbestos							
<b>B00E - R0004 - Movement - 6.39 m2</b>							
No Asbestos							
<b>B00E - R0006 - Home Base Store - 6.32 m2</b>							
No Asbestos							
<b>B00E - R0007 - Home Base - 57.18 m2</b>							
No Asbestos							
<b>B00E - R0008 - Movement - 7.1 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - General Learning - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Home Base - 57.17 m2</b>							
No Asbestos							
<b>B00F - R0002 - Personal Effects Storage - 10.33 m2</b>							
No Asbestos							
<b>B00F - R0003 - Movement - 12.85 m2</b>							
No Asbestos							
<b>B00F - R0005 - Uniform Shop - 21.16 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00F - R0006 - Personal Effects Storage - 10.37 m2</b>							
Wall Linings Internal	Flat AC Sheeting	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0007 - Home Base - 57.07 m2</b>							
No Asbestos							
<b>B00F - R0008 - Movement - 9.55 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00G - General Learning - 1950 - Brick/Block</b>							
<b>Exterior</b>							

Eaves Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00G - R0001 - Withdrawal Space - 1hb - 21.85 m2</b>							
No Asbestos							
<b>B00G - R0002 - Disabled Shower/Toilet - 4.11 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00G - R0004 - Movement - 7.69 m2</b>							
No Asbestos							
<b>B00G - R0005 - Personal Effects Storage - 11.06 m2</b>							
No Asbestos							
<b>B00G - R0006 - Home Base - 63.37 m2</b>							
No Asbestos							
<b>B00G - R0007 - Practical Activities - 1hb - .81 m2</b>							
No Asbestos							
<b>B00G - R0008 - Home Base - 85.6 m2</b>							
No Asbestos							
<b>B00G - R0009 - Practical Activities - 1hb - 2.11 m2</b>							
No Asbestos							
<b>B00G - R0010 - Personal Effects Storage - 11.38 m2</b>							
No Asbestos							
<b>B00G - R0011 - Cleaning Distributed Store - 2.87 m2</b>							
No Asbestos							
<b>B00G - R0012 - Movement - 20.29 m2</b>							
No Asbestos							
<b>B00G - R0013 - Movement - 3.02 m2</b>							
No Asbestos							
<b>B00G - R0014 - General Storeroom - 1.83 m2</b>							
No Asbestos							
<b>B00G - R0015 - Deputy Principal - 17.36 m2</b>							
No Asbestos							
<b>B00G - R0016 - Movement - 21.29 m2</b>							
Wall Linings Internal - Infill	Flat AC Sheeting						
<b>B00G - R0017 - Movement - 33.94 m2</b>							
No Asbestos							
<b>B00G - R9001 - No Access - 35.68 m2</b>							
No Asbestos							
<b>B00H - General Learning - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	15m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							



<b>B00H - R0001 - Home Base - 57.02 m2</b>							
No Asbestos							
<b>B00H - R0002 - Home Base Store - 5.53 m2</b>							
No Asbestos							
<b>B00H - R0003 - General Storeroom - 5.48 m2</b>							
No Asbestos							
<b>B00H - R0004 - Personal Effects Storage - 10.34 m2</b>							
No Asbestos							
<b>B00H - R0005 - Movement - 6.49 m2</b>							
No Asbestos							
<b>B00H - R0007 - Movement - 10.56 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - General Learning/Pupil Facilities - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	15m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00J - R0001 - Movement - 19.89 m2</b>							
No Asbestos							
<b>B00J - R0002 - Canteen - 22.39 m2</b>							
No Asbestos							
<b>B00J - R0003 - Movement - 2.31 m2</b>							
No Asbestos							
<b>B00J - R0004 - Staff Toilet - 3.35 m2</b>							
No Asbestos							
<b>B00J - R0005 - Canteen Office/Store - 4.41 m2</b>							
No Asbestos							
<b>B00J - R0007 - General Storeroom - 5.78 m2</b>							
No Asbestos							
<b>B00J - R0010 - External Movement - 4.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0011 - No Access - 3.84 m2</b>							
No Asbestos							
<b>B00J - R0012 - Personal Effects Storage - 3.37 m2</b>							
No Asbestos							
<b>B00J - R0013 - Interview - 14.95 m2</b>							
No Asbestos							
<b>B00J - R0014 - Home Base Store - 6.67 m2</b>							
No Asbestos							
<b>B00J - R0017 - Home Base Store - 6.94 m2</b>							
No Asbestos							
<b>B00J - R0018 - Personal Effects Storage - 3.81 m2</b>							
No Asbestos							
<b>B00J - R0019 - Movement - 3.24 m2</b>							
No Asbestos							
<b>B00J - R0021 - External Movement - 40.6 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0022 - External Movement - 8.96 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0023 - Staff Room - 11.2 m2</b>							
No Asbestos							
<b>B00J - R0024 - Staff Toilet - 4.52 m2</b>							
No Asbestos							
<b>B00J - R0025 - Staff Room - 90.62 m2</b>							
Require Inspection							
<b>B00J - R0026 - Staff Kitchen - 22.62 m2</b>							
Require Inspection							
<b>B00J - R0027 - General Storeroom - 6.84 m2</b>							
Require Inspection							
<b>B00J - R0028 - Movement - 23.79 m2</b>							
Require Inspection							
<b>B00K - General Learning - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	1	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00K - R0001 - Home Base - 57.37 m2</b>							
No Asbestos							
<b>B00K - R0002 - Home Base Store - 4.88 m2</b>							
No Asbestos							
<b>B00K - R0003 - Personal Effects Storage - 8.33 m2</b>							
No Asbestos							
<b>B00K - R0004 - Movement - 5.49 m2</b>							
No Asbestos							
<b>B00K - R0006 - Home Base Store - 4.88 m2</b>							
No Asbestos							
<b>B00K - R0007 - Home Base - 57.45 m2</b>							
No Asbestos							
<b>B00K - R0008 - Home Base - 57.05 m2</b>							
No Asbestos							
<b>B00K - R0009 - Home Base Store - 4.16 m2</b>							
No Asbestos							
<b>B00K - R0010 - Personal Effects Storage - 8.82 m2</b>							
No Asbestos							
<b>B00K - R0011 - Movement - 6.71 m2</b>							
No Asbestos							
<b>B00K - R0013 - Home Base - 57.29 m2</b>							
No Asbestos							

<b>B00K - R0014 - Home Base Store - 4.16 m2</b>							
No Asbestos							
<b>B00K - R0015 - External Movement - 2.52 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0016 - External Movement - 2.41 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0017 - Movement - 21.24 m2</b>							
No Asbestos							
<b>B00L - Pupil Facilities - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - Toilets - Girls - 56.4 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R0002 - General Storeroom - 41.1 m2</b>							
No Asbestos							
<b>B00M - Pupil Facilities - 1950 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	40m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00M - R0001 - Toilets - Boys - 56.34 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00M - R0002 - Sports Store - 41.02 m2</b>							
No Asbestos							
<b>B00N - Communal Facilities - 2010 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00N - R0001 - Communal Space - 146.89 m2</b>							
No Asbestos							
<b>B00N - R0002 - Raised Platform - 57.61 m2</b>							
No Asbestos							
<b>B00N - R0003 - Chair Storeroom - 13 m2</b>							
No Asbestos							
<b>B00N - R0004 - Communal/Performance Store - 9.61 m2</b>							
No Asbestos							
<b>B00N - R0005 - P.E. Store - 13.05 m2</b>							
No Asbestos							
<b>B00N - R0006 - Toilet - Lobby - 2.4 m2</b>							
No Asbestos							

<b>B00N - R0007 - Toilets - Girls - 7.25 m2</b>							
No Asbestos							
<b>B00N - R0008 - Sound Cupboard - 1.97 m2</b>							
No Asbestos							
<b>B00N - R0009 - Toilet - Lobby - 3.51 m2</b>							
No Asbestos							
<b>B00N - R0010 - Toilets - Boys - 5.63 m2</b>							
No Asbestos							
<b>B00N - R0011 - Cleaning Distributed Store - 3 m2</b>							
No Asbestos							
<b>B00N - R0012 - Other - 1.57 m2</b>							
No Asbestos							
<b>B00N - R0013 - Main Switch Board - 3.69 m2</b>							
No Asbestos							
<b>B00N - R0014 - Access Shower/Toilet/Change - 6.9 m2</b>							
No Asbestos							
<b>B00N - R0015 - Covered Outdoor Learning Area - 223.97 m2</b>							
No Asbestos							
<b>B00N - R0016 - Movement - 6.87 m2</b>							
No Asbestos							
<b>B00N - R0017 - Movement - 10.8 m2</b>							
No Asbestos							
<b>B00N - R0018 - Other - .35 m2</b>							
No Asbestos							
<b>B00N - R0019 - Movement - 13.28 m2</b>							
No Asbestos							
<b>B00O - Storage - 2016 - Metal Shed</b>							
<b>Exterior</b>							
Require Inspection							
<b>Interior</b>							
<b>B00O - R0001 - General Storeroom - Pre - 8.87 m2</b>							
Require Inspection							
<b>B00X - Other-Community Use - 1950 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	70m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Wall Cladding	Flat AC Sheeting						
<b>Interior</b>							
<b>B00X - R0001 - Other-Community Use - 237.64 m2</b>							
No Asbestos							

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020