

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Lansvale Public School (5220)
Region:	South Western Sydney AMU
State Electorate:	Cabramatta
Local Government Area:	Fairfield

Last Reviewed By:	WSP 07-DEC-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

5220 - Lansvale Public School
Site Plan (12753)

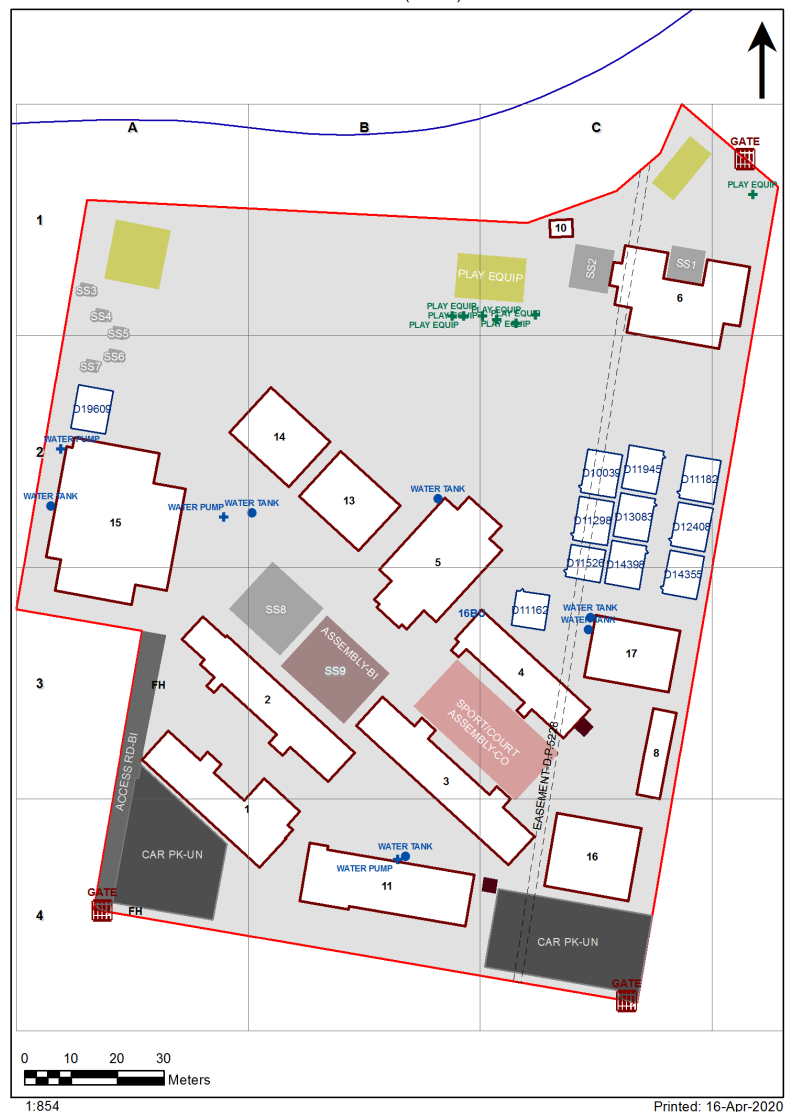

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B001 - General Learning - 1950 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B001 - R0001 - Movement - 68.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B001 - R0002 - Movement - 6.13 m2							
Electrical - Mounting Board	Resinous Board	1	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0003 - Toilets - Boys/Girls - 1.58 m2							
No Asbestos							
B001 - R0004 - Personal Effects Storage - 10.57 m2							
No Asbestos							
B001 - R0005 - Home Base - 73.02 m2							
No Asbestos							
B001 - R0006 - Home Base - 67.42 m2							
No Asbestos							
B001 - R0007 - Movement - 12.68 m2							
No Asbestos							
B001 - R0008 - Movement - 2.44 m2							
No Asbestos							
B001 - R0009 - Plant - .81 m2							
No Asbestos							
B001 - R0010 - Staff Room Annexe - 14.01 m2							
No Asbestos							
B001 - R0011 - General Storeroom - 2.03 m2							
No Asbestos							
B001 - R0012 - Personal Effects Storage - 6.33 m2							
No Asbestos							
B001 - R0013 - Home Base - 57.21 m2							
No Asbestos							
B001 - R0014 - Home Base Store - 3.95 m2							
No Asbestos							
B001 - R0015 - Movement - 8.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B001 - R0016 - General Storeroom - .9 m2							
No Asbestos							
B002 - General Learning - 1950 - Brick/Block							
Exterior							

Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B002 - R0001 - Home Base - 57.05 m2							
No Asbestos							
B002 - R0002 - Home Base Store - 7.31 m2							
No Asbestos							
B002 - R0003 - Toilets - Boys/Girls - 2.89 m2							
No Asbestos							
B002 - R0004 - Special Programs Room - 20.65 m2							
No Asbestos							
B002 - R0005 - Personal Effects Storage - 10.36 m2							
No Asbestos							
B002 - R0006 - Movement - 13.47 m2							
No Asbestos							
B002 - R0007 - Movement - 8.49 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B002 - R0008 - Home Base - 56.74 m2							
No Asbestos							
B002 - R0009 - Home Base - 56.9 m2							
No Asbestos							
B002 - R0010 - Personal Effects Storage - 10.35 m2							
No Asbestos							
B002 - R0011 - General Storeroom - 10.36 m2							
No Asbestos							
B002 - R0012 - Movement - 4.19 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B002 - R0013 - Movement - 6.3 m2							
No Asbestos							
B002 - R0014 - Staff Room Annexe - 22.28 m2							
No Asbestos							
B002 - R0015 - Cleaning Distributed Store - 4.21 m2							
No Asbestos							
B002 - R0016 - Movement - 1.98 m2							
No Asbestos							
B002 - R0017 - Movement - 13.55 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0018 - Canteen - 17.74 m2							
No Asbestos							
B002 - R0019 - Canteen Office/Store - 3.15 m2							
No Asbestos							

B002 - R0020 - Canteen Office/Store - 2.91 m2							
No Asbestos							
B003 - General Learning - 1950 - Brick/Block							
Exterior							
Underfloor Voids	Requires Inspection						
Ceiling Voids	Requires Inspection						
Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B003 - R0001 - Home Base - 57.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0002 - Home Base Store - 6.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0003 - Personal Effects Storage - 3.51 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting	1m2	Middle portion	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B003 - R0004 - Cleaning Distributed Store - 2.3 m2							
No Asbestos							
B003 - R0005 - General Storeroom - .61 m2							
No Asbestos							
B003 - R0006 - Movement - 2.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0007 - Staff Room Annexe - 13.92 m2							
No Asbestos							
B003 - R0008 - General Storeroom - 1.03 m2							
No Asbestos							
B003 - R0009 - Personal Effects Storage - 3.49 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0010 - Movement - 12.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0011 - Movement - 8.3 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B003 - R0012 - Home Base - 56.72 m2							
No Asbestos							
B003 - R0013 - Home Base Store - 6.75 m2							
No Asbestos							
B003 - R0014 - Home Base - 56.64 m2							
No Asbestos							
B003 - R0015 - Home Base Store - 6.75 m2							
No Asbestos							
B003 - R0016 - Personal Effects Storage - 3.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0017 - Special Programs Room - 20.5 m2							
No Asbestos							
B003 - R0018 - Toilets - Boys/Girls - 3.47 m2							

No Asbestos							
B003 - R0019 - Personal Effects Storage - 13.95 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0020 - Movement - 8.37 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B003 - R0021 - Home Base Store - 6.74 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B003 - R0022 - Home Base - 57.51 m2							
No Asbestos							
B004 - General Learning - 1950 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B004 - R0001 - Home Base - 57.2 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - R0002 - Home Base Store - 5.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B004 - R0003 - Personal Effects Storage - 4.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B004 - R0004 - General Storeroom - 10.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B004 - R0005 - Personal Effects Storage - 4.95 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B004 - R0006 - Movement - 9.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B004 - R0007 - Movement - 4.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B004 - R0008 - Home Base Store - 5.26 m2							
No Asbestos							
B004 - R0009 - Home Base - 56.57 m2							
No Asbestos							
B004 - R0010 - Home Base - 56.57 m2							
No Asbestos							
B004 - R0011 - Home Base Store - 5.26 m2							
No Asbestos							
B004 - R0012 - Personal Effects Storage - 3.3 m2							
No Asbestos							
B004 - R0013 - General Storeroom - 5.38 m2							
No Asbestos							
B004 - R0014 - General Storeroom - 6.48 m2							

No Asbestos							
B004 - R0015 - Movement - 6.48 m2							
No Asbestos							
B004 - R0016 - Movement - 4.53 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B005 - Library - 1995 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Interior							
B005 - R0001 - Cleaning Distributed Store - 3.43 m2							
No Asbestos							
B005 - R0002 - Security Store - 2.92 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B005 - R0003 - Special Programs Room - 42.12 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B005 - R0004 - Plant - 4.02 m2							
No Asbestos							
B005 - R0005 - Distribution Board - 1.61 m2							
No Asbestos		Note: No inspection of live electrical installation					
B005 - R0006 - Movement - 57.17 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B005 - R0007 - Reading Area - 227.98 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B005 - R0008 - Security Store - 14.08 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B005 - R0009 - Library Office/Workroom - 28.57 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B005 - R0010 - Movement - 21.66 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B006 - Pre-School Facilities - 1975 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B006 - R0001 - Staff Room Annexe - 9.22 m2							
No Asbestos							
B006 - R0002 - Staff Toilet - Pre - 1.34 m2							
No Asbestos							

B006 - R0005 - Communal/Performance Store - 4 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0006 - Communal/Performance Store - 41 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0007 - Cleaning Distributed Store - 85 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0008 - Movement - 3.85 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B006 - R0009 - Entry Vestibule - 21.23 m2							
No Asbestos							
B006 - R0010 - Kitchen - Pre - 15.4 m2							
No Asbestos							
B006 - R0011 - Withdrawal - Pre - 37.45 m2							
No Asbestos							
B006 - R0012 - General Storeroom - 8.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0013 - Home Base - Pre - 50.12 m2							
No Asbestos							
B006 - R0014 - Toilets - Boys/Girls - Pre - 12.11 m2							
No Asbestos							
B006 - R0015 - Movement - 9.09 m2							
No Asbestos							
B006 - R0016 - Movement - 9.54 m2							
No Asbestos							
B006 - R0017 - Movement - 13.76 m2							
No Asbestos							
B006 - R0018 - Withdrawal - Pre - 18.44 m2							
No Asbestos							
B006 - R0019 - Withdrawal - Pre - 37.17 m2							
No Asbestos							
B006 - R0020 - General Storeroom - 8.86 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B006 - R0021 - Home Base - Pre - 49.72 m2							
No Asbestos							
B006 - R0022 - Toilets - Boys/Girls - Pre - 12.11 m2							
No Asbestos							
B006 - R0023 - Movement - 9.09 m2							
No Asbestos							
B006 - R0024 - Movement - 9.61 m2							
No Asbestos							
B006 - R0026 - Laundry - Pre - 4.25 m2							
No Asbestos							
B006 - R0027 - Movement - 12.99 m2							
No Asbestos							
B006 - R0028 - Movement - 7.39 m2							

No Asbestos		
B006 - R0029 - Movement - 15.09 m2		
No Asbestos		
B006 - R0030 - External Movement - 9.36 m2		
No Asbestos		
B008 - Pupil Facilities - 1950 - Brick/Block		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Eaves Linings	Flat AC Sheeting	
Ceiling Voids	No Asbestos Found	
Interior		
B008 - R0001 - Toilets - Girls - 32.61 m2		
No Asbestos		
B008 - R0002 - Toilets - Boys - 32.66 m2		
No Asbestos		
B008 - R0003 - Drinking Facilities - 8.02 m2		
No Asbestos		
B008 - R0004 - Drinking Facilities - 8.02 m2		
No Asbestos		
B010 - Pre-School Facilities - 2003 - Timber		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B010 - R0001 - Movement - 3.42 m2		
No Asbestos		
B010 - R0002 - General Storeroom - Pre - 12.6 m2		
No Asbestos		
B011 - Administration/Staff Facilities - 2002 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B011 - R0001 - Staff Room Annexe - 25.89 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0002 - Staff Room - 50.84 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0003 - Staff Kitchen - 8.08 m2		
No Asbestos		
B011 - R0004 - Cleaning Distributed Store - 2.67 m2		
No Asbestos		
B011 - R0005 - Main Switch Board - 3.06 m2		
No Asbestos		
B011 - R0006 - Interview - 12.74 m2		

Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0007 - Deputy Principal - 12.74 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0008 - Principal - 16.89 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0009 - Interview - 12.7 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0010 - Entry Vestibule - 30.21 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0011 - Movement - 58.18 m2		
No Asbestos		
B011 - R0012 - Clerical Office/Workroom - 57.82 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B011 - R0013 - Sick Bay - 8.3 m2		
No Asbestos		
B011 - R0014 - Access Shower/Toilet - 5.79 m2		
No Asbestos		
B011 - R0015 - Security Store - 13.44 m2		
No Asbestos		
B011 - R0016 - Staff Toilet - 4.67 m2		
No Asbestos		
B011 - R0017 - Staff Toilet - 4.75 m2		
No Asbestos		
B011 - R0018 - Staff Toilet - 4.75 m2		
No Asbestos		
B011 - R0019 - Movement - 43.19 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B013 - General Learning - 2004 - Fibre Cement Clad		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B013 - R0001 - Movement - 38.48 m2		
No Asbestos		
B013 - R0002 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B013 - R0003 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B013 - R0004 - Home Base - 59.2 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B013 - R0005 - Withdrawal Space - 2hb - 11.35 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B013 - R0006 - Home Base - 59.19 m2		

Floor Coverings Res/Textile	No Asbestos Found	
B013 - R0007 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B013 - R0008 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B014 - General Learning - 2004 - Fibre Cement Clad		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B014 - R0001 - Movement - 38.48 m2		
No Asbestos		
B014 - R0002 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B014 - R0003 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B014 - R0004 - Home Base - 59.2 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B014 - R0005 - Withdrawal Space - 2hb - 11.35 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B014 - R0006 - Home Base - 59.19 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B014 - R0007 - Home Base Store - 6.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B014 - R0008 - Practical Activities - 1hb - 19.4 m2		
No Asbestos		
B015 - Communal Facilities/Pupil Facilities - 2009 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B015 - R0001 - P.E. Store - 20.78 m2		
No Asbestos		
B015 - R0002 - Movement - 5.88 m2		
No Asbestos		
B015 - R0003 - Raised Platform - 59.41 m2		
No Asbestos		
B015 - R0004 - Movement - 12.94 m2		
No Asbestos		
B015 - R0005 - Movement - 13.72 m2		
No Asbestos		
B015 - R0006 - Communal/Performance Store - 12.8 m2		
No Asbestos		

B015 - R0007 - Sports Store - 18.51 m2		
No Asbestos		
B015 - R0008 - Hall Chair Store - 12.76 m2		
No Asbestos		
B015 - R0009 - Cleaning Distributed Store - 6.85 m2		
No Asbestos		
B015 - R0010 - Distribution Board - 2.18 m2		Note: No inspection of live electrical installation
No Asbestos		
B015 - R0011 - External Movement - 110.88 m2		
No Asbestos		
B015 - R0012 - Movement - 10.73 m2		
No Asbestos		
B015 - R0013 - Toilets - Girls/Disabled Cubicle - 37.59 m2		
No Asbestos		
B015 - R0014 - Toilets - Boys/Disabled Cubicle - 21.09 m2		
No Asbestos		
B015 - R0015 - Communal Space - 206.36 m2		
No Asbestos		
B015 - R0016 - Covered Outdoor Learning Area - 155.36 m2		
No Asbestos		
B015 - R0017 - Sound Cupboard - 4.08 m2		
No Asbestos		
B015 - R0018 - Access Shower/Toilet - 8.6 m2		
No Asbestos		
B015 - R0019 - Plant - .79 m2		
No Asbestos		
B015 - R0020 - Garden Store - 16.39 m2		
No Asbestos		
B015 - R0021 - General Assistant/Bulk Store - 16.62 m2		
No Asbestos		
B016 - General Learning - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B016 - R0001 - External Movement - 66.72 m2		
No Asbestos		
B016 - R0002 - Practical Activities - 19.74 m2		
No Asbestos		
B016 - R0003 - Home Base Store - 6.26 m2		
No Asbestos		
B016 - R0004 - Home Base - 60.63 m2		
No Asbestos		
B016 - R0005 - Withdrawal Space - 2hb - 11.7 m2		
No Asbestos		
B016 - R0006 - Home Base - 60.7 m2		
No Asbestos		
B016 - R0007 - Home Base Store - 6.22 m2		
No Asbestos		
B016 - R0008 - Practical Activities - 18.94 m2		

No Asbestos		
B016 - R0009 - Main Switch Board - .41 m2		
No Asbestos		
B016 - R0010 - External Stairs - 9.69 m2		
No Asbestos		
B016 - R0011 - External Stairs - 9.69 m2		
No Asbestos		
B016 - R1001 - External Movement - 36.83 m2		
No Asbestos		
B016 - R1002 - Practical Activities - 19.72 m2		
No Asbestos		
B016 - R1003 - Home Base Store - 6.12 m2		
No Asbestos		
B016 - R1004 - Home Base - 60.49 m2		
No Asbestos		
B016 - R1005 - Withdrawal Space - 2hb - 11.78 m2		
No Asbestos		
B016 - R1006 - Home Base - 60.57 m2		
No Asbestos		
B016 - R1007 - Home Base Store - 6.13 m2		
No Asbestos		
B016 - R1008 - Practical Activities - 19.67 m2		
No Asbestos		
B016 - R1009 - External Stairs - 14.55 m2		
No Asbestos		
B016 - R1010 - External Stairs - 14.55 m2		
No Asbestos		
B017 - General Learning - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B017 - R0001 - External Movement - 43.87 m2		
No Asbestos		
B017 - R0002 - Practical Activities - 19.75 m2		
No Asbestos		
B017 - R0003 - Home Base Store - 6.13 m2		
No Asbestos		
B017 - R0004 - Home Base - 60.58 m2		
No Asbestos		
B017 - R0005 - Withdrawal Space - 2hb - 11.74 m2		
No Asbestos		
B017 - R0006 - Home Base - 60.58 m2		
No Asbestos		
B017 - R0007 - Home Base Store - 6.12 m2		
No Asbestos		
B017 - R0008 - Practical Activities - 19.1 m2		
No Asbestos		
B017 - R0009 - Main Switch Board - .39 m2		

No Asbestos	
-------------	--

Demountables**OS 601 10039 - Learning Unit - Standard/Withdrawal - Placement Date : 10-AUG-2001****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 600 11162 - Learning Unit - Small - Placement Date : 24-SEP-1996**Exterior**

Eaves Linings	Flat AC Sheeting	8.64m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- General Learning Space**

End Wall Panel	Flat AC Sheeting	50m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

OS 601 11182 - Learning Unit - Standard/Withdrawal - Placement Date : 19-JAN-2008**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 601 11298 - Learning Unit - Standard/Withdrawal - Placement Date : 30-JUN-1995**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
----------------	------------------	------	------------------

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 600 11526 - Learning Unit - Small - Placement Date : 05-NOV-1996			
Exterior			
Eaves Linings	Flat AC Sheeting	8.64m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- General Learning Space			
End Wall Panel	Flat AC Sheeting	50m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
OS 601 11945 - Learning Unit - Standard/Withdrawal - Placement Date : 03-JAN-2002			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 601 12408 - Learning Unit - Standard/Withdrawal - Placement Date : 02-JAN-2006			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 602 13083 - Learning Unit - Standard With P.A.A. - Placement Date : 15-AUG-2012			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 601 14355 - Learning Unit - Standard/Withdrawal - Placement Date : 03-JAN-2003			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			

R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 601 14398 - Learning Unit - Standard/Withdrawal - Placement Date : 10-DEC-2008			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 606 19609 - Learning Unit - Standard With P.A.A A/C - Placement Date : 17-JAN-2019			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			