


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Lakeside School (5686)</b>
<b>Region:</b>	<b>Hunter/Central Coast AMU</b>
<b>State Electorate:</b>	<b>Charlestown</b>
<b>Local Government Area:</b>	<b>Lake Macquarie</b>

<b>Last Reviewed By:</b>	<b>AECOM 29-JUN-2016</b>
<b>Last Revised By:</b>	<b>AECOM 25-JUN-2020</b>

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

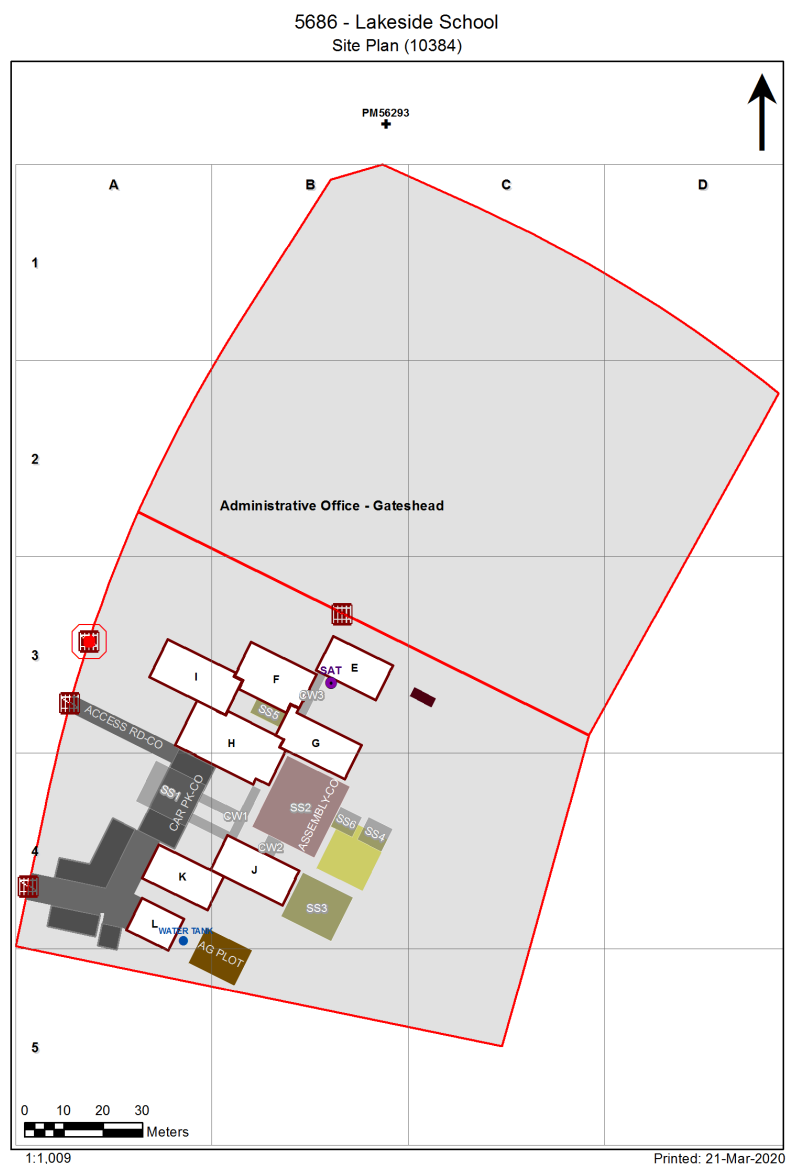

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00E - Library - 1971 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Compressed AC Sheet	80	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00E - R0001 - External Movement - 53.63 m2</b>							
No Asbestos							
<b>B00E - R0003 - Clerical Office/Workroom - 12.69 m2</b>							
Wall Linings Internal	Compressed AC Sheet	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0004 - Clerical Office/Workroom - 12.79 m2</b>							
Wall Linings Internal	Compressed AC Sheet	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0005 - Home Base - 72.66 m2</b>							
Wall Linings Internal	Compressed AC Sheet	3.00m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00E - R0006 - Practical Activities/Movement - 1hb - 6.07 m2</b>							
Wall Linings Internal	Compressed AC Sheet	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - Staff Facilities/General Learning - 1971 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Compressed AC Sheet	70	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00F - R0002 - Sports Store - 8.43 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Wall Linings Internal	Compressed AC Sheet	7m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	13.5m2	North and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	8.40m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0003 - Home Base - 52.03 m2</b>							
Wall Linings Internal	Flat AC Sheeting	32m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	14m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	52.00m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0004 - Staff Room - 52.1 m2</b>							
Wall Linings Internal	Flat AC Sheeting	32m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	14m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	52.10m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0005 - General Storeroom - 4.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	12.00m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
<b>B00F - R0006 - Sick Bay - 5.12 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	East and North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	4.5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	5.12m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0007 - Movement - 3 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	5.00m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	3.00m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0008 - General Storeroom - 4.09 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4.09m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0009 - External Movement - 71.64 m2</b>							
No Asbestos							
<b>B00G - General Learning - 1971 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	70	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00G - R0004 - External Movement - 41.41 m2</b>							
No Asbestos							
<b>B00G - R0007 - External Movement - 19.25 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0008 - General Assistant/Bulk Store - 5.09 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - R0009 - Toilet - S - 19.88 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - R0010 - Other - 6.31 m2</b>							

Wall Linings Internal	Compressed AC Sheet	6m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - (< 10 m2) - (X2)	6.31m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00G - R0011 - Home Base - 46.05 m2</b>							
Wall Linings Internal	Flat AC Sheeting	21m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	45m2	Lower Portion North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.05m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	46.05m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00G - R0012 - Home Base - 46.08 m2</b>							
Wall Linings Internal	Flat AC Sheeting	25m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	45m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	46.08m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00G - R0013 - Other - 6.35 m2</b>							
Wall Linings Internal	Compressed AC Sheet	6m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - (< 10 m2) - (X2)	6.35m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - Pupil Facilities/Building Services - 1971 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
<b>Interior</b>							
<b>B00H - R0003 - Sports Store - 7.1 m2</b>							
No Asbestos							
<b>B00H - R0006 - Sports Store - 7.12 m2</b>							
No Asbestos							
<b>B00H - R0009 - Canteen - 11.58 m2</b>							
No Asbestos							
<b>B00H - R0010 - Canteen Office/Store - 3.92 m2</b>							
No Asbestos							
<b>B00H - R0011 - Canteen Office/Store - 3.88 m2</b>							
No Asbestos							
<b>B00H - R0012 - Canteen - 13.73 m2</b>							
No Asbestos							
<b>B00H - R0014 - External Movement - 40.32 m2</b>							
No Asbestos							
<b>B00H - R0020 - General Assistant/Bulk Store - 33.36 m2</b>							
No Asbestos							
<b>B00H - R0021 - Communal Space - 32.42 m2</b>							
No Asbestos							
<b>B00H - R0022 - Toilet - S - 44.64 m2</b>							
No Asbestos							
<b>B00H - R0023 - External Movement - 3.04 m2</b>							
No Asbestos							
<b>B00H - R0024 - External Movement - 65.15 m2</b>							

No Asbestos							
<b>B00H - R0025 - Ramp - 32.88 m2</b>							
No Asbestos							
<b>B00H - R0026 - External Movement - 12.08 m2</b>							
No Asbestos							
<b>B00I - Administration/Staff Facilities - 1971 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Compressed AC Sheet	100	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00I - R0001 - External Movement - 68.75 m2</b>							
No Asbestos							
<b>B00I - R0002 - External Movement - 20.19 m2</b>							
No Asbestos							
<b>B00I - R0003 - Clerical Office - 19.08 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	West, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	8m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	19.08m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00I - R0004 - Security Store - 12.83 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	12.83m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00I - R0005 - Entry Vestibule - 26.64 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26.64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	25m2	East, North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	5m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	26.64m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00I - R0006 - Duplicating Workroom - 18.16 m2</b>							
Wall Linings Internal	Compressed AC Sheet	5.5m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	17.31m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0007 - Cleaning Supplies - 6.06 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	6m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2.5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	6.06m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
<b>B00I - R0008 - Principal - 25.83 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20.00m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings - Decorative Coating / Spray	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	25.83m2	Throughout	Mnimal Damage (2)	Medium (2)	Medium Priority (4-5)	Assumed Asbestos
<b>B00I - R0009 - Staff Toilet - 4.17 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0010 - Staff Toilet - 4.15 m2</b>							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0011 - Movement - 9.08 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9.08m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00I - R0012 - Distribution Board - 1 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Wall Linings Internal	Flat AC Sheeting	8.5m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Electrical Box / Cabinet	Flat AC Sheeting	3m2	Throughout	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
Electrical - Backing Board	Non Accessible Area						
Floor Coverings Res/Textile	Vinyl Tiles	1.50m2		Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - General Learning - 1971 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Compressed AC Sheet	70	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00J - R0007 - General Assistant/Bulk Store - 5.11 m2</b>							
Wall Linings Internal	Flat AC Sheeting	8m2	North and East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0008 - Toilet - S - 19.72 m2</b>							
No Asbestos							
<b>B00J - R0009 - Home Base - 45.91 m2</b>							
Wall Linings Internal	Compressed AC Sheet	28m2	North, West, and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45.91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0010 - Other - 6.23 m2</b>							
Wall Linings Internal	Compressed AC Sheet	5m2	West and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0011 - Home Base - 46.16 m2</b>							



Wall Linings Internal	Compressed AC Sheet	28m2	North, East, and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0012 - Other - 6.2 m2</b>							
Wall Linings Internal	Compressed AC Sheet	5m2	South and East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0013 - External Movement - 45.34 m2</b>							
No Asbestos							
<b>B00J - R0014 - External Movement - 13.41 m2</b>							
No Asbestos							
<b>B00K - General Learning - 1971 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Compressed AC Sheet	70	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00K - R0007 - External Movement - 38.69 m2</b>							
No Asbestos							
<b>B00K - R0008 - Home Base - 45.96 m2</b>							
Wall Linings Internal	Compressed AC Sheet	22m2	North, East, and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0009 - Other - 6.32 m2</b>							
Wall Linings Internal	Compressed AC Sheet	5m2	South and West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0010 - General Assistant/Bulk Store - 5.19 m2</b>							
Wall Linings Internal	Compressed AC Sheet	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0011 - Toilet - S - 19.74 m2</b>							
No Asbestos							
<b>B00K - R0012 - Home Base - 45.96 m2</b>							
Wall Linings Internal	Compressed AC Sheet	22m2	North, West, and South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00K - R0013 - Other - 6.32 m2</b>							
Wall Linings Internal	Compressed AC Sheet	5m2	South and East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - Mechanical Services - 2013 - Steel</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - Garage/Carport - 105.51 m2</b>							
No Asbestos							



## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020