


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Leichhardt Public School (7423)
Region:	Sydney AMU
State Electorate:	Balmain
Local Government Area:	Inner West

Last Reviewed By:	WSP 01-NOV-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

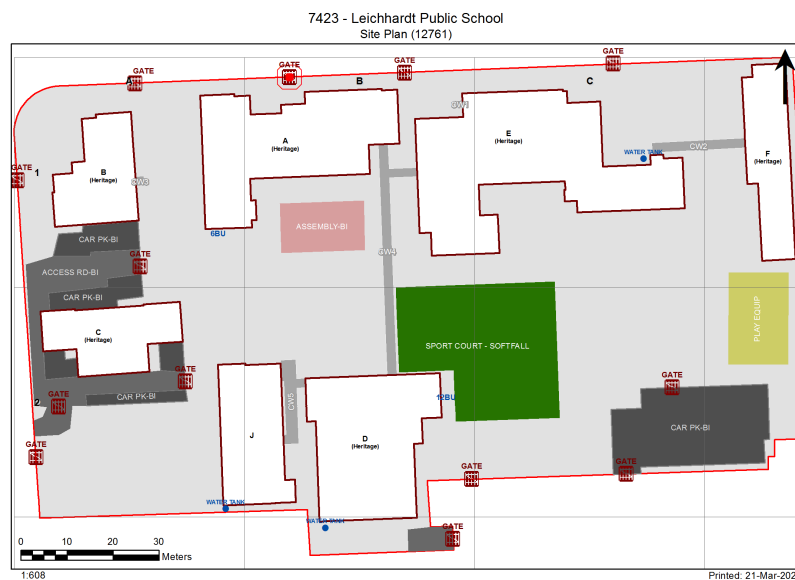

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/Library - 1897 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - M0001 - General Storeroom - 10.98 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	11m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - M0002 - Seminar/Study - 64.4 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	20m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - M0003 - Stairs - 3.68 m2</b>							
No Asbestos							
<b>B00A - M1001 - General Storeroom - 13.77 m2</b>							
No Asbestos							
<b>B00A - R0001 - Cleaning Distributed Store - 4.59 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00A - R0002 - Cleaning Distributed Store - 2.25 m2</b>							
Non Accessible							
<b>B00A - R0003 - Movement - 18.66 m2</b>							
No Asbestos							
<b>B00A - R0004 - Movement - 7.33 m2</b>							
No Asbestos							
<b>B00A - R0005 - Movement - 10.06 m2</b>							
No Asbestos							
<b>B00A - R0006 - Movement - 79.72 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	40m2	Ceiling half of room	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0007 - Staff Room - 75.57 m2</b>							
No Asbestos							
<b>B00A - R0008 - Movement - 19.75 m2</b>							
No Asbestos							
<b>B00A - R0009 - Staff Room Annexe - 14.68 m2</b>							
No Asbestos							
<b>B00A - R0010 - Deputy Principal - 14.8 m2</b>							
No Asbestos							
<b>B00A - R0011 - Interview - 14.73 m2</b>							
No Asbestos							
<b>B00A - R0012 - Principal - 27.13 m2</b>							
No Asbestos							
<b>B00A - R0013 - Security Store - 13.04 m2</b>							
No Asbestos							
<b>B00A - R0014 - Distribution Board - 1.28 m2</b>							
No Asbestos							Note: No inspection of live electrical installation
<b>B00A - R0015 - Movement - 3.5 m2</b>							
No Asbestos							
<b>B00A - R0016 - Cleaning Distributed Store - 2.7 m2</b>							
No Asbestos							
<b>B00A - R0017 - Movement - 15.31 m2</b>							
No Asbestos							
<b>B00A - R0018 - Library Office/Workroom - 22.57 m2</b>							

No Asbestos							
<b>B00A - R0022 - Security Store - 10.97 m2</b>							
No Asbestos							
<b>B00A - R0023 - Cleaning Distributed Store - 4.06 m2</b>							
No Asbestos							
<b>B00A - R0024 - Entry Vestibule - 17.79 m2</b>							
No Asbestos							
<b>B00A - R0025 - Movement - 3.13 m2</b>							
No Asbestos							
<b>B00A - R0026 - Staff Toilet - 3.6 m2</b>							
No Asbestos							
<b>B00A - R0027 - Staff Toilet - 3.63 m2</b>							
No Asbestos							
<b>B00A - R0028 - Clerical Office - 24.12 m2</b>							
No Asbestos							
<b>B00A - R0029 - Movement - 7.76 m2</b>							
No Asbestos							
<b>B00A - R0030 - Sick Bay - 9.38 m2</b>							
No Asbestos							
<b>B00A - R0031 - Duplicating Workroom - 29.74 m2</b>							
No Asbestos							
<b>B00A - R0032 - Toilets - Boys/Girls - 3.47 m2</b>							
No Asbestos							
<b>B00A - R0033 - Movement - 3.89 m2</b>							
No Asbestos							
<b>B00A - R0034 - Community Clinic - 12.28 m2</b>							
No Asbestos							
<b>B00A - R0035 - Special Programs Room - 47.54 m2</b>							
No Asbestos							
<b>B00A - R0037 - Home Base - 46.99 m2</b>							
No Asbestos							
<b>B00A - R0038 - Home Base - 40.84 m2</b>							
No Asbestos							
<b>B00A - R0039 - Movement - 41.19 m2</b>							
No Asbestos							
<b>B00A - R0040 - Stairs - 1.2 m2</b>							
No Asbestos							
<b>B00A - R1001 - Home Base - 46.57 m2</b>							
No Asbestos							
<b>B00A - R1002 - Home Base X2 - 92.63 m2</b>							
No Asbestos							
<b>B00A - R1003 - Home Base - 45.76 m2</b>							
No Asbestos							
<b>B00A - R1004 - General Storeroom - 16.84 m2</b>							
No Asbestos							
<b>B00A - R1005 - Home Base - 49.5 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	49.48m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1006 - Home Base - 49.16 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	49.14m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1007 - Home Base - 49.92 m2</b>							

Ceiling Structures/Linings	Compressed AC Sheet	49.91m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1008 - Security Store - 11.85 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	11.84m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1009 - Movement - 59.78 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	59.77m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1010 - Movement - 89.9 m2</b>							
No Asbestos							
<b>B00A - R1011 - General Storeroom - 23.57 m2</b>							
No Asbestos							
<b>B00A - R1012 - Home Base - 50.85 m2</b>							
No Asbestos							
<b>B00A - R1013 - Home Base - 51.71 m2</b>							
No Asbestos							
<b>B00B - Other-Dse Admin - 1891 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Compressed AC Sheet	50m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Other - Regional Use - 7.92 m2</b>							
No Asbestos							
<b>B00B - R0002 - Other - Regional Use - 10.06 m2</b>							
No Asbestos							
<b>B00B - R0003 - Other - Regional Use - 20.38 m2</b>							
No Asbestos							
<b>B00B - R0004 - Other - Regional Use - 40.59 m2</b>							
No Asbestos							
<b>B00B - R0005 - Other - Regional Use - 3.73 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0008 - Other - Regional Use - 9.69 m2</b>							
No Asbestos							
<b>B00B - R0009 - Other - Regional Use - 7.66 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	7.65m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0011 - Other - Regional Use - 9.76 m2</b>							
No Asbestos							
<b>B00B - R0013 - Movement - 72.24 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00B - R0014 - Home Base - 72.03 m2</b>							
No Asbestos							
<b>B00B - R0015 - Practical Activities - 11.3 m2</b>							
No Asbestos							
<b>B00B - R0016 - Stairs - 3.96 m2</b>							
No Asbestos							
<b>B00B - R1001 - Other - Regional Use - 82.31 m2</b>							
No Asbestos							
<b>B00B - R1002 - Other - Regional Use - 24.27 m2</b>							
No Asbestos							

<b>B00B - R1003 - Other - Regional Use - 40.77 m2</b>							
No Asbestos							
<b>B00B - R1004 - Other - Regional Use - 41.04 m2</b>							
No Asbestos							
<b>B00B - R1005 - Other - Regional Use - 9.31 m2</b>							
No Asbestos							
<b>B00B - R1006 - Other - Regional Use - 16.16 m2</b>							
No Asbestos							
<b>B00B - R1007 - Other - Regional Use - 22.89 m2</b>							
No Asbestos							
<b>B00B - R1008 - Other - Regional Use - 10.22 m2</b>							
No Asbestos							
<b>B00B - R1009 - Stairs - 16.22 m2</b>							
No Asbestos							
<b>B00C - Other-Dse Admin - 1909 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00C - R0001 - Other - Regional Use - 11.81 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0002 - Other - Regional Use - 3.53 m2</b>							
No Asbestos							
<b>B00C - R0003 - Other - Regional Use - 10.39 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0004 - Other - Regional Use - 12.91 m2</b>							
No Asbestos							
<b>B00C - R0005 - Other - Regional Use - 1.31 m2</b>							
No Asbestos							
<b>B00C - R0006 - Other - Regional Use - 12.32 m2</b>							
No Asbestos							
<b>B00C - R0007 - Other - Regional Use - 108.66 m2</b>							
No Asbestos							
<b>B00C - R0008 - Other - Regional Use - 42.95 m2</b>							
No Asbestos							
<b>B00C - R0009 - Other - Regional Use - 42.68 m2</b>							
No Asbestos							
<b>B00C - R0010 - Other - Regional Use - 2.11 m2</b>							
No Asbestos							
<b>B00C - R0011 - Other - Regional Use - 9.44 m2</b>							
No Asbestos							
<b>B00C - R0012 - Other - Regional Use - 16.58 m2</b>							
No Asbestos							
<b>B00C - R0013 - Other - Regional Use - 16.13 m2</b>							
No Asbestos							
<b>B00C - R0014 - Other - Regional Use - 4.38 m2</b>							
No Asbestos							
<b>B00C - R0015 - Other - Regional Use - 2.08 m2</b>							
No Asbestos							
<b>B00C - R0016 - Other - Regional Use - 1.86 m2</b>							

No Asbestos							
<b>B00D - Pupil Facilities - 1982 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - Toilets - Girls - 15.77 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	15.76m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0002 - Toilets - Boys - 14.92 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	14.92m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0003 - Movement - 21.07 m2</b>							
No Asbestos							
<b>B00D - R0004 - Sports Store - 20.74 m2</b>							
No Asbestos							
<b>B00D - R0005 - Garden Store - 11.42 m2</b>							
No Asbestos							
<b>B00D - R0006 - Movement - 24.65 m2</b>							
No Asbestos							
<b>B00D - R0007 - Hall Chair Store - 2.63 m2</b>							
No Asbestos							
<b>B00D - R0008 - Communal Space - 216.95 m2</b>							
No Asbestos							
<b>B00D - R0009 - Main Switch Board - 15.9 m2</b>							
No Asbestos							
<b>B00D - R0010 - P.E Store - 11.69 m2</b>							
No Asbestos							
<b>B00D - R0011 - Plant - 11.51 m2</b>							
No Asbestos							
<b>B00D - R0012 - Security Store - 24.82 m2</b>							
No Asbestos							
<b>B00D - R0013 - Movement - 31.51 m2</b>							
No Asbestos							
<b>B00D - R0014 - Hall Chair Store - 3.32 m2</b>							
No Asbestos							
<b>B00D - R0015 - Staff Toilet - 3.55 m2</b>							
No Asbestos							
<b>B00D - R0016 - Canteen Office/Store - 5.41 m2</b>							
No Asbestos							
<b>B00D - R0017 - Canteen Office/Store - 4.53 m2</b>							
No Asbestos							
<b>B00D - R0018 - Canteen - 38.21 m2</b>							
No Asbestos							
<b>B00D - R0019 - Raised Platform - 74.73 m2</b>							
No Asbestos							
<b>B00D - R0020 - Plant - .31 m2</b>							
No Asbestos							
<b>B00D - R0021 - Distribution Board - .87 m2</b>							
No Asbestos	<b>Note: No inspection of live electrical installation</b>						
<b>B00D - R0022 - Movement - 3.68 m2</b>							

No Asbestos							
<b>B00D - R0023 - Movement - 94.84 m2</b>							
No Asbestos							
<b>B00D - R0024 - General Assistant/Bulk Store - 7.68 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00D - R0025 - Cleaning Supplies - 10.37 m2</b>							
No Asbestos							
<b>B00E - General Learning/Support Unit - 1883 - Brick/Block</b>							
<b>Exterior</b>							
External Wall Structure - Awnings	Flat AC Sheeting	2	North-West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	50m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Plant - 8.07 m2</b>							
Electrical - Backing Board	Resinous Board						
<b>B00E - R0002 - General Storeroom - 3.68 m2</b>							
No Asbestos							
<b>B00E - R0003 - Movement - 4.02 m2</b>							
No Asbestos							
<b>B00E - R0004 - Personal Effects Storage - 6.11 m2</b>							
No Asbestos							
<b>B00E - R0005 - Home Base - 54.48 m2</b>							
No Asbestos							
<b>B00E - R0006 - Laundry - Type 2 - 39.18 m2</b>							
No Asbestos							
<b>B00E - R0007 - Practical Activities - M - 1hb - 18.68 m2</b>							
No Asbestos							
<b>B00E - R0008 - Home Base - M - 50.79 m2</b>							
No Asbestos							
<b>B00E - R0009 - Personal Effects Storage - 7.56 m2</b>							
No Asbestos							
<b>B00E - R0010 - Movement - 11.42 m2</b>							
No Asbestos							
<b>B00E - R0011 - Sick Bay - 4.39 m2</b>							
No Asbestos							
<b>B00E - R0012 - Disabled Toilet - 4.74 m2</b>							
No Asbestos							
<b>B00E - R0013 - Movement - 57.82 m2</b>							
No Asbestos							
<b>B00E - R0014 - Home Base - M - 50.5 m2</b>							
No Asbestos							
<b>B00E - R0015 - Practical Activities - M - 1hb - 53.16 m2</b>							
No Asbestos							
<b>B00E - R0016 - Cleaning Distributed Store - 1.75 m2</b>							
Non Accessible							
<b>B00E - R0017 - Duplicating Workroom - 26.05 m2</b>							
No Asbestos							
<b>B00E - R0018 - Staff Toilet - 2.45 m2</b>							
Wall Linings Internal	Compressed AC Sheet						



Partition Walls (Cubicles)	Compressed AC Sheet	m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0019 - Toilets - Boys - 6.5 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet						
<b>B00E - R0020 - Toilets - Girls - 8.92 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	1.5m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0021 - Cleaning Distributed Store - 2.54 m2</b>							
No Asbestos							
<b>B00E - R0022 - Practical Activities - M - 1hb - 51.33 m2</b>							
No Asbestos							
<b>B00E - R0023 - Movement - 7.48 m2</b>							
No Asbestos							
<b>B00E - R0024 - Security Store - 49.37 m2</b>							
No Asbestos							
<b>B00E - R0025 - Home Base - 47.18 m2</b>							
No Asbestos							
<b>B00E - R0026 - Home Base - 38.24 m2</b>							
No Asbestos							
<b>B00E - R0027 - Movement - 34.16 m2</b>							
No Asbestos							
<b>B00E - R0028 - Home Base - 64.77 m2</b>							
No Asbestos							
<b>B00E - R0029 - Home Base - 55.4 m2</b>							
No Asbestos							
<b>B00E - R0030 - Movement - 23.61 m2</b>							
No Asbestos							
<b>B00E - R0031 - General Storeroom - 9.7 m2</b>							
No Asbestos							
<b>B00E - R0032 - Plant - 13.22 m2</b>							
No Asbestos							
<b>B00E - R0033 - Movement - 6.95 m2</b>							
No Asbestos							
<b>B00E - R0034 - Home Base - 54.9 m2</b>							
No Asbestos							
<b>B00E - R0035 - Home Base - 54.72 m2</b>							
No Asbestos							
<b>B00E - R0036 - Movement - 9.44 m2</b>							
No Asbestos							
<b>B00E - R0037 - Personal Effects Storage - 15.23 m2</b>							
No Asbestos							
<b>B00E - R0038 - Cleaning Distributed Store - 1.31 m2</b>							
No Asbestos							
<b>B00E - R0039 - Entry Vestibule - 1.55 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	1.55m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0040 - Home Base - M - 52.69 m2</b>							
No Asbestos							
<b>B00E - R1001 - Personal Effects Storage - 7.74 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	7.74m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00E - R1002 - Withdrawal Space - 1hb - 10.03 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	10.02m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1003 - Home Base - 53.9 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	53.87m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1004 - Home Base - 51.52 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	51.5m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1005 - Home Base - 51.24 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	51.22m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1006 - Plant - 21.11 m2</b>							
No Asbestos							
<b>B00E - R1007 - Movement - 2.74 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	2.74m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1008 - Personal Effects Storage - 13.19 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	13.19m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1009 - Distribution Board - 1.37 m2</b>							
No Asbestos						<b>Note: No inspection of live electrical installation</b>	
<b>B00E - R1010 - Practical Activities - 1hb - 39.14 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	39.13m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1011 - Movement - 61.19 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	61.17m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - General Learning - 1928 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Home Base - 56.67 m2</b>							
No Asbestos							
<b>B00F - R0002 - Withdrawal Space - 1hb - 8.22 m2</b>							
No Asbestos							
<b>B00F - R0003 - Practical Activities - 1hb - 22.58 m2</b>							
No Asbestos							
<b>B00F - R0004 - Movement - 7.8 m2</b>							
No Asbestos							
<b>B00F - R0005 - General Storeroom - 3.8 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00F - R0006 - Home Base - 55.11 m2</b>							
No Asbestos							
<b>B00F - R0007 - Movement - 17.3 m2</b>							
No Asbestos							
<b>B00F - R0008 - Movement - 22.54 m2</b>							
No Asbestos							
<b>B00F - R0009 - Toilets - Boys - 10.67 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00F - R0010 - Staff Toilet - 4.3 m2</b>							
No Asbestos							
<b>B00F - R0011 - Cleaning Distributed Store - 2.87 m2</b>							
No Asbestos							
<b>B00F - R0012 - Distribution Board - .73 m2</b>							<b>Note: No inspection of live electrical installation</b>
Electrical - Backing Board	Resinous Board						
<b>B00F - R0013 - Toilets - Girls - 9.6 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Toilet cubicle partition	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0014 - Practical Activities - 1hb - 15.17 m2</b>							
No Asbestos							
<b>B00F - R0015 - Withdrawal Space - 1hb - 7.65 m2</b>							
No Asbestos							
<b>B00F - R0016 - Home Base - 61.16 m2</b>							
No Asbestos							
<b>B00F - R1001 - General Storeroom - 16.33 m2</b>							
No Asbestos							
<b>B00F - R1002 - Personal Effects Storage - 10.92 m2</b>							
No Asbestos							
<b>B00F - R1003 - General Storeroom - 9.52 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	9.52m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1004 - Practical Activities - 1hb - 14.85 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	14.84m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1005 - Withdrawal Space - 1hb - 12.71 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	12.71m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R1006 - Home Base - 63.63 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	63.6m2	Ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R9001 - Plant - 46.8 m2</b>							
No Asbestos							
<b>B00J - Library/General Learning - 2010 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00J - R0001 - Movement - 3.01 m2</b>							
No Asbestos							
<b>B00J - R0002 - Staff Toilet - 5.03 m2</b>							
No Asbestos							
<b>B00J - R0003 - Cleaning Distributed Store - 3.58 m2</b>							
No Asbestos							
<b>B00J - R0004 - Main Switch Board - .63 m2</b>							
No Asbestos							
<b>B00J - R0005 - K.L.A. Store - 19.06 m2</b>							
No Asbestos							
<b>B00J - R0006 - Communications Room - 7.78 m2</b>							
No Asbestos							

<b>B00J - R0007 - Library Office/Workroom - 25.96 m2</b>	
No Asbestos	
<b>B00J - R0008 - Reading Area - 232.07 m2</b>	
No Asbestos	
<b>B00J - R0009 - External Movement - 79.51 m2</b>	
No Asbestos	
<b>B00J - R0010 - Plant - 21.98 m2</b>	
No Asbestos	
<b>B00J - R1001 - Home Base - 59.1 m2</b>	
No Asbestos	
<b>B00J - R1002 - Home Base Store - 5.67 m2</b>	
No Asbestos	
<b>B00J - R1003 - Practical Activities - 1hb - 19.35 m2</b>	
No Asbestos	
<b>B00J - R1004 - Withdrawal Space - 1hb - 9.15 m2</b>	
No Asbestos	
<b>B00J - R1005 - Home Base - 60.23 m2</b>	
No Asbestos	
<b>B00J - R1006 - Home Base Store - 6.08 m2</b>	
No Asbestos	
<b>B00J - R1007 - Practical Activities - 1hb - 19.23 m2</b>	
No Asbestos	
<b>B00J - R1008 - Withdrawal Space - 2hb - 11.74 m2</b>	
No Asbestos	
<b>B00J - R1009 - Home Base - 60.69 m2</b>	
No Asbestos	
<b>B00J - R1010 - Home Base Store - 6.07 m2</b>	
No Asbestos	
<b>B00J - R1011 - Practical Activities - 1hb - 19.35 m2</b>	
No Asbestos	
<b>B00J - R1013 - External Movement - 76.66 m2</b>	
No Asbestos	

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020