


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lithgow High School (8125)
Region:	North Western NSW AMU
State Electorate:	Bathurst
Local Government Area:	Lithgow

Last Reviewed By:	Greencap 17-APR-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

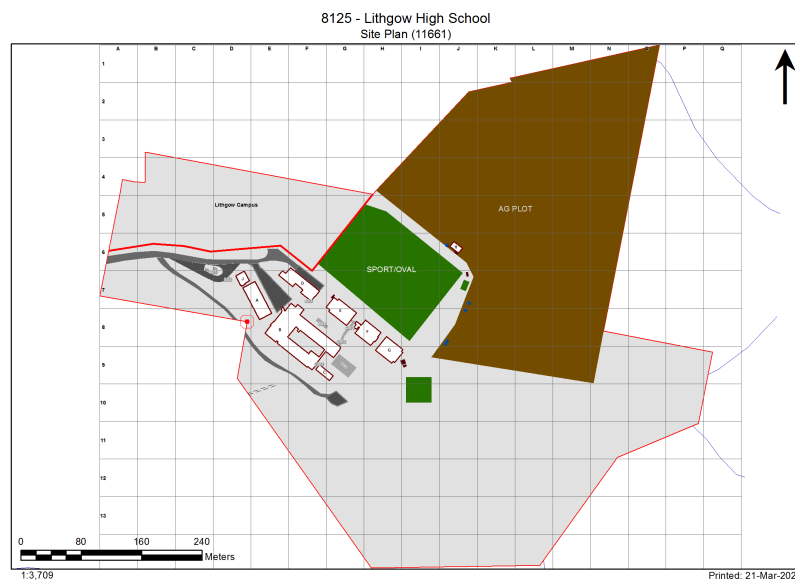

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Technological & Applied Studies - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00A - R0001 - L.P.G Store - 1.13 m2							
No Asbestos							
B00A - R0002 - Materials Store - 35.06 m2							
No Asbestos							
B00A - R0003 - Materials Store - 17.3 m2							
No Asbestos							
B00A - R0004 - Materials Technology L.S. - 74.46 m2							
No Asbestos							
B00A - R0005 - Metal Technology Bay - 23.93 m2							
No Asbestos							
B00A - R0006 - Welding Area - 12.2 m2							
Partition Walls (Cubicles)	Flat AC Sheeting						
B00A - R0007 - Materials Technology L.S. - 74.45 m2							
No Asbestos							
B00A - R0008 - Design L.S. - 35.04 m2							
No Asbestos							
B00A - R0009 - General Storeroom - .35 m2							
No Asbestos							
B00A - R0010 - Design L.S. - 55.48 m2							
No Asbestos							
B00A - R0011 - Movement - 9.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0012 - Movement - 4.81 m2							
No Asbestos							
B00A - R0013 - Staff - Toilet - 4.77 m2							
No Asbestos							
B00A - R0014 - Staff Study - 34.83 m2							
No Asbestos							
B00A - R0015 - Distribution Board Cupboard - 1.71 m2							
						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0016 - Secure Storeroom - 8.37 m2							
No Asbestos							
B00A - R0017 - Resource/Project Store - 55.48 m2							
No Asbestos							
B00A - R0018 - Cleaning Store - Distributed - 3.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0019 - Resource/Project Store - 13.87 m2							
No Asbestos							
B00A - R0020 - Materials Technology L.S. - 93.44 m2							
No Asbestos							

B00A - R0021 - Plant - 8.3 m2							
No Asbestos							
B00A - R0022 - Resource/Project Store - 8.49 m2							
No Asbestos							
B00A - R0023 - Materials Technology L.S. - 93.74 m2							
No Asbestos							
B00A - R0024 - Movement - 4.61 m2							
No Asbestos							
B00A - R0025 - Movement - 97.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - General Learning/Administration - 1962 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Interior							
B00B - M1001 - Control Room - 14.1 m2							
No Asbestos							
B00B - M1002 - Movement - 12.44 m2							
No Asbestos							
B00B - M1003 - Control Room - 14.4 m2							
No Asbestos							
B00B - R0001 - Shower/Change - 37.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0002 - General Learning Space - 52.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0003 - General Learning Space - 52.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0004 - Distribution Board Cupboard - .36 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00B - R0005 - General Learning Space - 52.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0006 - General Learning Space - 52.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0007 - General Storeroom - 9.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0008 - Staff Study - 42.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0009 - General Learning Space - 52.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0010 - General Learning Space - 53.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0011 - No Access - 10.72 m2							
No Asbestos							
B00B - R0012 - Movement - 177.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00B - R0013 - Movement - 4.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - R0014 - Pupil Entry - 16.89 m2							
No Asbestos							
B00B - R0015 - Main Switchroom - 8.55 m2							
Electrical - Backing Board	Resinous Board	2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0017 - Administration - Clerical - 54.59 m2							
No Asbestos							
B00B - R0018 - Interview/Office - Type 1 - 19.33 m2							
No Asbestos							
B00B - R0019 - Principal Office - 13.36 m2							
No Asbestos							
B00B - R0020 - Interview/Office - Type 1 - 12.79 m2							
No Asbestos							
B00B - R0021 - Public Entry - 15.8 m2							
Wall Linings Internal - Infill	Flat AC Sheeting						
B00B - R0022 - Clinic - Girls - 13.85 m2							
No Asbestos							
B00B - R0023 - Clinic-Toilets - 2.4 m2							
No Asbestos							
B00B - R0024 - Clinic-Toilets - 2.2 m2							
No Asbestos							
B00B - R0025 - Clinic - Boys - 14.68 m2							
No Asbestos							
B00B - R0026 - Duplicating Workroom - 42.99 m2							

No Asbestos							
B00B - R0027 - Cleaning Store - Distributed - 3.56 m2							
No Asbestos							
B00B - R0028 - Toilets-Disabled - 12.38 m2							
No Asbestos							
B00B - R0029 - Movement - 44.94 m2							
No Asbestos							
B00B - R0030 - Plant - 51.8 m2							
No Asbestos							
B00B - R0031 - General Storeroom - 13.69 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0032 - General Storeroom - 46.25 m2							
No Asbestos							
B00B - R0033 - Staff Change - 4.35 m2							
No Asbestos							
B00B - R0034 - General Storeroom - 4.37 m2							
No Asbestos							
B00B - R0035 - Student Canteen - 73.76 m2							
No Asbestos							
B00B - R0036 - Movement - 125.21 m2							
No Asbestos							
B00B - R0038 - Toilets-Girls - 95.14 m2							
No Asbestos							
B00B - R0039 - General Assistants - 16 m2							
No Asbestos							
B00B - R0040 - General Storeroom - 39.93 m2							
No Asbestos							
B00B - R0043 - Movement - 2.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - R0044 - Cleaning Store - Distributed - 3.84 m2							
No Asbestos							
B00B - R0045 - Movement - 2.18 m2							
No Asbestos							
B00B - R0047 - Art Learning Space - 72.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0048 - Staff Study - 24.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0049 - Art Learning Space - 61.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0050 - Distribution Board Cupboard - .32 m2							
Note: No inspection of live electrical installation							
Plant / Equipment - Electric Off Peak Heater	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0051 - Art Learning Space - 60.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0054 - Art Learning Space - 59.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0055 - Resources Store - 25.77 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0056 - No Access - 5.44 m2								
No Asbestos								
B00B - R0057 - Movement - 2.62 m2								
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
B00B - R0058 - Materials Store - 27.27 m2								
No Asbestos								
B00B - R0059 - Art Learning Space - 55.02 m2								
No Asbestos								
B00B - R0060 - Kiln Space - 9.04 m2								
No Asbestos								
B00B - R0062 - Communication Space - .84 m2								
No Asbestos								
B00B - R0063 - Security Store - 15.84 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0064 - Covered Area - 109.63 m2								
No Asbestos								
B00B - R0066 - Movement - 5.01 m2								
No Asbestos								
B00B - R0067 - Movement - 1.83 m2								
No Asbestos								
B00B - R0068 - Movement - 4.68 m2								
No Asbestos								
B00B - R0069 - Art Learning Space - 39.58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R0070 - Computer Store - 11.64 m2								
No Asbestos								
B00B - R0071 - Store - 20.66 m2								
No Asbestos								
B00B - R0072 - Stairs - 7.95 m2								
No Asbestos								
B00B - R0074 - Stairs - 3.67 m2								
No Asbestos								
B00B - R0075 - Stairs - 7.9 m2								
No Asbestos								
B00B - R0076 - General Storeroom - 5.48 m2								
No Asbestos								
B00B - R0077 - Movement - 9.05 m2								
No Asbestos								
B00B - R0078 - Movement - 7.43 m2								
No Asbestos								
B00B - R0079 - Lift - 2.24 m2								
No Asbestos								
B00B - R0080 - Movement - 419.34 m2								
No Asbestos								
B00B - R0081 - Movement - 292.33 m2								
Ceiling Structures/Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00B - R0082 - Movement - 36.56 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	37m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R0083 - Movement - 122.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	123m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00B - R1001 - General Learning Space - 37.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1002 - General Learning Space - 51.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1003 - Staff Study - 51.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1004 - Distribution Board Cupboard - .34 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	0.4m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00B - R1005 - General Learning Space - 51.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1006 - General Learning Space - 51.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1007 - General Learning Space - 51.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1008 - General Learning Space - 51.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1009 - General Learning Space - 51.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1011 - Movement - 175.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	176m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1012 - Staff - Toilet - 4.46 m2							
No Asbestos							
B00B - R1013 - Deputy Principal Office - 22.62 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1014 - Staff Study - 17.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1015 - Cleaning Store - Distributed - 3.33 m2							
No Asbestos							
B00B - R1016 - Toilets-Disabled - 5 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R1017 - Toilets-Boys - 22.49 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00B - R1018 - Toilets-Girls - 28.91 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00B - R1019 - Movement - 98.99 m2							
No Asbestos							
B00B - R1020 - Movement - 9.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1021 - Multi-Purpose Space - 8.24 m2							
No Asbestos							

B00B - R1022 - Multi-Purpose Space - 9.02 m2							
No Asbestos							
B00B - R1023 - Multi-Purpose Space - 324.35 m2							
No Asbestos							
B00B - R1024 - Stage - 139.72 m2							
No Asbestos							
B00B - R1025 - Music Store - 11.93 m2							
No Asbestos							
B00B - R1026 - General Storeroom - 19.95 m2							
No Asbestos							
B00B - R1027 - Music Store - 20.71 m2							
No Asbestos							
B00B - R1028 - General Storeroom - 20.64 m2							
No Asbestos							
B00B - R1029 - Cleaning Supplies Store - 4.54 m2							
No Asbestos							
B00B - R1030 - Movement - 56.99 m2							
No Asbestos							
B00B - R1031 - General Learning Space - 65.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1032 - Staff Study - 32.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1033 - General Storeroom - 6.74 m2							
No Asbestos							
B00B - R1034 - General Learning Space - 47.18 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1035 - Distribution Board Cupboard - .44 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Electrical - Mounting Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R1036 - Staff Study - 52.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1037 - Staff Study - 17.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1038 - Staff Study - 12.71 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R1039 - Commonroom - 105.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	106m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1040 - Cleaning Supplies Store - 3.66 m2							
No Asbestos							
B00B - R1041 - Movement - 11.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1042 - General Storeroom - 12.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1043 - Staff - Toilet - 6.35 m2							
No Asbestos							
B00B - R1044 - Staff Study - 6.24 m2							
No Asbestos							
B00B - R1046 - Movement - 54.54 m2							
No Asbestos							
B00B - R1048 - Stairs - 2.18 m2							
No Asbestos							
B00B - R1050 - Lift - 2.51 m2							
No Asbestos							
B00B - R1051 - Stairs - 17.1 m2							
No Asbestos							
B00B - R1052 - Stairs - 13.61 m2							
No Asbestos							
B00B - R1053 - Stairs - 6.43 m2							
No Asbestos							
B00B - R1054 - Stairs - 14.11 m2							
No Asbestos							
B00B - R1055 - Movement - 59.9 m2							
No Asbestos							
B00B - R1056 - Movement - 7.43 m2							
No Asbestos							
B00B - R1058 - Administration - Clerical - 8.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1059 - Administration - Clerical - 12.54 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R1060 - Movement - 85.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	85m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R1061 - Movement - 28.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	29m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2001 - Staff Study - 38.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	39m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2002 - General Learning Space - 51.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2003 - General Learning Space - 51.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2004 - Distribution Board Cupboard - .36 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R2005 - General Learning Space - 52.05 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2006 - General Learning Space - 51.12 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2007 - General Learning Space - 51.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2008 - General Learning Space - 52.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00B - R2009 - Computer Learning Space - 52.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00B - R2010 - Staff Study - 14.4 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00B - R2011 - General Storeroom - 5.75 m2								
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R2012 - Staff Study - 7.91 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00B - R2013 - Movement - 142 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	142m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00B - R2014 - General Storeroom - 8.28 m2								
No Asbestos								
B00B - R2015 - Movement - 136 m2								
No Asbestos								
B00B - R2016 - General Storeroom - 11.02 m2								
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R2017 - Staff Study - 26.72 m2								
No Asbestos								
B00B - R2018 - General Learning Space - 52.48 m2								
No Asbestos								
B00B - R2019 - General Learning Space - 54.82 m2								
No Asbestos								
B00B - R2020 - General Learning Space - 54.3 m2								
No Asbestos								
B00B - R2021 - Distribution Board Cupboard - .36 m2								
Note: No inspection of live electrical installation								
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00B - R2022 - General Learning Space - 55.77 m2								
No Asbestos								
B00B - R2023 - General Learning Space - 52.77 m2								
No Asbestos								
B00B - R2024 - General Learning Space - 54.39 m2								
No Asbestos								
B00B - R2025 - Stairs - 14.83 m2								
No Asbestos								
B00B - R2026 - Stairs - 12.76 m2								
No Asbestos								
B00B - R2027 - Stairs - 13.84 m2								
No Asbestos								
B00B - R2028 - Stairs - 18.71 m2								
No Asbestos								

B00B - R2029 - Movement - 7.7 m2							
No Asbestos							
B00C - Pupil Facilities - 1962 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	Surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Interior							
B00C - R0004 - External Movement - 12.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00C - R0007 - Toilets-Boys - 103.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	104m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00C - R0008 - Change - 62.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00D - General Learning - 1957 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	200m2	Surround	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B00D - R0001 - Performance Workspace - 54.13 m2							
No Asbestos							
B00D - R0002 - General Storeroom - 6.42 m2							
No Asbestos							
B00D - R0003 - Special Learning Space - 51.72 m2							
No Asbestos							
B00D - R0004 - General Storeroom - 6.68 m2							
No Asbestos							
B00D - R0005 - General Storeroom - 6.42 m2							
No Asbestos							
B00D - R0006 - General Storeroom - 6.2 m2							
No Asbestos							
B00D - R0007 - Special Learning Space - 53.5 m2							
No Asbestos							
B00D - R0008 - General Storeroom - 4.84 m2							
No Asbestos							
B00D - R0009 - Special Learning Space - 63.32 m2							
No Asbestos							
B00D - R0010 - General Storeroom - 9.59 m2							
No Asbestos							
B00D - R0011 - Staff Study - 11.56 m2							
No Asbestos							
B00D - R0012 - Staff - Toilet - 2.59 m2							

No Asbestos							
B00D - R0013 - Toilets-Disabled - 19.91 m2							
No Asbestos							
B00D - R0014 - Laundry - 12.36 m2							
No Asbestos							
B00D - R0015 - Toilets-Disabled - 21.82 m2							
No Asbestos							
B00D - R0017 - Movement - 1.34 m2							
No Asbestos							
B00D - R0018 - Cleaning Store - Distributed - .57 m2							
No Asbestos							
B00D - R0019 - Toilets-Boys - 15.1 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00D - R0020 - Cleaning Store - Distributed - 2.9 m2							
No Asbestos							
B00D - R0021 - Toilets-Girls - 18.65 m2							
No Asbestos							
B00D - R0022 - Distribution Board Cupboard - 1.28 m2							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0023 - Distribution Board Cupboard - 1.86 m2							Note: No inspection of live electrical installation
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0024 - General Storeroom - .73 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00D - R0025 - Movement - 131.37 m2							
No Asbestos							
B00D - R0026 - Movement - 2.24 m2							
No Asbestos							
B00D - R0027 - Movement - 3.2 m2							
No Asbestos							
B00D - R0028 - Movement - 160.84 m2							
No Asbestos							
B00D - R0029 - Covered Outdoor Space - 76.84 m2							
No Asbestos							
B00D - R0030 - Stairs - 2.75 m2							
No Asbestos							
B00D - R0031 - Stairs - 2.19 m2							
No Asbestos							
B00D - R1001 - Music Learning Space - 67.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1002 - Music Store - 15.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

B00D - R1003 - Performance Workspace - 67.43 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1004 - General Learning Space - 30.99 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	31m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1005 - Music Store - 4.44 m2							
No Asbestos							
B00D - R1006 - Staff Study - 27.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1007 - General Storeroom - 8.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1008 - Staff - Toilet - 7.01 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00D - R1009 - Movement - 104.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	105m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00D - R1010 - Staff Study - 32.49 m2							
No Asbestos							
B00D - R1011 - Stairs - 13.24 m2							
No Asbestos							
B00D - R1012 - Stairs - 14.06 m2							
No Asbestos							
B00E - Science/Technological & Applied Studies - 1970 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00E - R0001 - Laboratory L.S. - 93.63 m2							
No Asbestos							
B00E - R0002 - Distribution Board Cupboard - .96 m2							
No Asbestos							Note: No inspection of live electrical installation
B00E - R0003 - Preparation - 32.7 m2							
No Asbestos							
B00E - R0004 - Laboratory L.S. - 93.63 m2							
No Asbestos							
B00E - R0006 - General Learning Space - 46.56 m2							
No Asbestos							
B00E - R0007 - Movement - 13.01 m2							
No Asbestos							
B00E - R0008 - Cleaning Supplies Store - 3.75 m2							

No Asbestos	
B00E - R0009 - Staff Study - 17.06 m2	
No Asbestos	
B00E - R0010 - General Learning Space - 48.13 m2	
No Asbestos	
B00E - R0011 - Darkroom Space - 30.6 m2	
No Asbestos	
B00E - R0012 - General Learning Space - 52.39 m2	
No Asbestos	
B00E - R0013 - General Learning Space - 52.54 m2	
No Asbestos	
B00E - R0014 - Movement - 103.28 m2	
No Asbestos	
B00E - R0015 - Stairs - 15.51 m2	
No Asbestos	
B00E - R0016 - Senior Study - 72.15 m2	
No Asbestos	
B00E - R0017 - Change - 5.08 m2	
No Asbestos	
B00E - R1001 - Seminar - 39.97 m2	
No Asbestos	
B00E - R1002 - Cleaning Supplies Store - 2.92 m2	
No Asbestos	
B00E - R1003 - Food Technology L.S. - 75.8 m2	
No Asbestos	
B00E - R1004 - Food/Research Space - 25.63 m2	
No Asbestos	
B00E - R1005 - Food Technology L.S. - 103 m2	
No Asbestos	
B00E - R1008 - Staff - Toilet - 5 m2	
No Asbestos	
B00E - R1009 - Laundry - 6.62 m2	
No Asbestos	
B00E - R1010 - Distribution Board Cupboard - .72 m2	Note: No inspection of live electrical installation
No Asbestos	
B00E - R1011 - Secure Storeroom - 6.59 m2	
No Asbestos	
B00E - R1012 - Design L.S. - 57.58 m2	
No Asbestos	
B00E - R1013 - Design L.S. - 74.55 m2	
No Asbestos	
B00E - R1014 - Design L.S. - 74.56 m2	
No Asbestos	
B00E - R1016 - Staff Study - 48.36 m2	
No Asbestos	
B00E - R1017 - Movement - 102.03 m2	
No Asbestos	
B00E - R1018 - Stairs - 13.84 m2	
No Asbestos	
B00F - Library/Science Learning - 1970 - Brick/Block	
Exterior	

Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids - Slab on Ground	No Asbestos Found							
Interior								
B00F - M1001 - Senior Study - 16.12 m2								
No Asbestos								
B00F - M1002 - Senior Study - 14.54 m2								
No Asbestos								
B00F - M1003 - Senior Study - 19.86 m2								
No Asbestos								
B00F - M1004 - Senior Study - 14.54 m2								
No Asbestos								
B00F - M1005 - General Storeroom - 38.36 m2								
No Asbestos								
B00F - M1006 - Plant - 5.64 m2								
No Asbestos								
B00F - M1007 - Movement - 15.5 m2								
No Asbestos								
B00F - M1008 - Stairs - 2.43 m2								
No Asbestos								
B00F - M1009 - Stairs - 2.43 m2								
No Asbestos								
B00F - R0001 - Laboratory L.S. - 91.32 m2								
No Asbestos								
B00F - R0002 - Staff Study - 48.67 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00F - R0003 - Laboratory L.S. - 91.39 m2								
No Asbestos								
B00F - R0004 - Laboratory L.S. - 91.4 m2								
No Asbestos								
B00F - R0005 - Chemical Store - 1.84 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00F - R0006 - Preparation - 44.79 m2								
No Asbestos								
B00F - R0007 - Laboratory L.S. - 91.4 m2								
No Asbestos								
B00F - R0008 - Apparatus Store - 17.06 m2								
No Asbestos								
B00F - R0009 - Distribution Board Cupboard - .47 m2						Note: No inspection of live electrical installation		
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00F - R0010 - Movement - 40.37 m2								
No Asbestos								
B00F - R0011 - Movement - 30.42 m2								
No Asbestos								
B00F - R0012 - Cleaning Supplies Store - 7.85 m2								
No Asbestos								
B00F - R0013 - Plant - 9.68 m2								
No Asbestos								
B00F - R0014 - Stairs - 8.11 m2								

No Asbestos							
B00F - R1001 - Seminar - 12.8 m2							
No Asbestos							
B00F - R1002 - Seminar - 12.15 m2							
No Asbestos							
B00F - R1003 - No Access - 13.15 m2							
No Asbestos							
B00F - R1004 - Cleaning Supplies Store - .62 m2							
No Asbestos							
B00F - R1005 - Movement - 4.24 m2							
No Asbestos							
B00F - R1006 - Distribution Board Cupboard - .26 m2						Note: No inspection of live electrical installation	
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R1007 - Seminar - 12.09 m2							
No Asbestos							
B00F - R1008 - General Storeroom - 12.64 m2							
No Asbestos							
B00F - R1009 - Main Area - 323.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B00F - R1010 - Audio Visual Workroom - 28.63 m2							
No Asbestos							
B00F - R1011 - Administration - Clerical - 9.3 m2							
No Asbestos							
B00F - R1012 - General Storeroom - 12.72 m2							
No Asbestos							
B00F - R1013 - Workroom - 17.53 m2							
No Asbestos							
B00F - R1014 - Staff - Toilet - 2.77 m2							
No Asbestos							
B00F - R1015 - Movement - 27.9 m2							
No Asbestos							
B00F - R1016 - Movement - 3.11 m2							
No Asbestos							
B00F - R1017 - Staff - Toilet - 2.79 m2							
No Asbestos							
B00F - R1018 - Computer Learning Space - 72.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00F - R1019 - Stairs - 16.63 m2							
No Asbestos							
B00F - R1020 - Stairs - 1.96 m2							
No Asbestos							
B00F - R1021 - Stairs - 2.3 m2							
No Asbestos							
B00G - Physical Education - 1987 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							

B00G - R0001 - External Movement - 8.6 m2		
No Asbestos		
B00G - R0002 - Sport Equipment Store - 39.34 m2		
No Asbestos		
B00G - R0005 - Distribution Board Cupboard - .63 m2		Note: No inspection of live electrical installation
No Asbestos		
B00G - R0006 - Movement - 8.6 m2		
No Asbestos		
B00G - R0007 - External Movement - 8.63 m2		
No Asbestos		
B00G - R0008 - Shower/Change - 27.56 m2		
No Asbestos		
B00G - R0009 - Staff Change - 5.4 m2		
No Asbestos		
B00G - R0010 - Shower/Change - 27.56 m2		
No Asbestos		
B00G - R0011 - External Movement - 8.63 m2		
No Asbestos		
B00G - R0012 - Gymnasium - 457.99 m2		
No Asbestos		
B00G - R0013 - Staff Study - 21.51 m2		
No Asbestos		
B00G - R0014 - Sport Equipment Store - 40.94 m2		
No Asbestos		
B00H - Agricultural Science - 1962 - Brick/Veneer		
Exterior		
Ceiling Voids - Raked Ceiling	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00H - R0001 - Machine Storage - 38.22 m2		
No Asbestos		
B00H - R0002 - Class Tools Storage - 36.65 m2		
Wall Linings Internal	Flat AC Sheeting	
B00H - R0003 - Animal Space - 25.14 m2		
Wall Linings Internal	Flat AC Sheeting	
B00H - R0004 - Plant Space - 11.37 m2		
Wall Linings Internal	Flat AC Sheeting	
B00J - Technological & Applied Studies - 2011 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00J - R0001 - Materials Learning Space - Type 1 - 116.34 m2		
No Asbestos		
B00J - R0002 - Project Store - Type 1 - 11.23 m2		
No Asbestos		
B00J - R0003 - Materials Store - 15.2 m2		
No Asbestos		
B00J - R0004 - Distribution Board Cupboard - .71 m2		Note: No inspection of live electrical installation

No Asbestos	
B00J - R0005 - Outdoor Learning Area - 33.5 m2	
No Asbestos	
B00J - R0006 - Dust Extraction Space - 3.91 m2	
No Asbestos	
B00J - R0007 - External Movement - 8.95 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020