


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lake Macquarie High School (8210)
Region:	Hunter/Central Coast AMU
State Electorate:	Lake Macquarie
Local Government Area:	Lake Macquarie

Last Reviewed By:	WSP 30-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.	

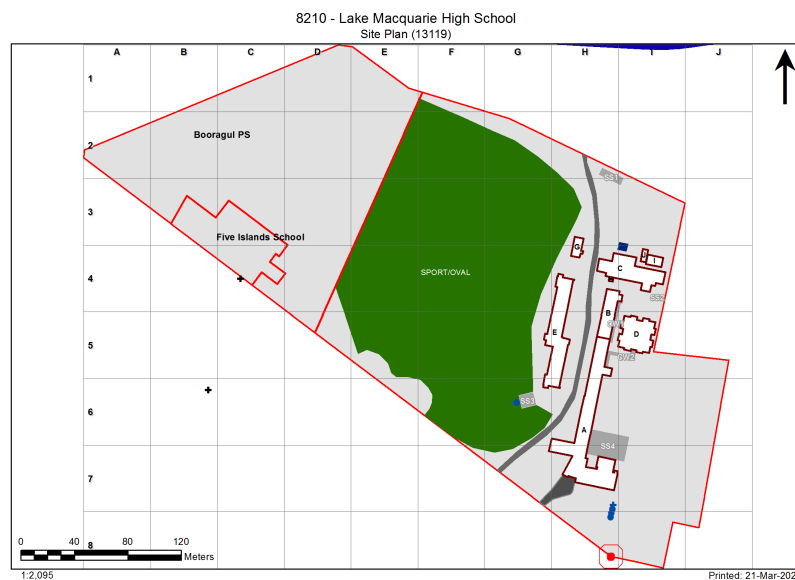

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Various - 1958 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	5	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00A - R0001 - Movement - 118.08 m2							
No Asbestos							
B00A - R0002 - Toilets-Girls - 32.41 m2							
No Asbestos							
B00A - R0003 - Cleaning Store - Distributed - 1.25 m2							
No Asbestos							
B00A - R0004 - General Storeroom - 3.42 m2							
No Asbestos							
B00A - R0005 - Garden Store Room - 13.88 m2							
No Asbestos							
B00A - R0006 - Movement - 149.27 m2							
No Asbestos							
B00A - R0007 - General Storeroom - 1.97 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0008 - Multi-Purpose Space - 10.91 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0009 - Staff - Toilet - 2.91 m2							
No Asbestos							
B00A - R0010 - Student Canteen - 49.12 m2							
No Asbestos							
B00A - R0011 - Movement - 192.54 m2							
No Asbestos							
B00A - R0012 - Toilets-Boys - 50.03 m2							
No Asbestos							
B00A - R0013 - Performance Workspace - 71.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	72m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0014 - Distribution Board Cupboard - 5.62 m2							
Note: No inspection of live electrical installation							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0015 - Cleaning Supplies Store - 6.13 m2							
No Asbestos							
B00A - R0016 - Cleaning Store - Distributed - 6.28 m2							
No Asbestos							
B00A - R0017 - General Storeroom - 11.79 m2							
No Asbestos							
B00A - R0018 - Multi-Purpose Space - 70.64 m2							
No Asbestos							
B00A - R0019 - Cleaning Supplies Store - 11.43 m2							

No Asbestos							
B00A - R0020 - General Storeroom - 50.2 m2							
No Asbestos							
B00A - R0021 - Stairs - .41 m2							
No Asbestos							
B00A - R0022 - Stairs - 8.13 m2							
No Asbestos							
B00A - R0023 - Movement - 5.12 m2							
No Asbestos							
B00A - R0024 - Movement - 2.19 m2							
No Asbestos							
B00A - R0025 - Movement - 2.2 m2							
No Asbestos							
B00A - R0026 - Movement - 16.33 m2							
No Asbestos							
B00A - R0027 - Movement - 11.04 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0028 - General Storeroom - 70.83 m2							
No Asbestos							
B00A - R1001 - Computer Learning Space - 56.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1002 - Staff Study - 38.1 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	39m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1003 - Staff Study - 18.32 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00A - R1004 - Staff Study - 34.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	35m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1005 - Staff - Toilet - 4.97 m2							
No Asbestos							
B00A - R1006 - Cleaning Supplies Store - 3.52 m2							
No Asbestos							
B00A - R1007 - General Storeroom - 8.55 m2							
No Asbestos							
B00A - R1008 - General Learning Space - 50.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1009 - General Learning Space - 50.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

B00A - R1010 - General Learning Space - 50.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1011 - General Learning Space - 50.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1012 - General Learning Space - 50.26 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1013 - General Learning Space - 50.33 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1014 - Duplicating Workroom - 27.23 m2							
No Asbestos							
B00A - R1015 - Deputy Principal Office - 13.7 m2							
No Asbestos							
B00A - R1016 - Multi-Purpose Space - 7.43 m2							
No Asbestos							
B00A - R1021 - Stage - 92.51 m2							
No Asbestos							
B00A - R1022 - Multi-Purpose Space - 260.45 m2							
No Asbestos							
B00A - R1023 - Control Room - 9.18 m2							
No Asbestos							
B00A - R1024 - Interview/Office - Type 1 - 15.59 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1025 - Public Entry - 71.49 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	72m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1026 - Sport Equipment Store - 10.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1027 - Ancillary Staff - 19.88 m2							
No Asbestos							
B00A - R1028 - Staff - Toilet - 5.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1029 - General Storeroom - 14.79 m2							
No Asbestos							
B00A - R1032 - Principal Office - 16.55 m2							

No Asbestos							
B00A - R1033 - Staff - Toilet - 3.33 m2							
No Asbestos							
B00A - R1034 - General Storeroom - 1.8 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00A - R1035 - Clinic - Girls - 5.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00A - R1036 - Clinic - Boys - 5.34 m2							
No Asbestos							
B00A - R1037 - Staff - Toilet - 3.61 m2							
No Asbestos							
B00A - R1038 - Movement - 1.86 m2							
No Asbestos							
B00A - R1039 - Staff - Toilet - 4.14 m2							
No Asbestos							
B00A - R1040 - Movement - 2.15 m2							
No Asbestos							
B00A - R1041 - Administration - Clerical - 10.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R1043 - Stairs - 11.48 m2							
No Asbestos							
B00A - R1044 - Stairs - 13.66 m2							
No Asbestos							
B00A - R1045 - Stairs - 9.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1046 - Stairs - 12.45 m2							
No Asbestos							
B00A - R1047 - Stairs - 5.14 m2							
No Asbestos							
B00A - R1048 - Chair Store - 7.61 m2							
No Asbestos							
B00A - R1049 - Staff - Toilet - 3.49 m2							
No Asbestos							
B00A - R1050 - Student Canteen - 13.64 m2							
No Asbestos							
B00A - R1051 - Student Canteen - 69.65 m2							
No Asbestos							
B00A - R1052 - Movement - 2.67 m2							
No Asbestos							
B00A - R1053 - Movement - 2.97 m2							
No Asbestos							
B00A - R1054 - Movement - 19.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R1055 - Movement - 223.63 m2							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R1056 - Administration - Clerical - 60.42 m2							
No Asbestos							
B00A - R1057 - Movement - 19.42 m2							
Electrical - Mounting Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R2001 - Staff Study - 29.75 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2002 - Staff Study - 34.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	35m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	35m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R2003 - Staff Study - 8.46 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2004 - Cleaning Store - Distributed - 3.52 m2							
No Asbestos							
B00A - R2005 - Staff - Toilet - 4.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R2006 - General Learning Space - 50.09 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2007 - General Learning Space - 49.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2008 - General Learning Space - 50.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2009 - General Learning Space - 49.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2010 - General Learning Space - 49.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2011 - General Learning Space - 49.64 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

B00A - R2013 - General Learning Space - 50.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2014 - Leading Teacher - 15.25 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2015 - General Storeroom - 23.45 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2016 - Multi-Purpose Space - 13.94 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2017 - Commonroom - 129.88 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	130m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R2018 - Movement - 193.48 m2							
Electrical - Backing Board	Resinous Board	2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R2019 - Stairs - 15.45 m2							
No Asbestos							
B00A - R2020 - Stairs - 11.48 m2							
No Asbestos							
B00B - Various - 1958 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	5	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00B - R0001 - Laundry - 15.58 m2							
No Asbestos							
B00B - R0002 - Food Technology L.S. - 115.27 m2							
No Asbestos							
B00B - R0003 - Preparation - 15.41 m2							
No Asbestos							
B00B - R0004 - Food Technology L.S. - 110.01 m2							
No Asbestos							
B00B - R0005 - Movement - 6.61 m2							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0006 - Cleaning Store - Distributed - 2.8 m2							
No Asbestos							
B00B - R0007 - Staff Study - 14.6 m2							
No Asbestos							
B00B - R0008 - Food/Research Space - 11.78 m2							
No Asbestos							

B00B - R0009 - Staff - Toilet - 3.67 m2							
No Asbestos							
B00B - R0010 - Food/Research Space - 5.69 m2							
No Asbestos							
B00B - R0011 - Stairs - 6.3 m2							
No Asbestos							
B00B - R0012 - Movement - 1.05 m2							
No Asbestos							
B00B - R0013 - Movement - 1.04 m2							
No Asbestos							
B00B - R0014 - Stairs - 4.45 m2							
No Asbestos							
B00B - R0015 - Movement - 2.52 m2							
No Asbestos							
B00B - R1001 - General Learning Space - 55.07 m2							
No Asbestos							
B00B - R1002 - Materials Technology L.S. - 59.5 m2							
No Asbestos							
B00B - R1003 - Materials Store - 8.39 m2							
No Asbestos							
B00B - R1004 - Resources Store - 11.43 m2							
No Asbestos							
B00B - R1005 - Materials Store - 8.27 m2							
No Asbestos							
B00B - R1006 - Materials Store - 9.89 m2							
No Asbestos							
B00B - R1007 - Art Learning Space - 62.66 m2							
No Asbestos							
B00B - R1008 - Interview/Office - Type 1 - 7.19 m2							
No Asbestos							
B00B - R1009 - General Storeroom - 6.55 m2							
No Asbestos							
B00B - R1010 - Staff - Toilet - 6.5 m2							
No Asbestos							
B00B - R1011 - Cleaning Store - Distributed - 2.08 m2							
No Asbestos							
B00B - R1012 - Movement - 53.35 m2							
No Asbestos							
B00B - R1013 - Movement - 2.7 m2							
No Asbestos							
B00B - R1014 - Stairs - 6.26 m2							
No Asbestos							
B00B - R1015 - Stairs - 15.13 m2							
No Asbestos							
B00C - Various - 1958 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Insulation Material	5	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						

Interior							
B00C - R0004 - Movement - 9.25 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0005 - Cleaning Store - Distributed - 3.37 m2							
No Asbestos							
B00C - R0009 - Stairs - 4.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0011 - Bulk Store - 8.64 m2							
Material - Packing	Flat AC Sheeting	10	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0012 - General Learning Space - 36.08 m2							
No Asbestos							
B00C - R0013 - Workshop Area - 163.93 m2							
No Asbestos							
B00C - R0014 - Welding Area - 4.28 m2							
No Asbestos							
B00C - R0015 - Welding Area - 4.28 m2							
No Asbestos							
B00C - R0016 - Welding Area - 4.28 m2							
No Asbestos							
B00C - R0017 - General Learning Space - 57.01 m2							
No Asbestos							
B00C - R0018 - Workshop Area - 44.24 m2							
No Asbestos							
B00C - R1001 - Materials Technology L.S. - 105.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	106m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1002 - Movement - 8.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1003 - Staff Study - 20.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00C - R1004 - Staff Change - 5.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1005 - Staff - Toilet - 2.44 m2							
No Asbestos							
B00C - R1006 - Cleaning Store - Distributed - 2.35 m2							
No Asbestos							
B00C - R1007 - Movement - 59.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R1008 - Materials Technology L.S. - 132.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	133m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	80m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Furniture / Fixtures	Compressed AC Sheet	1	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00C - R1009 - Staff Study - 9.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1010 - Resource/Project Store - 16.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1011 - Staff Study - 9.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive						
B00C - R1012 - Resource/Project Store - 15.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1013 - Design L.S. - 52.16 m2							
Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	200m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1014 - General Learning Space - 51.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	180m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1015 - Multi-Purpose Space - 4.06 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1016 - Resources Space - 11.44 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1017 - Staff Study - 8.61 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1018 - Stairs - 7.82 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - Various - 1984 - Brick/Veneer							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0001 - Main Area - 402.32 m2							

No Asbestos							
B00D - R0002 - Resources Store - 4.89 m2							
No Asbestos							
B00D - R0003 - Audio Visual Workroom - 34.78 m2							
No Asbestos							
B00D - R0004 - Workroom - 40.57 m2							
No Asbestos							
B00D - R0005 - Librarian - 11.85 m2							
No Asbestos							
B00D - R0006 - Entry - 16 m2							
No Asbestos							
B00D - R0007 - Distribution Board Cupboard - 1.23 m2							
							Note: No inspection of live electrical installation
Wall Linings Internal	Flat AC Sheeting						
Electrical - Backing Board	Resinous Board	2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0008 - Staff - Toilet - 2.39 m2							
No Asbestos							
B00D - R0009 - Staff - Toilet - 2.4 m2							
No Asbestos							
B00D - R0010 - Cleaning Store - Distributed - .88 m2							
No Asbestos							
B00D - R0011 - Seminar - 13.47 m2							
No Asbestos							
B00D - R0012 - Seminar - 20.71 m2							
No Asbestos							
B00E - Various - 1973 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting						
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
External Roof Structure	Resinous Membrane	12	North,South and west porches	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00E - R0002 - Preparation - 37.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0004 - General Learning Space - 52.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R0005 - General Learning Space - 52.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R0006 - Staff - Toilet - 6.59 m2							

No Asbestos							
B00E - R0007 - Cleaning Store - Distributed - 3.95 m2							
No Asbestos							
B00E - R0008 - Chemical Store - 11.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Wall Linings Internal	Compressed AC Sheet						
B00E - R0009 - Apparatus Store - 25.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0010 - Laboratory L.S. - 85.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	8m2	East	Mnimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00E - R0011 - Preparation - 38.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	39m2	Throughout	Mnimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00E - R0012 - Laboratory L.S. - 86.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	87m2	Throughout	Mnimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos)
B00E - R0013 - Cleaning Store - Distributed - 1.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0014 - Cleaning Store - Distributed - 1.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0015 - Movement - 123.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0016 - Movement - 97.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00E - R0017 - Movement - 6.3 m2							
No Asbestos							
B00E - R0018 - Stairs - 1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0019 - Stairs - 2.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0020 - Movement - 7.59 m2							
No Asbestos							
B00E - R0021 - Stairs - .82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0022 - Stairs - 22.81 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00E - R0023 - Movement - 3.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0024 - Movement - 6.31 m2							

Ceiling Structures/Linings	No Asbestos Found	
B00E - R0025 - General Learning Space - Type 3 - 40.15 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R0026 - Science Laboratory - 45.58 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R0027 - Science Laboratory - 46.82 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R0028 - General Learning Space - Type 3 - 40.31 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1001 - Music Learning Space - 66.28 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive	
B00E - R1002 - Music Store - 12.67 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1003 - Music Learning Space - 52.53 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
Floor Coverings Res/Textile	Vinyl Sheet - Adhesive	
B00E - R1004 - Materials Store - 6.27 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1005 - Darkroom Space - 6.23 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1006 - Darkroom Space - 13.6 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1007 - Workroom - 11.41 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1008 - Resource/Project Store - 11.5 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1009 - Art Learning Space - 95.82 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00E - R1010 - Resources Store - 11.16 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1011 - Staff Study - 26.23 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	
B00E - R1012 - Staff - Toilet - 6.49 m2		
No Asbestos		
B00E - R1013 - General Storeroom - 13.06 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Sheet	
B00E - R1014 - Staff Study - 39.45 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	
B00E - R1015 - Computer Store - 5.04 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1016 - Resources Store - 5.09 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1017 - Cleaning Store - Distributed - 2.1 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1018 - Computer Learning Space - 52.53 m2		
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
B00E - R1019 - Workroom - 12.72 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	
B00E - R1020 - Staff Study - 12.79 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	
Floor Coverings Res/Textile	Vinyl Sheet	
B00E - R1021 - Senior Study - 65.38 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
Floor Coverings Res/Textile	Vinyl Sheet	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	
B00E - R1022 - Staff Study - 12.82 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Floor Coverings Res/Textile	Vinyl Sheet	

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00E - R1023 - Computer Resource - 12.86 m2								
Floor Coverings Res/Textile	Vinyl Sheet							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1024 - Staff Study - 11.87 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
B00E - R1025 - Stairs - 16.34 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1026 - Movement - 109.04 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00E - R1028 - Stairs - 4.75 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R1030 - Stairs - 15.96 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R1031 - Movement - 82.6 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Electrical - Backing Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
B00E - R2001 - General Storeroom - 6.61 m2								
No Asbestos								
B00E - R9001 - Sport Equipment Store - 50.16 m2								
No Asbestos								
B00E - R9002 - Shower/Change - 49.06 m2								
No Asbestos								
B00E - R9003 - Shower/Change - 5.36 m2								
No Asbestos								
B00E - R9004 - Movement - 15.76 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R9005 - Stairs - 2.99 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00E - R9006 - Movement - 17.77 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00G - Multi Purpose Facilities - 2010 - Steel								
Exterior								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B00G - R0001 - External Movement - 3.13 m2								

No Asbestos		
B00G - R0002 - Staff Kitchen - 10.94 m2		
No Asbestos		
B00G - R0003 - Staff - Toilet - 3.01 m2		
No Asbestos		
B00G - R0004 - Toilet - Lobby - 2.16 m2		
No Asbestos		
B00G - R0005 - Movement - 2.16 m2		
No Asbestos		
B00G - R0006 - Staff Shower - 3 m2		
No Asbestos		
B00G - R0007 - Staff Study - 47.83 m2		
No Asbestos		
B00G - R0008 - Careers Advisers Office - 10.59 m2		
No Asbestos		
B00G - R0009 - Aboriginal Resource Centre - 10.59 m2		
No Asbestos		
B00H - Mechanical Services - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Eaves Linings	Flat AC Sheeting	
Interior		
B00H - R0001 - Plant - 5.37 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00I - Storage - 2005 - Metal Shed		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00I - R0001 - Bulk Store - 78.26 m2		
No Asbestos		
B00J - Storage - 2014 - Metal Shed		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00J - R0001 - General Assistants - 34.63 m2		
No Asbestos		

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020