


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Lake Illawarra High School (8474)</b>
<b>Region:</b>	<b>Southern NSW AMU</b>
<b>State Electorate:</b>	<b>Shellharbour</b>
<b>Local Government Area:</b>	<b>Shellharbour</b>

<b>Last Reviewed By:</b>	<b>Greencap 26-AUG-2014</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

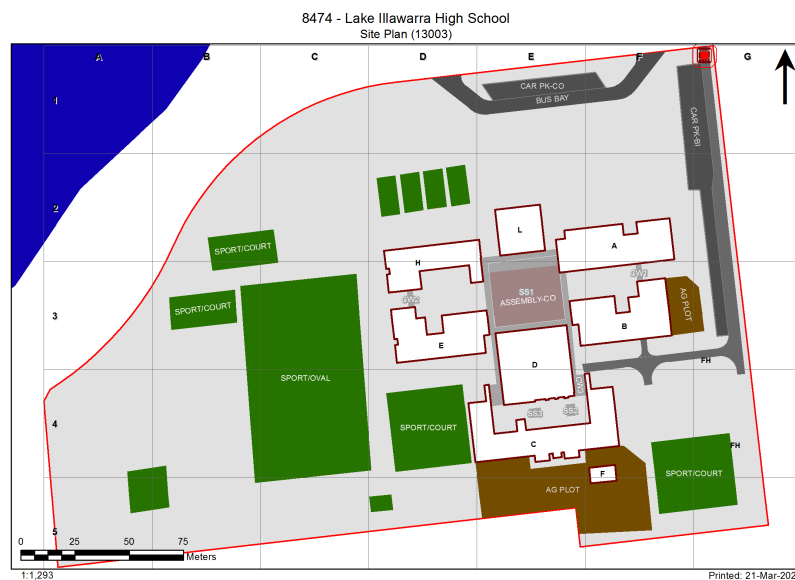

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/workingwithus/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/General Learning - 1974 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00A - R0001 - Interview/Office - Type 1 - 12.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	12.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0002 - Cleaning Store - Distributed - 3.37 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	3.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Darkroom Space - 13.32 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0007 - External Movement - 10.44 m2</b>							
No Asbestos							
<b>B00A - R0008 - Careers Advisers Office - 13.39 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	13.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0009 - Interview/Office - Type 1 - 13.28 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	13.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - External Movement - 27.24 m2</b>							
No Asbestos							
<b>B00A - R0011 - Sport Equipment Store - 5.75 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	5.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0012 - Commonroom - 126.52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0013 - External Movement - 9.12 m2</b>							
No Asbestos							
<b>B00A - R0014 - General Storeroom - 5.57 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0015 - Staff - Toilet - 20.08 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00A - R0016 - Clinic-Waiting - 25.81 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00A - R0017 - General Storeroom - 9.14 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
<b>B00A - R0018 - Duplicating Workroom - 21.71 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00A - R0019 - Staff - Toilet - 5.17 m2</b>								
No Asbestos								
<b>B00A - R0020 - Staff - Toilet - 5.21 m2</b>								
No Asbestos								
<b>B00A - R0021 - Movement - 46.81 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	46.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0022 - General Storeroom - 7.4 m2</b>								
No Asbestos								
<b>B00A - R0023 - External Movement - 87.83 m2</b>								
No Asbestos								
<b>B00A - R0024 - Public Entry - 16.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	16.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0025 - Administration - Clerical - 11.6 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	11.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0026 - Administration - Clerical - 28.91 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	28.91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28.91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0027 - Principal Office - 21.95 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	21.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0028 - Staff - Toilet - 3.33 m2</b>								
No Asbestos								

<b>B00A - R0029 - General Storeroom - 1.87 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0030 - Security Store - 13.62 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0031 - Distribution Board Cupboard - 1.41 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	1.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	1.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0032 - Staff - Toilet - 21.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0033 - Staff Change - 5.59 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0034 - External Movement - 9.15 m2</b>							
No Asbestos							
<b>B00A - R0035 - Interview/Office - Type 1 - 10.82 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	10.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10.82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0036 - Interview/Office - Type 1 - 11.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	11.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0037 - Toilets-Girls - 6.4 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0038 - Toilets-Boys - 5.95 m2</b>							
No Asbestos							
<b>B00A - R0039 - Interview/Office - Type 1 - 12.17 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	12.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0040 - Interview/Office - Type 1 - 12.07 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	12.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.07m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0041 - Movement - 57.15 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	57.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0042 - Art Learning Space - 45.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	45.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	45.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0043 - General Learning Space - 41.61 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	41.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	41.61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0044 - Dark Room - 18.33 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R0045 - External Stairs - 16 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00A - R0046 - External Stairs - 17.31 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	17.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00A - R1001 - General Learning Space - 64.02 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	64.02m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1002 - General Learning Space - 64.22 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	64.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1003 - General Learning Space - 53.8 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1004 - Movement - 21.22 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	21.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	21.22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

<b>B00A - R1005 - External Movement - 58.15 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Over stairs	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	58.15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	51.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1006 - Study Space - 39.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	39.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	39.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1007 - Cleaning Store - Distributed - 1.45 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R1008 - Toilets-Boys - 17.22 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1009 - Distribution Board Cupboard - .7 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1010 - Toilets-Girls - 18.59 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubides)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1011 - Clinic - Boys - 12.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	12.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1012 - Clinic - Girls - 16.62 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	16.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1013 - General Storeroom - 5.85 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	5.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.85m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1014 - Deputy Principal Office - 16.57 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	16.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1015 - Leading Teacher - 12.53 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	12.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1016 - Movement - 74.59 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	74.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	74.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1017 - External Movement - 63.26 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Over stairs	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1018 - Staff Study - 30.56 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	30.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	30.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1019 - General Learning Space - 52.77 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1020 - General Learning Space - 52.77 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1021 - General Learning Space - 53.14 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1022 - General Learning Space - 53.8 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1023 - External Stairs - 23.18 m2</b>								



Ceiling Structures/Linings	Flat AC Sheeting	23.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R1024 - External Stairs - 24 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24.0m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - Science/Agricultural Science - 1974 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00B - R0001 - Laboratory L.S. - 71.12 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles	71.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0002 - Computer Resource - 22.31 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	22.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0003 - Apparatus Store - 12.77 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	12.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Staff Study - 32.65 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	32.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - General Storeroom - 3.36 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0007 - Distribution Board Cupboard - .59 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
No Asbestos							
<b>B00B - R0008 - Workshop Area - 42.37 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	42.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0009 - Laboratory L.S. - 93.84 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R0010 - Preparation - 36.45 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0011 - Chemical Store - 3.76 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0012 - Growing/Breeding - 14.08 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0014 - General Storeroom - 7.43 m2</b>								
No Asbestos								
<b>B00B - R0015 - Toilets-Girls - 20.65 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet							
<b>B00B - R0016 - Toilets-Boys - 17.51 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet							
<b>B00B - R0017 - Cleaning Store - Distributed - 1.51 m2</b>								
No Asbestos								
<b>B00B - R0018 - Study Space - 25.81 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00B - R0019 - Distribution Board Cupboard - .62 m2</b>								
<b>Note: No inspection of live electrical installation</b>								
No Asbestos								
<b>B00B - R0020 - Apparatus Store - 37.63 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R0021 - General Storeroom - 14.35 m2</b>								
No Asbestos								
<b>B00B - R0022 - Lift - .84 m2</b>								
No Asbestos								
<b>B00B - R0023 - External Movement - 169.28 m2</b>								
No Asbestos								
<b>B00B - R0024 - External Stairs - 15.43 m2</b>								
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00B - R0025 - External Stairs - 8.23 m2</b>								
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00B - R0026 - Laboratory L.S. - 93.93 m2</b>								
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00B - R0027 - Laboratory L.S. - 89.11 m2</b>								
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00B - R1002 - Distribution Board Cupboard - .57 m2</b>								
<b>Note: No inspection of live electrical installation</b>								
No Asbestos								
<b>B00B - R1003 - Preparation - 32.56 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1004 - Apparatus Store - 3.54 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00B - R1005 - Apparatus Store - 12.82 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

<b>B00B - R1011 - Plant - .71 m2</b>							
Electrical - Backing Board	Resinous Board	.2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1013 - Toilets-Girls - 19.55 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00B - R1014 - Toilets-Girls - 17.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1015 - Cleaning Store - Distributed - 1.52 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1016 - External Movement - 4.43 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1017 - General Storeroom - 7.71 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1018 - Plant Space - 12.46 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R1019 - Distribution Board Cupboard - .65 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	0.2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1020 - Chemical Store - 37.14 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1021 - Lift - .84 m2</b>							
No Asbestos							
<b>B00B - R1022 - External Movement - 139.36 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	140m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1023 - External Stairs - 24.06 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24.06m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R1024 - External Stairs - 23.25 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	23.25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R1028 - Laboratory L.S. - 87.41 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R1029 - Laboratory L.S. - 87.32 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00B - R1030 - Preparation - Science - 52.24 m2</b>							
Ceiling Structures/Linings	Non Accessible Area	m2					
<b>B00B - R1031 - Laboratory L.S. - 86.42 m2</b>							
Wall Linings Internal	Flat AC Sheeting						

<b>B00B - R1032 - Laboratory L.S. - 86.24 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00C - Art/Technological &amp; Applied Studies - 1974 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00C - R0001 - General Assistants - 13.17 m2</b>							
No Asbestos							
<b>B00C - R0002 - Staff - Toilet - 4.35 m2</b>							
No Asbestos							
<b>B00C - R0004 - Maintenance Bulk Store - 18.64 m2</b>							
No Asbestos							
<b>B00C - R0006 - Distribution Board Cupboard - .58 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00C - R0016 - Materials Technology L.S. - 77.48 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - R0017 - Wood Technology Bay - 13.41 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0018 - Wood Technology Bay - 19.21 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00C - R0019 - Materials Technology L.S. - 77.67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - R0020 - General Learning Space - 31.53 m2</b>							
No Asbestos							
<b>B00C - R0021 - General Storeroom - 6.23 m2</b>							
No Asbestos							
<b>B00C - R0022 - General Storeroom - 5.86 m2</b>							
No Asbestos							
<b>B00C - R0023 - Distribution Board Cupboard - .59 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00C - R0024 - Art Learning Space - 66.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0025 - Kiln Space - 69.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting						
<b>B00C - R0034 - Distribution Board Cupboard - .57 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
Electrical - Backing Board	Resinous Board	1.0	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0036 - Dust Extraction Space - 7.17 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0037 - Cleaning Store - Distributed - 6.13 m2</b>							
No Asbestos							
<b>B00C - R0038 - General Storeroom - 6.13 m2</b>							
No Asbestos							

B00C - R0039 - Art Learning Space - 67.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles	67.47m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0040 - Movement - 3.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0041 - Craft Store - 17.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0042 - Art Learning Space - 62.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles	62.92m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
B00C - R0043 - Darkroom Space - 3.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0044 - Dark Room - 37.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0045 - General Storeroom - 2.38 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
B00C - R0046 - External Stairs - 6.31 m2							
No Asbestos							
B00C - R0047 - Store - 20.54 m2							
No Asbestos							
B00C - R0048 - Store - 20.68 m2							
No Asbestos							
B00C - R0049 - External Stairs - 6.8 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0050 - External Stairs - 6.8 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0054 - Metal Technology Bay - 89.29 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00C - R0055 - Metal Technology Bay - 107.65 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00C - R0056 - Store - 10.01 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00C - R0057 - Metal Technology Bay - 80.08 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00C - R0058 - Workshop Area - 3.85 m2							

Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00C - R0059 - Welding Area - 3.94 m2</b>								
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00C - R0060 - Welding Area - 3.92 m2</b>								
Ceiling Structures/Linings	Non Accessible Area	m2						
<b>B00C - R0061 - External Movement - 30.03 m2</b>								
No Asbestos								
<b>B00C - R0062 - External Movement - 116.6 m2</b>								
No Asbestos								
<b>B00C - R1001 - Staff Study - 55.79 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00C - R1002 - Staff - Toilet - 10.28 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1003 - Staff - Toilet - 10.34 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1004 - Distribution Board Cupboard - .54 m2</b>								
<b>Note: No inspection of live electrical installation</b>								
No Asbestos								
<b>B00C - R1005 - Computer Learning Space - 66.07 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R1006 - Computer Resource - 23.29 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00C - R1007 - Design L.S. - 66.36 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	66.36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1008 - Movement - 7.17 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	7.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1009 - Food Technology L.S. - 94.42 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
Floor Coverings Res/Textile	Vinyl Tiles	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1010 - Laundry - 14.49 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1011 - Food/Research Space - 16.67 m2</b>								

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1012 - Staff Study - 15.16 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00C - R1013 - Food/Research Space - 95.69 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
Floor Coverings Res/Textile	Vinyl Tiles	96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1014 - External Movement - 4.62 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00C - R1015 - Commonroom - 31.7 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1016 - Cleaning Supplies Store - 11.43 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1017 - Distribution Board Cupboard - .59 m2</b>								
						<b>Note: No inspection of live electrical installation</b>		
No Asbestos								
<b>B00C - R1018 - Design L.S. - 69.57 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	3m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R1019 - Materials Store - 5.12 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	5.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1020 - Design L.S. - 69.28 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1021 - Materials Store - 6.3 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R1022 - External Movement - 2.79 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00C - R1023 - External Movement - 4.76 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00C - R1024 - General Storeroom - 19.39 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							

Floor Coverings Res/Textile	Vinyl Tiles	19.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1025 - Cleaning Supplies Store - 13.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	13.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1026 - Distribution Board Cupboard - .56 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00C - R1027 - External Movement - 160.41 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	161m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1028 - External Stairs - 10.32 m2</b>							
No Asbestos							
<b>B00D - Other - 1974 - Brick/Block</b>							
<b>Exterior</b>							
Wall Linings Internal - Infill	Compressed AC Sheet						
Electrical - Backing Board	Resinous Board	2.4	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - Student Canteen - 59.43 m2</b>							
No Asbestos							
<b>B00D - R0002 - Office/Store - 11.56 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0003 - Staff - Toilet - 10.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0004 - Staff Study - 11.2 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0005 - External Movement - 4.86 m2</b>							
No Asbestos							
<b>B00D - R0006 - General Storeroom - .89 m2</b>							
No Asbestos							
<b>B00D - R0007 - Shower/Change - 24.94 m2</b>							
No Asbestos							
<b>B00D - R0008 - Toilets-Girls - 14.85 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0009 - Shower/Change - 43.85 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0010 - Movement - .87 m2</b>							
No Asbestos							
<b>B00D - R0011 - Shower/Change - 25.07 m2</b>							
No Asbestos							
<b>B00D - R0012 - Toilets-Girls - 14.72 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0013 - External Movement - 30.47 m2</b>							
No Asbestos							



<b>B00D - R0014 - Plant - 3.27 m2</b>							
No Asbestos							
<b>B00D - R0016 - Performing Arts Store - 20.05 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0017 - Performance Workspace - 103.11 m2</b>							
No Asbestos							
<b>B00D - R0018 - External Movement - 5.68 m2</b>							
No Asbestos							
<b>B00D - R0020 - Sport Equipment Store - 8.55 m2</b>							
No Asbestos							
<b>B00D - R0021 - Cleaning Store - Distributed - 2.25 m2</b>							
No Asbestos							
<b>B00D - R0022 - Main Switchroom - 9.51 m2</b>							
No Asbestos							
<b>B00D - R0023 - Sport Equipment Store - 8.23 m2</b>							
No Asbestos							
<b>B00D - R0024 - External Movement - 4.85 m2</b>							
No Asbestos							
<b>B00D - R0025 - Sport Equipment Store - 62.24 m2</b>							
No Asbestos							
<b>B00D - R0026 - Pupil Entry - 67.01 m2</b>							
No Asbestos							
<b>B00D - R0027 - Multi-Purpose Space - 457.8 m2</b>							
No Asbestos							
<b>B00D - R1001 - External Movement - 1.03 m2</b>							
No Asbestos							
<b>B00D - R1002 - Shower/Change - 32.29 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1003 - Toilets-Boys - 6.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1004 - Cleaning Store - Distributed - 2.95 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1005 - Staff Shower - 11.61 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1006 - Plant - 12.93 m2</b>							
Plant / Equipment - Flue	Fibre Cement Pipe	4	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1007 - Practice/Seminar - 13.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1008 - Music Learning Space - 82.83 m2</b>							
No Asbestos							
<b>B00D - R1009 - Music Learning Space - 79.01 m2</b>							
No Asbestos							
<b>B00D - R1010 - Control Room - 25.68 m2</b>							
No Asbestos							

<b>B00D - R1011 - Control Room - 14.3 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1012 - General Storeroom - 11.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1013 - Control Room - 13.2 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1014 - Gymnasium - 44.93 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1015 - External Movement - .96 m2</b>							
No Asbestos							
<b>B00D - R1016 - Shower/Change - 32.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1017 - Cleaning Store - Distributed - 3.01 m2</b>							
No Asbestos							
<b>B00D - R1018 - Toilets-Boys - 6.58 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1019 - Shower/Change - 45.28 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1020 - External Movement - 21.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - General Learning/Art - 1974 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00E - R0001 - General Storeroom - 6.59 m2</b>							
No Asbestos							
<b>B00E - R0002 - General Learning Space - 53.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0003 - General Learning Space - 52.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	52.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0004 - Darkroom Space - 25.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0005 - Cleaning Store - Distributed - .63 m2</b>							
No Asbestos							
<b>B00E - R0006 - Distribution Board Cupboard - 1 m2</b>							
<b>Note: No inspection of live electrical installation</b>							

No Asbestos							
<b>B00E - R0007 - Computer Resource - 5.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0008 - Staff Study - 45.45 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	45.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0009 - General Learning Space - 52.49 m2</b>							
No Asbestos							
<b>B00E - R0010 - Art Learning Space - 66.01 m2</b>							
No Asbestos							
<b>B00E - R0011 - General Learning Space - 51.2 m2</b>							
No Asbestos							
<b>B00E - R0012 - General Learning Space - 53.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0013 - General Storeroom - 14.73 m2</b>							
No Asbestos							
<b>B00E - R0014 - General Learning Space - 53.66 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	53.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0015 - Toilets-Girls - 24.91 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00E - R0016 - Cleaning Store - Distributed - 3.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00E - R0017 - Toilets-Boys - 24.1 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00E - R0018 - External Movement - 160.8 m2</b>							
No Asbestos							
<b>B00E - R0019 - External Stairs - 9.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9.84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00E - R0020 - External Stairs - 17.1 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00E - R1001 - General Learning Space - 52.92 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00E - R1002 - General Learning Space - 53.15 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00E - R1003 - Computer Learning Space - 52.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00E - R1004 - Staff Study - 25.3 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00E - R1005 - Cleaning Store - Distributed - .64 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00E - R1006 - Distribution Board Cupboard - .96 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>								
No Asbestos								
<b>B00E - R1007 - General Storeroom - 4.64 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00E - R1008 - Staff Study - 46.43 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00E - R1009 - General Learning Space - 52.93 m2</b>								
No Asbestos								
<b>B00E - R1010 - General Learning Space - 65.64 m2</b>								
No Asbestos								
<b>B00E - R1011 - General Learning Space - 50.72 m2</b>								
No Asbestos								
<b>B00E - R1012 - General Learning Space - 53 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00E - R1013 - General Learning Space - 53.07 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00E - R1014 - External Movement - 137.58 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Over stairs	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00E - R1015 - External Stairs - 25.55 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	25.55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00E - R1016 - External Stairs - 25.11 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	25.11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00F - Agricultural Science - 1974 - Steel</b>								
<b>Exterior</b>								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00F - R0001 - External Movement - 21.11 m2</b>								
No Asbestos								
<b>B00F - R0002 - Animal Space - 20.43 m2</b>								
No Asbestos								
<b>B00F - R0003 - Animal Space - 42.31 m2</b>								
No Asbestos								
<b>B00H - General Learning - 1974 - Brick/Block</b>								
<b>Exterior</b>								
Ceiling Voids	Non Accessible Area							
Underfloor Voids - Slab on Ground	Non Accessible Area							
<b>Interior</b>								
<b>B00H - R0001 - Toilets-Boys - 24.37 m2</b>								

Partition Walls (Cubicles)	Compressed AC Sheet	
<b>B00H - R0002 - Cleaning Store - Distributed - 2.39 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00H - R0003 - General Learning Space - 52.55 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0004 - General Learning Space - 52.19 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0005 - Distribution Board Cupboard - .79 m2</b>		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B00H - R0006 - Staff Study - 41.85 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0007 - General Storeroom - 4.33 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0008 - Cleaning Store - Distributed - .68 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )	
<b>B00H - R0009 - Study Space - 25.08 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0010 - General Learning Space - 52.92 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0011 - General Learning Space - 66.12 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0012 - General Learning Space - 67.03 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )	
Floor Coverings Res/Textile	Vinyl Tiles	
<b>B00H - R0013 - General Storeroom - 15.2 m2</b>		
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )	
<b>B00H - R0014 - General Storeroom - 7.12 m2</b>		
No Asbestos		
<b>B00H - R0015 - External Movement - 146.77 m2</b>		
No Asbestos		

<b>B00H - R0016 - External Stairs - 9.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - R0017 - External Stairs - 18.04 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18.04m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - R1001 - Toilets-Girls - 23.43 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Partition Walls (Cubicles)	Compressed AC Sheet						
<b>B00H - R1002 - Cleaning Store - Distributed - 2.39 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R1003 - General Learning Space - 52.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00H - R1004 - General Learning Space - 52.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00H - R1005 - Distribution Board Cupboard - .8 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R1006 - General Storeroom - 19.48 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1007 - Staff Study - 25.85 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00H - R1008 - Cleaning Store - Distributed - .7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R1009 - Staff Study - 25.31 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1010 - General Learning Space - 52.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00H - R1011 - General Learning Space - 64.98 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00H - R1012 - General Learning Space - 66.01 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00H - R1013 - External Movement - 121.04 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	122m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R1014 - External Stairs - 25.3 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - R1015 - External Stairs - 25.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	25.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00L - Library - 1974 - Brick/Block</b>							
<b>Exterior</b>							

Ceiling Voids	Non Accessible Area							
Underfloor Voids - Slab on Ground	Non Accessible Area							
<b>Interior</b>								
<b>B00L - R0001 - Audio Visual Workroom - 46.81 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00L - R0002 - Secure Storeroom - 6.99 m2</b>								
No Asbestos								
<b>B00L - R0003 - Staff - Toilet - 4.08 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00L - R0004 - Librarian - 15.25 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00L - R0005 - Entry - 14.53 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00L - R0006 - External Movement - 2.99 m2</b>								
No Asbestos								
<b>B00L - R0007 - Workroom - 46.96 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00L - R0008 - Staff - Toilet - 4.02 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
<b>B00L - R0009 - General Storeroom - 5.01 m2</b>								
No Asbestos								
<b>B00L - R0010 - Cleaning Store - Distributed - 1.7 m2</b>								
No Asbestos								
<b>B00L - R0011 - Main Area - 194.74 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )							
<b>B00L - R0012 - Tiered Learning Area - 12.34 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00L - R0013 - Movement - 29.93 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00L - R0014 - Stairs - .61 m2</b>								
No Asbestos								
<b>B00L - R0015 - Stairs - .62 m2</b>								
No Asbestos								
<b>B00L - R1001 - Computer Resource - 15.4 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )							
<b>B00L - R1002 - Main Area - 114.1 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
<b>B00L - R1003 - Distribution Board Cupboard - .9 m2</b>								
<b>Note: No inspection of live electrical installation</b>								
Ceiling Structures/Linings	Flat AC Sheeting	0.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00L - R1004 - Main Area - 101.67 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )							
<b>B00L - R1005 - Cleaning Store - Distributed - .9 m2</b>								

Ceiling Structures/Linings	Flat AC Sheeting	0.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00L - R1006 - Seminar - 15.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1007 - Seminar - 15.52 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1008 - Interview/Office - Type 1 - 15.44 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1009 - Seminar - 15.44 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00L - R1010 - Stairs - 3.16 m2</b>							
No Asbestos							
<b>B00L - R1011 - Stairs - 3.12 m2</b>							
No Asbestos							



## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020