


# Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lambton High School (8482)
Region:	Hunter/Central Coast AMU
State Electorate:	Newcastle
Local Government Area:	Newcastle

Last Reviewed By:	WSP 30-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

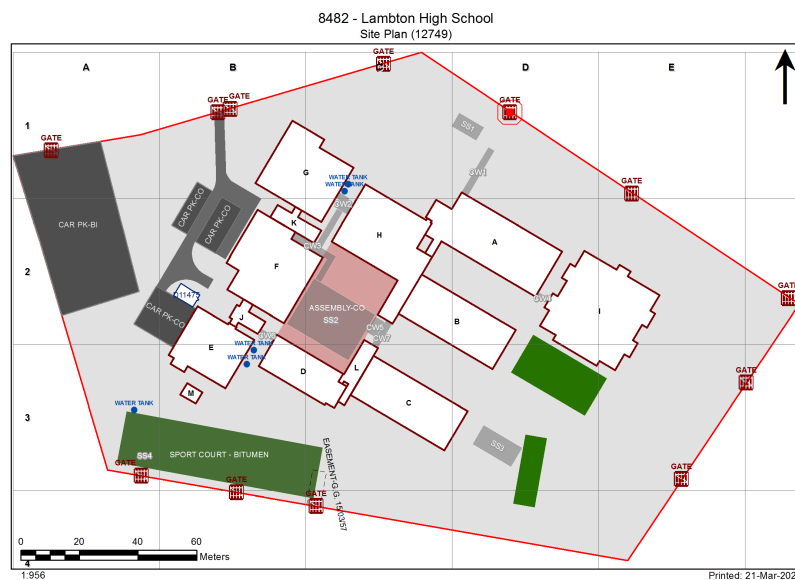

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/General Learning - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0002 - General Storeroom - 15.95 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0003 - Duplicating Workroom - 8.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Commonroom - 92.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0006 - Clinic-Waiting - 14.45 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0007 - Staff Study - 9.47 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0008 - Interview/Office - Type 1 - 9.68 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0009 - General Storeroom - 2.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - Cleaning Store - Distributed - 2.9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00A - R0011 - Distribution Board Cupboard - 1.18 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00A - R0012 - Security Store - 15.27 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00A - R0013 - Principal Office - 22.55 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0016 - Deputy Principal Office - 19.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0017 - Interview/Office - Type 1 - 16.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0018 - Movement - 7.26 m2</b>							
No Asbestos							
<b>B00A - R0019 - Public Entry - 46.4 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0020 - Staff - Toilet - 9.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0021 - Staff - Toilet - 10.22 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0022 - Toilets-Girls - 10.18 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0023 - Toilets-Boys - 9.24 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0024 - Movement - 63.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0025 - Movement - 7.83 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0026 - Teachers Aides - 12.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0027 - Staff Study - 13.39 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0028 - Movement - 87.1 m2</b>							
No Asbestos							
<b>B00A - R0029 - Movement - 50.72 m2</b>							
No Asbestos							
<b>B00A - R0030 - Stairs - 4.65 m2</b>							
No Asbestos							
<b>B00A - R0031 - Movement - 18.59 m2</b>							

No Asbestos							
<b>B00A - R0032 - Movement - 9.89 m2</b>							
No Asbestos							
<b>B00A - R0033 - External Movement - 6.12 m2</b>							
No Asbestos							
<b>B00A - R0034 - Movement - 3.46 m2</b>							
No Asbestos							
<b>B00A - R0035 - Lift - 2.1 m2</b>							
No Asbestos							
<b>B00A - R0036 - Administration - Clerical - 53.12 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0037 - External Movement - 16.81 m2</b>							
No Asbestos							
<b>B00A - R0038 - Movement - 17.32 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0039 - Staff Study - 13.22 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
<b>B00A - R0040 - Staff Study - 15.32 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0041 - Archive Store - 9.03 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R1001 - Computer Learning Space - 53.92 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1002 - General Learning Space - 53.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1003 - Staff Study - 22.22 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1004 - General Storeroom - 6.72 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00A - R1005 - Cleaning Store - Distributed - 3.28 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
<b>B00A - R1006 - General Learning Space - 59.89 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1007 - General Learning Space - 59.88 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
<b>B00A - R1008 - Senior Study - 53.84 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1009 - General Learning Space - 39.82 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1010 - General Learning Space - 39.81 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1011 - Distribution Board Cupboard - .53 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>								
Electrical - Mounting Board	Resinous Board	2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00A - R1013 - General Learning Space - 39.98 m2</b>								
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00A - R1014 - Movement - 1.76 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00A - R1015 - Movement - 60.13 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive							
<b>B00A - R1018 - Stairs - 14.98 m2</b>								
Non Accessible								
<b>B00A - R1019 - Movement - 15.28 m2</b>								
No Asbestos								
<b>B00A - R1020 - Stairs - 18.59 m2</b>								
No Asbestos								
<b>B00A - R1021 - Movement - 37.1 m2</b>								
No Asbestos								
<b>B00A - R1022 - Movement - 6.53 m2</b>								

No Asbestos							
<b>B00A - R1023 - Movement - 3.46 m2</b>							
No Asbestos							
<b>B00A - R1024 - Toilets-Unisex - 17.86 m2</b>							
Require Inspection							
<b>B00B - General Learning - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - General Learning Space - 53.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0002 - General Learning Space - 53.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0003 - Staff Study - 13.01 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Cleaning Store - Distributed - 2.32 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - Staff Study - 10.6 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0006 - Distribution Board Cupboard - .99 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0007 - Apparatus Store - 30.87 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R0008 - Darkroom Space - 7.96 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R0009 - Staff - Toilet - 5.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00B - R0010 - General Storeroom - 4.55 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R0011 - General Learning Space - 52.97 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0012 - General Learning Space - 39.45 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0013 - General Learning Space - 52.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0014 - General Learning Space - 51.51 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0015 - Movement - 1.87 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00B - R0017 - General Storeroom - 4.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
<b>B00B - R0019 - Movement - 10.16 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00B - R0021 - Staff Study - 32.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0022 - Movement - 94.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00B - R1001 - General Learning Space - 53.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1002 - General Learning Space - 53.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1003 - Staff Study - 18.37 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1004 - General Learning Space - 53.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1005 - General Learning Space - 54.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						



Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1006 - General Learning Space - 53.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1007 - General Learning Space - 54.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1008 - Staff Study - 10.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1009 - Cleaning Store - Distributed - 3.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1010 - Distribution Board Cupboard - 1.41 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span>							
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R1011 - General Storeroom - 18.37 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1012 - General Learning Space - 53.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1013 - Staff Study - 39.18 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1014 - Movement - 1.29 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00B - R1015 - Movement - 27.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1016 - Movement - 14.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R1017 - Movement - 15.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						

## B00C - General Learning - 1972 - Brick/Block

### Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						

### Interior

#### B00C - R0001 - General Learning Space - 53.7 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

#### B00C - R0002 - Staff Study - 24.84 m2

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--------------------	-----------------------------

#### B00C - R0003 - General Learning Space - 53.7 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

#### B00C - R0004 - General Storeroom - 10.59 m2

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	------	--------------	--------------------	---------	--------------------	-----------------------------

#### B00C - R0005 - General Learning Space - 53.7 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

#### B00C - R0006 - General Learning Space - 53.34 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

#### B00C - R0007 - Movement - 1.71 m2

No Asbestos							
-------------	--	--	--	--	--	--	--

#### B00C - R0008 - General Storeroom - 4.37 m2

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------------	-------------	-----	--------------	--------------------	---------	--------------------	-----------------------------

#### B00C - R0009 - Staff - Toilet - 4.84 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
----------------------------	--	--	--	--	--	--	--

#### B00C - R0010 - Staff - Toilet - 8.92 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
----------------------------	--	--	--	--	--	--	--

#### B00C - R0011 - Apparatus Store - 31.38 m2

Floor Coverings Res/Textile	Vinyl Tiles	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

#### B00C - R0012 - Distribution Board Cupboard - 1.04 m2

Note: No inspection of live electrical installation

Electrical - Backing Board	Resinous Board	3	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	3	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

#### B00C - R0013 - Staff Study - 11.05 m2

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
----------------------------	---	--	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0014 - Cleaning Store - Distributed - 2.48 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0017 - General Storeroom - 9.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0018 - General Storeroom - 5.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0019 - General Learning Space - 53.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0021 - Movement - 5.91 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00C - R0022 - Staff Study - 50.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0023 - Movement - 78.09 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00C - R0024 - Store - 5.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1001 - General Learning Space - 53.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1002 - General Learning Space - 53.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1003 - Movement - 18.73 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1004 - Staff Study - 18.2 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1005 - General Learning Space - 53.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00C - R1006 - General Learning Space - 54.43 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1007 - General Learning Space - 53.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1008 - General Learning Space - 54.44 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1009 - General Storeroom - 17.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1010 - Distribution Board Cupboard - 1.43 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Mounting Board	Resinous Board	3	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R1011 - Cleaning Store - Distributed - 2.61 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1012 - Staff Study - 10.72 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1013 - Staff Study - 39.45 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1014 - General Learning Space - 53.33 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1015 - Movement - 27.9 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R1016 - Movement - 1.34 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R1017 - Movement - 13.08 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00D - Science/Art - 1975 - Brick/Block</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting	3m2	South facing, East facing, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - General Assistants - 23.31 m2</b>							
No Asbestos							
<b>B00D - R0002 - Garden Store Room - .9 m2</b>							
No Asbestos							
<b>B00D - R0003 - Garden Store Room - .8 m2</b>							
No Asbestos							
<b>B00D - R0004 - Distribution Board Cupboard - .72 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Mounting Board	Resinous Board	3	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0005 - Garden Store Room - .9 m2</b>							
No Asbestos							
<b>B00D - R0006 - Laboratory L.S. - 90.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00D - R0007 - Preparation - 48.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0008 - Laboratory L.S. - 90.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00D - R0009 - Movement - 63.68 m2</b>							
No Asbestos							
<b>B00D - R1001 - Movement - .63 m2</b>							
No Asbestos							
<b>B00D - R1002 - General Storeroom - 10.47 m2</b>							
No Asbestos							
<b>B00D - R1003 - General Storeroom - 12.07 m2</b>							
No Asbestos							
<b>B00D - R1004 - General Learning Space - 90.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1005 - Staff Study - 48.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1006 - Art Learning Space - 90.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						

Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1007 - Movement - 60.55 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00D - R1008 - Plant - 1.46 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R1009 - Garden Store Room - 1.46 m2</b>							
Ceiling Structures/Linings	No Asbestos Found						
<b>B00D - R1010 - Distribution Board Cupboard - 1.46 m2</b>				<b>Note: No inspection of live electrical installation</b>			
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R1011 - Plant - 1.46 m2</b>							
Ceiling Structures/Linings	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - Technological &amp; Applied Studies/Art - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Toilets-Boys - 68.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0002 - Cleaning Store - Distributed - 2.01 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0003 - Distribution Board Cupboard - 2.75 m2</b>				<b>Note: No inspection of live electrical installation</b>			
Electrical - Mounting Board	Resinous Board	5	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0004 - Welding Area - 10.81 m2</b>							
Floor Coverings Res/Textile	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00E - R0005 - Materials Technology L.S. - 72.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00E - R0006 - Materials Store - 21.01 m2</b>							
No Asbestos							
<b>B00E - R0007 - Metal Technology Bay - 10.44 m2</b>							
Floor Coverings Res/Textile	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Furniture / Fixtures	Flat AC Sheeting	2	North facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
<b>B00E - R0008 - Materials Technology L.S. - 82.87 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
Furniture / Fixtures	Flat AC Sheeting	2	South facing, West facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)

<b>B00E - R0009 - Darkroom Space - 18.27 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0010 - Art Learning Space - 63.93 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	64m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0011 - Bulk Store - 7.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0012 - Movement - 37.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0013 - Movement - 1.91 m2</b>							
No Asbestos							
<b>B00E - R0014 - Kiln Space - 13.14 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00E - R0015 - Plant - 12.33 m2</b>							
No Asbestos							
<b>B00E - R1001 - Design L.S. - 52.08 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00E - R1002 - General Storeroom - 8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1003 - Distribution Board Cupboard - .98 m2</b>							
				<b>Note: No inspection of live electrical installation</b>			
Electrical - Backing Board	Resinous Board	2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00E - R1004 - Materials Technology L.S. - 83.02 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00E - R1005 - Materials Store - 21.12 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00E - R1006 - Materials Store - 5.31 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00E - R1007 - Materials Technology L.S. - 83.01 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00E - R1008 - Cleaning Store - Distributed - .67 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1009 - Materials Store - 8.7 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1010 - Design L.S. - 52.82 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1011 - Staff Study - 26.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1012 - Movement - 2.02 m2</b>							
No Asbestos							
<b>B00E - R1013 - Movement - 46.56 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1014 - General Storeroom - 5.23 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1015 - Materials Store - 4.25 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R1016 - No Access - 4.96 m2</b>							
No Asbestos							
<b>B00E - R1017 - Materials Store - 4.05 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - Pupil Facilities - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0012 - Student Canteen - 52.44 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0013 - General Storeroom - 6.1 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0014 - Main Switchroom - 10.3 m2</b>							
Electrical - Mounting Board	Resinous Board	3	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00F - R0015 - Tiered Learning Area - 187.14 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00F - R0016 - Audio Visual Workroom - 120.05 m2</b>							
Non Accessible							



<b>B00F - R0018 - External Movement - 77.66 m2</b>							
Require Inspection							
<b>B00F - R0019 - Student Canteen - 38.75 m2</b>							
Require Inspection							
<b>B00F - R0020 - Covered Area - 12.28 m2</b>							
Require Inspection							
<b>B00F - R0021 - Staff Study - 30.4 m2</b>							
Require Inspection							
<b>B00F - R0022 - Movement - 15.03 m2</b>							
Require Inspection							
<b>B00F - R0023 - Movement - 37.65 m2</b>							
Require Inspection							
<b>B00F - R0024 - General Storeroom - 5.28 m2</b>							
Require Inspection							
<b>B00F - R0025 - General Storeroom - 18.99 m2</b>							
Require Inspection							
<b>B00F - R0026 - Gymnasium - 47.55 m2</b>							
Require Inspection							
<b>B00F - R0027 - Toilet - Lobby - 1.69 m2</b>							
Require Inspection							
<b>B00F - R0028 - Staff - Toilet - 2.06 m2</b>							
Require Inspection							
<b>B00F - R0029 - Staff Kitchen - 2.27 m2</b>							
Require Inspection							
<b>B00F - R1001 - Cleaning Store - Distributed - 3.59 m2</b>							
No Asbestos							
<b>B00F - R1002 - Staff Change - 9.83 m2</b>							
No Asbestos							
<b>B00F - R1003 - Staff - Toilet - 7.82 m2</b>							
No Asbestos							
<b>B00F - R1005 - Shower/Change - 46.77 m2</b>							
No Asbestos							
<b>B00F - R1006 - Shower/Change - 47.51 m2</b>							
No Asbestos							
<b>B00F - R1008 - Staff - Toilet - 7.81 m2</b>							
No Asbestos							
<b>B00F - R1009 - Staff Change - 9.92 m2</b>							
No Asbestos							
<b>B00F - R1010 - Cleaning Store - Distributed - 3.57 m2</b>							
Plant / Equipment - Boiler	Fibre Cement Pipe	2	North facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00F - R1012 - Movement - 11.64 m2</b>							
No Asbestos							
<b>B00F - R1013 - Movement - 13.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R1014 - Store - 23.71 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						

B00F - R1015 - Movement - 4.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting	6m2	North & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R1016 - Toilets-Boys - 10.37 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R1017 - Movement - 4.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting	6m2	South & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R1018 - Toilets-Girls - 10.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R1019 - Movement - 13.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - ( X2 )						
B00F - R1020 - Change - 13.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
B00F - R9001 - General Storeroom - 116.27 m2							
No Asbestos							
B00G - Technological & Applied Studies/Art - 1972 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00G - R0001 - Food Technology L.S. - 81.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	82m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
B00G - R0008 - General Learning Space - 65.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0011 - Staff Study - 32.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0012 - General Storeroom - 4.73 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0013 - Staff Study - 17.49 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0014 - Distribution Board Cupboard - .96 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Mounting Board	Resinous Board	2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0015 - Toilets-Girls - 65.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00G- R0016 - Movement - 2.11 m2</b>							
No Asbestos							
<b>B00G- R0018 - Food Technology L.S. - 113.85 m2</b>							
No Asbestos							
<b>B00G- R0019 - Preparation - Materials - 20.72 m2</b>							
No Asbestos							
<b>B00G- R0020 - Pantry - 10.08 m2</b>							
No Asbestos							
<b>B00G- R0021 - Other - 14.69 m2</b>							
No Asbestos							
<b>B00G- R0022 - Laundry - 4.08 m2</b>							
No Asbestos							
<b>B00G- R0023 - General Storeroom - 1.02 m2</b>							
No Asbestos							
<b>B00G- R0024 - Movement - 71.45 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00G- R0025 - External Movement - 40.88 m2</b>							
No Asbestos							
<b>B00G- R0026 - Staff Study - 9.74 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1001 - Materials Technology L.S. - 65.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1002 - Music Learning Space - 65.29 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1003 - Staff Study - 32.16 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1004 - Music Learning Space - 65.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1005 - Darkroom Space - 13.87 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1006 - Art Learning Space - 65.3 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1007 - Art Learning Space - 64.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1008 - Distribution Board Cupboard - .84 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1009 - Materials Technology L.S. - 64.97 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1010 - Shower/Change - 4.54 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1011 - Materials Store - 10.59 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1013 - Resources Store - 1.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1014 - Resources Space - 1.91 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1015 - Cleaning Store - Distributed - .85 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R1016 - Movement - 56.48 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	57m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00H - Library/Science - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
<b>Interior</b>							

<b>B00H - M1001 - Main Area - 154.8 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 )						
<b>B00H - M1002 - Seminar - 23.82 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - M1003 - Seminar - 23.82 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R0001 - Laboratory L.S. - 91.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R0002 - Preparation - 49.26 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R0003 - Laboratory L.S. - 91.58 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R0004 - Distribution Board Cupboard - .73 m2</b>							
				<b>Note: No inspection of live electrical installation</b>			
Electrical - Mounting Board	Resinous Board	2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R0005 - Laboratory L.S. - 91.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R0006 - Preparation - 49.27 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00H - R0007 - Laboratory L.S. - 91.57 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R0008 - Movement - 2.73 m2</b>							
No Asbestos							
<b>B00H - R0009 - Movement - 2.48 m2</b>							
No Asbestos							
<b>B00H - R0010 - Movement - 58.58 m2</b>							
No Asbestos							
<b>B00H - R0013 - General Storeroom - 17.25 m2</b>							
No Asbestos							
<b>B00H - R0014 - General Storeroom - 4.34 m2</b>							
No Asbestos							
<b>B00H - R0015 - Movement - 11.64 m2</b>							
No Asbestos							
<b>B00H - R0016 - Movement - 87.88 m2</b>							
No Asbestos							
<b>B00H - R0017 - Toilets-Disabled - 12.93 m2</b>							
No Asbestos							
<b>B00H - R0018 - Plant - 15.28 m2</b>							
No Asbestos							
<b>B00H - R1001 - Staff - Toilet - 4.81 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R1002 - Staff - Toilet - 4.81 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00H - R1003 - Workroom - 13.69 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1004 - General Storeroom - 8.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R1005 - Audio Visual Workroom - 35.55 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1006 - Librarian - 9.86 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1007 - Seminar - 13.03 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1008 - Seminar - 14.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1009 - Seminar - 13.6 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1010 - Distribution Board Cupboard - .52 m2</b>							
				<b>Note: No inspection of live electrical installation</b>			
Electrical - Mounting Board	Resinous Board	2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R1011 - Cleaning Store - Distributed - 2.03 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00H - R1012 - Distribution Board Cupboard - .28 m2</b>							
				<b>Note: No inspection of live electrical installation</b>			
Electrical - Backing Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - R1013 - Seminar - 14.36 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1014 - Seminar - 12.96 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00H - R1015 - Main Area - 379.42 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( > 250 m2) - ( X25 )						
<b>B00H - R1016 - Movement - 17.25 m2</b>							
No Asbestos							
<b>B00H - R1017 - Movement - 125.46 m2</b>							
No Asbestos							
<b>B00H - R1018 - Movement - 2.36 m2</b>							
No Asbestos							
<b>B00I - Multi Purpose Facilities - 1997 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
<b>Interior</b>							

<b>B001 - M0001 - Movement - 39.96 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B001 - M0002 - Multi-Purpose Space - 94.82 m2</b>		
Floor Coverings Res/Textile	No Asbestos Found	
<b>B001 - M0003 - Music Learning Space - 43.35 m2</b>		
Require Inspection		
<b>B001 - M0004 - Stairs - 4.32 m2</b>		
Require Inspection		
<b>B001 - M0005 - Stairs - 6.15 m2</b>		
Require Inspection		
<b>B001 - M0006 - Stairs - 6.86 m2</b>		
Require Inspection		
<b>B001 - R0001 - Shower/Change - 21.11 m2</b>		
No Asbestos		
<b>B001 - R0002 - Chair Store - 13.41 m2</b>		
No Asbestos		
<b>B001 - R0004 - Movement - 10.59 m2</b>		
No Asbestos		
<b>B001 - R0008 - Shower/Change - 21.18 m2</b>		
No Asbestos		
<b>B001 - R0009 - Movement - 11.23 m2</b>		
No Asbestos		
<b>B001 - R0010 - Chair Store - 13.03 m2</b>		
No Asbestos		
<b>B001 - R0012 - Multi-Purpose Space - 479.28 m2</b>		
No Asbestos		
<b>B001 - R0013 - Movement - 3.41 m2</b>		
No Asbestos		
<b>B001 - R0014 - Sport Equipment Store - 27.81 m2</b>		
No Asbestos		
<b>B001 - R0015 - Distribution Board Cupboard - 1.26 m2</b>		
		<b>Note: No inspection of live electrical installation</b>
No Asbestos		
<b>B001 - R0016 - Toilets-Boys - 15.13 m2</b>		
No Asbestos		
<b>B001 - R0017 - Cleaning Store - Distributed - 3.46 m2</b>		
No Asbestos		
<b>B001 - R0018 - Disabled Toilet - 5.52 m2</b>		
No Asbestos		
<b>B001 - R0019 - Movement - 24.76 m2</b>		
No Asbestos		
<b>B001 - R0020 - Staff Kitchen - 12.46 m2</b>		
No Asbestos		
<b>B001 - R0021 - Movement - 6.34 m2</b>		
No Asbestos		
<b>B001 - R0022 - Toilets-Girls - 19.33 m2</b>		
No Asbestos		
<b>B001 - R0023 - Sport Equipment Store - 18.88 m2</b>		
No Asbestos		
<b>B001 - R0024 - Movement - 1.54 m2</b>		
No Asbestos		

<b>B00I - R0025 - Movement - 5.18 m2</b>		
No Asbestos		
<b>B00I - R0026 - Movement - 8.36 m2</b>		
No Asbestos		
<b>B00I - R0027 - Movement - 10.55 m2</b>		
No Asbestos		
<b>B00I - R0028 - Movement - 10.56 m2</b>		
No Asbestos		
<b>B00I - R0029 - Movement - 32.84 m2</b>		
No Asbestos		
<b>B00I - R0030 - Movement - 10.55 m2</b>		
No Asbestos		
<b>B00I - R0031 - Movement - 10.55 m2</b>		
No Asbestos		
<b>B00I - R0032 - Plant - .43 m2</b>		
Require Inspection		
<b>B00I - R0033 - Stairs - 6.03 m2</b>		
Require Inspection		
<b>B00I - R0034 - Lift - 1.37 m2</b>		
Require Inspection		
<b>B00I - R0035 - Stairs - 6.11 m2</b>		
Require Inspection		
<b>B00I - R0036 - Stage - 89.84 m2</b>		
Require Inspection		
<b>B00I - R0037 - Stairs - 5.72 m2</b>		
Require Inspection		
<b>B00I - R0038 - Stairs - 6.62 m2</b>		
Require Inspection		
<b>B00J - Shed - 1999 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00J - R0001 - Resources Store - 11.59 m2</b>		
No Asbestos		
<b>B00J - R0002 - Kiln Space - 15.35 m2</b>		
No Asbestos		
<b>B00J - R0003 - General Storeroom - 8.15 m2</b>		
No Asbestos		
<b>B00J - R0004 - Movement - 1.82 m2</b>		
No Asbestos		
<b>B00J - R0005 - Stairs - 1.86 m2</b>		
No Asbestos		
<b>B00J - R0006 - Movement - 4.45 m2</b>		
No Asbestos		
<b>B00J - R0007 - Movement - 6.91 m2</b>		
No Asbestos		
<b>B00J - R0008 - Movement - 1.98 m2</b>		
No Asbestos		
<b>B00J - R1001 - Movement - 8.15 m2</b>		



No Asbestos		
<b>B00J - R1002 - Movement - 14.03 m2</b>		
No Asbestos		
<b>B00J - R1003 - Movement - 4.45 m2</b>		
No Asbestos		
<b>B00J - R1004 - Movement - 9.78 m2</b>		
No Asbestos		
<b>B00J - R1005 - Movement - 14.11 m2</b>		
No Asbestos		
<b>B00K - Shed - 1999 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00K - M0001 - Music Store - 13.41 m2</b>		
No Asbestos		
<b>B00K - R0001 - Music Store - 26.46 m2</b>		
No Asbestos		
<b>B00K - R0002 - Movement - 13.58 m2</b>		
No Asbestos		
<b>B00K - R0003 - General Storeroom - 6.34 m2</b>		
No Asbestos		
<b>B00K - R0004 - General Storeroom - 10.63 m2</b>		
No Asbestos		
<b>B00K - R0005 - External Movement - 7.85 m2</b>		
No Asbestos		
<b>B00K - R0006 - Movement - 6.3 m2</b>		
No Asbestos		
<b>B00K - R0007 - Stairs - 6.34 m2</b>		
No Asbestos		
<b>B00K - R1001 - Movement - 6.41 m2</b>		
No Asbestos		
<b>B00K - R1002 - Movement - 14.09 m2</b>		
No Asbestos		
<b>B00K - R1003 - Movement - 6.32 m2</b>		
No Asbestos		
<b>B00L - Shed - 1999 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids - Flat Roof	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00L - R0001 - General Storeroom - 9.79 m2</b>		
No Asbestos		
<b>B00L - R0002 - Movement - 6.84 m2</b>		
No Asbestos		
<b>B00L - R0003 - Movement - 83.08 m2</b>		
No Asbestos		
<b>B00L - R1001 - Movement - 81.34 m2</b>		

No Asbestos	
<b>B00M - Storage - 2014 - Metal Shed</b>	
<b>Exterior</b>	
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
<b>Interior</b>	
<b>B00M - R0001 - Sport Equipment Store - 25.6 m2</b>	
No Asbestos	

## Demountables

### OS 758 11475 - Darkroom - Placement Date : 23-JAN-1998

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

#### Exterior

Eaves Linings	Flat AC Sheeting	5.76m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

#### Interior

##### R1- Darkroom Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Assumed Asbestos

##### R2- Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Assumed Asbestos