


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Farmborough Road Public School (3976)
Region:	Southern NSW AMU
State Electorate:	Wollongong
Local Government Area:	Wollongong

Last Reviewed By:	AECOM 18-JUN-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

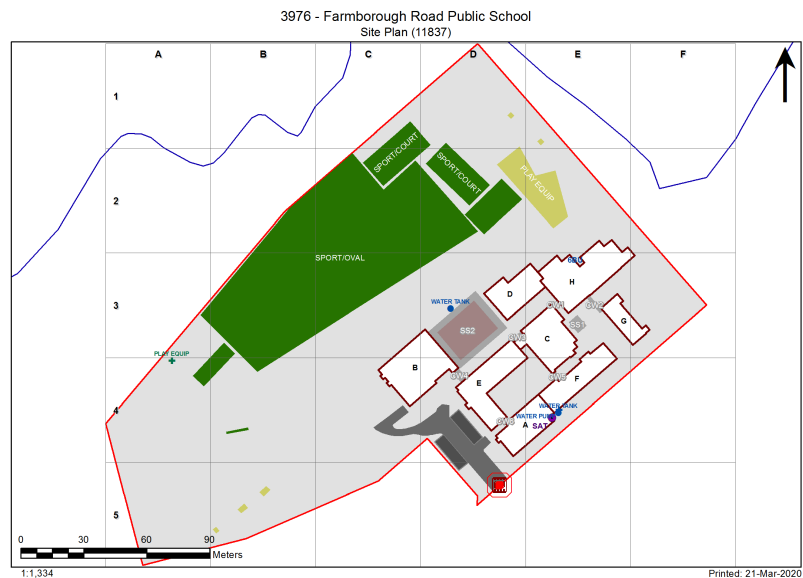

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1979 - Brick/Block							
Exterior							
External Wall Structure - Awnings	Flat AC Sheeting	2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	2m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0002 - External Movement - 2.68 m2							
No Asbestos							
B00A - R0003 - Deputy Principal - 12.92 m2							
No Asbestos							
B00A - R0004 - Deputy Principal - 12.6 m2							
No Asbestos							
B00A - R0005 - Staff Toilet - 4.52 m2							
No Asbestos							
B00A - R0006 - Cleaning Distributed Store - 2.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Manhole cover	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0007 - Staff Toilet - 4.58 m2							
No Asbestos							
B00A - R0008 - Sick Bay - 12.64 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0009 - Clerical Office - 12.6 m2							
No Asbestos							
B00A - R0010 - Entry Vestibule - 19.29 m2							
No Asbestos							
B00A - R0011 - Interview - 11.7 m2							
No Asbestos							
B00A - R0012 - Principal - 20.31 m2							
No Asbestos							
B00A - R0013 - Movement - 5.83 m2							
No Asbestos							
B00A - R0014 - General Assistant/Bulk Store - 22.58 m2							
No Asbestos							
B00A - R0015 - Clerical Office/Workroom - 31.56 m2							
No Asbestos							
B00A - R0016 - Distribution Board - .63 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R0017 - Security Store - 12.11 m2							
No Asbestos							
B00A - R0018 - Movement - 26.99 m2							
No Asbestos							
B00A - R0019 - External Movement - 2.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Awning to roller door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0020 - External Movement - 57.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	57.18m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0021 - External Movement - 3.34 m2							
No Asbestos							
B00A - R0022 - Staff Room - 48.39 m2							
No Asbestos							
B00A - R0023 - Staff Kitchen - 22.21 m2							
No Asbestos							
B00B - Communal Facilities/Pupil Facilities - 1979 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
External Wall Structure - Awnings	Flat AC Sheeting	60	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00B - R0001 - Communal Space - 237.17 m2							
No Asbestos							
B00B - R0002 - Hall Chair Store - 9.92 m2							
No Asbestos							
B00B - R0003 - Toilets - Boys - 11.8 m2							
No Asbestos							
B00B - R0004 - Toilets - Girls - 9.23 m2							
No Asbestos							
B00B - R0005 - Cleaning Distributed Store - 2.57 m2							
No Asbestos							
B00B - R0006 - Movement - 53.29 m2							
No Asbestos							
B00B - R0007 - Canteen - 46.47 m2							
No Asbestos							
B00B - R0008 - Canteen Office/Store - 5.5 m2							
No Asbestos							
B00B - R0009 - Staff Toilet - 3.15 m2							
No Asbestos							
B00B - R0010 - Canteen Office/Store - 2.82 m2							
No Asbestos							
B00B - R0011 - General Assistant/Bulk Store - 8.46 m2							
No Asbestos							
B00B - R0012 - Distribution Board - .43 m2							
No Asbestos							
B00B - R0013 - P.E Store - 34.93 m2							
No Asbestos							
B00B - R0014 - General Storeroom - 12.67 m2							
No Asbestos							
B00B - R0015 - External Movement - 2.94 m2							
No Asbestos							
B00B - R0016 - External Movement - 1.67 m2							
No Asbestos							

Note: No inspection of live electrical installation

No Asbestos							
B00B - R0017 - External Movement - 2.34 m2							
No Asbestos							
B00B - R0018 - External Movement - 2.34 m2							
No Asbestos							
B00B - R0019 - External Movement - 144.75 m2							
No Asbestos							
B00B - R0020 - Raised Platform - 32.41 m2							
No Asbestos							
B00C - Library/Pupil Facilities - 1979 - Brick/Block							
Exterior							
External Wall Structure - Awnings	Flat AC Sheeting	10	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	10m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00C - M0001 - General Storeroom - 14.52 m2							
No Asbestos							
B00C - M0002 - Stairs - 4.15 m2							
No Asbestos							
B00C - R0002 - Library Office/Workroom - 9.2 m2							
No Asbestos							
B00C - R0003 - Communications Room - 11.1 m2							
No Asbestos							
B00C - R0004 - Library Office/Workroom - 18.97 m2							
No Asbestos							
B00C - R0005 - Staff Toilet - 4.37 m2							
No Asbestos							
B00C - R0006 - Movement - 8.79 m2							
No Asbestos							
B00C - R0007 - Staff Toilet - 3.09 m2							
No Asbestos							
B00C - R0008 - Cleaning Distributed Store - 1.93 m2							
No Asbestos							
B00C - R0009 - K.L.A. Store - 12.23 m2							
No Asbestos							
B00C - R0010 - Special Programs Room - 12.15 m2							
No Asbestos							
B00C - R0011 - Distribution Board - 1.85 m2							
No Asbestos							
B00C - R0012 - External Movement - 20.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Upper portion	Good Condition (1)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0013 - External Movement - 52.23 m2							
Ceiling Structures/Linings	Flat AC Sheeting	52.23m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0014 - Reading Area - 221.26 m2							

Note: No inspection of live electrical installation

No Asbestos							
B00C - R0015 - Special Programs Room - 23.28 m2							
No Asbestos							
B00C - R0016 - Stairs - 1.37 m2							
No Asbestos							
B00C - R9001 - Toilets - Girls - 10.08 m2							
No Asbestos							
B00C - R9002 - Toilets - Boys - 13.65 m2							
No Asbestos							
B00C - R9003 - Staff Toilet - 2.77 m2							
No Asbestos							
B00C - R9004 - General Assistant/Bulk Store - 7.36 m2							
No Asbestos							
B00C - R9005 - Garden Store - 37.29 m2							
No Asbestos							
B00C - R9006 - General Storeroom - 68.93 m2							
No Asbestos							
B00C - R9007 - Main Switch Board - 8.94 m2							
No Asbestos							
B00C - R9008 - External Movement - 47.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	47.19m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - General Learning - 1979 - Brick/Block							
Exterior							
External Wall Structure - Awnings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0001 - Home Base - 58.17 m2							
No Asbestos							
B00D - R0002 - Home Base Store - 5.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0003 - Personal Effects Storage - 29.27 m2							
No Asbestos							
B00D - R0004 - Practical Activities - 1hb - 39.41 m2							
No Asbestos							
B00D - R0005 - General Storeroom - 6.02 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0006 - Distribution Board - .61 m2							
							Note: No inspection of live electrical installation
No Asbestos							
B00D - R0007 - Home Base - 55.93 m2							
No Asbestos							
B00D - R0008 - Home Base Store - 5.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0009 - Withdrawal Space - 1hb - 12.28 m2							

No Asbestos							
B00D - R0010 - External Movement - 8.04 m2							
No Asbestos							
B00D - R0011 - External Movement - 127.41 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - General Learning - 1956 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	35m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting						
Wall Cladding	Flat AC Sheeting	2m2	Wall panel on stairs off ER0015 & ER0014	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	8m2	Between north end of block E veranda & beginning of block H walkway	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0001 - Home Base - 53.58 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00E - R0002 - Home Base - 53.58 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00E - R0003 - Home Base - 56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0004 - Home Base Store - 10.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0005 - Staff Room Annexe - 16.02 m2							
Electrical - Mounting Board	Resinous Board	1	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0006 - Movement - 20.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0007 - Staff Toilet - 6.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6.52m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0008 - Interview - 17.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0009 - General Storeroom - 10 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0010 - Movement - 10.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

B00E - R0011 - Cleaning Distributed Store - 6.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0012 - Home Base - 53.58 m2							
No Asbestos							
B00E - R0013 - Movement - 76.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	76.85m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0014 - Cleaning Distributed Store - 3.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3.4m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0015 - Movement - 17.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	17.23m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0016 - Personal Effects Storage - 8.77 m2							
No Asbestos							
B00E - R0017 - Home Base - 53.29 m2							
No Asbestos							
B00E - R0018 - Home Base Store - 4.44 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4.44m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R9001 - Uniform Shop - 55.23 m2							
Floor Coverings Res/Textile	Vinyl Tiles	55.23m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R9002 - Toilets - Girls - 22.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	22.41m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Flat AC Sheeting	22.41m2		Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R9003 - Staff Toilet - 1.86 m2							
No Asbestos							
B00E - R9004 - General Storeroom - 65.23 m2							
Ceiling Structures/Linings	Flat AC Sheeting	65.23m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	65.23m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R9005 - General Storeroom - 40.13 m2							
Ceiling Structures/Linings	Flat AC Sheeting	m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	40.13m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet	47.13m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R9006 - General Storeroom - 46.71 m2							
Ceiling Structures/Linings	Flat AC Sheeting	46.71m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting	46.71m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R9007 - Special Programs Room - 62.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	62.12m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R9008 - External Movement - 54.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	54.6m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
B00E - R9009 - External Movement - 4.25 m2							
No Asbestos							
B00F - General Learning - 1982 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	35m2	South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - General Storeroom - 8.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8.41m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0002 - Movement - 3.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3.32m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0003 - Staff Toilet - 4.83 m2							
No Asbestos							
B00F - R0004 - Cleaning Distributed Store - .87 m2							
No Asbestos							
B00F - R0005 - General Storeroom - 6.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6.97m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0006 - General Storeroom - 5.52 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5.52m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0007 - Movement - 73.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8.41m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5.57m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0008 - Home Base - 53.58 m2							
No Asbestos							
B00F - R0009 - Home Base - 53.66 m2							
No Asbestos							
B00F - R0010 - Withdrawal Space - 1hb - 12.63 m2							
No Asbestos							
B00F - R0011 - Staff Room Annexe - 9.43 m2							
No Asbestos							

B00F - R0012 - Home Base - 53.58 m2							
No Asbestos							
B00F - R0013 - Home Base - 53.58 m2							
No Asbestos							
B00F - R0014 - Home Base Store - 5.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8.41m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	5.57m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0015 - Movement - 4.88 m2							
No Asbestos							
B00F - R0016 - Staff Toilet - 2.75 m2							
No Asbestos							
B00F - R0017 - Cleaning Supplies - 16.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles	16.44m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0018 - External Movement - 16.76 m2							
No Asbestos							
B00F - R9001 - Toilets - Boys - 53.4 m2							
Floor Coverings Res/Textile	Vinyl Tiles	53.4m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	53.4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Furniture / Fixtures	Flat AC Sheeting						
B00F - R9002 - Staff Toilet - 1.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1.25m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R9004 - General Storeroom - 16.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16.03m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R9005 - General Storeroom - 27.07 m2							
Ceiling Structures/Linings	Flat AC Sheeting	27.07m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R9006 - General Storeroom - 55.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	55.83m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R9007 - Toilets - Girls - 67.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	67.69m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R9008 - Staff Toilet - 1.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1.81m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R9009 - General Storeroom - 39.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	39.09m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R9010 - Garden Store - 4.2 m2							
No Asbestos							

B00G - General Learning - 1981 - Brick/Veneer

Exterior

External Wall Structure - Awnings	Flat AC Sheeting	45	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	16m2	Infill panel below windows on northern and southern walls	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Interior

B00G - R0001 - Personal Effects Storage - 14.46 m2

No Asbestos

B00G - R0002 - Home Base - 58.45 m2

No Asbestos

B00G - R0003 - Home Base - 77.42 m2

No Asbestos

B00G - R0004 - Personal Effects Storage - 12.12 m2

No Asbestos

B00G - R0005 - Toilets - Boys/Girls - 4.37 m2

No Asbestos

B00G - R0006 - Home Base Store - 2.31 m2

No Asbestos

B00G - R0008 - External Stairs - 7.88 m2

Ceiling Structures/Linings	Flat AC Sheeting	7.5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-------	---------------	--------------------	---------	--------------------	-----------------------------

B00G - R0009 - External Movement - 7.7 m2

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	---------------	--------------------	---------	--------------------	-----------------------------

B00G - R9001 - General Storeroom - 27.95 m2

No Asbestos

B00G - R9002 - External Stairs - 4.94 m2

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	-----	---------------	--------------------	---------	--------------------	-----------------------------

B00H - General Learning/Tiered Learning - 1979 - Brick/Block

Exterior

External Wall Structure - Awnings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Wall Cladding	Flat AC Sheeting						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						

Interior

B00H - R0001 - Home Base - 60.48 m2

No Asbestos

B00H - R0002 - Toilets - Boys/Girls - 3.45 m2

No Asbestos

B00H - R0003 - Home Base Store - 4.65 m2	
No Asbestos	
B00H - R0004 - Withdrawal Space - 1hb - 12.53 m2	
No Asbestos	
B00H - R0005 - Home Base - 56.2 m2	
No Asbestos	
B00H - R0006 - Toilets - Boys/Girls - 3.27 m2	
No Asbestos	
B00H - R0007 - Home Base Store - 6.46 m2	
No Asbestos	
B00H - R0008 - Practical Activities - 1hb - 19.36 m2	
No Asbestos	
B00H - R0009 - Personal Effects Storage - 7.98 m2	
No Asbestos	
B00H - R0010 - Practical Activities - 1hb - 40.4 m2	
No Asbestos	
B00H - R0012 - Special Programs Room - 28.71 m2	
No Asbestos	
B00H - R0013 - Movement - 38.85 m2	
No Asbestos	
B00H - R0015 - Craft Store - 12.48 m2	
No Asbestos	
B00H - R0016 - Practical Activities - 1hb - 45.6 m2	
No Asbestos	
B00H - R0017 - Kiln Room - 1.78 m2	
No Asbestos	
B00H - R0018 - Movement - 2.43 m2	
No Asbestos	
B00H - R0019 - Cleaning Distributed Store - 2.9 m2	
No Asbestos	
B00H - R0020 - Home Base Store - 6.73 m2	
No Asbestos	
B00H - R0021 - Home Base - 57.6 m2	
No Asbestos	
B00H - R0022 - Staff Room Annexe - 11.9 m2	
No Asbestos	
B00H - R0023 - Home Base - 59.39 m2	
No Asbestos	
B00H - R0024 - Home Base Store - 6.22 m2	
No Asbestos	
B00H - R0025 - Practical Activities - 1hb - 25.07 m2	
No Asbestos	
B00H - R0026 - Withdrawal Space - 1hb - 10.87 m2	
No Asbestos	
B00H - R0027 - Practical Activities - 1hb - 13.66 m2	
No Asbestos	
B00H - R0028 - External Movement - 73.4 m2	
No Asbestos	
B00H - R0029 - External Movement - 34.17 m2	
No Asbestos	
B00H - R0030 - External Movement - 1.69 m2	
No Asbestos	

B00H - R0031 - Stairs - 6.03 m2	
No Asbestos	
B00H - R0032 - Stairs - 3.16 m2	
No Asbestos	
B00H - R0033 - Special Programs Room - 7.78 m2	
No Asbestos	
B00H - R9001 - Special Programs Room - 56.9 m2	
No Asbestos	
B00H - R9002 - General Storeroom - 8.22 m2	
No Asbestos	
B00H - R9003 - Personal Effects Storage - 15.44 m2	
No Asbestos	
B00H - R9004 - Practical Activities - 1hb - 9.95 m2	
No Asbestos	
B00H - R9005 - Staff Room Annexe - 10.89 m2	
No Asbestos	
B00H - R9006 - Home Base - 54.35 m2	
No Asbestos	
B00H - R9007 - Home Base Store - 6.5 m2	
No Asbestos	
B00H - R9008 - Sports Store - 3.29 m2	
No Asbestos	
B00H - R9009 - Home Base - 58.57 m2	
No Asbestos	
B00H - R9010 - Home Base Store - 6.25 m2	
No Asbestos	
B00H - R9011 - Distribution Board - .94 m2	
No Asbestos	Note: No inspection of live electrical installation
B00H - R9012 - Practical Activities - 1hb - 13.38 m2	
No Asbestos	
B00H - R9013 - Personal Effects Storage - 15.24 m2	
No Asbestos	
B00H - R9014 - Withdrawal Space - 1hb - 11.39 m2	
No Asbestos	
B00H - R9015 - Home Base - 56.24 m2	
No Asbestos	
B00H - R9016 - Home Base Store - 6.71 m2	
No Asbestos	
B00H - R9017 - Practical Activities - 1hb - 26.08 m2	
No Asbestos	
B00H - R9018 - Special Programs Room - 2.6 m2	
No Asbestos	
B00H - R9019 - Stairs - 4.61 m2	
No Asbestos	
B00H - R9020 - Stairs - 6.03 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020