


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Fairvale Public School (4009)</b>
<b>Region:</b>	<b>South Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Fairfield</b>
<b>Local Government Area:</b>	<b>Fairfield</b>

<b>Last Reviewed By:</b>	<b>WSP 28-FEB-2017</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

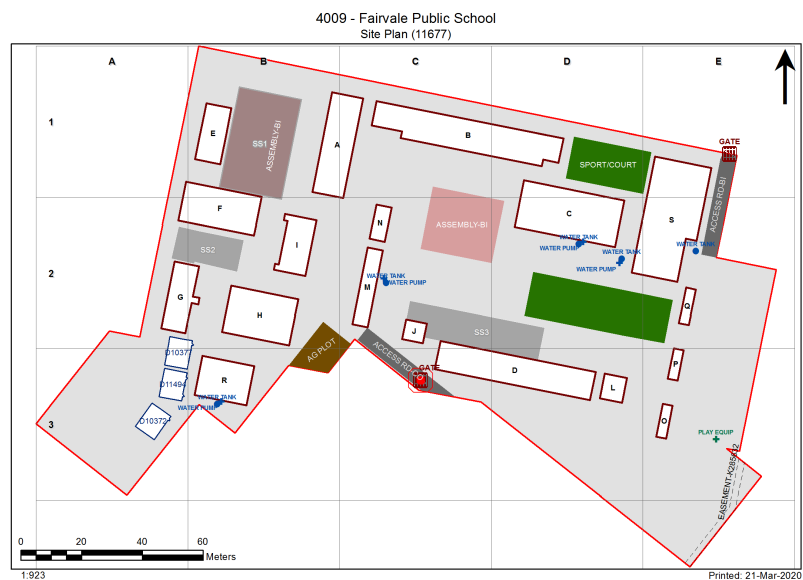

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration - 1960 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	16	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	Flat AC Sheeting	2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	AC Fragments/Debris	1	Under R0023	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00A - R0008 - Distribution Board - 1.04 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Electrical - Mounting Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - Principal - 18.27 m2</b>							
No Asbestos							
<b>B00A - R0012 - Deputy Principal - 10.35 m2</b>							
No Asbestos							
<b>B00A - R0013 - General Storeroom - 9.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0018 - Movement - 58.81 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	8m2	West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0023 - Staff Kitchen - 21.72 m2</b>							
No Asbestos							
<b>B00A - R0025 - Toilet - Lobby - 1.88 m2</b>							
Requires Inspection							
<b>B00A - R0026 - Toilets-Unisex - 1.88 m2</b>							
Requires Inspection							
<b>B00A - R0027 - Movement - 10.31 m2</b>							
Requires Inspection							
<b>B00A - R0028 - General Storeroom - 10.23 m2</b>							
Requires Inspection							
<b>B00A - R0029 - Clerical Office - 27.24 m2</b>							
Requires Inspection							
<b>B00A - R0030 - Movement - 5.21 m2</b>							
Requires Inspection							
<b>B00A - R0031 - Toilet - Lobby - 2.19 m2</b>							
Requires Inspection							
<b>B00A - R0032 - Toilets - Girls - 2.19 m2</b>							
Requires Inspection							
<b>B00A - R0033 - Toilets-Unisex - 2.19 m2</b>							
Requires Inspection							
<b>B00A - R0034 - Toilet - Lobby - 2.19 m2</b>							

Requires Inspection							
<b>B00A - R0035 - Toilet - Lobby - 2.19 m2</b>							
Requires Inspection							
<b>B00A - R0036 - Toilets-Unisex - 2.19 m2</b>							
Requires Inspection							
<b>B00A - R0037 - Sick Bay - 7.2 m2</b>							
Requires Inspection							
<b>B00A - R0038 - Entry Vestibule - 18.2 m2</b>							
Requires Inspection							
<b>B00A - R0039 - Clerical/Printing - 21.94 m2</b>							
Requires Inspection							
<b>B00A - R0040 - Staff Room - 58.75 m2</b>							
Requires Inspection							
<b>B00A - R0041 - Staff Toilet - 2.12 m2</b>							
Requires Inspection							
<b>B00A - R0042 - Staff Room Annexe - 10.52 m2</b>							
Requires Inspection							
<b>B00B - General Learning - 1960 - Concrete Framed</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Underfloor Voids	Requires Inspection						
<b>Interior</b>							
<b>B00B - R0003 - Home Base Store - 6.36 m2</b>							
No Asbestos							
<b>B00B - R0004 - General Storeroom - 3.66 m2</b>							
No Asbestos							
<b>B00B - R0005 - Movement - 3.01 m2</b>							
No Asbestos							
<b>B00B - R0006 - Distribution Board - .4 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
No Asbestos							
<b>B00B - R0007 - Interview - 14.3 m2</b>							
No Asbestos							
<b>B00B - R0008 - Movement - 12.94 m2</b>							
No Asbestos							
<b>B00B - R0009 - Movement - 4.09 m2</b>							
No Asbestos							
<b>B00B - R0010 - General Storeroom - 2.57 m2</b>							
No Asbestos							
<b>B00B - R0011 - Personal Effects Storage - 3.66 m2</b>							
No Asbestos							
<b>B00B - R0012 - Home Base Store - 6.36 m2</b>							
No Asbestos							
<b>B00B - R0013 - Home Base - 57.37 m2</b>							
No Asbestos							
<b>B00B - R0014 - Home Base - 57.2 m2</b>							
No Asbestos							
<b>B00B - R0015 - Home Base Store - 6.36 m2</b>							
No Asbestos							
<b>B00B - R0016 - Personal Effects Storage - 3.62 m2</b>							

No Asbestos		
<b>B00B - R0017 - General Storeroom - .6 m2</b>		
No Asbestos		
<b>B00B - R0018 - Movement - 14.41 m2</b>		
No Asbestos		
<b>B00B - R0019 - Movement - 4.13 m2</b>		
No Asbestos		
<b>B00B - R0020 - Communal/Performance Store - 3.62 m2</b>		
No Asbestos		
<b>B00B - R0021 - Withdrawal Space - 1hb - 19.12 m2</b>		
No Asbestos		
<b>B00B - R0022 - Home Base Store - 6.36 m2</b>		
No Asbestos		
<b>B00B - R0023 - Home Base - 57.2 m2</b>		
No Asbestos		
<b>B00B - R0024 - Home Base - 57.04 m2</b>		
No Asbestos		
<b>B00B - R0025 - Home Base Store - 6.6 m2</b>		
No Asbestos		
<b>B00B - R0026 - Personal Effects Storage - 3.46 m2</b>		
No Asbestos		
<b>B00B - R0027 - Movement - 6.37 m2</b>		
No Asbestos		
<b>B00B - R0028 - Movement - 4.09 m2</b>		
No Asbestos		
<b>B00B - R0029 - Personal Effects Storage - 3.46 m2</b>		
No Asbestos		
<b>B00B - R0030 - Home Base Store - 6.6 m2</b>		
No Asbestos		
<b>B00B - R0031 - Home Base - 58.63 m2</b>		
No Asbestos		
<b>B00B - R0032 - Movement - 43.04 m2</b>		
No Asbestos		
<b>B00B - R0033 - Movement - 38.72 m2</b>		
No Asbestos		
<b>B00B - R0034 - Movement - 6.72 m2</b>		
No Asbestos		
<b>B00B - R0035 - Special Programs Room - 58.63 m2</b>		
No Asbestos		
<b>B00C - Library/Tiered Learning - 1960 - Brick/Block</b>		
<b>Exterior</b>		
Ceiling Voids - Raked Ceiling	No Asbestos Found	
Underfloor Voids - Slab on Ground	Non Accessible Area	
<b>Interior</b>		
<b>B00C - R0001 - Plant - 1.71 m2</b>		
No Asbestos		
<b>B00C - R0002 - Special Programs Store - 4.98 m2</b>		
No Asbestos		
<b>B00C - R0003 - Special Programs Room - 39.94 m2</b>		
No Asbestos		

<b>B00C - R0004 - Movement - 3.8 m2</b>							
No Asbestos							
<b>B00C - R0005 - Staff Toilet - 6.52 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0006 - Staff Toilet - 6.88 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0007 - Movement - 2.67 m2</b>							
No Asbestos							
<b>B00C - R0008 - Distribution Board - 1.93 m2</b>							<b>Note: No inspection of live electrical installation</b>
Wall Linings Internal	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0009 - Movement - 11.03 m2</b>							
No Asbestos							
<b>B00C - R0010 - Movement - 140.65 m2</b>							
No Asbestos							
<b>B00C - R0011 - Movement - 3.25 m2</b>							
No Asbestos							
<b>B00C - R0012 - Communications Room - 13.08 m2</b>							
No Asbestos							
<b>B00C - R0013 - Library Office/Workroom - 24.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0014 - Reading Area - 222.36 m2</b>							
No Asbestos							
<b>B00D - General Learning - 1958 - Concrete</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00D - R0004 - Cleaning Distributed Store - 6.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0005 - Sports Store - 25.04 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0006 - General Storeroom - 6.45 m2</b>							
No Asbestos							
<b>B00D - R0007 - Interview - 13.76 m2</b>							
No Asbestos							
<b>B00D - R0011 - Movement - 94.42 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00D - R0012 - Practical Activities - 7.92 m2</b>							
No Asbestos							
<b>B00D - R0013 - Practical Activities - 7.92 m2</b>							
No Asbestos							
<b>B00D - R0014 - Practical Activities - 7.92 m2</b>							
No Asbestos							
<b>B00D - R0015 - Practical Activities - 7.92 m2</b>							

No Asbestos							
<b>B00D - R0016 - Practical Activities - 7.53 m2</b>							
No Asbestos							
<b>B00D - R0017 - Practical Activities - 6.8 m2</b>							
No Asbestos							
<b>B00D - R0018 - Home Base - 46.18 m2</b>							
No Asbestos							
<b>B00D - R0019 - Home Base - 45.26 m2</b>							
No Asbestos							
<b>B00D - R0020 - Home Base - 44.84 m2</b>							
No Asbestos							
<b>B00D - R0021 - Home Base - 44.99 m2</b>							
No Asbestos							
<b>B00D - R0022 - Home Base - 45 m2</b>							
No Asbestos							
<b>B00D - R0023 - Home Base - 45.06 m2</b>							
No Asbestos							
<b>B00E - General Learning - 1965 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - Home Base - 57.12 m2</b>							
No Asbestos							
<b>B00E - R0003 - Movement - 5.89 m2</b>							
No Asbestos							
<b>B00E - R0004 - Home Base Store - .56 m2</b>							
No Asbestos							
<b>B00E - R0005 - Movement - 1.49 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0006 - Home Base Store - .56 m2</b>							
No Asbestos							
<b>B00E - R0008 - Home Base - 56.94 m2</b>							
No Asbestos							
<b>B00E - R0009 - Home Base Store - 3.1 m2</b>							
No Asbestos							
<b>B00E - R0010 - Home Base Store - 3.1 m2</b>							
No Asbestos							
<b>B00E - R0011 - Practical Activities - 6.33 m2</b>							
No Asbestos							
<b>B00E - R0012 - Practical Activities - 6.37 m2</b>							
No Asbestos							
<b>B00F - General Learning/Administration - 1960 - Concrete Framed</b>							
<b>Exterior</b>							

Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - General Storeroom - 5.22 m2</b>							
No Asbestos							
<b>B00F - R0002 - Craft Store - 1.14 m2</b>							
No Asbestos							
<b>B00F - R0004 - Movement - 6.33 m2</b>							
No Asbestos							
<b>B00F - R0005 - Community Clinic - 18.25 m2</b>							
No Asbestos							
<b>B00F - R0011 - Movement - 3.62 m2</b>							
No Asbestos							
<b>B00F - R0012 - Practical Activities - 1hb - 6.41 m2</b>							
No Asbestos							
<b>B00F - R0014 - Outdoor Learning Area - 94.58 m2</b>							
No Asbestos							
<b>B00F - R0016 - Home Base - 65.58 m2</b>							
No Asbestos							
<b>B00F - R0017 - Practical Activities - 10.51 m2</b>							
No Asbestos							
<b>B00F - R0018 - Isolation Space - 15.85 m2</b>							
No Asbestos							
<b>B00F - R0019 - Home Base Store - 9.9 m2</b>							
No Asbestos							
<b>B00F - R0020 - Home Base Store - 3.99 m2</b>							
No Asbestos							
<b>B00F - R0021 - Practical Activities - 6.7 m2</b>							
No Asbestos							
<b>B00F - R0022 - Home Base - 65.02 m2</b>							
No Asbestos							
<b>B00G - General Learning - 1958 - Concrete Framed</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
<b>Interior</b>							
<b>B00G - R0001 - Home Base - 58.64 m2</b>							
No Asbestos							
<b>B00G - R0003 - Movement - 12.96 m2</b>							
No Asbestos							
<b>B00G - R0004 - General Storeroom - 1.05 m2</b>							
No Asbestos							
<b>B00G - R0005 - Plant - 2.85 m2</b>							
No Asbestos							



<b>B00G - R0006 - No Access - 16.66 m2</b>							
No Asbestos							
<b>B00G - R0008 - Home Base - 58.64 m2</b>							
No Asbestos							
<b>B00G - R0009 - Movement - 3.99 m2</b>							
No Asbestos							
<b>B00G - R0010 - Home Base Store - 3.06 m2</b>							
No Asbestos							
<b>B00G - R0011 - Practical Activities - 6.88 m2</b>							
No Asbestos							
<b>B00G - R0012 - Practical Activities - 6.89 m2</b>							
No Asbestos							
<b>B00G - R0013 - Home Base Store - 3.01 m2</b>							
No Asbestos							
<b>B00H - General Learning - 1981 - Concrete</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0005 - Movement - 18.09 m2</b>							
No Asbestos							
<b>B00H - R0006 - Craft Store - 3.35 m2</b>							
No Asbestos							
<b>B00H - R0007 - Interview - 17.89 m2</b>							
No Asbestos							
<b>B00H - R0012 - Outdoor Learning Area - 132.16 m2</b>							
No Asbestos							
<b>B00H - R0013 - Home Base Store - 4.82 m2</b>							
No Asbestos							
<b>B00H - R0014 - Practical Activities - 6.69 m2</b>							
No Asbestos							
<b>B00H - R0015 - Practical Activities - 6.6 m2</b>							
No Asbestos							
<b>B00H - R0016 - Home Base Store - 4.76 m2</b>							
No Asbestos							
<b>B00H - R0017 - Home Base - 67.93 m2</b>							
No Asbestos							
<b>B00H - R0018 - Home Base - 67.75 m2</b>							
No Asbestos							
<b>B00I - General Learning - 1960 - Concrete</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						

<b>Interior</b>							
<b>B00I - R0001 - Movement - 2.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0002 - Personal Effects Storage - 6.63 m2</b>							
No Asbestos							
<b>B00I - R0010 - Movement - 1.98 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00I - R0011 - Movement - 3.13 m2</b>							
No Asbestos							
<b>B00I - R0012 - Home Base Store - 6.25 m2</b>							
No Asbestos							
<b>B00I - R0013 - Practical Activities - 7.42 m2</b>							
No Asbestos							
<b>B00I - R0014 - Practical Activities - 6.6 m2</b>							
No Asbestos							
<b>B00I - R0015 - Home Base Store - 2.95 m2</b>							
No Asbestos							
<b>B00I - R0016 - Home Base - 67.59 m2</b>							
No Asbestos							
<b>B00I - R0017 - Home Base - 67.4 m2</b>							
No Asbestos							
<b>B00J - Pupil Facilities - 1960 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00J - R0002 - Canteen Office/Store - 2.53 m2</b>							
No Asbestos							
<b>B00J - R0005 - Canteen - 30.52 m2</b>							
No Asbestos							
<b>B00J - R0006 - Staff Toilet - 1.7 m2</b>							
No Asbestos							
<b>B00J - R0007 - Canteen Office/Store - 1.79 m2</b>							
No Asbestos							
<b>B00L - Special Purpose - 1956 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Eaves Linings	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - Home Base - 47.08 m2</b>							
No Asbestos							
<b>B00L - R0002 - Movement - 11.96 m2</b>							
No Asbestos							

**B00M - Pupil Facilities - 1958 - Concrete Framed****Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting						

**Interior****B00M - R0001 - Drinking Facilities - 13.74 m2**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

**B00M - R0002 - Cleaning Distributed Store - 3.23 m2**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	--

**B00M - R0003 - Movement - 6.77 m2**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	--

**B00M - R0004 - No Access - 38.74 m2**

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

**B00M - R0005 - Sports Store - 10.23 m2**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

**B00M - R0006 - Drinking Facilities - 14.03 m2**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

**B00M - R0007 - Movement - 10.24 m2**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	------	------------	--------------------	---------	--------------------	--

**B00M - R0008 - Cleaning Distributed Store - 1.35 m2**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	-----	------------	--------------------	---------	--------------------	--

**B00M - R0009 - Toilets - Girls - 22.29 m2**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	23m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

**B00N - Pupil Facilities - 1958 - Concrete****Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting						

**Interior****B00N - R0001 - Toilets - Girls - 30.46 m2**

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	------------------	------	------------	--------------------	---------	--------------------	--

<b>B00N - R0002 - Cleaning Distributed Store - 1.29 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00N - R0003 - Handwashing Facilities - 12.5 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00N - R0004 - Drinking Facilities - 9.32 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00O - Building Services - 1960 - Concrete</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Flat AC Sheeting	4	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00O - R0001 - Garden Store - 11.93 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00O - R0002 - General Assistant/Bulk Store - 20.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00P - Pupil Facilities - 1956 - Concrete</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Flat AC Sheeting	4	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found						
<b>Interior</b>							
<b>B00P - R0001 - Drinking Facilities - 15.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00P - R0002 - P.E Store - 15.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - Pupil Facilities - 1971 - Concrete</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Wall Linings Internal - Infill	Flat AC Sheeting	4	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							

<b>B00Q - R0001 - Cleaning Distributed Store - 1.4 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00Q - R0002 - Toilets - Boys - 34.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00R - General Learning - 2004 - Fibre Cement Clad</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00R - R0001 - Movement - 34.75 m2</b>							
No Asbestos							
<b>B00R - R0002 - Practical Activities - 1hb - 19.98 m2</b>							
No Asbestos							
<b>B00R - R0003 - Home Base Store - 5.47 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00R - R0004 - Home Base - 59.04 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00R - R0005 - Withdrawal Space - 2hb - 11.65 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00R - R0006 - Home Base - 59.05 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00R - R0007 - Home Base Store - 5.48 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00R - R0008 - Practical Activities - 1hb - 19.99 m2</b>							
No Asbestos							
<b>B00S - Communal Facilities - 2009 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00S - R0001 - External Movement - 29.9 m2</b>							
No Asbestos							
<b>B00S - R0002 - Hall Chair Store - 10.97 m2</b>							
No Asbestos							
<b>B00S - R0003 - Communal/Performance Store - 10.91 m2</b>							
No Asbestos							
<b>B00S - R0004 - P.E Store - 17.26 m2</b>							
No Asbestos							
<b>B00S - R0005 - Main Switch Board - 2.44 m2</b>							
No Asbestos							
<b>B00S - R0006 - Cleaning Distributed Store - 4.2 m2</b>							

No Asbestos	
<b>B00S - R0007 - Toilets - Girls - 9.76 m2</b>	
No Asbestos	
<b>B00S - R0008 - Toilet - Lobby - 2.32 m2</b>	
No Asbestos	
<b>B00S - R0009 - Sound Cupboard - 2.03 m2</b>	
No Asbestos	
<b>B00S - R0010 - Toilets - Boys - 6.42 m2</b>	
No Asbestos	
<b>B00S - R0011 - Toilet - Lobby - 1.44 m2</b>	
No Asbestos	
<b>B00S - R0012 - Access Shower/Toilet - 6.97 m2</b>	
No Asbestos	
<b>B00S - R0013 - Covered Outdoor Learning Area - 234.72 m2</b>	
No Asbestos	
<b>B00S - R0014 - Communal Space - 204.99 m2</b>	
No Asbestos	
<b>B00S - R0015 - Movement - 17.72 m2</b>	
No Asbestos	
<b>B00S - R0016 - Raised Platform - 57.77 m2</b>	
No Asbestos	
<b>B00S - R0017 - Movement - 12.72 m2</b>	
No Asbestos	
<b>B00S - R0018 - External Movement - 23.66 m2</b>	
No Asbestos	

## Demountables

### OS 602 10372 - Learning Unit - Standard With P.A.A. - Placement Date : 20-SEP-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 601 10377 - Learning Unit - Standard/Withdrawal - Placement Date : 21-DEC-2009

#### Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

#### Interior

##### R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

##### R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

##### R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

### OS 751 11494 - Learning Unit - ESL - Placement Date : 06-NOV-2014

#### Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

#### Interior

##### R1- Esl

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos

##### R2- Esl

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos