


# Asbestos Register

(Hazardous Materials and Risk Assessment)

|                               |  |
|-------------------------------|--|
| <b>School:</b>                | <b>Horsley Park Public School (2182)</b> |
| <b>Region:</b>                | <b>South Western Sydney AMU</b>          |
| <b>State Electorate:</b>      | <b>Mulgoa</b>                            |
| <b>Local Government Area:</b> | <b>Fairfield</b>                         |

|                          |                          |
|--------------------------|--------------------------|
| <b>Last Reviewed By:</b> | <b>AECOM 26-MAY-2015</b> |
| <b>Last Revised By:</b>  |                          |

|  |           |
|--|-----------|
| <b>Historical Fibro In Grounds Investigations/Events</b>   | <b>No</b> |
| <p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p> |           |

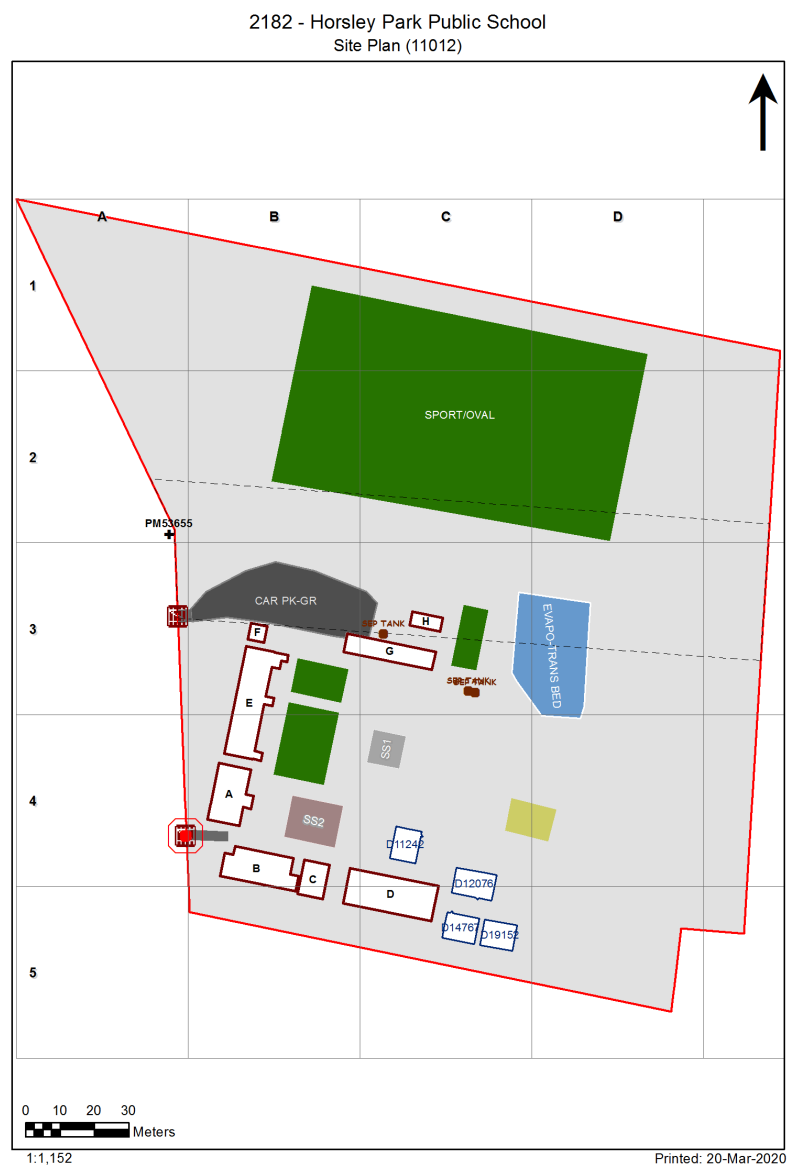

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

| Rating                     | Description  |
|----------------------------|--|
| Good condition (1)         | For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles  |
| Minimal damage (2)         | For non-friable asbestos that has a very small amount of damage, eg hairline cracks.   |
| Some damage / unsealed (3) | For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed. |
| Poor condition (4)         | For non-friable asbestos that has extensive damage. Visible asbestos debris  |
| Friable asbestos (5)       | Any occurrence of friable asbestos   |

| Product   | Material Description | Extent | Location              | Material Condition | Risk Status | Remediation Priority | Result   |
|---|----------------------|--------|-----------------------|--------------------|-------------|----------------------|--|
| <b>B00A - General Learning - 1934 - Timber</b>              |                      |        |                       |                    |             |                      |  |
| <b>Exterior</b>   |                      |        |                       |                    |             |                      |  |
| Eaves Linings   | Flat AC Sheeting     | 40m2   | East, West            | Good Condition (1) | Low (1)     | Low Priority (2-3)   | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining  | Flat AC Sheeting     | 30m2   | North, South          | Good Condition (1) | Low (1)     | Low Priority (2-3)   | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids   | No Asbestos Found    |        |                       |                    |             |                      |  |
| Underfloor Voids  | Non Accessible Area  |        |                       |                    |             |                      |  |
| <b>Interior</b>   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0005 - Home Base Store - 5.64 m2</b>             |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0006 - Interview - 16.53 m2</b>                  |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0009 - Main Switch Board - 6.06 m2</b>           |                      |        |                       |                    |             |                      |  |
| Electrical - Backing Board                                  | Resinous Board       | 2      | South, Middle portion | Good Condition (1) | Low (1)     | Low Priority (2-3)   | Chrysotile (white asbestos)                            |
| Wall Linings Internal                                       | Flat AC Sheeting     | 3m2    | South, Middle portion | Good Condition (1) | Low (1)     | Low Priority (2-3)   | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00A - R0010 - External Movement - 8.41 m2</b>           |                      |        |                       |                    |             |                      |  |
| Ceiling Structures/Linings                                  | Flat AC Sheeting     | 9m2    | Throughout            | Good Condition (1) | Low (1)     | Low Priority (2-3)   | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00A - R0011 - Staff Room - 14.93 m2</b>                 |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0012 - Staff Kitchen - 6.01 m2</b>               |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0013 - Staff Toilet - 7.25 m2</b>                |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0014 - General Storeroom - 5.32 m2</b>           |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0015 - Movement - 17.87 m2</b>                   |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0016 - Home Base - 55.51 m2</b>                  |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00A - R0017 - Practical Activities - 1hb - 10.85 m2</b> |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00B - Library - 1978 - Timber</b>                       |                      |        |                       |                    |             |                      |  |
| <b>Exterior</b>   |                      |        |                       |                    |             |                      |  |
| Ceiling Voids   | No Asbestos Found    |        |                       |                    |             |                      |  |
| Underfloor Voids  | No Asbestos Found    |        |                       |                    |             |                      |  |
| <b>Interior</b>   |                      |        |                       |                    |             |                      |  |
| <b>B00B - R0003 - Canteen - 16.01 m2</b>                    |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00B - R0005 - Handwashing Facilities - 8.17 m2</b>      |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00B - R0006 - Canteen Covered Area - 17.23 m2</b>       |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |
| <b>B00B - R0007 - External Movement - 30.73 m2</b>          |                      |        |                       |                    |             |                      |  |
| No Asbestos   |                      |        |                       |                    |             |                      |  |

|   |                   |      |                          |                    |         |                    |  |
|---|-------------------|------|--------------------------|--------------------|---------|--------------------|--|
| <b>B00B - R0008 - Library Office/Workroom - 11.09 m2</b>            |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00B - R0009 - Reading Area - 86.47 m2</b>                       |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00B - R0010 - Communications Room - 8.17 m2</b>                 |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00C - General Learning - 1940 - Timber</b>                      |                   |      |                          |                    |         |                    |  |
| <b>Exterior</b>   |                   |      |                          |                    |         |                    |  |
| Ceiling Voids   | No Asbestos Found |      |                          |                    |         |                    |  |
| Underfloor Voids  | No Asbestos Found |      |                          |                    |         |                    |  |
| Eaves Linings   | Flat AC Sheeting  | 30m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>Interior</b>   |                   |      |                          |                    |         |                    |  |
| <b>B00C - R0001 - Home Base - 52.56 m2</b>                          |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00C - R0002 - External Movement - 17.31 m2</b>                  |                   |      |                          |                    |         |                    |  |
| Ceiling Structures/Linings  | Flat AC Sheeting  | 18m2 | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Wall Linings Internal   | Flat AC Sheeting  | 3m2  | West, Upper portion      | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00D - General Learning/Administration - 1978 - Brick/Veneer</b> |                   |      |                          |                    |         |                    |  |
| <b>Exterior</b>   |                   |      |                          |                    |         |                    |  |
| Wall Linings Internal - Infill                                      | Flat AC Sheeting  |      |                          |                    |         |                    |  |
| Eaves Linings   | Flat AC Sheeting  | 20m2 | South                    | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| Gable Verge Lining  | Flat AC Sheeting  | 20m2 | East, West               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| Ceiling Voids   | No Asbestos Found |      |                          |                    |         |                    |  |
| Underfloor Voids  | Flat AC Sheeting  |      | West                     | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| <b>Interior</b>   |                   |      |                          |                    |         |                    |  |
| <b>B00D - R0001 - Clerical Office - 11.19 m2</b>                    |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00D - R0002 - Uniform Shop - .5 m2</b>                          |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00D - R0003 - General Storeroom - 6.57 m2</b>                   |                   |      |                          |                    |         |                    |  |
| Floor Coverings Res/Textile   | Vinyl Tiles       | 7m2  | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| <b>B00D - R0004 - Principal - 16.15 m2</b>                          |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00D - R0005 - Sick Bay - 15.77 m2</b>                           |                   |      |                          |                    |         |                    |  |
| Floor Coverings Res/Textile   | Vinyl Tiles       | 16m2 | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| <b>B00D - R0006 - Home Base - 56.81 m2</b>                          |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00D - R0007 - Home Base Store - 6.67 m2</b>                     |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00D - R0008 - Personal Effects Storage - 13.06 m2</b>           |                   |      |                          |                    |         |                    |  |
| No Asbestos   |                   |      |                          |                    |         |                    |  |
| <b>B00D - R0009 - Home Base Store - 6.67 m2</b>                     |                   |      |                          |                    |         |                    |  |

|  |                     |       |              |                            |         |                       |  |
|--|---------------------|-------|--------------|----------------------------|---------|-----------------------|--|
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00D - R0010 - Special Programs Room - 57.13 m2</b>     |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00D - R0011 - External Movement - 46.69 m2</b>         |                     |       |              |                            |         |                       |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 47m2  | Throughout   | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos)                            |
| <b>B00D - R0012 - Craft Store - 4.53 m2</b>                |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00D - R9001 - Security Store - 30.8 m2</b>             |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - General Learning - 1978 - Brick/Veneer</b>       |                     |       |              |                            |         |                       |  |
| <b>Exterior</b>  |                     |       |              |                            |         |                       |  |
| Eaves Linings  | Flat AC Sheeting    | 50m2  | East, West   | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos)                            |
| Gable Verge Lining   | Flat AC Sheeting    | 30m2  | North, South | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos)                            |
| Underfloor Voids   | AC Fragments/Debris |       | Throughout   | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos)                            |
| Ceiling Voids  | No Asbestos Found   |       |              |                            |         |                       |  |
| <b>Interior</b>  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0001 - External Movement - 4.9 m2</b>           |                     |       |              |                            |         |                       |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 5m2   | Throughout   | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos)                            |
| <b>B00E - R0005 - Communal Space - 56.45 m2</b>            |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0006 - Communal Space - 56.45 m2</b>            |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0009 - Movement - 3.08 m2</b>                   |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0010 - External Movement - 4.81 m2</b>          |                     |       |              |                            |         |                       |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 5m2   | Throughout   | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos)                            |
| <b>B00E - R0011 - Home Base - 85.78 m2</b>                 |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0013 - External Movement - 7.15 m2</b>          |                     |       |              |                            |         |                       |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 8m2   | Throughout   | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos)                            |
| <b>B00E - R0014 - Personal Effects Storage - 8.31 m2</b>   |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0015 - Home Base Store - 5.29 m2</b>            |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0016 - Practical Activities - 1hb - 9.66 m2</b> |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |
| <b>B00E - R0017 - Toilet - Lobby - 1.77 m2</b>             |                     |       |              |                            |         |                       |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 1.5m2 | Throughout   | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00E - R0018 - Toilets-Unisex - 1.79 m2</b>             |                     |       |              |                            |         |                       |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 1.5m2 | Throughout   | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00E - R0019 - Home Base Store - 4.58 m2</b>            |                     |       |              |                            |         |                       |  |
| Electrical - Backing Board                                 | Resinous Board      | 0.5   | East         | Good Condition (1)         | Low (1) | Low Priority (2-3)    | Assumed Asbestos                                       |
| <b>B00E - R0020 - Practical Activities - 4.85 m2</b>       |                     |       |              |                            |         |                       |  |
| No Asbestos  |                     |       |              |                            |         |                       |  |

|  |                     |       |                          |                    |         |                    |  |
|--|---------------------|-------|--------------------------|--------------------|---------|--------------------|--|
| <b>B00E - R0021 - Home Base Store - 5.79 m2</b>            |                     |       |                          |                    |         |                    |  |
| No Asbestos  |                     |       |                          |                    |         |                    |  |
| <b>B00F - Pupil Facilities - 1978 - Brick/Veneer</b>       |                     |       |                          |                    |         |                    |  |
| <b>Exterior</b>  |                     |       |                          |                    |         |                    |  |
| Eaves Linings  | Flat AC Sheeting    | 10m2  | East, West               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Wall Cladding  | Flat AC Sheeting    | 40m2  | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Floor Coverings Res/Textile                                | Compressed AC Sheet |       |                          |                    |         |                    |  |
| Ceiling Voids - Flat Roof                                  | No Asbestos Found   |       |                          |                    |         |                    |  |
| Underfloor Voids   | No Asbestos Found   |       |                          |                    |         |                    |  |
| <b>Interior</b>  |                     |       |                          |                    |         |                    |  |
| <b>B00F - R0001 - Entry Vestibule - 6.35 m2</b>            |                     |       |                          |                    |         |                    |  |
| Floor Coverings Res/Textile                                | Vinyl Tiles         |       |                          |                    |         |                    |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 6m2   | Throughout               | Mnimal Damage (2)  | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| <b>B00F - R0002 - Community Clinic - 10.28 m2</b>          |                     |       |                          |                    |         |                    |  |
| Floor Coverings Res/Textile                                | Vinyl Tiles         |       |                          |                    |         |                    |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 10m2  | Throughout               | Mnimal Damage (2)  | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| <b>B00F - R0003 - Staff Toilet - 4.14 m2</b>               |                     |       |                          |                    |         |                    |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 4m2   | Throughout               | Mnimal Damage (2)  | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)                            |
| Floor Coverings Res/Textile                                | Vinyl Tiles         |       |                          |                    |         |                    |  |
| <b>B00G - Pupil Facilities - 1978 - Brick/Block</b>        |                     |       |                          |                    |         |                    |  |
| <b>Exterior</b>  |                     |       |                          |                    |         |                    |  |
| Eaves Linings  | Flat AC Sheeting    | 20m2  | North, South             | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids - Flat Roof                                  | No Asbestos Found   |       |                          |                    |         |                    |  |
| Underfloor Voids - Slab on Ground                          | No Asbestos Found   |       |                          |                    |         |                    |  |
| <b>Interior</b>  |                     |       |                          |                    |         |                    |  |
| <b>B00G - R0001 - Toilets - Girls - 51.2 m2</b>            |                     |       |                          |                    |         |                    |  |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet | 15m2  | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 52m2  | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00G - R0002 - Sports Store - 18.02 m2</b>              |                     |       |                          |                    |         |                    |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 18m2  | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00G - R0003 - Toilets - Boys - 49.31 m2</b>            |                     |       |                          |                    |         |                    |  |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet | 15m2  | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 50m2  | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00G - R0004 - Cleaning Distributed Store - 1.47 m2</b> |                     |       |                          |                    |         |                    |  |
| Ceiling Structures/Linings                                 | Flat AC Sheeting    | 1.5m2 | Throughout               | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00H - Other - 2007 - Metal Shed</b>                    |                     |       |                          |                    |         |                    |  |

|   |                   |  |
|---|-------------------|--|
| <b>Exterior</b>                                 |                   |  |
| No Asbestos                                     |                   |  |
| Underfloor Voids                                | No Asbestos Found |  |
| Ceiling Voids                                   | No Asbestos Found |  |
| <b>Interior</b>                                 |                   |  |
| <b>B00H - R0001 - Garage/Carport - 34.38 m2</b> |                   |  |
| No Asbestos                                     |                   |  |

## Demountables

### OS 602 11242 - Learning Unit - Standard With P.A.A. - Placement Date : 20-JAN-2015

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 621 12076 - Single Learning Unit - H/Cap - Placement Date : 02-MAY-2014

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 602 14767 - Learning Unit - Standard With P.A.A. - Placement Date : 01-MAY-2014

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

### OS 606 19152 - Learning Unit - Standard With P.A.A A/C - Placement Date : 20-DEC-2017

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found