


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hilltop Road Public School (3997)
Region:	Western Sydney AMU
State Electorate:	Granville
Local Government Area:	Cumberland

Last Reviewed By:	Greencap 12-DEC-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

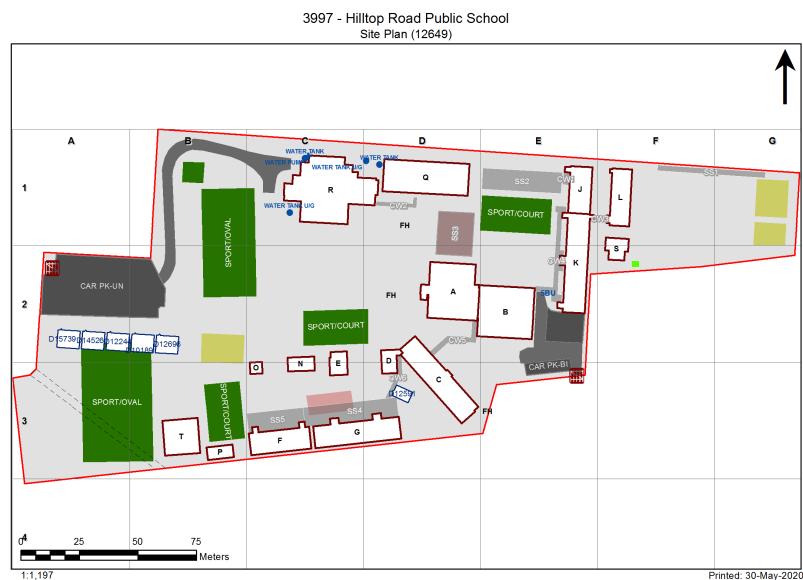

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Communal Facilities - 1972 - Brick/Block							
Exterior							
Wall Cladding	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - External Movement - 119.4 m2							
Ceiling Structures/Linings	No Asbestos Found						
B00A - R0003 - Movement - 10.44 m2							
No Asbestos							
B00A - R0004 - Sports Store - 12.06 m2							
No Asbestos							
B00A - R0005 - Toilets - Girls - 55.51 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0006 - Cleaning Distributed Store - 9.68 m2							
No Asbestos							
B00A - R0007 - Toilets - Boys - 56.23 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0008 - Garden Store - 10.37 m2							
No Asbestos							
B00A - R0009 - General Storeroom - 3.82 m2							
No Asbestos							
B00A - R0010 - Movement - 7.04 m2							
No Asbestos							
B00A - R0011 - General Storeroom - 31.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0012 - Movement - 148.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00A - R0013 - Stairs - 5.72 m2							
No Asbestos							
B00A - R1001 - Home Base - 65.22 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1002 - Movement - 65.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1003 - Home Base - 68.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1004 - Distribution Board - 1.34 m2							
No Asbestos							Note: No inspection of live electrical installation

B00A - R1005 - Home Base - 68.91 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1006 - External Movement - 18.75 m2							
No Asbestos							
B00A - R1007 - Home Base - 65.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1008 - Stairs - 13.69 m2							
No Asbestos							
B00B - Administration/Library - 1972 - Brick/Block							
Exterior							
Wall Cladding	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - External Movement - 98.92 m2							
No Asbestos							
B00B - R0003 - Staff Toilet - 7.45 m2							
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Plant / Equipment - Incinerator	Encapsulated Asbestos material within unit	1	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0004 - Staff Toilet - 5.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0005 - Movement - 31.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0006 - Community Clinic - 16.81 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0007 - Deputy Principal - 14.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0008 - Staff Toilet - 2.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0009 - General Storeroom - 2.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0010 - Cleaning Distributed Store - 1.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0011 - Interview - 14.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0012 - Entry Vestibule - 11.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

B00B - R0013 - Principal - 16.09 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0014 - Staff Toilet - 3.81 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0015 - General Storeroom - 3.37 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0016 - Sick Bay - 8.6 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0017 - Clerical Office - 16.14 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0018 - Security Store - 16.24 m2		
Floor Coverings Res/Textile	Vinyl Tiles	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0019 - Duplicating Workroom - 12.27 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0020 - Main Switch Board - 8.01 m2		
No Asbestos		
B00B - R0023 - Staff Toilet - 2.74 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0024 - Canteen Office/Store - 4.58 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0025 - Canteen Office/Store - 5.2 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0026 - Staff Kitchen - 5.49 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0027 - Staff Room - 58.59 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R0028 - Staff Kitchen - 8.29 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0029 - Special Programs Room - 39.89 m2		
No Asbestos		
B00B - R0030 - Movement - 2.55 m2		
No Asbestos		
B00B - R0031 - Movement - 36.1 m2		
No Asbestos		
B00B - R1001 - Reading Area - 218.44 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)	
B00B - R1002 - Home Base - 54.11 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1003 - Movement - 38.08 m2		

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1004 - Staff Room - 19.32 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1005 - Library Office/Workroom - 6.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1006 - Toilets - Boys - 3.95 m2							
Partition Walls (Cubides)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1007 - Distribution Board - .84 m2						Note: No inspection of live electrical installation	
Door - Lining	Flat AC Sheeting	6	West	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1008 - Cleaning Distributed Store - 2.15 m2							
No Asbestos							
B00B - R1009 - Toilets - Girls - 3.97 m2							
Partition Walls (Cubides)	Compressed AC Sheet	4m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1010 - K.L.A. Store - 12.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1011 - Communications Room - 12.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - General Learning - 1953 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - External Movement - 59.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0002 - External Movement - 10.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0003 - External Movement - 42.2 m2							
No Asbestos							
B00C - R0004 - Staff Toilet - 5.65 m2							
No Asbestos							
B00C - R0005 - Movement - 3.21 m2							
No Asbestos							
B00C - R0006 - Interview - 12.68 m2							
No Asbestos							
B00C - R0007 - Home Base - 53.68 m2							
Wall Linings Internal	Flat AC Sheeting	30m2	North, South, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0008 - Home Base - 53.82 m2							
No Asbestos							
B00C - R0009 - Interview - 9.31 m2							

No Asbestos							
B00C - R0010 - Home Base Store - 12.68 m2							
No Asbestos							
B00C - R0011 - Home Base - 53.53 m2							
No Asbestos							
B00C - R0012 - Home Base - 53.17 m2							
No Asbestos							
B00C - R0013 - Home Base Store - 5.5 m2							
No Asbestos							
B00C - R0014 - General Storeroom - 16.23 m2							
No Asbestos							
B00D - Building Services - 1953 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - External Movement - 20.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0002 - General Assistant/Bulk Store - 22.59 m2							
No Asbestos							
B00D - R0003 - General Storeroom - 11.23 m2							
No Asbestos							
B00D - R0004 - Sports Store - 10.83 m2							
No Asbestos							
B00E - Other-After School Care - 1953 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Movement - 15.62 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0002 - Out Of School Hours Care Centre - 53.53 m2							
No Asbestos							
B00F - General Learning - 1953 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	70m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - External Movement - 5.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0006 - External Movement - 5.99 m2							

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0007 - Home Base - 69.01 m2							
No Asbestos							
B00F - R0008 - Practical Activities - 1hb - 18.62 m2							
No Asbestos							
B00F - R0009 - Personal Effects Storage - 7.87 m2							
No Asbestos							
B00F - R0010 - Home Base Store - 7.9 m2							
No Asbestos							
B00F - R0011 - Withdrawal Space - 2hb - 21.65 m2							
No Asbestos							
B00F - R0012 - Home Base - 71.09 m2							
No Asbestos							
B00F - R0013 - Practical Activities - 1hb - 19.81 m2							
No Asbestos							
B00F - R0014 - Personal Effects Storage - 6.17 m2							
No Asbestos							
B00F - R0015 - Home Base Store - 6.25 m2							
No Asbestos							
B00G - General Learning - 1953 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G - R0001 - Home Base - 66.28 m2							
No Asbestos							
B00G - R0002 - Home Base Store - 7.85 m2							
No Asbestos							
B00G - R0003 - General Storeroom - 3.85 m2							
No Asbestos							
B00G - R0004 - Home Base Store - 7.94 m2							
No Asbestos							
B00G - R0005 - Personal Effects Storage - 3.89 m2							
No Asbestos							
B00G - R0006 - Movement - 7.5 m2							
No Asbestos							
B00G - R0007 - External Movement - 9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0008 - Home Base - 65.76 m2							
No Asbestos							
B00G - R0009 - Home Base - 66.22 m2							
No Asbestos							
B00G - R0010 - Home Base Store - 8.04 m2							
No Asbestos							
B00G - R0011 - General Storeroom - 3.81 m2							
No Asbestos							

B00G - R0012 - Home Base Store - 8.01 m2							
No Asbestos							
B00G - R0013 - General Storeroom - 3.83 m2							
No Asbestos							
B00G - R0014 - Movement - 7.44 m2							
No Asbestos							
B00G - R0015 - Home Base - 65.91 m2							
No Asbestos							
B00G - R0016 - External Movement - 8.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - General Learning - 1957 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	, Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0002 - Home Base - 92.54 m2							
No Asbestos							
B00J - R0003 - Home Base - 66.06 m2							
No Asbestos							
B00J - R0004 - External Movement - 5.39 m2							
No Asbestos							
B00J - R0005 - Movement - 9.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0006 - Personal Effects Storage - 8.53 m2							
No Asbestos							
B00J - R0007 - Home Base Store - 4.31 m2							
No Asbestos							
B00K - General Learning - 1953 - Timber							
Exterior							
Eaves Linings	Flat AC Sheeting	100m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00K - R0001 - External Movement - 2.52 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00K - R0002 - Personal Effects Storage - 12.18 m2							
No Asbestos							
B00K - R0003 - Home Base - 65.98 m2							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0004 - Home Base - 93.45 m2							
No Asbestos							
B00K - R0005 - Staff Toilet - 1.6 m2							

Furniture / Fixtures - Cistern	Fibre Cement Casting (Monocrete)							
B00K - R0006 - Movement - 10.97 m2								
No Asbestos								
B00K - R0007 - External Movement - 9.66 m2								
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00K - R0010 - Home Base - 66.1 m2								
No Asbestos								
B00K - R0011 - Home Base - 66.16 m2								
No Asbestos								
B00K - R0013 - Movement - 6.34 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
B00K - R0014 - General Storeroom - 12.65 m2								
No Asbestos								
B00K - R0015 - External Movement - 5.94 m2								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00K - R0016 - External Movement - 5.23 m2								
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00K - R0017 - Movement - 3.48 m2								
No Asbestos								
B00K - R0018 - Personal Effects Storage - 8.27 m2								
No Asbestos								
B00K - R0019 - Home Base Store - 4.18 m2								
No Asbestos								
B00K - R0020 - Personal Effects Storage - 8.27 m2								
No Asbestos								
B00K - R0021 - Home Base Store - 4.18 m2								
No Asbestos								
B00K - R0022 - Personal Effects Storage - 8.24 m2								
No Asbestos								
B00K - R0023 - Home Base Store - 4.18 m2								
No Asbestos								
B00L - General Learning - 1953 - Brick/Veneer								
Exterior								
Eaves Linings	Flat AC Sheeting	60m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B00L - R0001 - Home Base Store - 6.41 m2								
No Asbestos								
B00L - R0002 - Home Base - 56.62 m2								
No Asbestos								
B00L - R0003 - Movement - 2.99 m2								
No Asbestos								
B00L - R0004 - Personal Effects Storage - 4.15 m2								
No Asbestos								
B00L - R0005 - External Movement - 1.62 m2								

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00L - R0006 - Home Base - 85.01 m2							
No Asbestos							
B00L - R0007 - Toilets - Boys/Girls - 4.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00L - R0008 - Personal Effects Storage - 3.57 m2							
No Asbestos							
B00L - R0009 - Home Base Store - 10.81 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0010 - Movement - 8.09 m2							
No Asbestos							
B00L - R0011 - External Movement - 4.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00N - Pupil Facilities - 1953 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00N - R0001 - Toilets - Boys - 53.89 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00N - R0002 - General Storeroom - 4.02 m2							
No Asbestos							
B00O - Pupil Facilities - 1953 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00O - R0001 - Drinking Facilities - 10.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00O - R0002 - Drinking Facilities - 9.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00P - Pupil Facilities - 1953 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00P - R0002 - Cleaning Distributed Store - 2.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00P - R0003 - Toilets - Girls - 44.72 m2							
No Asbestos							

B00P - R0004 - Cleaning Distributed Store - 3.82 m2

No Asbestos

B00Q - General Learning - 2010 - Brick/Veneer**Exterior**

Underfloor Voids No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00Q - R0001 - Home Base - 60.25 m2**

No Asbestos

B00Q - R0002 - Home Base Store - 6.22 m2

No Asbestos

B00Q - R0003 - Practical Activities - 1hb - 18.78 m2

No Asbestos

B00Q - R0004 - Withdrawal Space - 2hb - 11.48 m2

No Asbestos

B00Q - R0005 - Home Base - 60.69 m2

No Asbestos

B00Q - R0006 - Home Base Store - 6.21 m2

No Asbestos

B00Q - R0007 - Practical Activities - 1hb - 18.96 m2

No Asbestos

B00Q - R0008 - Home Base - 60.53 m2

No Asbestos

B00Q - R0009 - Home Base Store - 6.21 m2

No Asbestos

B00Q - R0010 - Practical Activities - 1hb - 18.95 m2

No Asbestos

B00Q - R0011 - Withdrawal Space - 2hb - 11.51 m2

No Asbestos

B00Q - R0012 - Home Base - 60.26 m2

No Asbestos

B00Q - R0013 - Home Base Store - 6.21 m2

No Asbestos

B00Q - R0014 - Practical Activities - 1hb - 18.84 m2

No Asbestos

B00Q - R0015 - External Movement - 95.71 m2

No Asbestos

B00R - Communal Facilities/Other - 2011 - Brick/Veneer**Exterior**

Underfloor Voids No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00R - R0001 - Communal Space - 202.01 m2**

No Asbestos

B00R - R0002 - Raised Platform - 60.3 m2

No Asbestos

B00R - R0003 - Hall Chair Store - 11.15 m2

No Asbestos

B00R - R0004 - Cleaning Supplies - 12.9 m2

No Asbestos

B00R - R0005 - Toilets - Girls - 9.8 m2

No Asbestos		
B00R - R0006 - Toilet - Lobby - 3.93 m2		
No Asbestos		
B00R - R0007 - Sound Cupboard - 3.05 m2		
No Asbestos		
B00R - R0008 - Access Shower/Toilet - 6.71 m2		
No Asbestos		
B00R - R0009 - Toilets - Boys - 7.01 m2		
No Asbestos		
B00R - R0010 - Toilet - Lobby - 2.11 m2		
No Asbestos		
B00R - R0011 - P.E Store - 14.66 m2		
No Asbestos		
B00R - R0012 - Communal/Performance Store - 10.8 m2		
No Asbestos		
B00R - R0013 - Main Switch Board - 2.67 m2		
No Asbestos		
B00R - R0014 - Canteen - 43.66 m2		
No Asbestos		
B00R - R0015 - Canteen Office/Store - 10.37 m2		
No Asbestos		
B00R - R0016 - General Assistant/Bulk Store - 14.08 m2		
No Asbestos		
B00R - R0017 - Plant - .95 m2		
No Asbestos		
B00R - R0018 - Movement - 5.23 m2		
No Asbestos		
B00R - R0019 - Ramp - 13.48 m2		
No Asbestos		
B00R - R0020 - Movement - 12.77 m2		
No Asbestos		
B00R - R0021 - Movement - 2.53 m2		
No Asbestos		
B00R - R0022 - External Movement - 5.11 m2		
No Asbestos		
B00R - R0023 - Plant - 1.54 m2		
No Asbestos		
B00R - R0024 - External Movement - 6.36 m2		
No Asbestos		
B00R - R0025 - Canteen Covered Area - 36.45 m2		
No Asbestos		
B00R - R0026 - External Movement - 65.34 m2		
No Asbestos		
B00R - R0027 - Covered Outdoor Learning Area - 177.26 m2		
No Asbestos		
B00S - Pupil Facilities/Staff Facilities - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00S - R0001 - External Movement - 26.71 m2		

No Asbestos	
B00S - R0002 - Toilets - Girls - 22.58 m2	
No Asbestos	
B00S - R0003 - Access Shower/Toilet - 5.89 m2	
No Asbestos	
B00S - R0004 - Toilets - Boys - 16.15 m2	
No Asbestos	
B00T - Administration/Staff Facilitie - 2017 - Steel	
Exterior	
Require Inspection	
Interior	
B00T - R0001 - Staff Room - 16.37 m2	
Require Inspection	
B00T - R0002 - Staff Room - 11.2 m2	
Require Inspection	
B00T - R0003 - Staff Room - 11.2 m2	
Require Inspection	
B00T - R0004 - Staff Kitchen - 7.84 m2	
Require Inspection	
B00T - R0005 - Staff Toilet - 10.16 m2	
Require Inspection	
B00T - R0006 - Movement - 3.64 m2	
Require Inspection	
B00T - R0007 - Staff Toilet - 7.45 m2	
Require Inspection	
B00T - R0008 - Plant - 1.98 m2	
Require Inspection	
B00T - R0009 - Practical Activities - 108.41 m2	
Require Inspection	
B00T - R0010 - Clerical Office - 11.6 m2	
Require Inspection	
B00T - R0011 - Staff Room - 14.29 m2	
Require Inspection	
B00T - R0012 - Staff Room - 9.87 m2	
Require Inspection	

Demountables

OS 603 10189 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 20-FEB-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 12244 - Learning Unit - Standard With P.A.A. - Placement Date : 30-OCT-2014

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 750 12591 - Learning Unit - ESL - Placement Date : 05-JUN-2009

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 12696 - Learning Unit - Standard With P.A.A. - Placement Date : 18-SEP-2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 14526 - Learning Unit - Standard With P.A.A. - Placement Date : 18-NOV-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 15739 - Learning Unit - Standard With P.A.A. - Placement Date : 24-APR-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found