


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Hornsby Heights Public School (4274)</b>
<b>Region:</b>	<b>Northern Sydney AMU</b>
<b>State Electorate:</b>	<b>Hornsby</b>
<b>Local Government Area:</b>	<b>Hornsby</b>

Last Reviewed By:	WSP 13-SEP-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>Yes</b>
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

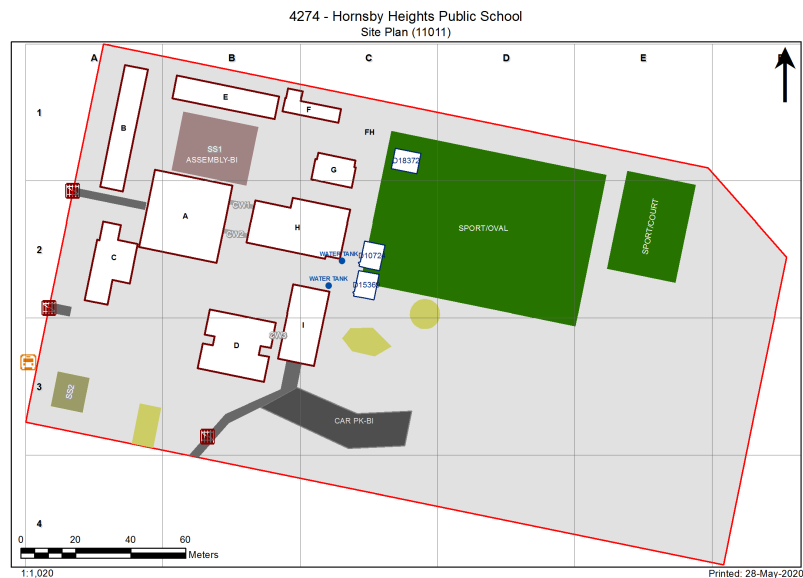

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/General Learning - 1972 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Linings Internal - Infill	Flat AC Sheeting	20	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>Interior</b>							
<b>B00A - R0001 - Home Base - 64.78 m2</b>							
No Asbestos							
<b>B00A - R0002 - Practical Activities - 1hb - 9.84 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0003 - Home Base - 64.2 m2</b>							
No Asbestos							
<b>B00A - R0004 - Practical Activities - 1hb - 9.84 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Toilets - Boys - 20.95 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0006 - Sports Store - 6.99 m2</b>							
No Asbestos							
<b>B00A - R0007 - Staff Room - 83.51 m2</b>							
No Asbestos							
<b>B00A - R0008 - Staff Toilet - 11.02 m2</b>							
No Asbestos							
<b>B00A - R0009 - Cleaning Distributed Store - 5.64 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00A - R0010 - Staff Toilet - 11.07 m2</b>							
No Asbestos							
<b>B00A - R0011 - Movement - 18.11 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0012 - General Storeroom - 19.5 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0013 - Security Store - 9.41 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0014 - Movement - 15.71 m2</b>							
No Asbestos							
<b>B00A - R0015 - General Storeroom - 9.62 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0016 - Staff Room Annexe - 17.18 m2</b>							
No Asbestos							
<b>B00A - R0017 - Security Store - 9.7 m2</b>							

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0018 - Deputy Principal - 17.19 m2</b>							
No Asbestos							
<b>B00A - R0019 - Staff Toilet - 3.37 m2</b>							
No Asbestos							
<b>B00A - R0020 - General Storeroom - 2.99 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0021 - Principal - 21.14 m2</b>							
No Asbestos							
<b>B00A - R0022 - Main Switch Board - 10.87 m2</b>							
No Asbestos							
<b>B00A - R0023 - Entry Vestibule - 33.15 m2</b>							
No Asbestos							
<b>B00A - R0024 - Clerical Office - 17.36 m2</b>							
No Asbestos							
<b>B00A - R0025 - Duplicating Workroom - 14.18 m2</b>							
No Asbestos							
<b>B00A - R0026 - Sick Bay - 15.33 m2</b>							
No Asbestos							
<b>B00A - R0027 - Staff Toilet - 4.2 m2</b>							
No Asbestos							
<b>B00A - R0028 - Toilets - Girls - 20.57 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0029 - Movement - 107.35 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - General Learning - 1972 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	60m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Compressed AC Sheet	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>Interior</b>							
<b>B00B - R0001 - Movement - 1.4 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0002 - Movement - 2.57 m2</b>							
No Asbestos							
<b>B00B - R0003 - General Storeroom - 3.83 m2</b>							
No Asbestos							
<b>B00B - R0004 - Communal/Performance Store - 19.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00B - R0005 - Home Base - 57.12 m2</b>							
No Asbestos							
<b>B00B - R0006 - Home Base Store - 5.55 m2</b>							
No Asbestos							

<b>B00B - R0007 - Personal Effects Storage - 4.24 m2</b>							
No Asbestos							
<b>B00B - R0008 - Movement - 4.1 m2</b>							
No Asbestos							
<b>B00B - R0009 - Cleaning Distributed Store - .62 m2</b>							
No Asbestos							
<b>B00B - R0010 - Movement - 1.51 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0011 - Practical Activities - 1hb - .55 m2</b>							
No Asbestos							
<b>B00B - R0012 - Personal Effects Storage - 3.39 m2</b>							
No Asbestos							
<b>B00B - R0013 - Distribution Board - .57 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0014 - Special Programs Store - 5.45 m2</b>							
No Asbestos							
<b>B00B - R0015 - Home Base - 57.04 m2</b>							
No Asbestos							
<b>B00B - R0016 - Home Base - 57.04 m2</b>							
No Asbestos							
<b>B00B - R0017 - Home Base Store - 4.16 m2</b>							
No Asbestos							
<b>B00B - R0018 - Personal Effects Storage - 5.45 m2</b>							
No Asbestos							
<b>B00B - R0019 - Movement - 4.08 m2</b>							
No Asbestos							
<b>B00B - R0020 - Practical Activities - 1hb - .54 m2</b>							
No Asbestos							
<b>B00B - R0021 - Movement - 1.45 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00B - R0022 - Practical Activities - 1hb - .54 m2</b>							
No Asbestos							
<b>B00B - R0023 - Personal Effects Storage - 5.45 m2</b>							
No Asbestos							
<b>B00B - R0024 - Home Base Store - 4.16 m2</b>							
No Asbestos							
<b>B00B - R0025 - Home Base - 57.04 m2</b>							
No Asbestos							
<b>B00B - R0026 - Movement - 4.43 m2</b>							
No Asbestos							
<b>B00B - R0027 - General Storeroom - .7 m2</b>							
No Asbestos							
<b>B00B - R0028 - General Storeroom - 18.02 m2</b>							
No Asbestos							
<b>B00B - R0029 - General Storeroom - 1.09 m2</b>							
No Asbestos							
<b>B00B - R0030 - General Storeroom - 5.91 m2</b>							
No Asbestos							
<b>B00B - R0031 - Movement - 1.5 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - General Learning/Pupil Facilities - 1965 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Gable Verge Lining	Compressed AC Sheet	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00C - R0001 - Movement - 1.16 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0002 - Personal Effects Storage - 7.23 m2</b>							
No Asbestos							
<b>B00C - R0003 - Home Base Store - 4.75 m2</b>							
No Asbestos							
<b>B00C - R0004 - Home Base - 57.03 m2</b>							
No Asbestos							
<b>B00C - R0005 - Home Base - 85.95 m2</b>							
No Asbestos							
<b>B00C - R0006 - Toilets - Boys/Girls - 2.91 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00C - R0007 - Home Base Store - 2.85 m2</b>							
No Asbestos							
<b>B00C - R0008 - Personal Effects Storage - 4.59 m2</b>							
Electrical - Mounting Board	Resinous Board	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00C - R0009 - Movement - 2.85 m2</b>							
No Asbestos							
<b>B00C - R0010 - Outdoor Learning Area - 80.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0011 - Movement - 9.71 m2</b>							
No Asbestos							
<b>B00C - R0012 - Movement - 14.02 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0013 - Canteen - 18.19 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0014 - Canteen Office/Store - 3.3 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0015 - Canteen Office/Store - 2.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R9001 - General Assistant/Bulk Store - 19.45 m2</b>							
No Asbestos							

## B00D - Library/General Learning - 1961 - Brick/Block

### Exterior

Gable Verge Lining	Compressed AC Sheet	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Linings Internal - Infill	Flat AC Sheeting	6	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

### Interior

#### B00D - R0001 - Reading Area - 159.51 m2

No Asbestos

#### B00D - R0002 - Security Store - 13.16 m2

No Asbestos

#### B00D - R0003 - Library Office/Workroom - 19.53 m2

No Asbestos

#### B00D - R0004 - Practical Activities - 1hb - 18.11 m2

Floor Coverings Res/Textile	Vinyl Tiles						
-----------------------------	-------------	--	--	--	--	--	--

#### B00D - R0005 - Home Base - 59.13 m2

No Asbestos

#### B00D - R0006 - Special Programs Room - 59.35 m2

No Asbestos

#### B00D - R0007 - Practical Activities - 1hb - 17.89 m2

Floor Coverings Res/Textile	Vinyl Tiles						
-----------------------------	-------------	--	--	--	--	--	--

#### B00D - R0008 - Toilets - Girls - 18.75 m2

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	---------------------	-----	--------------------	--------------------	---------	--------------------	-----------------------------

#### B00D - R0009 - Uniform Shop - 6.02 m2

Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
-----------------------------	----------------	---	-------------	--------------------	---------	--------------------	------------------

#### B00D - R0010 - Toilets - Boys - 19.68 m2

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	---------------------	-----	--------------------	--------------------	---------	--------------------	-----------------------------

#### B00D - R0011 - Main Switch Board - 4.38 m2

No Asbestos

#### B00D - R0012 - Movement - 24.49 m2

Wall Linings Internal	Flat AC Sheeting	6m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------	------------------	-----	-----------------------------	--------------------	---------	--------------------	-----------------------------

#### B00D - R0013 - Movement - 24.49 m2

Wall Linings Internal	Flat AC Sheeting	6m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------	------------------	-----	-----------------------------	--------------------	---------	--------------------	-----------------------------

## B00E - General Learning - 1965 - Brick/Veneer

### Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Compressed AC Sheet	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

### Interior

#### B00E - R0001 - Home Base - 57.97 m2

No Asbestos							
<b>B00E - R0002 - Home Base Store - 4.68 m2</b>							
No Asbestos							
<b>B00E - R0003 - Personal Effects Storage - 10.12 m2</b>							
No Asbestos							
<b>B00E - R0004 - Movement - 4.14 m2</b>							
No Asbestos							
<b>B00E - R0005 - Movement - 1.51 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00E - R0006 - No Access - .64 m2</b>							
No Asbestos							
<b>B00E - R0007 - Home Base Store - 4.63 m2</b>							
No Asbestos							
<b>B00E - R0008 - Home Base - 57.66 m2</b>							
No Asbestos							
<b>B00E - R0009 - Home Base - 58.05 m2</b>							
No Asbestos							
<b>B00E - R0010 - Home Base Store - 4.26 m2</b>							
No Asbestos							
<b>B00E - R0011 - Personal Effects Storage - 9.09 m2</b>							
Electrical - Mounting Board	Resinous Board	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00E - R0012 - Movement - 6.23 m2</b>							
No Asbestos							
<b>B00E - R0013 - General Storeroom - .61 m2</b>							
No Asbestos							
<b>B00E - R0014 - Movement - 1.56 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00E - R0015 - Cleaning Distributed Store - .62 m2</b>							
No Asbestos							
<b>B00E - R0016 - Home Base Store - 4.24 m2</b>							
No Asbestos							
<b>B00E - R0017 - Home Base - 57.65 m2</b>							
No Asbestos							
<b>B00F - Pupil Facilities/Building Services - 1965 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00F - R0001 - Garden Store - 18.48 m2</b>							
No Asbestos							
<b>B00F - R0002 - Drinking Facilities - 6.9 m2</b>							
No Asbestos							
<b>B00F - R0003 - General Assistant/Bulk Store - 33.14 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R0004 - No Access - 3.06 m2</b>							



Non Accessible							
<b>B00F - R0005 - General Storeroom - 12.87 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R0006 - Toilets - Boys - 12.12 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00F - R0007 - Toilets - Girls - 10.39 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00F - R0008 - Drinking Facilities - 6.99 m2</b>							
No Asbestos							
<b>B00G - Special Purpose - 1965 - Timber</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	12m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>Interior</b>							
<b>B00G - R0001 - Movement - 25.51 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G - R0002 - Out Of School Hours Care Centre - 5.4 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00G - R0003 - Out Of School Hours Care Centre - 53.44 m2</b>							
No Asbestos							
<b>B00G - R0004 - Special Programs Room - 53.58 m2</b>							
No Asbestos							
<b>B00H - Communal Facilities - 2004 - Brick/Veneer</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00H - R0003 - Communications Cupboard - 1.85 m2</b>							
No Asbestos							
<b>B00H - R0004 - Cleaning Distributed Store - 3.05 m2</b>							
No Asbestos							
<b>B00H - R0005 - Hall Chair Store - 8.89 m2</b>							
No Asbestos							
<b>B00H - R0006 - P.E Store - 12.82 m2</b>							
No Asbestos							
<b>B00H - R0007 - Communal/Performance Store - 8.89 m2</b>							
No Asbestos							
<b>B00H - R0008 - Sports Store - 12.78 m2</b>							
No Asbestos							
<b>B00H - R0009 - Access Shower/Toilet - 4.64 m2</b>							
No Asbestos							
<b>B00H - R0010 - Main Switch Board - 2.62 m2</b>							
No Asbestos							

<b>B00H - R0011 - Covered Outdoor Learning Area - 244.29 m2</b>		
No Asbestos		
<b>B00H - R0012 - Movement - 22.45 m2</b>		
No Asbestos		
<b>B00H - R0013 - Movement - 10.67 m2</b>		
No Asbestos		
<b>B00H - R0014 - Communal Space - 186.44 m2</b>		
No Asbestos		
<b>B00H - R0015 - Raised Platform - 59.86 m2</b>		
No Asbestos		
<b>B00I - General Learning - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00I - R0001 - Practical Activities - 1hb - 19.24 m2</b>		
No Asbestos		
<b>B00I - R0002 - Home Base - 60.39 m2</b>		
No Asbestos		
<b>B00I - R0003 - Home Base Store - 6.08 m2</b>		
No Asbestos		
<b>B00I - R0004 - Withdrawal Space - 2hb - 11.64 m2</b>		
No Asbestos		
<b>B00I - R0005 - Practical Activities - 1hb - 18.73 m2</b>		
No Asbestos		
<b>B00I - R0006 - Home Base - 59.11 m2</b>		
No Asbestos		
<b>B00I - R0007 - Home Base Store - 6.08 m2</b>		
No Asbestos		
<b>B00I - R0008 - Practical Activities - 20.5 m2</b>		
No Asbestos		
<b>B00I - R0009 - Home Base - 57.7 m2</b>		
No Asbestos		
<b>B00I - R0010 - Home Base Store - 5.71 m2</b>		
No Asbestos		
<b>B00I - R0011 - Withdrawal Space - 1hb - 8.34 m2</b>		
No Asbestos		
<b>B00I - R0012 - External Movement - 64.74 m2</b>		
No Asbestos		

**Demountables**

**OS 602 10724 - Learning Unit - Standard With P.A.A. - Placement Date : 28-OCT-2015**

**Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found

**OS 606 15369 - Learning Unit - Standard With P.A.A A/C - Placement Date : 29-JAN-1996**

No Asbestos Found

**OS 606 18372 - Learning Unit - Standard With P.A.A A/C - Placement Date : 10-MAR-2020**

**Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.**

No Asbestos Found