

# Asbestos Register


(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Holsworthy Public School (4288)</b>
<b>Region:</b>	<b>South Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Holsworthy</b>
<b>Local Government Area:</b>	<b>Liverpool</b>

<b>Last Reviewed By:</b>	<b>Greencap 26-AUG-2014</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

4288 - Holsworthy Public School  
Site Plan (11010)

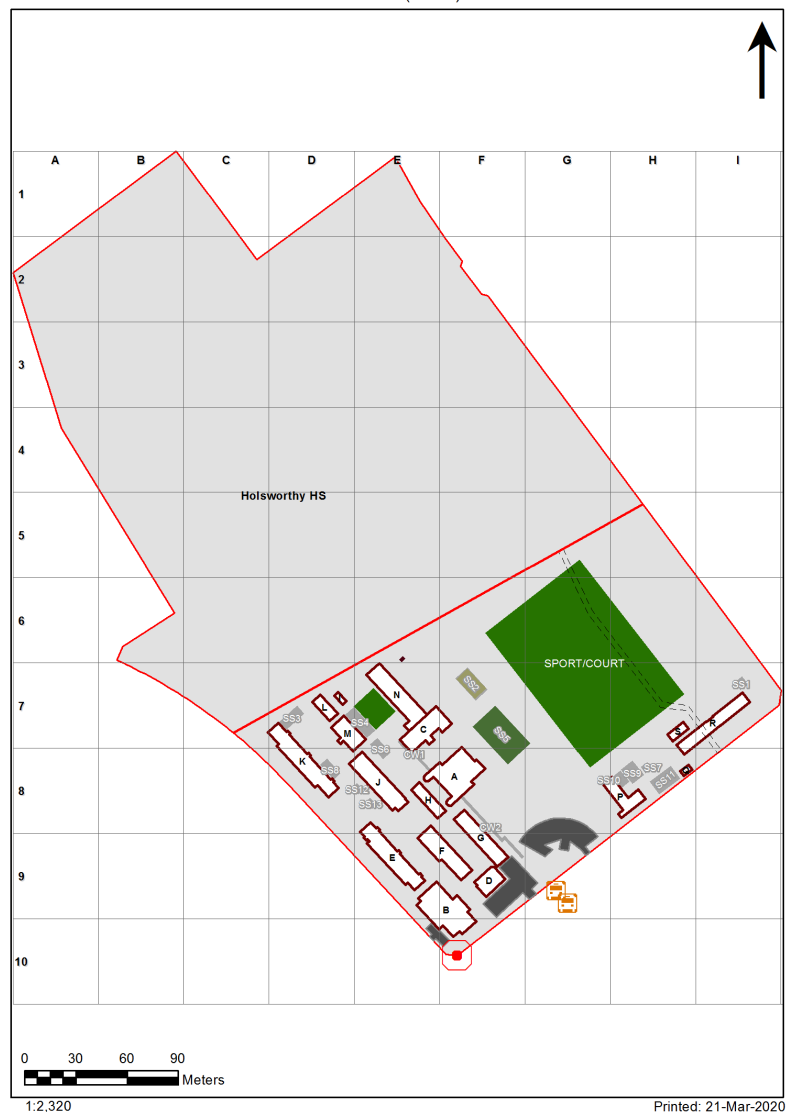

1:2,320

Printed: 21-Mar-2020

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Administration/Library - 1961 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	100m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting - Profiled						
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
<b>Interior</b>							
<b>B00A - M1001 - General Storeroom - 38.92 m2</b>							
No Asbestos							
<b>B00A - M1003 - Stairs - 5.16 m2</b>							
No Asbestos							
<b>B00A - R0001 - Movement - 30.11 m2</b>							
No Asbestos							
<b>B00A - R0003 - Staff Room Annexe - 15.92 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0004 - Entry Vestibule - 6.83 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0005 - Deputy Principal - 13.75 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0006 - Movement - 15.31 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0007 - Security Store - 11.88 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0008 - Staff Toilet - 7.98 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet						
<b>B00A - R0009 - Staff Toilet - 8.64 m2</b>							
No Asbestos							
<b>B00A - R0010 - Cleaning Distributed Store - 3.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0011 - Sick Bay - 9.11 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0012 - Duplicating Workroom - 20.94 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0013 - Clerical Office - 12.46 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0014 - Entry Vestibule - 41.01 m2</b>							

Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 )						
<b>B00A - R0015 - Distribution Board - .58 m2</b>							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00A - R0016 - Movement - 9.06 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0017 - Principal - 21.96 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0018 - Deputy Principal - 12.78 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0019 - Staff Room Annexe - 11.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R0020 - Movement - 1.19 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )						
<b>B00A - R0021 - Movement - 80.33 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00A - R0022 - Garden Store - 4.46 m2</b>							
No Asbestos							
<b>B00A - R0023 - Garden Store - 4.46 m2</b>							
No Asbestos							
<b>B00A - R0024 - Staff Room - 89.13 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 70 - 120 m2) - ( X8 )						
<b>B00A - R0025 - Staff Kitchen - 15.34 m2</b>							
Ceiling Structures/Linings	Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )						
<b>B00A - R1001 - Reading Area - 286.86 m2</b>							
No Asbestos							
<b>B00A - R1002 - Seminar/Study - 12.68 m2</b>							
No Asbestos							
<b>B00A - R1003 - Seminar/Study - 12.85 m2</b>							
No Asbestos							
<b>B00A - R1004 - Library Office/Workroom - 7.99 m2</b>							
No Asbestos							
<b>B00A - R1005 - Communications Room - 13.5 m2</b>							
No Asbestos							
<b>B00A - R1006 - Library Office/Workroom - 26.16 m2</b>							
No Asbestos							
<b>B00A - R1007 - Distribution Board - .68 m2</b>							<b>Note: No inspection of live electrical installation</b>
Ceiling Structures/Linings	Flat AC Sheeting	0.68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R1008 - Cleaning Distributed Store - .54 m2</b>							
No Asbestos							
<b>B00A - R1009 - Toilets - Girls - 2.8 m2</b>							
No Asbestos							
<b>B00A - R1010 - Toilets - Boys - 2.8 m2</b>							
No Asbestos							
<b>B00A - R1011 - Entry Vestibule - 14.89 m2</b>							

No Asbestos							
<b>B00A - R1012 - Movement - 34.12 m2</b>							
No Asbestos							
<b>B00A - R1013 - Movement - 20.72 m2</b>							
No Asbestos							
<b>B00A - R1015 - Stairs - .71 m2</b>							
No Asbestos							
<b>B00B - Communal Facilities - 1961 - Brick/Block</b>							
<b>Exterior</b>							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Wall Cladding	Corrugated AC Sheeting						
<b>Interior</b>							
<b>B00B - M0001 - Communal/Performance Store - 14.12 m2</b>							
No Asbestos							
<b>B00B - M0002 - Plant - 9.11 m2</b>							
No Asbestos							
<b>B00B - M0003 - Stairs - 3.93 m2</b>							
No Asbestos							
<b>B00B - R0001 - Communal Space - 205.57 m2</b>							
No Asbestos							
<b>B00B - R0002 - Raised Platform - 63.77 m2</b>							
No Asbestos							
<b>B00B - R0003 - Cleaning Distributed Store - 5.19 m2</b>							
No Asbestos							
<b>B00B - R0004 - P.E Store - 11.23 m2</b>							
No Asbestos							
<b>B00B - R0005 - Distribution Board - .81 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
No Asbestos							
<b>B00B - R0006 - Movement - 40.39 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	34m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0007 - Canteen - 43.47 m2</b>							
No Asbestos							
<b>B00B - R0008 - Canteen Office/Store - 2.7 m2</b>							
No Asbestos							
<b>B00B - R0009 - Canteen Office/Store - 6.36 m2</b>							
No Asbestos							
<b>B00B - R0010 - Staff Toilet - 3.08 m2</b>							
No Asbestos							
<b>B00B - R0011 - Movement - 3.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0012 - Toilets - Girls - 9.87 m2</b>							
No Asbestos							
<b>B00B - R0013 - Toilets - Boys - 10.99 m2</b>							
No Asbestos							
<b>B00B - R0014 - Movement - 1.46 m2</b>							

No Asbestos							
<b>B00B - R0015 - No Access - 4.29 m2</b>							
No Asbestos							
<b>B00B - R0016 - No Access - .5 m2</b>							
No Asbestos							
<b>B00B - R0017 - Movement - 86.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
External Wall Structure	Compressed AC Sheet						
<b>B00B - R0018 - Movement - 23.45 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00B - R0019 - Stairs - .33 m2</b>							
No Asbestos							
<b>B00C - General Learning - 1961 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
<b>Interior</b>							
<b>B00C - R0002 - Toilets - Boys/Girls - 2.95 m2</b>							
No Asbestos							
<b>B00C - R0004 - Withdrawal Space - 1hb - 10.48 m2</b>							
No Asbestos							
<b>B00C - R0006 - Toilets - Boys/Girls - 2.92 m2</b>							
No Asbestos							
<b>B00C - R0008 - Movement - 75.67 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00C - R0009 - Garden Store - 14.85 m2</b>							
No Asbestos							
<b>B00C - R0010 - General Assistant/Bulk Store - 12.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0011 - Practical Activities - 1hb - 20.56 m2</b>							
No Asbestos							
<b>B00C - R0012 - Home Base - 69.14 m2</b>							
No Asbestos							
<b>B00C - R0013 - Home Base - 73.18 m2</b>							
No Asbestos							
<b>B00C - R0014 - Practical Activities - 1hb - 21.04 m2</b>							
No Asbestos							
<b>B00D - General Learning - 1961 - Timber</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

<b>Interior</b>							
<b>B00D - R0001 - Special Programs Room - 20.07 m2</b>							
No Asbestos							
<b>B00D - R0002 - Withdrawal Space - 1hb - 21.68 m2</b>							
No Asbestos							
<b>B00D - R0003 - Practical Activities - 1hb - 28.46 m2</b>							
No Asbestos							
<b>B00D - R0004 - Home Base - 42.68 m2</b>							
No Asbestos							
<b>B00D - R0005 - Outdoor Learning Area - 34.16 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Movement and wall lining above door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00E - General Learning - 1961 - Concrete Framed</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	80m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Wall Cladding	Compressed AC Sheet						
Window	Mastic						
<b>Interior</b>							
<b>B00E - R0001 - General Storeroom - 27.19 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00E - R0002 - Movement - 1.69 m2</b>							
No Asbestos							
<b>B00E - R0003 - Movement - 5.28 m2</b>							
Wall Linings Internal	Flat AC Sheeting						
<b>B00E - R0004 - Personal Effects Storage - 3.62 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00E - R0005 - Home Base Store - 6.44 m2</b>							
No Asbestos							
<b>B00E - R0006 - Home Base - 56.61 m2</b>							
No Asbestos							
<b>B00E - R0007 - Home Base - 56.61 m2</b>							
No Asbestos							
<b>B00E - R0010 - Personal Effects Storage - 3.65 m2</b>							
No Asbestos							
<b>B00E - R0011 - Movement - 6.23 m2</b>							
No Asbestos							
<b>B00E - R0012 - Movement - 1.66 m2</b>							
No Asbestos							
<b>B00E - R0013 - Personal Effects Storage - 3.66 m2</b>							
No Asbestos							
<b>B00E - R0015 - Home Base - 56.3 m2</b>							
No Asbestos							
<b>B00E - R0016 - Home Base - 56.76 m2</b>							
No Asbestos							
<b>B00E - R0018 - Home Base Store - 6.38 m2</b>							

No Asbestos							
<b>B00E - R0019 - Personal Effects Storage - 3.65 m2</b>							
No Asbestos							
<b>B00E - R0020 - Movement - 6.36 m2</b>							
No Asbestos							
<b>B00E - R0021 - Movement - 1.68 m2</b>							
No Asbestos							
<b>B00E - R0022 - Movement - 10.95 m2</b>							
No Asbestos							
<b>B00E - R0023 - General Assistant/Bulk Store - 18.23 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00E - R0024 - Movement - 4.34 m2</b>							
No Asbestos							
<b>B00E - R0025 - Sports Store - 5.64 m2</b>							
No Asbestos							
<b>B00E - R0026 - Movement - 1.68 m2</b>							
No Asbestos							
<b>B00E - R0027 - Practical Activities - 1hb - 12.69 m2</b>							
No Asbestos							
<b>B00E - R0028 - Practical Activities - 1hb - 12.55 m2</b>							
No Asbestos							
<b>B00E - R0029 - Home Base Store - 9.49 m2</b>							
No Asbestos							
<b>B00E - R0030 - Home Base Store - 9.44 m2</b>							
No Asbestos							
<b>B00E - R0031 - Practical Activities - 1hb - 12.61 m2</b>							
No Asbestos							
<b>B00E - R0032 - Practical Activities - 1hb - 12.6 m2</b>							
No Asbestos							
<b>B00F - General Learning/Administration - 1961 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00F - R0001 - Home Base - 56.8 m2</b>							
No Asbestos							
<b>B00F - R0002 - Home Base Store - 4.68 m2</b>							
No Asbestos							
<b>B00F - R0003 - Personal Effects Storage - 9.05 m2</b>							
No Asbestos							
<b>B00F - R0004 - Movement - 5.2 m2</b>							
No Asbestos							
<b>B00F - R0005 - Craft Store - .55 m2</b>							
No Asbestos							
<b>B00F - R0007 - General Storeroom - .55 m2</b>							
No Asbestos							
<b>B00F - R0008 - Home Base Store - 4.68 m2</b>							



No Asbestos							
<b>B00F - R0009 - Home Base - 56.4 m2</b>							
No Asbestos							
<b>B00F - R0013 - Movement - 1.33 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R0014 - Entry Vestibule - 12.73 m2</b>							
No Asbestos							
<b>B00F - R0015 - General Storeroom - 14.97 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00F - R0017 - Staff Toilet - 3.27 m2</b>							
Wall Linings Internal	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos) , Amosite (Brown asbestos)
<b>B00F - R0018 - Community Clinic - 19.41 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00F - R0019 - General Storeroom - .71 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00F - R0020 - Cleaning Distributed Store - 1.88 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00F - R0021 - Practical Activities - 1hb - 14.65 m2</b>							
No Asbestos							
<b>B00F - R0022 - Practical Activities - 1hb - 14.76 m2</b>							
No Asbestos							
<b>B00F - R0023 - External Movement - 7.72 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00F - R0028 - Home Base - 61.05 m2</b>							
No Asbestos							
<b>B00F - R0029 - Practical Activities - 1hb - 10.34 m2</b>							
No Asbestos							
<b>B00G - General Learning - 1961 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Window	Mastic						
Gable Verge Lining	Flat AC Sheeting	12m2	Nort, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00G - R0001 - Home Base - 56.86 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	4	South, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00G - R0002 - Home Base Store - 4.58 m2</b>							
No Asbestos							

<b>B00G - R0003 - Personal Effects Storage - 8.3 m2</b>							
No Asbestos							
<b>B00G - R0004 - Movement - 5.63 m2</b>							
No Asbestos							
<b>B00G - R0005 - Home Base Store - .55 m2</b>							
No Asbestos							
<b>B00G - R0006 - Movement - 1.49 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00G - R0007 - Home Base Store - .55 m2</b>							
No Asbestos							
<b>B00G - R0008 - Home Base Store - 4.58 m2</b>							
No Asbestos							
<b>B00G - R0009 - Home Base - 58.98 m2</b>							
No Asbestos							
<b>B00G - R0010 - Home Base - 56.94 m2</b>							
No Asbestos							
<b>B00G - R0011 - Home Base Store - 4.72 m2</b>							
No Asbestos							
<b>B00G - R0012 - Personal Effects Storage - 8.9 m2</b>							
Electrical - Backing Board	Resinous Board	1	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting						
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00G - R0013 - Movement - 5.13 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	South, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00G - R0014 - Home Base Store - .55 m2</b>							
No Asbestos							
<b>B00G - R0015 - Movement - 1.49 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00G - R0016 - Home Base Store - .55 m2</b>							
No Asbestos							
<b>B00G - R0017 - Home Base Store - 4.72 m2</b>							
No Asbestos							
<b>B00G - R0018 - Home Base - 57.09 m2</b>							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	South, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00H - Pupil Facilities - 1977 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Gable Ends	Fibre Cement Moulded						
<b>Interior</b>							
<b>B00H - R0001 - Drinking Facilities - 7.08 m2</b>							

No Asbestos							
<b>B00H - R0002 - Movement - 13.19 m2</b>							
No Asbestos							
<b>B00H - R0003 - Drinking Facilities - 7.02 m2</b>							
No Asbestos							
<b>B00H - R0004 - Cleaning Distributed Store - 1.61 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00H - R0005 - Toilets - Girls - 43.89 m2</b>							
Partition Walls (Cubicles)	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00H - R0006 - Toilets - Girls - 8.32 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00H - R0007 - Cleaning Supplies - 8.5 m2</b>							
Floor Coverings Res/Textile	Vnyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00H - R0008 - Toilets - Boys - 45.84 m2</b>							
Partition Walls (Cubicles)	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00I - Communal Facilities - 2005 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00I - R0001 - Interview - 8.29 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00I - R0002 - Staff Toilet - 1.59 m2</b>							
No Asbestos							
<b>B00I - R0003 - Staff Room Annexe - 10.29 m2</b>							
Floor Coverings Res/Textile	No Asbestos Found						
<b>B00J - General Learning - 1977 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting	50m2	South, East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Flat AC Sheeting	260	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wnindow	Mastic						
<b>Interior</b>							
<b>B00J - R0001 - Home Base - 57.46 m2</b>							
No Asbestos							
<b>B00J - R0002 - Home Base Store - 6.26 m2</b>							
No Asbestos							
<b>B00J - R0003 - Personal Effects Storage - 6.23 m2</b>							

No Asbestos							
<b>B00J - R0004 - Movement - 4.85 m2</b>							
No Asbestos							
<b>B00J - R0005 - Cleaning Distributed Store - .55 m2</b>							
No Asbestos							
<b>B00J - R0007 - General Storeroom - .55 m2</b>							
No Asbestos							
<b>B00J - R0008 - Home Base Store - 6.26 m2</b>							
No Asbestos							
<b>B00J - R0009 - Home Base - 57.38 m2</b>							
No Asbestos							
<b>B00J - R0010 - Home Base - 57.29 m2</b>							
No Asbestos							
<b>B00J - R0011 - Home Base Store - 6.39 m2</b>							
No Asbestos							
<b>B00J - R0012 - Personal Effects Storage - 6.13 m2</b>							
No Asbestos							
<b>B00J - R0013 - Movement - 4.99 m2</b>							
No Asbestos							
<b>B00J - R0014 - General Storeroom - .59 m2</b>							
No Asbestos							
<b>B00J - R0016 - General Storeroom - .59 m2</b>							
No Asbestos							
<b>B00J - R0017 - Home Base Store - 6.39 m2</b>							
No Asbestos							
<b>B00J - R0018 - Home Base - 57.3 m2</b>							
No Asbestos							
<b>B00J - R0019 - Cleaning Supplies - 8.1 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00J - R0020 - Main Switch Board - 8.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
Electrical - Mounting Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00J - R0021 - Practical Activities - 1hb - 15.37 m2</b>							
No Asbestos							
<b>B00J - R0022 - Practical Activities - 1hb - 14.94 m2</b>							
No Asbestos							
<b>B00J - R0023 - Practical Activities - 1hb - 15.03 m2</b>							
No Asbestos							
<b>B00J - R0024 - Practical Activities - 1hb - 15.13 m2</b>							
No Asbestos							
<b>B00J - R0025 - Movement - 8.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00J - R0026 - Movement - 8.07 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00K - General Learning - 1961 - Concrete Framed</b>							

Exterior							
Eaves Linings	Flat AC Sheeting						
Window	Mastic						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	260	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
<b>B00K - R0001 - Special Programs Room - 17.93 m2</b>							
No Asbestos							
<b>B00K - R0002 - General Storeroom - 5.63 m2</b>							
No Asbestos							
<b>B00K - R0003 - Movement - 8.96 m2</b>							
No Asbestos							
<b>B00K - R0004 - General Storeroom - .97 m2</b>							
No Asbestos							
<b>B00K - R0005 - Personal Effects Storage - 12.32 m2</b>							
No Asbestos							
<b>B00K - R0006 - Toilets - Boys/Girls - 2.04 m2</b>							
No Asbestos							
<b>B00K - R0008 - Home Base Store - .95 m2</b>							
No Asbestos							
<b>B00K - R0009 - Home Base - 78.37 m2</b>							
No Asbestos							
<b>B00K - R0010 - Home Base - 56.67 m2</b>							
No Asbestos							
<b>B00K - R0012 - Personal Effects Storage - 4.17 m2</b>							
No Asbestos							
<b>B00K - R0013 - Personal Effects Storage - 4.42 m2</b>							
No Asbestos							
<b>B00K - R0014 - Movement - 6.31 m2</b>							
No Asbestos							
<b>B00K - R0015 - Movement - 1.93 m2</b>							
No Asbestos							
<b>B00K - R0017 - Home Base - 56.44 m2</b>							
No Asbestos							
<b>B00K - R0019 - Home Base Store - 5.62 m2</b>							
No Asbestos							
<b>B00K - R0020 - Personal Effects Storage - 4.34 m2</b>							
No Asbestos							
<b>B00K - R0021 - Movement - 7.71 m2</b>							
No Asbestos							
<b>B00K - R0022 - Movement - 1.59 m2</b>							
No Asbestos							
<b>B00K - R0023 - Special Programs Room - 21.14 m2</b>							
No Asbestos							
<b>B00K - R0024 - Home Base Store - 31.49 m2</b>							
Furniture / Fixtures - Blackboard	Vinyl Sheet						
<b>B00K - R0025 - Movement - 1.8 m2</b>							
No Asbestos							
<b>B00K - R0026 - Practical Activities - 1hb - 13.31 m2</b>							
No Asbestos							

<b>B00K - R0027 - Practical Activities - 1hb - 13.31 m2</b>							
No Asbestos							
<b>B00K - R0028 - Home Base Store - 8.91 m2</b>							
No Asbestos							
<b>B00K - R0029 - Home Base Store - 8.96 m2</b>							
No Asbestos							
<b>B00K - R0030 - Practical Activities - 1hb - 13.41 m2</b>							
No Asbestos							
<b>B00K - R0031 - Practical Activities - 1hb - 13.35 m2</b>							
No Asbestos							
<b>B00K - R0032 - Home Base - 56.69 m2</b>							
No Asbestos							
<b>B00L - Pupil Facilities - 1961 - Concrete</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00L - R0001 - Toilets - Girls - 34.21 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet						
<b>B00L - R0002 - Cleaning Distributed Store - 1.21 m2</b>							
No Asbestos							
<b>B00L - R0003 - Drinking Facilities - 5.22 m2</b>							
No Asbestos							
<b>B00L - R0004 - Movement - 3.6 m2</b>							
No Asbestos							
<b>B00L - R0005 - Movement - 3.6 m2</b>							
No Asbestos							
<b>B00L - R0006 - Drinking Facilities - 5.22 m2</b>							
No Asbestos							
<b>B00L - R0007 - Toilets - Boys - 35.89 m2</b>							
Partition Walls (Cubides)	Compressed AC Sheet						
<b>B00M - General Learning - 1961 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Window	Mastic						
Eaves Linings	Flat AC Sheeting						
<b>Interior</b>							
<b>B00M - R0001 - Home Base - 57.6 m2</b>							
No Asbestos							
<b>B00M - R0003 - Personal Effects Storage - 7.8 m2</b>							
No Asbestos							
<b>B00M - R0004 - Personal Effects Storage - 6.28 m2</b>							
No Asbestos							
<b>B00M - R0006 - Home Base - 56.88 m2</b>							
No Asbestos							

<b>B00M - R0007 - Movement - 6.16 m2</b>							
No Asbestos							
<b>B00M - R0008 - Movement - 4.95 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (White asbestos)
<b>B00M - R0009 - Practical Activities - 1hb - 15 m2</b>							
No Asbestos							
<b>B00M - R0010 - Home Base Store - 7.31 m2</b>							
No Asbestos							
<b>B00M - R0011 - Home Base Store - 5.83 m2</b>							
No Asbestos							
<b>B00M - R0012 - Practical Activities - 1hb - 14.56 m2</b>							
No Asbestos							
<b>B00N - General Learning - 1961 - Brick/Veneer</b>							
<b>Exterior</b>							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00N - R0001 - Movement - 1.15 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00N - R0002 - Personal Effects Storage - 7.25 m2</b>							
No Asbestos							
<b>B00N - R0004 - Home Base - 57.91 m2</b>							
No Asbestos							
<b>B00N - R0005 - Home Base - 57.31 m2</b>							
No Asbestos							
<b>B00N - R0007 - Personal Effects Storage - 6.23 m2</b>							
No Asbestos							
<b>B00N - R0008 - Movement - 5.52 m2</b>							
No Asbestos							
<b>B00N - R0009 - Home Base Store - .55 m2</b>							
No Asbestos							
<b>B00N - R0010 - Movement - 1.49 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting						
<b>B00N - R0011 - Cleaning Distributed Store - .55 m2</b>							
No Asbestos							
<b>B00N - R0012 - Personal Effects Storage - 6.16 m2</b>							
No Asbestos							
<b>B00N - R0014 - Home Base - 56.69 m2</b>							
No Asbestos							
<b>B00N - R0015 - Home Base - 85.66 m2</b>							
No Asbestos							
<b>B00N - R0018 - Personal Effects Storage - 6.34 m2</b>							
No Asbestos							
<b>B00N - R0019 - Movement - 3.14 m2</b>							
No Asbestos							
<b>B00N - R0020 - Toilets - Boys/Girls - 3.82 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00N - R0021 - Movement - 10.22 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00N - R0022 - Home Base Store - 8.25 m2</b>								
No Asbestos								
<b>B00N - R0023 - Practical Activities - 1hb - 13.84 m2</b>								
No Asbestos								
<b>B00N - R0024 - Practical Activities - 1hb - 14.22 m2</b>								
No Asbestos								
<b>B00N - R0025 - Home Base Store - 6.18 m2</b>								
No Asbestos								
<b>B00N - R0026 - Home Base Store - 6.11 m2</b>								
No Asbestos								
<b>B00N - R0027 - Practical Activities - 1hb - 14.1 m2</b>								
No Asbestos								
<b>B00N - R0028 - Practical Activities - 1hb - 21.44 m2</b>								
No Asbestos								
<b>B00N - R0029 - Home Base Store - 7.48 m2</b>								
No Asbestos								
<b>B00P - Other-After School Care - 1977 - Timber</b>								
<b>Exterior</b>								
Ceiling Voids	No Asbestos Found							
Electrical - Backing Board	Resinous Board							
Eaves Linings	Flat AC Sheeting	80m2	Surrounding	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
Underfloor Voids	No Asbestos Found							
<b>Interior</b>								
<b>B00P - R0001 - Out Of School Hours Care Centre - 9.8 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting							
<b>B00P - R0002 - Out Of School Hours Care Centre - 7.38 m2</b>								
No Asbestos								
<b>B00P - R0003 - Out Of School Hours Care Centre - 10.8 m2</b>								
No Asbestos								
<b>B00P - R0004 - Out Of School Hours Care Centre - 9.09 m2</b>								
No Asbestos								
<b>B00P - R0005 - Out Of School Hours Care Centre - 3.92 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
<b>B00P - R0006 - Out Of School Hours Care Centre - 1.72 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
<b>B00P - R0007 - Out Of School Hours Care Centre - .6 m2</b>								
Wall Linings Internal	Flat AC Sheeting							
<b>B00P - R0008 - Out Of School Hours Care Centre - 3.22 m2</b>								
No Asbestos								
<b>B00P - R0009 - Out Of School Hours Care Centre - 9.31 m2</b>								
Ceiling Structures/Linings - Access Hatch	Flat AC Sheeting							
<b>B00P - R0010 - Out Of School Hours Care Centre - 10.21 m2</b>								



No Asbestos		
<b>B00P - R0011 - Out Of School Hours Care Centre - 57.09 m2</b>		
No Asbestos		
<b>B00P - R0012 - Out Of School Hours Care Centre - 36.79 m2</b>		
No Asbestos		
<b>B00P - R0013 - Out Of School Hours Care Centre - 10.77 m2</b>		
No Asbestos		
<b>B00P - R0014 - Out Of School Hours Care Centre - 9.25 m2</b>		
No Asbestos		
<b>B00P - R0015 - Out Of School Hours Care Centre - 1.86 m2</b>		
No Asbestos		
<b>B00P - R0016 - Out Of School Hours Care Centre - 1.74 m2</b>		
No Asbestos		
<b>B00P - R0017 - Out Of School Hours Care Centre - 1.67 m2</b>		
No Asbestos		
<b>B00P - R0018 - Out Of School Hours Care Centre - 11 m2</b>		
No Asbestos		
<b>B00Q - Other - Community Use - 2010 - Metal Shed</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00Q - R0001 - General Storeroom - 19.15 m2</b>		
No Asbestos		
<b>B00R - Other - Community Use - 2000 - Fibre Cement Clad</b>		
<b>Exterior</b>		
Eaves Linings	Flat AC Sheeting	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00R - R0001 - General Storeroom - 6.89 m2</b>		
No Asbestos		
<b>B00R - R0002 - Staff Kitchen - 18.34 m2</b>		
No Asbestos		
<b>B00R - R0003 - Shower/Change - 3.8 m2</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	
<b>B00R - R0004 - Toilets - Girls - 1.69 m2</b>		
No Asbestos		
<b>B00R - R0005 - Shower/Change - 3.84 m2</b>		
No Asbestos		
<b>B00R - R0006 - Special Programs Room - 17.73 m2</b>		
No Asbestos		
<b>B00R - R0007 - General Storeroom - 8.82 m2</b>		
No Asbestos		
<b>B00R - R0008 - Cleaning Distributed Store - .33 m2</b>		
No Asbestos		

<b>B00R - R0009 - General Storeroom - 1.14 m2</b>		
No Asbestos		
<b>B00R - R0010 - General Storeroom - .61 m2</b>		
No Asbestos		
<b>B00R - R0011 - Special Programs Room - 76.64 m2</b>		
No Asbestos		
<b>B00R - R0012 - External Movement - 32.21 m2</b>		
Ceiling Structures/Linings	Flat AC Sheeting	
<b>B00R - R0013 - Special Programs Room - 77.5 m2</b>		
No Asbestos		
<b>B00R - R0014 - Toilets - Boys - 3.84 m2</b>		
No Asbestos		
<b>B00R - R0015 - Toilets - Boys - 1.69 m2</b>		
No Asbestos		
<b>B00R - R0016 - Shower/Change - 3.99 m2</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	
Wall Linings Internal	Flat AC Sheeting	
<b>B00R - R0017 - General Storeroom - 9.73 m2</b>		
No Asbestos		
<b>B00R - R0018 - General Storeroom - 3.57 m2</b>		
No Asbestos		
<b>B00R - R0019 - Cleaning Distributed Store - .33 m2</b>		
No Asbestos		
<b>B00R - R0020 - General Storeroom - 4.24 m2</b>		
No Asbestos		
<b>B00R - R0021 - Staff Room - 15.04 m2</b>		
No Asbestos		
<b>B00R - R0022 - Staff Kitchen - 19.87 m2</b>		
No Asbestos		
<b>B00S - Other - Community Use - 2006 - Metal Shed</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
<b>Interior</b>		
<b>B00S - R0001 - General Storeroom - 55.54 m2</b>		
No Asbestos		

## Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020