


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	HopeTown School (5755)
Region:	Hunter/Central Coast AMU
State Electorate:	Wyong
Local Government Area:	Central Coast

Last Reviewed By:	WSP 30-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

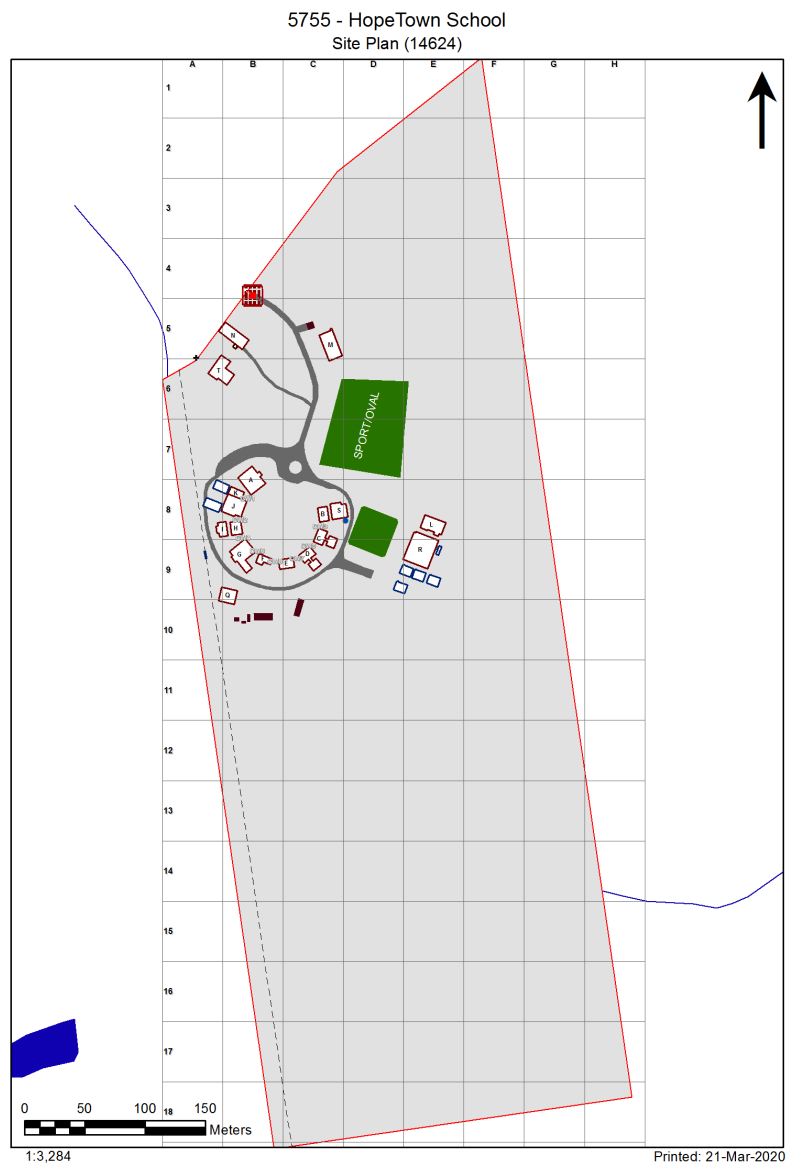

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1987 - Brick/Veneer							
Exterior							
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	48m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal - Infill	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	48m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B00A - R0001 - Clerical Office - 16.49 m2							
No Asbestos							
B00A - R0002 - Entry Vestibule - 16.21 m2							
No Asbestos							
B00A - R0003 - Deputy Principal - 8.12 m2							
No Asbestos							
B00A - R0004 - Principal - 21.25 m2							
No Asbestos							
B00A - R0005 - Movement - 4.85 m2							
No Asbestos							
B00A - R0006 - Cleaning Distributed Store - 6.67 m2							
No Asbestos							
B00A - R0007 - Staff Kitchen - 4.76 m2							
No Asbestos							
B00A - R0008 - Staff Toilet - 2.92 m2							
No Asbestos							
B00A - R0009 - Staff Toilet - 3.37 m2							
No Asbestos							
B00A - R0010 - Movement - 2.28 m2							
No Asbestos							
B00A - R0011 - Utility Space - 34.26 m2							
No Asbestos							
B00A - R0012 - Staff Room Annexe - 45.72 m2							
No Asbestos							
B00A - R0013 - External Movement - 84.57 m2							
Wall Linings Internal	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0014 - Movement - 16.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
B00B - Pupil Facilities - 1987 - Steel							
Exterior							
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	7m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						

Eaves Linings	Flat AC Sheeting	7m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Wall Cladding	Flat AC Sheeting						
Interior							
B00B - R0001 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0002 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0003 - Movement - 7.75 m2							
Wall Linings Internal	Flat AC Sheeting	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0004 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0005 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0006 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0007 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0008 - Residential Showers - 5.63 m2							
Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0009 - Dormitory - 6.84 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0010 - Dormitory - 4.61 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0011 - Movement - 13.68 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B00B - R0012 - External Movement - 20.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - Pupil Facilities - 1987 - Steel							
Exterior							
Underfloor Voids	Flat AC Sheeting						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						

Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	28m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	28m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting						
Interior							
B00C - R0001 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Movement - 7.76 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0004 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	6m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0005 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0006 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0007 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0008 - Residential Showers - 5.63 m2							
Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - Dormitory - 7.28 m2							
Non Accessible							
Non Accessible							
B00C - R0010 - Dormitory - 4.67 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0011 - Movement - 13.28 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0012 - External Movement - 20.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0013 - Movement - 4.5 m2							
No Asbestos							
B00C - R0014 - Res. Common Room - 34.12 m2							
No Asbestos							
B00C - R0015 - Dormitory - 4.85 m2							
No Asbestos							
B00C - R0016 - Dormitory - 5.49 m2							

No Asbestos							
B00C - R0017 - Dormitory - 9.49 m2							
No Asbestos							
B00D - General Learning - 1987 - Steel							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	28m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	28m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0002 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0003 - Movement - 7.76 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0004 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0005 - Dormitory - 4.59 m2							
No Asbestos							
B00D - R0006 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0007 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0008 - Residential Showers - 5.63 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0009 - Dormitory - 7.28 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0010 - Dormitory - 4.67 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R0011 - Movement - 13.26 m2							
Wall Linings Internal	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Tiles						
B00D - R0012 - External Movement - 20.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0013 - Movement - 4.58 m2							
No Asbestos							
B00D - R0014 - Res. Common Room - 36.79 m2							
No Asbestos							
B00D - R0015 - Dormitory - 5.77 m2							

No Asbestos							
B00D - R0016 - Dormitory - 5.73 m2							
No Asbestos							
B00D - R0017 - Dormitory - 5.71 m2							
No Asbestos							
B00E - Pupil Facilities - 1987 - Steel							
Exterior							
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	10m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	16m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	16m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0002 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0003 - Movement - 7.75 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0004 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0005 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0006 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0007 - Dormitory - 4.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0008 - Residential Showers - 5.63 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0009 - Dormitory - 7.27 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0010 - Dormitory - 4.67 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0011 - Movement - 13.28 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting						
B00E - R0012 - External Movement - 20.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - Pupil Facilities - 1987 - Steel							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						

Eaves Linings	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	3m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							
B00F - R0001 - External Movement - 20.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R0002 - Toilets - Girls - 16.62 m2							
No Asbestos							
B00F - R0003 - Toilets - Boys - 16.65 m2							
Wall Linings Internal	Flat AC Sheeting						
B00F - R0004 - Cleaning Distributed Store - 16.1 m2							
Wall Linings Internal	Flat AC Sheeting						
B00G - Pupil Facilities - 1987 - Steel							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	34m2	North, South, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	34m2	North, South, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	54m2	East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	54m2	East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G - R0001 - Canteen - 4.18 m2							
No Asbestos							
B00G - R0002 - Canteen - 6.03 m2							
No Asbestos							
B00G - R0003 - Canteen - 21.66 m2							
No Asbestos							
B00G - R0004 - General Assistant/Bulk Store - 7.11 m2							
No Asbestos							
B00G - R0005 - General Assistant/Bulk Store - 7.89 m2							

Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0006 - Canteen - 7.22 m2							
No Asbestos							
B00G - R0007 - External Movement - 10.31 m2							
No Asbestos							
B00G - R0008 - Main Switch Board - 4.04 m2							
No Asbestos							
B00G - R0009 - Laundry - 16.6 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00G - R0010 - Laundry - 33.49 m2							
Wall Linings Internal	Flat AC Sheeting						
B00G - R0011 - Communal Space - 116.82 m2							
No Asbestos							
B00G - R0012 - External Movement - 24.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00G - R0013 - External Movement - 24.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00H - Library - 1987 - Steel							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	AC Fragments/Debris						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	8m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Gable Ends	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Gable Ends	Flat AC Sheeting						
Interior							
B00H - R0001 - Seminar/Study - 7.13 m2							
Wall Linings Internal	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0002 - Special Programs Room - 2.48 m2							
Wall Linings Internal	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0003 - Staff Toilet - 2.48 m2							
Wall Linings Internal	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0004 - Seminar/Study - 7.13 m2							
No Asbestos							
B00H - R0005 - Main Area - 24.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00H - R0006 - Seminar/Study - 7.13 m2							

Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0007 - Staff Toilet - 2.48 m2							
Wall Linings Internal	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0008 - Staff Toilet - 2.48 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0009 - Staff Room Annexe - 7.13 m2							
Wall Linings Internal	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0010 - External Movement - 26.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
B00I - General Learning - 1987 - Brick/Veneer							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - Special Programs Room - 28.17 m2							
No Asbestos							
B00I - R0002 - Home Base - 53.94 m2							
No Asbestos							
B00I - R0003 - General Assistant/Bulk Store - 9.82 m2							
No Asbestos							
B00J - General Learning - 1987 - Brick/Veneer							
Exterior							
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	12m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	AC Fragments/Debris						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00J - R0001 - Home Base - 35.53 m2							
No Asbestos							
B00J - R0002 - Home Base - 35.59 m2							
No Asbestos							
B00J - R0003 - Sports Store - 10.7 m2							

Wall Linings Internal	Flat AC Sheeting						
B00J - R0004 - Covered Outdoor Learning Area - 162.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
B00K - General Learning - 1987 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Underfloor Voids	AC Fragments/Debris						
Underfloor Voids	No Asbestos Found						
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Interior							
B00K - R0001 - Home Base - 35.47 m2							
No Asbestos							
B00K - R0002 - Home Base - 35.64 m2							
No Asbestos							
B00L - Physical Education - 1987 - Steel							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00L - R0001 - Hydrotherapy - Pool - 192.95 m2							
No Asbestos							
B00L - R0002 - Plant - 7.17 m2							
No Asbestos							
B00M - Staff Facilities - 1987 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	1m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	1m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Cladding	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Interior							
B00M - R0001 - Commonroom - 43.12 m2							
No Asbestos							
B00M - R0002 - Staff Kitchen - 40.09 m2							
No Asbestos							

B00M - R0003 - Movement - 4.54 m2		
No Asbestos		
B00M - R0004 - Laundry - 4.12 m2		
No Asbestos		
B00M - R0005 - Shower/Change - 12.15 m2		
No Asbestos		
B00M - R0006 - Shower/Change - 2.91 m2		
Wall Linings Internal	Flat AC Sheeting	
B00M - R0007 - General Assistant/Bulk Store - 3.45 m2		
No Asbestos		
B00M - R0008 - Clerical Office - 14.54 m2		
No Asbestos		
B00M - R0009 - Clerical Office - 13.15 m2		
No Asbestos		
B00M - R0010 - Clerical Office - 12.29 m2		
No Asbestos		
B00M - R0011 - Clerical Office - 11.78 m2		
No Asbestos		
B00M - R0012 - Movement - 7.72 m2		
No Asbestos		
B00M - R0013 - External Movement - 85.67 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00N - Building Services - 1987 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	
Interior		
B00N - R0001 - External Movement - 20.69 m2		
No Asbestos		
B00N - R0002 - General Assistant/Bulk Store - 73.89 m2		
No Asbestos		
B00N - R0003 - General Assistant/Bulk Store - 22.76 m2		
No Asbestos		
B00N - R0004 - General Assistant/Bulk Store - 17.06 m2		
No Asbestos		
B00N - R0005 - Garden Store - 94.06 m2		
No Asbestos		
B00O - Building Services - 1990 - Metal Shed		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00O - R0001 - Garden Store - 8.85 m2		
No Asbestos		
B00Q - Agricultural Science - 1987 - Timber		
Exterior		
Wall Cladding	Flat AC Sheeting	

Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00Q - R0001 - General Assistant/Bulk Store - 17.35 m2							
No Asbestos							
B00Q - R0002 - General Assistant/Bulk Store - 9.95 m2							
Non Accessible							
Non Accessible							
B00Q - R0003 - General Assistant/Bulk Store - 66.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00Q - R0004 - General Assistant/Bulk Store - 22.56 m2							
No Asbestos							
B00Q - R0005 - General Assistant/Bulk Store - 9.23 m2							
No Asbestos							
B00Q - R0006 - General Assistant/Bulk Store - 17.08 m2							
No Asbestos							
B00Q - R0007 - External Movement - 6.89 m2							
Wall Linings Internal	Flat AC Sheeting						
B00R - Multi Purpose Facilities - 1987 - Concrete							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Wall Cladding	Flat AC Sheeting						
Wall Cladding	Flat AC Sheeting	40m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting						
Wall Cladding	Flat AC Sheeting	40m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Interior							
B00R - R0001 - Sports Store - 37.64 m2							
No Asbestos							
B00R - R0002 - Shower/Change - 12.65 m2							
No Asbestos							
B00R - R0003 - Disabled Toilet - 1.85 m2							
No Asbestos							
B00R - R0004 - Movement - 4.8 m2							
No Asbestos							
B00R - R0005 - Shower/Change - 14.68 m2							
No Asbestos							
B00R - R0006 - Communal Space - 392.08 m2							
No Asbestos							
B00R - R0007 - External Movement - 43.74 m2							
No Asbestos							
B00R - R0008 - External Movement - 18.19 m2							
No Asbestos							
B00R - R0009 - Stairs - 3.08 m2							
No Asbestos							
B00R - R1001 - General Assistant/Bulk Store - 16.82 m2							

Floor Coverings Res/Textile	No Asbestos Found						
B00R - R1002 - Staff Room Annexe - 58.57 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00R - R1003 - Stairs - 3.48 m2							
No Asbestos							
B00R - R1004 - Seminar/Study - 16.48 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00S - Library - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00S - R0001 - External Movement - 16.29 m2							
No Asbestos							
B00S - R0002 - Reading Area - 90.24 m2							
No Asbestos							
B00S - R0003 - Library Office/Workroom - 18.91 m2							
No Asbestos							
B00S - R0004 - K.L.A. Store - 9.96 m2							
No Asbestos							
B00S - R0005 - Communications Room - 8.74 m2							
No Asbestos							
B00T - Residential Facilities - 1980 - Timber							
Exterior							
Underfloor Voids	Requires Inspection						
Ceiling Voids	Requires Inspection						
Interior							
B00T - R0001 - Residence - Movement - 22.96 m2							
Requires Inspection							
B00T - R0002 - Residence - Movement - 7.93 m2							
Requires Inspection							
B00T - R0003 - Residence - Bathroom - 4.93 m2							
Requires Inspection							
B00T - R0004 - Residence - Living - 42.21 m2							
Requires Inspection							
B00T - R0005 - Residence - Kitchen - 14.11 m2							
Requires Inspection							
B00T - R0006 - Residence - Living - 13.6 m2							
Requires Inspection							
B00T - R0007 - Residence - Living - 10 m2							
Requires Inspection							
B00T - R0008 - Residence - Movement - 48.6 m2							
Requires Inspection							
B00T - R0009 - Residence - Lounge - 17.41 m2							
Requires Inspection							
B00T - R0010 - Residence - Other - 1.01 m2							

Requires Inspection							
B00T - R0011 - Residence - Movement - 11.2 m2							
Requires Inspection							
B00T - R0012 - Residence - Bedroom - 9.97 m2							
Requires Inspection							
B00T - R0013 - Residence - Bedroom - 11.69 m2							
Requires Inspection							
B00T - R0014 - Residence - Movement - 17.15 m2							
Requires Inspection							
B00T - R0015 - Residence - Other - 3.7 m2							
Requires Inspection							
B00T - R0016 - Residence - Bedroom - 16.48 m2							
Requires Inspection							

Demountables**OS 602 10019 - Learning Unit - Standard With P.A.A. - Placement Date : 01-MAR-2010**

No Asbestos Found

OS 601 10279 - Learning Unit - Standard/Withdrawal - Placement Date : 03-MAR-2004**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 842 11481 - Country Toilet - Relta - Boys/Girls - Placement Date : 26-JAN-2005**Exterior**

Eaves Linings	Flat AC Sheeting	2.88m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Toilets-Girls**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Assumed Asbestos
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Toilet Partitions	Compressed AC Sheet	4m2	Assumed Asbestos

R2- Staff Toilet

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Assumed Asbestos

R3- Toilets-Boys

Toilet Partitions	Compressed AC Sheet	6m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Assumed Asbestos

R4- Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

OS 780 12560 - Woodwork/Metalwork/Heat Area/Store - Placement Date : 15-NOV-1999**Exterior**

Eaves Linings	Flat AC Sheeting	17.28m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Store**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Assumed Asbestos

R2- Materials Technology L.S.

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	91m2	Assumed Asbestos

OS 711 14661 - Home Science/Art/Science Dem/Computer - Placement Date : 09-AUG-1995**Exterior**

Eaves Linings	Flat AC Sheeting	14.4m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Computer Room			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	m2	Assumed Asbestos
R2- Food Technology L.S.			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	73m2	Assumed Asbestos
R3- Storeroom			
Ceiling Structures/Linings	Flat AC Sheeting	m2	Assumed Asbestos
OS 602 15753 - Learning Unit - Standard With P.A.A. - Placement Date : 10-JUL-2014			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 601 16814 - Learning Unit - Standard/Withdrawal - Placement Date : 03-MAR-2004			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos