


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Ingleburn Public School (2206)
Region:	South Western Sydney AMU
State Electorate:	Macquarie Fields
Local Government Area:	Campbelltown

Last Reviewed By:	WSP 16-OCT-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

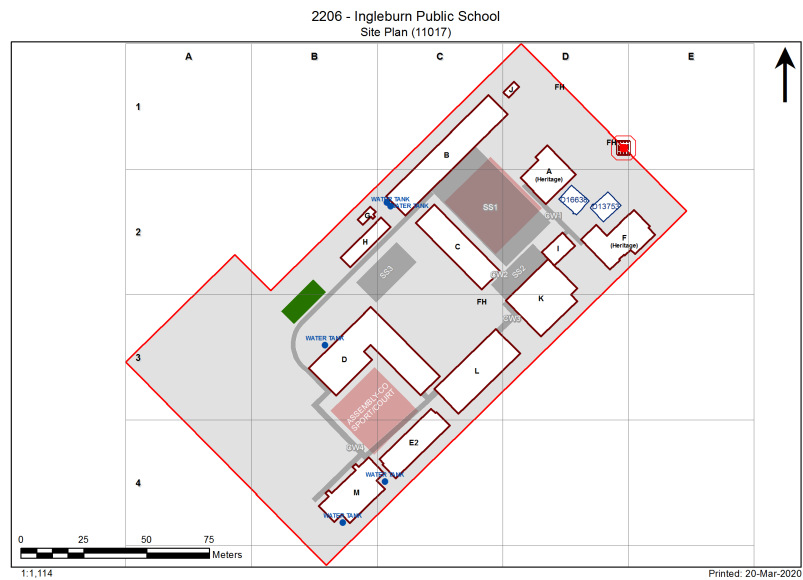

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Staff Facilities - 1892 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris - Vinyl Floor Tile		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Interior							
B00A - R0001 - Staff Room - 45.13 m2							
No Asbestos							
B00A - R0002 - Security Store - 11.06 m2							
No Asbestos							
B00A - R0003 - Staff Room Annexe - 45.51 m2							
No Asbestos							
B00A - R0004 - Cleaning Supplies - 14.99 m2							
No Asbestos							
B00A - R0005 - Movement - 35.12 m2							
No Asbestos							
B00A - R0006 - Staff Toilet - 3.25 m2							
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0007 - Staff Toilet - 3.25 m2							
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0008 - Special Programs Room - 47.46 m2							
No Asbestos							
B00A - R0009 - Movement - 16.21 m2							
No Asbestos							
B00B - General Learning/Staff Facilities - 1969 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	46m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	28	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	AC Fragments/Debris		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Interior							
B00B - M0001 - General Storeroom - 8.54 m2							
No Asbestos							
B00B - M0002 - Craft Store - 8.83 m2							
No Asbestos							
B00B - M0003 - Movement - 7.12 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - M0004 - Movement - 7.06 m2							

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0001 - Movement - 103.62 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	28m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0002 - Movement - 9.33 m2							
No Asbestos							
B00B - R0003 - Main Switch Board - 4.77 m2							
No Asbestos							
B00B - R0004 - Cleaning Distributed Store - 6.82 m2							
No Asbestos							
B00B - R0006 - Home Base - 57.02 m2							
No Asbestos							
B00B - R0008 - Home Base - 57.1 m2							
No Asbestos							
B00B - R0009 - Home Base Store - 6.63 m2							
No Asbestos							
B00B - R0010 - Personal Effects Storage - 13.38 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0011 - Distribution Board - .31 m2							Note: No inspection of live electrical installation
No Asbestos							
B00B - R0012 - Home Base Store - 6.67 m2							
No Asbestos							
B00B - R0013 - Home Base - 57.02 m2							
No Asbestos							
B00B - R0014 - Staff Room Annexe - 28.04 m2							
No Asbestos							
B00B - R0015 - Movement - 6.84 m2							
No Asbestos							
B00B - R0016 - General Storeroom - 13.74 m2							
No Asbestos							
B00B - R0017 - Home Base - 57.03 m2							
No Asbestos							
B00B - R0018 - Home Base Store - 6.9 m2							
No Asbestos							
B00B - R0022 - Home Base Store - 6.68 m2							
No Asbestos							
B00B - R0023 - Home Base - 57.03 m2							
No Asbestos							
B00B - R0024 - Practical Activities - 9.7 m2							
No Asbestos							
B00B - R0025 - Home Base Store - 3.57 m2							
No Asbestos							
B00B - R0026 - Practical Activities/Movement - 2hb - 13.13 m2							
No Asbestos							
B00B - R1001 - Movement - 119.23 m2							
Ceiling Structures/Linings	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	28m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1005 - Home Base - 57.1 m2							

Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	1	West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R1006 - Home Base - 57.03 m2							
No Asbestos							
B00B - R1007 - Home Base Store - 6.63 m2							
No Asbestos							
B00B - R1008 - Personal Effects Storage - 13.26 m2							
No Asbestos							
B00B - R1009 - Distribution Board - .36 m2							
No Asbestos							
B00B - R1010 - Home Base Store - 6.63 m2							
No Asbestos							
B00B - R1011 - Home Base - 56.95 m2							
No Asbestos							
B00B - R1012 - Deputy Principal - 28.04 m2							
No Asbestos							
B00B - R1014 - Home Base - 56.94 m2							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	North, East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R1015 - Home Base Store - 6.71 m2							
No Asbestos							
B00B - R1016 - Personal Effects Storage - 13.81 m2							
No Asbestos							
B00B - R1017 - Home Base Store - 6.74 m2							
No Asbestos							
B00B - R1018 - Home Base - 57.33 m2							
Plant / Equipment - Thermacon Heater	Encapsulated Asbestos material within unit	2	North, West	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R1019 - Practical Activities - 9.4 m2							
No Asbestos							
B00B - R1020 - Home Base Store - 3.95 m2							
No Asbestos							
B00C - General Learning - 1950 - Brick/Block							
Exterior							
Wall Linings Internal - Infill	Flat AC Sheeting	20	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Underfloor Voids	Packing						
Interior							
B00C - R0001 - Movement - 69.66 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	24m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0003 - Home Base Store - 4.39 m2							
No Asbestos							
B00C - R0005 - Home Base - 57.05 m2							
No Asbestos							
B00C - R0006 - Home Base Store - 4.34 m2							
No Asbestos							
B00C - R0007 - Personal Effects Storage - 8.83 m2							

No Asbestos							
B00C - R0008 - Home Base - 56.55 m2							
No Asbestos							
B00C - R0009 - Home Base Store - 5.22 m2							
No Asbestos							
B00C - R0010 - Personal Effects Storage - 8.59 m2							
No Asbestos							
B00C - R0011 - Home Base - 57.04 m2							
No Asbestos							
B00C - R0012 - Home Base Store - 4.54 m2							
No Asbestos							
B00C - R0013 - Personal Effects Storage - 9.26 m2							
No Asbestos							
B00C - R0014 - Home Base - 56.91 m2							
No Asbestos							
B00C - R0015 - Practical Activities - 9.5 m2							
No Asbestos							
B00D - General Learning/Support Unit - 1969 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	38m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	26m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Toilet - E - 2.83 m2							
No Asbestos							
B00D - R0002 - Home Base Store - E - 4.24 m2							
No Asbestos							
B00D - R0003 - Personal Effects - E - 6.95 m2							
No Asbestos							
B00D - R0004 - Home Base - E - 89.05 m2							
No Asbestos							
B00D - R0005 - Home Base - E - 88.97 m2							
No Asbestos							
B00D - R0006 - Toilet - E - 2.72 m2							
No Asbestos							
B00D - R0007 - Home Base Store - E - 4.09 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0008 - Personal Effects - E - 6.62 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00D - R0009 - Personal Effects - E - 6.73 m2							
No Asbestos							
B00D - R0010 - Home Base Store - E - 4.06 m2							
No Asbestos							
B00D - R0011 - Toilet - E - 2.71 m2							
No Asbestos							
B00D - R0012 - Home Base - E - 89.27 m2							
No Asbestos							
B00D - R0013 - Security Store - 27.14 m2							

No Asbestos							
B00D - R0014 - General Storeroom - 8.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0015 - Cleaning Distributed Store - 6.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0016 - Sports Store - 15.42 m2							
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0017 - Toilets - Girls - 29.06 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0018 - Toilets - Boys - 28.55 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0019 - Movement - 196.16 m2							
Ceiling Structures/Linings	Flat AC Sheeting	197m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0020 - Movement - 93.07 m2							
No Asbestos							
B00F - Administration - 1892 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Packing		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00F - R0001 - Principal - 16.99 m2							
No Asbestos							
B00F - R0002 - Interview - 14.93 m2							
No Asbestos							
B00F - R0003 - Entry Vestibule - 13.02 m2							
No Asbestos							
B00F - R0004 - Movement - 25.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - R0005 - Sick Bay - Shower/Toilet - 9.47 m2							
No Asbestos							
B00F - R0006 - Sick Bay - 10.52 m2							
No Asbestos							
B00F - R0007 - Distribution Board - .43 m2							
No Asbestos							
B00F - R0008 - Duplicating Workroom - 32.7 m2							
No Asbestos							
B00F - R0009 - Security Store - 17.63 m2							
No Asbestos							
B00F - R0010 - Uniform Shop - 16.5 m2							
No Asbestos							
B00F - R0011 - Movement - 8.37 m2							
No Asbestos							

Note: No inspection of live electrical installation

B00F - R0012 - Movement - 18.69 m2							
No Asbestos							
B00F - R0013 - Staff Toilet - 3.39 m2							
Wall Linings Internal	Flat AC Sheeting						
B00F - R0014 - Clerical Office - 11.63 m2							
No Asbestos							
B00F - R0015 - Clerical Office/Workroom - 14.09 m2							
No Asbestos							
B00F - R0016 - Deputy Principal - 14.53 m2							
No Asbestos							
B00F - R0017 - Movement - 13.1 m2							
No Asbestos							
B00F - R0018 - Movement - 4.85 m2							
No Asbestos							
B00F - R0019 - Movement - 5.13 m2							
No Asbestos							
B00F - R0020 - Movement - 16.61 m2							
No Asbestos							
B00G - Other-Community Use - 1965 - Metal Shed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00G - R0001 - Other-Vacant - 10.22 m2							
No Asbestos							
B00G - R0002 - Toilets-Unisex - 1.67 m2							
No Asbestos							
B00G - R0003 - Other-Vacant - 8.57 m2							
No Asbestos							
B00G - R0004 - External Movement - 1.34 m2							
No Asbestos							
B00H - Pupil Facilities/Building Services - 1965 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00H - R0001 - Toilets - Boys - 54.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0002 - General Assistant/Bulk Store - 16.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0003 - Garden Store - 17.17 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0004 - General Assistant/Bulk Store - 17.26 m2							
No Asbestos							
B00I - Pupil Facilities - 1968 - Brick/Block							

Exterior							
Eaves Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00I - R0001 - Toilets - Girls - 49.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0002 - Cleaning Distributed Store - 1.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00I - R0003 - Movement - 22.45 m2							
No Asbestos							
B00J - Other-Community Use - 1965 - Metal Shed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0001 - Reading Area - 8.44 m2							
No Asbestos							
B00J - R0002 - Reading Area - 8.41 m2							
No Asbestos							
B00K - Communal Facilities/Pupil Facilities - 1995 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00K - R0001 - Cleaning Distributed Store - 2.08 m2							
No Asbestos							
B00K - R0002 - Toilets - Boys - 6.53 m2							
No Asbestos							
B00K - R0003 - Movement - 1.04 m2							
No Asbestos							
B00K - R0004 - Communal Space - 36.03 m2							
No Asbestos							
B00K - R0005 - Toilets - Girls - 8.41 m2							
No Asbestos							
B00K - R0006 - Plant - .62 m2							
No Asbestos							
B00K - R0007 - Distribution Board - .54 m2							
No Asbestos							Note: No inspection of live electrical installation
B00K - R0008 - Canteen - 42.82 m2							
No Asbestos							
B00K - R0009 - Canteen Office/Store - 11.82 m2							
No Asbestos							
B00K - R0010 - Communal Space - 220.65 m2							
No Asbestos							
B00K - R0011 - Disabled Shower/Toilet - 8.34 m2							

No Asbestos		
B00K - R0012 - P.E Store - 15.56 m2		
No Asbestos		
B00K - R0013 - Plant - .63 m2		
No Asbestos		
B00K - R0014 - Hall Chair Store - 10.93 m2		
No Asbestos		
B00K - R0015 - Movement - 24.3 m2		
No Asbestos		
B00K - R0016 - Movement - 42.82 m2		
No Asbestos		
B00L - Library/Tiered Learning - 1995 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00L - R0001 - Main Switch Board - 2.96 m2		
No Asbestos		
B00L - R0002 - Cleaning Distributed Store - 4.08 m2		
No Asbestos		
B00L - R0003 - Plant - 6.62 m2		
No Asbestos		
B00L - R0004 - Distribution Board - .67 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00L - R0005 - Special Programs Store - 1.78 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0006 - Special Programs Room - 42.12 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0007 - Movement - 29.25 m2		
No Asbestos		
B00L - R0008 - Communications Room - 12.71 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0009 - Library Office/Workroom - 25.89 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0010 - Reading Area - 224.66 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00L - R0011 - Movement - 91.56 m2		
No Asbestos		
B00M - General Learning - 1999 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00M - R0001 - Distribution Board - .99 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00M - R0002 - Home Base - 51.55 m2		
Floor Coverings Res/Textile	No Asbestos Found	

B00M - R0003 - Practical Activities - 1hb - 24.67 m2							
No Asbestos							
B00M - R0004 - Home Base Store - 8.76 m2							
No Asbestos							
B00M - R0005 - Withdrawal Space - 1hb - 11.8 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00M - R0006 - Home Base - 51.74 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00M - R0007 - Practical Activities - 1hb - 25.96 m2							
No Asbestos							
B00M - R0008 - Home Base Store - 8.73 m2							
No Asbestos							
B00M - R0009 - Movement - 52.65 m2							
No Asbestos							
B00M - R0010 - Movement - 11.04 m2							
No Asbestos							
B00M - R0011 - Movement - 10.8 m2							
No Asbestos							
B00M - R0012 - External Stairs - 3.14 m2							
No Asbestos							
B00M - R0013 - External Stairs - 3.14 m2							
No Asbestos							
B00M - R1001 - Movement - 65.56 m2							
No Asbestos							
B00M - R1002 - Home Base - 49.9 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00M - R1003 - Practical Activities - 1hb - 28.57 m2							
No Asbestos							
B00M - R1004 - Home Base Store - 8.3 m2							
No Asbestos							
B00M - R1005 - Withdrawal Space - 1hb - 11.42 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00M - R1006 - Home Base - 49.85 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B00M - R1007 - Practical Activities - 1hb - 28.64 m2							
No Asbestos							
B00M - R1008 - Home Base Store - 8.3 m2							
No Asbestos							
B0E2 - General Learning - 1968 - Timber							
Exterior							
Underfloor Voids	AC Fragments/Debris		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Packing		Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)	Assumed Asbestos
Eaves Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Flat AC Sheeting						

Interior							
B0E2 - R0002 - Home Base - 53.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B0E2 - R0003 - Home Base - 53.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B0E2 - R0004 - Home Base - 53.73 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B0E2 - R0006 - Movement - 13.19 m2							
No Asbestos							
B0E2 - R0009 - Special Programs Room - 16.16 m2							
No Asbestos							
B0E2 - R0010 - Withdrawal Space - 1hb - 17.54 m2							
No Asbestos							
B0E2 - R0011 - Movement - 50.42 m2							
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B0E2 - R0012 - Withdrawal - M - 20.09 m2							
No Asbestos							

Demountables

OS 602 13753 - Learning Unit - Standard With P.A.A. - Placement Date : 02-NOV-2016

No Asbestos Found

OS 602 16638 - Learning Unit - Standard With P.A.A. - Placement Date : 10-AUG-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found