

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Ingleburn High School (8262)
Region:	South Western Sydney AMU
State Electorate:	Macquarie Fields
Local Government Area:	Campbelltown

Last Reviewed By:	Greencap 29-MAY-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

8262 - Ingleburn High School
Site Plan (10758)

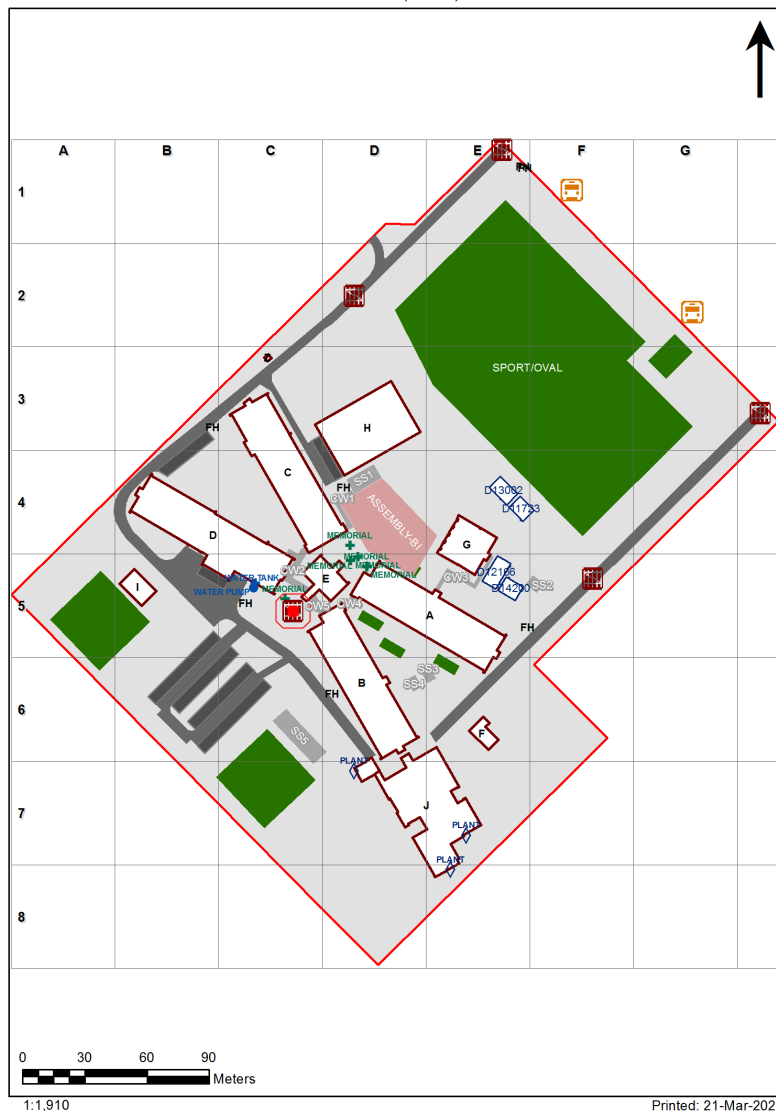

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning - 1960 - Brick/Veneer							
Exterior							
Underfloor Voids	AC Fragments/Debris						
Underfloor Voids	Packing	1	Variable positions	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Interior							
B00A - R0002 - General Learning Space - 54.69 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0003 - General Learning Space - 54.69 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0004 - General Learning Space - 55.59 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0005 - Interview/Office - Type 1 - 13.32 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0006 - Uniform Shop - 13.43 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0007 - General Learning Space - 54.76 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0008 - General Learning Space - 54.62 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0009 - General Learning Space - 54.76 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0013 - Archive Store - 27.53 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0014 - General Learning Space - 54.76 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0015 - Resources Store - 27.04 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0016 - Staff Study - 54.76 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0018 - Staff - Toilet - 10.67 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0019 - General Learning Space - 54.76 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0020 - General Learning Space - 53.86 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0021 - General Learning Space - 54.21 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0022 - General Learning Space - 54.69 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0027 - Leading Teacher - 13.54 m2							
No Asbestos							
B00A - R0028 - Printing/Photocopying - 26.97 m2							
No Asbestos							
B00A - R0029 - Performance Workshop - 27.08 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0030 - General Learning Space - 54.69 m2							
Wall Linings Internal	Flat AC Sheeting						

B00A - R0031 - Cleaning Store - Distributed - 2.42 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0032 - Staff - Toilet - 6.18 m2							
Floor Coverings Res/Textile	Corrugated AC Sheeting	6.18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting						
B00A - R0033 - Distribution Board Cupboard - .95 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00A - R0036 - Computer Learning Space - 54.92 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0038 - External Movement - 7.13 m2							
No Asbestos							
B00A - R0039 - External Movement - 8.69 m2							
No Asbestos							
B00A - R0040 - External Movement - 47.77 m2							
No Asbestos							
B00A - R0041 - Student Waiting - 13.33 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0042 - Movement - 287.3 m2							
Wall Linings Internal	Flat AC Sheeting						
B00A - R0043 - General Learning Space - 54.76 m2							
No Asbestos							
B00B - General Learning/Art/Music - 1960 - Brick/Block							
Exterior							
Underfloor Voids	AC Fragments/Debris	0.5	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Flat AC Sheeting	1	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Interior							
B00B - R0018 - Distribution Board Cupboard - .76 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0021 - Staff Study - 27.61 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0024 - General Learning Space - 54.84 m2							
No Asbestos							
B00B - R0031 - Computer Learning Space - 55.14 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0034 - Art Learning Space - 62.07 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0035 - Workshop - 51.03 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0036 - Kiln Space - 9.62 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0037 - Art Learning Space - 61.31 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0038 - General Learning Space - 57.18 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0039 - Store - 11.12 m2							
Wall Linings Internal	Flat AC Sheeting						

B00B - R0040 - Staff - Toilet - 12.17 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0041 - Staff - Toilet - 6.07 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0044 - External Movement - 6.8 m2							
No Asbestos							
B00B - R0045 - Resources Store - 19.68 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0046 - General Learning Space - 54.31 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0047 - General Learning Space - 54.09 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0048 - External Movement - 7.98 m2							
No Asbestos							
B00B - R0049 - Music Learning Space - 59.62 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0050 - Music Store - 21.14 m2							
No Asbestos							
B00B - R0051 - Music Learning Space - 78.32 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0054 - Cleaning Store - Distributed - 3.56 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0055 - Careers Advisers Office - 22.95 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0059 - General Learning Space - 54.61 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0062 - Darkroom Space - 2.11 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0063 - Dark Room - 24.14 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0064 - Staff Study - 43.05 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0065 - Resources Store - 11.82 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0066 - Commonroom - 82.38 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0067 - Staff Kitchen - 6.29 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0068 - Movement - 286.47 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0069 - External Movement - 47.23 m2							
No Asbestos							
B00B - R0070 - Staff Study - 50.06 m2							
No Asbestos							
B00B - R0071 - Staff Kitchen - 4.55 m2							
No Asbestos							
B00C - Science Learning/General Learning - 1960 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Flat AC Sheeting	0.5	Variable positions	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)

Underfloor Voids	AC Fragments/Debris	0.5	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting						
Interior							
B00C - R0001 - Staff Study - 27.16 m2							
No Asbestos							
B00C - R0002 - Food Technology L.S. - 68.62 m2							
No Asbestos							
B00C - R0003 - Food/Research Space - 54.54 m2							
No Asbestos							
B00C - R0004 - Main Switchroom - 5.91 m2							
No Asbestos							
B00C - R0005 - Preparation - Materials - 20.54 m2							
No Asbestos							
B00C - R0006 - Food Technology L.S. - 68.41 m2							
No Asbestos							
B00C - R0007 - Laundry - 9.26 m2							
No Asbestos							
B00C - R0008 - Class Tools Storage - 26.29 m2							
No Asbestos							
B00C - R0013 - Resources Store - 11.59 m2							
No Asbestos							
B00C - R0014 - Staff - Toilet - 9.17 m2							
No Asbestos							
B00C - R0015 - Staff - Toilet - 7.01 m2							
No Asbestos							
B00C - R0021 - Sport Equipment Store - 6.33 m2							
No Asbestos							
B00C - R0024 - Distribution Board Cupboard - .55 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00C - R0026 - Laboratory L.S. - 96.66 m2							
No Asbestos							
B00C - R0027 - Preparation - Science - 26.97 m2							
No Asbestos							
B00C - R0028 - Apparatus Store - 26.97 m2							
No Asbestos							
B00C - R0029 - Laboratory L.S. - 96.29 m2							
No Asbestos							
B00C - R0032 - Preparation - Science - 25.58 m2							
No Asbestos							
B00C - R0033 - Laboratory L.S. - 82.67 m2							
No Asbestos							
B00C - R0036 - Design L.S. - 72.95 m2							
No Asbestos							
B00C - R0037 - Resources Store - 8.99 m2							
No Asbestos							
B00C - R0038 - Cleaning Store - Distributed - 4.45 m2							
No Asbestos							
B00C - R0039 - External Movement - 10.65 m2							
No Asbestos							
B00C - R0040 - Class Tools Storage - 19.87 m2							

Plant / Equipment - Incubator	Insulation Material	0.51	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0041 - Laboratory L.S. - 95.02 m2							
No Asbestos							
B00C - R0042 - External Movement - 7.26 m2							
No Asbestos							
B00C - R0043 - Laboratory L.S. - 94.79 m2							
No Asbestos							
B00C - R0044 - Staff Study - 40.04 m2							
No Asbestos							
B00C - R0045 - General Storeroom - 5.47 m2							
No Asbestos							
B00C - R0046 - Chemical Store - 13.41 m2							
No Asbestos							
B00C - R0047 - Resources Store - 14.67 m2							
No Asbestos							
B00C - R0049 - Stairs - 5.41 m2							
No Asbestos							
B00C - R0051 - Stairs - .63 m2							
No Asbestos							
B00C - R0052 - External Movement - 78.94 m2							
No Asbestos							
B00C - R0053 - Movement - 278.96 m2							
Wall Linings Internal	Flat AC Sheeting						
B00C - R1001 - General Learning Space - 54.1 m2							
No Asbestos							
B00C - R1002 - General Learning Space - 53.8 m2							
No Asbestos							
B00C - R1003 - Computer Learning Space - 54.17 m2							
No Asbestos							
B00C - R1006 - General Storeroom - 3.03 m2							
No Asbestos							
B00C - R1008 - General Learning Space - 54.1 m2							
No Asbestos							
B00C - R1009 - Movement - 61.1 m2							
No Asbestos							
B00C - R1010 - Stairs - 9.96 m2							
No Asbestos							
B00C - R1011 - Stairs - 7.14 m2							
No Asbestos							
B00C - R1012 - Staff Study - 36.52 m2							
No Asbestos							
B00C - R1013 - G.L.S. Store - 7.49 m2							
No Asbestos							
B00C - R1014 - Store - 59.68 m2							
No Asbestos							
B00D - Technological & Applied Studies/Pupil Facilities - 1960 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						

Interior							
B00D - R0005 - Covered Area - 162.61 m2							
No Asbestos							
B00D - R0006 - Staff - Toilet - 7.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7.26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
B00D - R0007 - Tea Room - 18.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos), Crocidolite (blue asbestos)
B00D - R0009 - Movement - 128.1 m2							
No Asbestos							
B00D - R0010 - Materials Store - 20.44 m2							
No Asbestos							
B00D - R0011 - General Learning Space - 62.72 m2							
No Asbestos							
B00D - R0012 - Materials Store - 23.4 m2							
No Asbestos							
B00D - R0013 - Cleaning Store - Distributed - 3.33 m2							
No Asbestos							
B00D - R0014 - Resources Store - 10.78 m2							
No Asbestos							
B00D - R0015 - Project Store - Type 1 - 22.77 m2							
No Asbestos							
B00D - R0016 - Design L.S. - 55.51 m2							
No Asbestos							
B00D - R0017 - Computer Learning Space - 62.33 m2							
No Asbestos							
B00D - R0018 - Staff Study - 27.4 m2							
No Asbestos							
B00D - R0019 - Dust Extraction Space - 5.41 m2							
No Asbestos							
B00D - R0020 - Wood Technology L.S. - 77.54 m2							
No Asbestos							
B00D - R0021 - Wood Technology Bay - 41.12 m2							
No Asbestos							
B00D - R0022 - Materials Technology L.S. - 77.54 m2							
No Asbestos							
B00D - R0024 - Student Canteen - 49.47 m2							
No Asbestos							
B00D - R0025 - Pantry - 7.83 m2							
No Asbestos							
B00D - R0027 - External Movement - 55.25 m2							
No Asbestos							
B00D - R0028 - Toilets-Disabled - 4.86 m2							
No Asbestos							
B00D - R0029 - General Assistants - 20.6 m2							
No Asbestos							
B00D - R0030 - Toilet - Lobby - 5.46 m2							
No Asbestos							
B00D - R0031 - Staff - Toilet - 1.5 m2							

No Asbestos							
B00D - R0032 - External Movement - 6.5 m2							
No Asbestos							
B00D - R0033 - Metal Technology Bay - 29.46 m2							
No Asbestos							
B00D - R0034 - Welding Area - 4.6 m2							
Wall Linings Internal - Infill	Flat AC Sheeting						
Wall Linings Internal	Flat AC Sheeting						
B00D - R0036 - General Storeroom - 18.53 m2							
No Asbestos							
B00D - R0037 - Toilets-Boys - 82.1 m2							
Ceiling Structures/Linings	Flat AC Sheeting	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00D - R0038 - Toilets-Girls - 48.75 m2							
Ceiling Structures/Linings	Flat AC Sheeting	48.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00D - R0039 - Toilets-Girls - 49.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting	49.94m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00D - R0040 - Covered Area - 198.76 m2							
Require Inspection							
B00D - R0041 - External Movement - 123.77 m2							
Require Inspection							
B00D - R9002 - General Storeroom - 324.03 m2							
No Asbestos							
B00D - R9003 - Archive Store - 21.73 m2							
No Asbestos							
B00D - R9004 - Garden Store Room - 26.58 m2							
No Asbestos							
B00D - R9005 - General Storeroom - 6.08 m2							
No Asbestos							
B00D - R9006 - Other-Vacant - 1.4 m2							
No Asbestos							
B00E - Administration - 1960 - Brick/Veneer							
Exterior							
Underfloor Voids	Non Accessible Area						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0005 - Administration - Clerical - 13.24 m2							
No Asbestos							
B00E - R0010 - Staff Room Annexe - 12.82 m2							
No Asbestos							
B00E - R0011 - Principal - 17.83 m2							
No Asbestos							
B00E - R0012 - Archive Store - 6.92 m2							
No Asbestos							
B00E - R0014 - Communication Space - 5.96 m2							
Wall Linings Internal	Flat AC Sheeting						
B00E - R0016 - Toilets-Unisex - 1.34 m2							

No Asbestos							
B00E - R0017 - Clinic - 6.22 m2							
No Asbestos							
B00E - R0018 - Ancillary Staff - 17.48 m2							
No Asbestos							
B00E - R0019 - Administration - Clerical - 33.59 m2							
No Asbestos							
B00E - R0021 - Cleaning Store - Distributed - 2.94 m2							
No Asbestos							
B00E - R0022 - General Storeroom - 3.89 m2							
No Asbestos							
B00E - R0024 - Movement - 6.4 m2							
No Asbestos							
B00E - R0025 - External Movement - 14.9 m2							
No Asbestos							
B00E - R0027 - Student Waiting - 13.14 m2							
No Asbestos							
B00E - R0028 - Toilet - Lobby - 4.13 m2							
No Asbestos							
B00E - R0029 - Staff - Toilet - 2.48 m2							
No Asbestos							
B00E - R0030 - External Movement - 29.17 m2							
No Asbestos							
B00E - R0031 - Deputy Principal Office - 10.44 m2							
No Asbestos							
B00E - R0032 - Deputy Principal Office - 12.77 m2							
No Asbestos							
B00E - R0033 - Movement - .96 m2							
No Asbestos							
B00E - R0034 - Public Reception - 10.46 m2							
Require Inspection							
B00E - R0035 - Student Reception - 16.4 m2							
Require Inspection							
B00E - R0036 - Store - 1.3 m2							
Require Inspection							
B00E - R0037 - Staff - Toilet - 2.16 m2							
Require Inspection							
B00F - Storage - 1960 - Brick/Block							
Exterior							
Gable Ends	Flat AC Sheeting	45m2	East&West&variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Interior							
B00F - R0001 - General Storeroom - 7.48 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0004 - Kiln Space - 8.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0005 - Other-Vacant - 8.58 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0006 - External Movement - 20.87 m2							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0007 - External Movement - 4.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4.28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0008 - General Storeroom - 33.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	33.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - Library - 1989 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00G - R0001 - Staff - Toilet - 4.1 m2							
No Asbestos							
B00G - R0002 - Audio Visual Workroom - 14.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0003 - Library Administration - 15.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0004 - Main Entry - 11.86 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0005 - Librarian - 15.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0006 - Tea Room - 14.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0007 - Staff - Toilet - 4.08 m2							
No Asbestos							
B00G - R0009 - Tiered Learning Area - 11.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G - R0010 - Movement - 28.2 m2							
No Asbestos							
B00G - R0011 - Multi Media Workshop - 60.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00G - R0012 - Plant - 7.14 m2							
Plant / Equipment - Air Conditioning Unit	Mastic	0.2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0013 - Plant - 7.13 m2							
Plant / Equipment - Air Conditioning Unit	Mastic	0.2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0014 - Stairs - 3.67 m2							
No Asbestos							
B00G - R0015 - Stairs - 7.88 m2							
No Asbestos							
B00G - R0016 - Movement - 3.11 m2							

No Asbestos							
B00G- R0017 - External Movement - 5.3 m2							
No Asbestos							
B00G- R0018 - Stairs - .88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G- R0019 - Stairs - .9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G- R0020 - Seminar - 15.4 m2							
Require Inspection							
B00G- R0021 - Seminar - 15.17 m2							
Require Inspection							
B00G- R0022 - Main Area - 143.22 m2							
Require Inspection							
B00G- R1002 - Cleaning Store - Distributed - .87 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G- R1003 - Computer Store - 8.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G- R1004 - System Administrators Office - 20.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G- R1005 - Senior Study - 31.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G- R1006 - Staff Study - 15.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G- R1007 - Distribution Board Cupboard - 1.13 m2							
						Note: No inspection of live electrical installation	
Wall Linings Internal	Flat AC Sheeting	1m2	Behind Door	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00G- R1008 - Movement - 22.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00G- R1011 - Computer Learning Space - 106.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00G- R1012 - Main Area - 68.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00G- R1013 - Stairs - 3.46 m2							
No Asbestos							
B00G- R1014 - Stairs - 2.55 m2							
No Asbestos							
B00G- R1015 - Stairs - 3.65 m2							
No Asbestos							
B00G- R1016 - Stairs - 2.58 m2							
No Asbestos							
B00H - Multi Purpose Facilities - 1991 - Brick/Block							
Exterior							

Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - M0001 - Movement - 3.95 m2		
Wall Linings Internal	Flat AC Sheeting	
B00H - M0002 - Control Room - 2.08 m2		
No Asbestos		
B00H - R0002 - Sport Equipment Store - 29.89 m2		
No Asbestos		
B00H - R0003 - Sport Equipment Store - 20.54 m2		
No Asbestos		
B00H - R0004 - Staff - Toilet - 4.11 m2		
No Asbestos		
B00H - R0005 - Distribution Board Cupboard - 3.48 m2		Note: No inspection of live electrical installation
No Asbestos		
B00H - R0007 - Stage - 68.32 m2		
No Asbestos		
B00H - R0008 - Chair Store - 44.39 m2		
No Asbestos		
B00H - R0011 - Cleaning Store - Distributed - 3.38 m2		
No Asbestos		
B00H - R0012 - Staff Kitchen - 14.8 m2		
No Asbestos		
B00H - R0013 - Sport Equipment Store - 6.02 m2		
No Asbestos		
B00H - R0016 - External Movement - 266.83 m2		
No Asbestos		
B00H - R0017 - Toilet - Lobby - 3.12 m2		
No Asbestos		
B00H - R0018 - Toilets-Girls - 18.15 m2		
No Asbestos		
B00H - R0019 - Change - 30.77 m2		
No Asbestos		
B00H - R0020 - Toilet - Lobby - 2.95 m2		
No Asbestos		
B00H - R0021 - Toilets-Boys - 18.45 m2		
No Asbestos		
B00H - R0022 - Change - 30.7 m2		
No Asbestos		
B00H - R0023 - Tea Room - 9.7 m2		
No Asbestos		
B00H - R0024 - Staff Study - 24.43 m2		
Wall Linings Internal	Flat AC Sheeting	
B00H - R0025 - Multi-Purpose Space - 484.75 m2		
No Asbestos		
B00H - R0026 - Movement - 15.91 m2		
No Asbestos		
B00H - R0027 - Movement - 15.81 m2		
No Asbestos		
B00H - R0028 - Movement - 5.62 m2		
No Asbestos		
B00H - R0029 - General Storeroom - 16.32 m2		

No Asbestos	
B00H - R0030 - Stairs - .18 m2	
No Asbestos	
B00I - Physical Education - 2017 - Steel	
Exterior	
Require Inspection	
Interior	
B00I - R0001 - Gymnasium - 132.32 m2	
Require Inspection	
B00J - General Learning - 2019 - Brick/Veneer	
Exterior	
Require Inspection	
Interior	
B00J - R0001 - Toilets-Boys - 10.42 m2	
Require Inspection	
B00J - R0002 - Toilets-Disabled - 6.46 m2	
Require Inspection	
B00J - R0003 - Toilets-Girls - 20.99 m2	
Require Inspection	
B00J - R0004 - General Learning Space - 58.47 m2	
Require Inspection	
B00J - R0005 - General Learning Space - 58.47 m2	
Require Inspection	
B00J - R0006 - Seminar - Type 1 - 25.57 m2	
Require Inspection	
B00J - R0007 - General Learning Space - 58.47 m2	
Require Inspection	
B00J - R0008 - General Learning Space - 58.47 m2	
Require Inspection	
B00J - R0009 - Seminar - Type 1 - 9.8 m2	
Require Inspection	
B00J - R0010 - Movement - 6.69 m2	
Require Inspection	
B00J - R0011 - Practical Activities Area - 2 G.L.S. - 9.65 m2	
Require Inspection	
B00J - R0012 - Communications Cupboard - 8.15 m2	
Require Inspection	
B00J - R0013 - General Storeroom - 1.87 m2	
Require Inspection	
B00J - R0014 - Distribution Board Cupboard - 1.21 m2	
Require Inspection	
B00J - R0015 - Practical Activities Area - 2 G.L.S. - 6.6 m2	
Require Inspection	
B00J - R0016 - Movement - 52.73 m2	
Require Inspection	
B00J - R0017 - Seminar - Type 1 - 11.56 m2	
Require Inspection	
B00J - R0018 - General Learning Space - 59.38 m2	
Require Inspection	
B00J - R0019 - General Learning Space - 59.37 m2	
Require Inspection	

Note: No inspection of live electrical installation

B00J - R0020 - General Learning Space - 59.38 m2							
Require Inspection							
B00J - R0021 - Seminar - Type 1 - 24.15 m2							
Require Inspection							
B00J - R0022 - General Learning Space - 58.54 m2							
Require Inspection							
B00J - R0023 - Performance Workshop - 94.92 m2							
Require Inspection							
B00J - R0024 - General Learning Space - 58.47 m2							
Require Inspection							
B00J - R0025 - Cleaning Store - Distributed - 4.11 m2							
Require Inspection							
B00J - R0026 - G.L.S. Store - 19.95 m2							
Require Inspection							
B00J - R0027 - Other-Community Use - 51.48 m2							
Require Inspection							
B00J - R0028 - Outdoor Learning Area - 234.41 m2							
Require Inspection							
B00J - R0029 - External Movement - 154.08 m2							
Require Inspection							
B00J - R0030 - External Movement - 40.16 m2							
Require Inspection							
B00J - R0031 - Movement - 59.5 m2							
Require Inspection							
B00J - R0032 - Practical Activities Area - 2 G.L.S. - 6.36 m2							
Require Inspection							
B00J - R0033 - External Movement - 16.01 m2							
Require Inspection							
B00J - R0034 - External Movement - 7.07 m2							
Require Inspection							
B00J - R0035 - External Movement - 17.48 m2							
Require Inspection							
B00J - R0036 - External Movement - 15.6 m2							
Require Inspection							
B00Z - Building Services - 1960 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground							
Interior							
B00Z - R0001 - External Movement - 3.17 m2							
No Asbestos							
B00Z - R0002 - Plant - 1.86 m2							
No Asbestos							

Demountables

OS 601 11723 - Learning Unit - Standard/Withdrawal - Placement Date : 01-DEC-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 700 12166 - Art Learning Space/Workshop/Store - Placement Date : 12-FEB-2003

Exterior

Eaves Linings	Flat AC Sheeting	17.28m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- Art Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	91m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 621 13002 - Single Learning Unit - H/Cap - Placement Date : 03-DEC-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 14200 - Learning Unit - Standard/Withdrawal - Placement Date : 01-DEC-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found