


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Jamisontown Public School (4544)</b>
<b>Region:</b>	<b>Western Sydney AMU</b>
<b>State Electorate:</b>	<b>Penrith</b>
<b>Local Government Area:</b>	<b>Penrith</b>

Last Reviewed By:	WSP 17-JUN-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

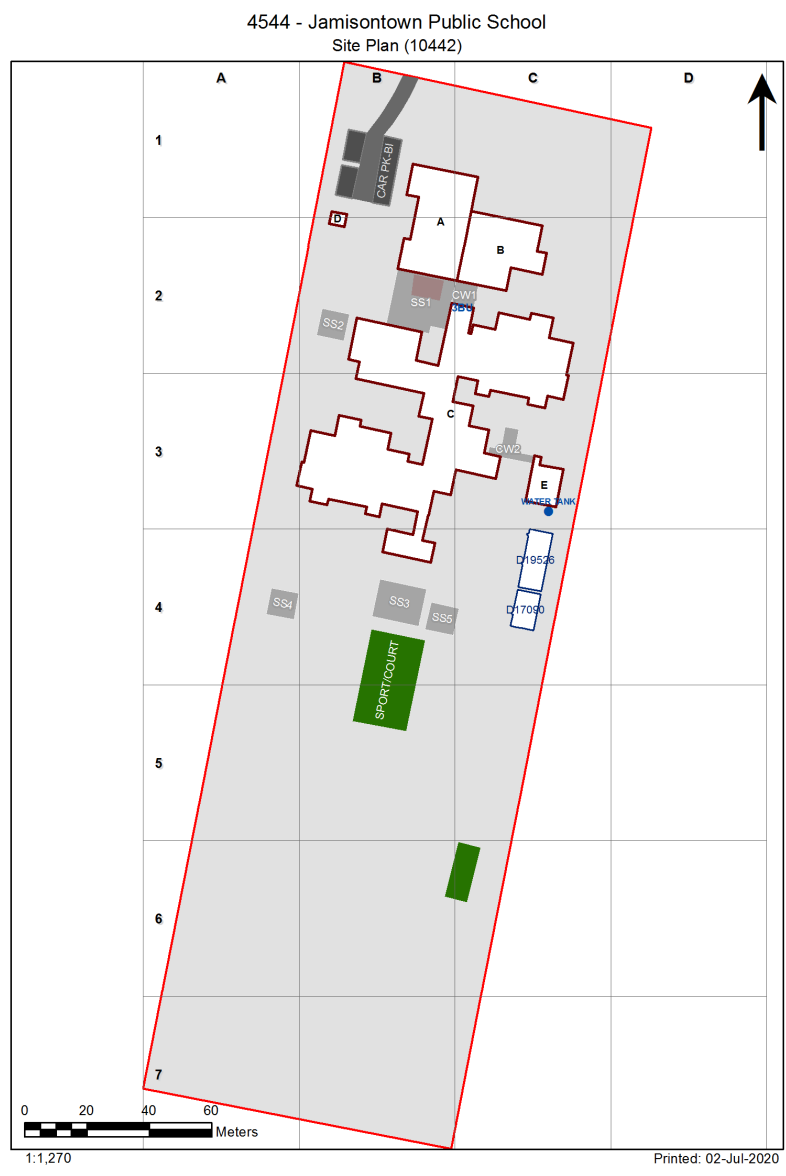

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - Communal Facilities/Pupil Facilities - 1982 - Brick/Block</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting	40m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00A - R0001 - Hall Chair Store - 12.5 m2</b>							
No Asbestos							
<b>B00A - R0002 - P.E Store - 12.71 m2</b>							
No Asbestos							
<b>B00A - R0003 - Communal Space - 250.16 m2</b>							
No Asbestos							
<b>B00A - R0004 - Toilets - Boys - 23.9 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Disabled Toilet - 3.63 m2</b>							
No Asbestos							
<b>B00A - R0006 - Movement - 86.17 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	87m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00A - R0007 - Canteen - 43.19 m2</b>							
No Asbestos							
<b>B00A - R0008 - Canteen Office/Store - 4 m2</b>							
No Asbestos							
<b>B00A - R0009 - Staff Toilet - 2.87 m2</b>							
No Asbestos							
<b>B00A - R0010 - Canteen Office/Store - 7.82 m2</b>							
No Asbestos							
<b>B00A - R0011 - Movement - 4.83 m2</b>							
No Asbestos							
<b>B00A - R0012 - Toilets - Girls - 20.11 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0013 - Raised Platform - 53.8 m2</b>							
No Asbestos							
<b>B00A - R0014 - Movement - 3.75 m2</b>							
No Asbestos							
<b>B00A - R0015 - Cleaning Supplies - 25.64 m2</b>							
No Asbestos							
<b>B00A - R0016 - Main Switch Board - 7.45 m2</b>							
Electrical - Mounting Board	Resinous Board						
<b>B00A - R0017 - Movement - 11.31 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0018 - Cleaning Supplies - 8.57 m2</b>							
No Asbestos							
<b>B00A - R0019 - General Assistant/Bulk Store - 12.85 m2</b>							

No Asbestos							
<b>B00B - Administration/Staff Facilities - 1982 - Brick/Block</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00B - R0001 - Community Clinic - 21.62 m2</b>							
No Asbestos							
<b>B00B - R0002 - Community Clinic - 3.43 m2</b>							
No Asbestos							
<b>B00B - R0003 - Movement - 3.28 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0004 - Community Clinic - 6.42 m2</b>							
No Asbestos							
<b>B00B - R0005 - Distribution Board - 1.02 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Floor Coverings Res/Textile	Compressed AC Sheet	2m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0006 - Movement - 46.08 m2</b>							
No Asbestos							
<b>B00B - R0007 - Staff Room - 70.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0008 - Sick Bay - 12.18 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0009 - Interview - 13.21 m2</b>							
No Asbestos							
<b>B00B - R0010 - General Storeroom - 13.22 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0011 - Staff Toilet - 6.54 m2</b>							
No Asbestos							
<b>B00B - R0012 - Cleaning Distributed Store - .79 m2</b>							
No Asbestos							
<b>B00B - R0013 - Staff Toilet - 3.64 m2</b>							
No Asbestos							
<b>B00B - R0014 - Staff Room Annexe - 12.14 m2</b>							
No Asbestos							
<b>B00B - R0015 - Deputy Principal - 13.11 m2</b>							
No Asbestos							
<b>B00B - R0016 - Entry Vestibule - 19.36 m2</b>							
No Asbestos							
<b>B00B - R0017 - Clerical Office - 13.21 m2</b>							
No Asbestos							
<b>B00B - R0018 - Clerical Office/Workroom - 32.54 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00B - R0019 - Principal - 22.61 m2</b>							

No Asbestos							
<b>B00B - R0020 - Movement - 5.76 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0021 - Movement - 17.04 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0022 - Movement - 37.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - General Learning/Library - 1982 - Brick/Block</b>							
<b>Exterior</b>							
Wall Cladding	Flat AC Sheeting	100m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids							
<b>Interior</b>							
<b>B00C - R0001 - Movement - 14.53 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0002 - Movement - 44.21 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	North, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0003 - Home Base - 60.58 m2</b>							
No Asbestos							
<b>B00C - R0004 - General Storeroom - 7.36 m2</b>							
No Asbestos							
<b>B00C - R0005 - Practical Activities - 1hb - 26.43 m2</b>							
No Asbestos							
<b>B00C - R0006 - Home Base - 60.4 m2</b>							
No Asbestos							
<b>B00C - R0007 - Home Base Store - 5.22 m2</b>							
No Asbestos							
<b>B00C - R0008 - Withdrawal Space - 1hb - 13.72 m2</b>							
No Asbestos							
<b>B00C - R0009 - Home Base - 60.85 m2</b>							
No Asbestos							
<b>B00C - R0010 - Movement - 12.21 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0011 - Home Base Store - 4.75 m2</b>							
No Asbestos							
<b>B00C - R0012 - Distribution Board - .59 m2</b>							
				<b>Note: No inspection of live electrical installation</b>			
Floor Coverings Res/Textile	Compressed AC Sheet	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0013 - Home Base - 64.21 m2</b>							
No Asbestos							
<b>B00C - R0014 - Home Base Store - 6.33 m2</b>							

No Asbestos							
<b>B00C - R0015 - Craft Store - 5.8 m2</b>							
No Asbestos							
<b>B00C - R0016 - Withdrawal Space - 1hb - 14.01 m2</b>							
No Asbestos							
<b>B00C - R0017 - Home Base - 60.42 m2</b>							
No Asbestos							
<b>B00C - R0018 - Home Base Store - 5.88 m2</b>							
No Asbestos							
<b>B00C - R0019 - Security Store - 11.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00C - R0020 - Cleaning Distributed Store - 5.35 m2</b>							
No Asbestos							
<b>B00C - R0021 - Movement - 5.14 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0022 - Movement - 4.79 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	5m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0023 - Personal Effects Storage - 5.57 m2</b>							
No Asbestos							
<b>B00C - R0024 - Seminar/Study - 13.54 m2</b>							
No Asbestos							
<b>B00C - R0025 - Seminar/Study - 13.54 m2</b>							
No Asbestos							
<b>B00C - R0026 - Reading Area - 209.51 m2</b>							
No Asbestos							
<b>B00C - R0027 - Communications Room - 12.77 m2</b>							
No Asbestos							
<b>B00C - R0028 - Library Office/Workroom - 25.94 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00C - R0029 - Movement - 21.39 m2</b>							
No Asbestos							
<b>B00C - R0030 - Movement - 1.82 m2</b>							
No Asbestos							
<b>B00C - R0031 - Communications Room - 47.91 m2</b>							
No Asbestos							
<b>B00C - R0032 - Staff Toilet - 2.01 m2</b>							
No Asbestos							
<b>B00C - R0033 - Toilets - Boys - 16.93 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0034 - Movement - 32.48 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0035 - Staff Toilet - 2.19 m2</b>							
No Asbestos							
<b>B00C - R0036 - Toilets - Girls - 14.55 m2</b>							

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0037 - Cleaning Distributed Store - 2.03 m2</b>							
No Asbestos							
<b>B00C - R0038 - Sports Store - 24.25 m2</b>							
No Asbestos							
<b>B00C - R0039 - Deputy Principal - 12.35 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00C - R0040 - General Storeroom - 16.26 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00C - R0041 - Home Base Store - 5.11 m2</b>							
No Asbestos							
<b>B00C - R0042 - Home Base - 60.72 m2</b>							
No Asbestos							
<b>B00C - R0043 - Withdrawal Space - 1hb - 13.99 m2</b>							
No Asbestos							
<b>B00C - R0044 - Home Base - 63.94 m2</b>							
No Asbestos							
<b>B00C - R0045 - Home Base Store - 6.38 m2</b>							
No Asbestos							
<b>B00C - R0046 - General Storeroom - 5.67 m2</b>							
No Asbestos							
<b>B00C - R0047 - Home Base Store - 5.08 m2</b>							
No Asbestos							
<b>B00C - R0048 - Home Base - 60.61 m2</b>							
No Asbestos							
<b>B00C - R0049 - Movement - 11.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0050 - Withdrawal Space - 1hb - 13.68 m2</b>							
No Asbestos							
<b>B00C - R0051 - Home Base Store - 5.24 m2</b>							
No Asbestos							
<b>B00C - R0052 - Home Base - 59.86 m2</b>							
No Asbestos							
<b>B00C - R0053 - Practical Activities - 1hb - 26.13 m2</b>							
No Asbestos							
<b>B00C - R0054 - Movement - 45.41 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	North, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0055 - Home Base - 60.38 m2</b>							
No Asbestos							
<b>B00C - R0056 - Movement - 14.01 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0057 - Craft Store - 7.36 m2</b>							
No Asbestos							
<b>B00C - R0058 - Home Base Store - 4.76 m2</b>							
No Asbestos							
<b>B00C - R0059 - Withdrawal Space - 1hb - 13.07 m2</b>							

No Asbestos							
<b>B00C - R0060 - Home Base Store - 4.96 m2</b>							
No Asbestos							
<b>B00C - R0061 - Home Base - 60.48 m2</b>							
No Asbestos							
<b>B00C - R0062 - Movement - 17.34 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0063 - Movement - 16.68 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	4m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0064 - Practical Activities - 1hb - 30.7 m2</b>							
No Asbestos							
<b>B00C - R0065 - Withdrawal Space - 1hb - 16.96 m2</b>							
No Asbestos							
<b>B00C - R0066 - Distribution Board - .63 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00C - R0067 - Movement - 106.95 m2</b>							
No Asbestos							
<b>B00C - R0068 - Movement - 4.64 m2</b>							
No Asbestos							
<b>B00C - R0069 - Toilets - Boys - 15.08 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0070 - Toilets - Girls - 14.63 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0071 - Distribution Board - .59 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Floor Coverings Res/Textile	Compressed AC Sheet	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0072 - Special Programs Room - 31.78 m2</b>							
No Asbestos							
<b>B00C - R0073 - Distribution Board - .65 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Floor Coverings Res/Textile	Compressed AC Sheet	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0074 - Cleaning Distributed Store - 3.97 m2</b>							
No Asbestos							
<b>B00C - R0075 - Home Base Store - 5 m2</b>							
No Asbestos							
<b>B00C - R0076 - Withdrawal Space - 1hb - 7.3 m2</b>							
No Asbestos							
<b>B00C - R0077 - Home Base - 60.97 m2</b>							
No Asbestos							
<b>B00C - R0078 - Home Base Store - 4.4 m2</b>							
No Asbestos							
<b>B00C - R0079 - Home Base - 61.22 m2</b>							
No Asbestos							
<b>B00C - R0080 - Movement - 9.68 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)



Wall Linings Internal	Flat AC Sheeting	3m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0081 - Withdrawal Space - 1hb - 12.85 m2</b>							
No Asbestos							
<b>B00C - R0082 - Home Base - 60.96 m2</b>							
No Asbestos							
<b>B00C - R0083 - Home Base Store - 5.17 m2</b>							
No Asbestos							
<b>B00C - R0084 - Movement - 54.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	South, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0085 - Practical Activities - 1hb - 23.43 m2</b>							
No Asbestos							
<b>B00C - R0086 - Withdrawal Space - 1hb - 15.51 m2</b>							
No Asbestos							
<b>B00C - R0087 - Craft Store - 5.13 m2</b>							
No Asbestos							
<b>B00C - R0088 - Movement - 38.94 m2</b>							
No Asbestos							
<b>B00C - R0089 - Movement - 21.7 m2</b>							
No Asbestos							
<b>B00C - R0090 - Movement - 4.35 m2</b>							
No Asbestos							
<b>B00C - R0091 - Withdrawal Space - 1hb - 15.06 m2</b>							
No Asbestos							
<b>B00C - R0092 - Practical Activities - 1hb - 26.27 m2</b>							
No Asbestos							
<b>B00C - R0093 - Movement - 20.65 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00C - R0094 - Home Base - 60.8 m2</b>							
No Asbestos							
<b>B00C - R0095 - Movement - 17.11 m2</b>							
Wall Linings Internal	Flat AC Sheeting	2m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0096 - Withdrawal Space - 1hb - 12.92 m2</b>							
No Asbestos							
<b>B00C - R0097 - Home Base Store - 4.96 m2</b>							
No Asbestos							
<b>B00C - R0098 - Home Base Store - 4.9 m2</b>							
No Asbestos							
<b>B00C - R0099 - Toilets - Boys - 12.81 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0100 - Toilets - Girls - 13.65 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0101 - Movement - 26.11 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0102 - Movement - 57.59 m2</b>							
No Asbestos							
<b>B00C - R0103 - Movement - 38.27 m2</b>							
No Asbestos							
<b>B00C - R0104 - Movement - 55.33 m2</b>							
No Asbestos							
<b>B00C - R0105 - Movement - 140.42 m2</b>							
No Asbestos							
<b>B00D - Building Services - 1982 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00D - R0001 - General Assistant/Bulk Store - 17.14 m2</b>							
No Asbestos							
<b>B00E - Multi Purpose Facilities - 2010 - Brick/Veneer</b>							
<b>Exterior</b>							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
<b>Interior</b>							
<b>B00E - R0001 - External Movement - 34.13 m2</b>							
No Asbestos							
<b>B00E - R0002 - Special Programs Store - 16.92 m2</b>							
No Asbestos							
<b>B00E - R0003 - Special Programs Room - 32.12 m2</b>							
No Asbestos							
<b>B00E - R0004 - Special Programs Room - 31.96 m2</b>							
No Asbestos							

**Demountables**

**OS 621 17090 - Single Learning Unit - H/Cap - Placement Date : 18-DEC-2018**

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

**OS 612 19526 - Learning Unit - Double With Resource - Placement Date : 27-DEC-2018**

**Note:** This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found