


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kincumber Public School (2304)
Region:	Hunter/Central Coast AMU
State Electorate:	Terrigal
Local Government Area:	Central Coast

Last Reviewed By:	AECOM 29-JUN-2016
Last Revised By:	Greencap 25-JUL-2020

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

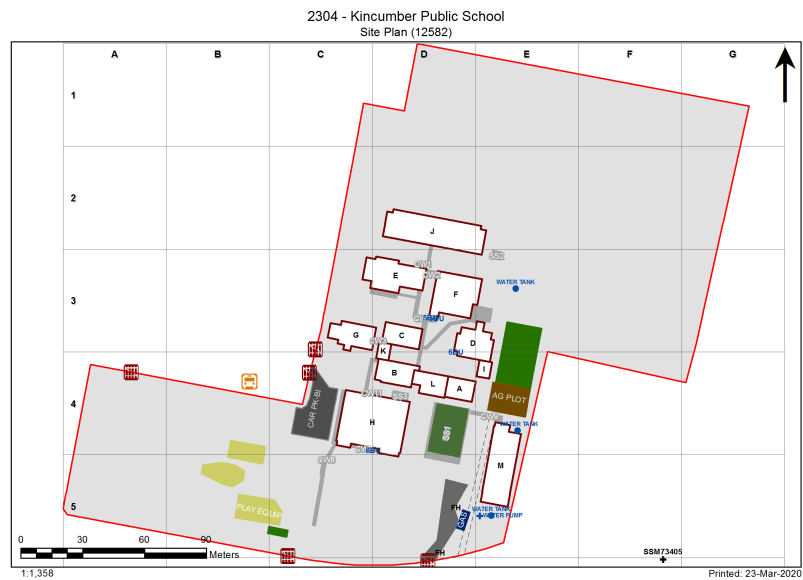

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning - 1975 - Brick/Veneer							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Compressed AC Sheet	20m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	4	South facing, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00A - R0001 - Home Base - 57.02 m2							
No Asbestos							
B00A - R0002 - Home Base Store - 7.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0003 - Distribution Board - .25 m2							
						Note: No inspection of live electrical installation	
Electrical - Mounting Board	Resinous Board	2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	6m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0004 - Personal Effects Storage - 6.24 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0005 - Staff Room Annexe - 14.78 m2							
No Asbestos							
B00A - R0006 - Staff Room Annexe - 13.18 m2							
No Asbestos							
B00A - R0007 - Movement - 22.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	12m2	South facing, Upper portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - Administration - 1870 - Timber							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Interior							

B00B - R0001 - Staff Toilet - 3.72 m2							
Wall Linings Internal	Flat AC Sheeting						
B00B - R0002 - Staff Kitchen - 10.31 m2							
No Asbestos							
B00B - R0003 - Staff Room - 56.2 m2							
No Asbestos							
B00B - R0005 - General Storeroom - 11.16 m2							
No Asbestos							
B00B - R0006 - Staff Room Annexe - 15.65 m2							
No Asbestos							
B00B - R0007 - Staff Room Annexe - 24.4 m2							
No Asbestos							
B00B - R0008 - External Movement - 69.61 m2							
Require Inspection							
B00C - General Learning - 1975 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Compressed AC Sheet	20m2	East facing, West facing	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Insulation Material						
Interior							
B00C - R0001 - Practical Activities - 1hb - 18.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19.00m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - Home Base - 50.35 m2							
No Asbestos							
B00C - R0003 - Home Base - 50.82 m2							
No Asbestos							
B00C - R0004 - Practical Activities - 1hb - 19.21 m2							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0005 - Movement - 35.11 m2							
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - General Learning - 1975 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Compressed AC Sheet	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Insulation Material						
Interior							
B00D - R0001 - Practical Activities - 1hb - 13.37 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0002 - Home Base - 56.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0003 - Home Base - 56.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0004 - Practical Activities - 1hb - 13.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0005 - Movement - 31.5 m2							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0006 - Movement - 44.35 m2							
No Asbestos							
B00D - R0007 - Sports Store - 3.52 m2							
No Asbestos							
B00D - R1001 - Practical Activities - 1hb - 18.89 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19.00m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1002 - Home Base - 50.35 m2							
No Asbestos							
B00D - R1003 - Home Base - 50.43 m2							
No Asbestos							
B00D - R1004 - Practical Activities - 1hb - 18.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19.00m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1005 - Movement - 45.38 m2							
Ceiling Structures/Linings	Flat AC Sheeting	46m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - General Learning - 1985 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting						
Gable Verge Lining	Compressed AC Sheet						
Interior							
B00E - R0001 - Toilets - Boys - 11.93 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00E - R0002 - Distribution Board - .96 m2							
Note: No inspection of live electrical installation							
No Asbestos							
B00E - R0003 - Toilets - Girls - 12.81 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
B00E - R0004 - Home Base Store - 3.74 m2							
No Asbestos							
B00E - R0005 - Cleaning Distributed Store - 1.67 m2							
No Asbestos							

B00E - R0006 - Home Base - 61.52 m2							
No Asbestos							
B00E - R0007 - Withdrawal Space - 1hb - 8.45 m2							
No Asbestos							
B00E - R0008 - Movement - 47.11 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Cladding	Compressed AC Sheet						
B00E - R0009 - Practical Activities - 1hb - 54.46 m2							
No Asbestos							
B00E - R0010 - Security Store - 4.7 m2							
No Asbestos							
B00E - R0011 - Home Base Store - 4.01 m2							
No Asbestos							
B00E - R0012 - Movement - 8.18 m2							
No Asbestos							
B00E - R0013 - Home Base - 60.29 m2							
No Asbestos							
B00E - R0014 - Home Base Store - 3.46 m2							
No Asbestos							
B00E - R0015 - Withdrawal Space - 1hb - 8.37 m2							
No Asbestos							
B00E - R0016 - Home Base - 60.22 m2							
No Asbestos							
B00F - Library - 1985 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00F - R0001 - Library Office/Workroom - 25.33 m2							
No Asbestos							
B00F - R0002 - K.L.A. Store - 10.73 m2							
No Asbestos							
B00F - R0003 - Special Programs Room - 40.22 m2							
No Asbestos							
B00F - R0004 - Movement - 2.02 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R0005 - Distribution Board - 1.73 m2							
Note: No inspection of live electrical installation							
Ceiling Structures/Linings	Flat AC Sheeting	2.00m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	
B00F - R0006 - General Storeroom - 2.61 m2							
No Asbestos							
B00F - R0007 - Movement - 10.01 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R0009 - Movement - 43.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00F - R0010 - Special Programs Room - 44.97 m2							
No Asbestos							

B00F - R0011 - External Movement - 26.76 m2		
No Asbestos		
B00F - R0012 - Reading Area - 182.98 m2		
No Asbestos		
B00G - Administration - 1986 - Brick/Block		
Exterior		
Ceiling Voids - Raked Ceiling	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Eaves Linings	Flat AC Sheeting	
Interior		
B00G - R0001 - Deputy Principal - 12.82 m2		
No Asbestos		
B00G - R0002 - Security Store - 12.7 m2		
No Asbestos		
B00G - R0003 - Principal - 18.28 m2		
No Asbestos		
B00G - R0004 - Security Store - 10.32 m2		
No Asbestos		
B00G - R0005 - Sick Bay - 8.7 m2		
No Asbestos		
B00G - R0006 - Distribution Board - .43 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00G - R0007 - Duplicating Workroom - 33.38 m2		
No Asbestos		
B00G - R0008 - Clerical Office - 12.55 m2		
No Asbestos		
B00G - R0009 - Entry Vestibule - 10.7 m2		
No Asbestos		
B00G - R0010 - Movement - 8.38 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0011 - Clerical Office/Workroom - 12.66 m2		
No Asbestos		
B00G - R0012 - Staff Toilet - 6.22 m2		
No Asbestos		
B00G - R0013 - Cleaning Distributed Store - 2.28 m2		
No Asbestos		
B00G - R0014 - Staff Toilet - 6.24 m2		
No Asbestos		
B00G - R0015 - Deputy Principal - 12.66 m2		
No Asbestos		
B00G - R0016 - Movement - 35.2 m2		
No Asbestos		
B00H - Communal Facilities - 1986 - Brick/Block		
Exterior		
Ceiling Voids - Flat Roof	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Interior		

B00H - R0001 - Disabled Shower/Toilet - 5.25 m2		
No Asbestos		
B00H - R0002 - Toilets - Boys - 7.78 m2		
No Asbestos		
B00H - R0003 - Movement - 7.59 m2		
No Asbestos		
B00H - R0004 - Shower/Change - 2.44 m2		
No Asbestos		
B00H - R0005 - Cleaning Supplies - 1.92 m2		
No Asbestos		
B00H - R0006 - Toilets - Girls - 6.59 m2		
No Asbestos		
B00H - R0007 - Movement - 7.88 m2		
No Asbestos		
B00H - R0008 - Shower/Change - 2.4 m2		
No Asbestos		
B00H - R0009 - Movement - 18.63 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00H - R0010 - Movement - 15.89 m2		
No Asbestos		
B00H - R0011 - Sports Store - 16.95 m2		
No Asbestos		
B00H - R0012 - Movement - 26.73 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00H - R0013 - Garden Store - 13.66 m2		
No Asbestos		
B00H - R0014 - Cleaning Supplies - 12.79 m2		
No Asbestos		
B00H - R0015 - Movement - 12.35 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00H - R0016 - General Storeroom - 9.45 m2		
No Asbestos		
B00H - R0017 - Movement - 13.67 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B00H - R0018 - Hall Chair Store - 5.02 m2		
No Asbestos		
B00H - R0019 - Movement - 4.9 m2		
No Asbestos		
B00H - R0020 - P.E. Store - 4.98 m2		
No Asbestos		
B00H - R0021 - General Storeroom - 17.51 m2		
No Asbestos		
B00H - R0022 - Distribution Board - 1.28 m2		
No Asbestos		
B00H - R0023 - General Assistant/Bulk Store - 19.29 m2		
No Asbestos		
B00H - R0024 - Movement - 17.03 m2		
No Asbestos		
B00H - R0025 - Plant - .63 m2		

Note: No inspection of live electrical installation

No Asbestos							
B00H - R0026 - Plant - .68 m2							
No Asbestos							
B00H - R0027 - Communal Space - 200.24 m2							
No Asbestos							
B00H - R0028 - Raised Platform - 48.3 m2							
No Asbestos							
B00H - R0029 - Movement - 1.65 m2							
No Asbestos							
B00H - R0030 - Canteen Office/Store - 7.14 m2							
No Asbestos							
B00H - R0031 - Canteen Office/Store - 4.64 m2							
No Asbestos							
B00H - R0032 - Canteen - 49.08 m2							
No Asbestos							
B00H - R0033 - Movement - 195.1 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00I - Pupil Facilities - 1975 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	15m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Compressed AC Sheet	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00I - R0001 - Toilets - Boys - 12.46 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	8.00m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R0004 - Movement - 15.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00I - R0005 - Toilets-Unisex - 12.27 m2							
No Asbestos							
B00J - General Learning - 1970 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Interior							
B00J - R0001 - Cleaning Distributed Store - 2.81 m2							
Wall Linings Internal	Flat AC Sheeting						
B00J - R0002 - Kiln Room - 5.99 m2							
Wall Linings Internal	Flat AC Sheeting						
B00J - R0003 - Staff Shower/Change - 9 m2							

Wall Linings Internal	Flat AC Sheeting	
B00J - R0004 - Home Base Store - 6.39 m2		
No Asbestos		
B00J - R0005 - Withdrawal Space - 1hb - 5.38 m2		
No Asbestos		
B00J - R0006 - Movement - 5.04 m2		
No Asbestos		
B00J - R0007 - Home Base - 57.59 m2		
No Asbestos		
B00J - R0008 - Practical Activities - 1hb - 21.41 m2		
No Asbestos		
B00J - R0009 - Practical Activities - 1hb - 21.42 m2		
No Asbestos		
B00J - R0010 - Home Base - 57.6 m2		
No Asbestos		
B00J - R0011 - Movement - 4.69 m2		
No Asbestos		
B00J - R0012 - Withdrawal Space - 1hb - 11.13 m2		
No Asbestos		
B00J - R0013 - Home Base Store - 5.93 m2		
No Asbestos		
B00J - R0014 - Distribution Board - .65 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00J - R0015 - Home Base Store - 5.85 m2		
No Asbestos		
B00J - R0016 - Practical Activities - 1hb - 21.42 m2		
No Asbestos		
B00J - R0017 - Home Base - 57.6 m2		
No Asbestos		
B00J - R0018 - Practical Activities - 1hb - 21.42 m2		
No Asbestos		
B00J - R0019 - Home Base - 57.6 m2		
No Asbestos		
B00J - R0020 - Movement - 6.18 m2		
No Asbestos		
B00J - R0021 - Withdrawal Space - 1hb - 5.45 m2		
No Asbestos		
B00J - R0022 - Home Base Store - 6.27 m2		
No Asbestos		
B00J - R0023 - Toilets - Girls - 10.79 m2		
Wall Linings Internal	Flat AC Sheeting	
B00J - R0024 - Toilets - Boys - 9.4 m2		
Wall Linings Internal	Flat AC Sheeting	
B00J - R0025 - Movement - 198.86 m2		
No Asbestos		
B00K - Pupil Facilities - 1975 - Brick/Block		
Exterior		
Ceiling Voids - Raked Ceiling	Non Accessible Area	
Underfloor Voids - Slab on Ground	Non Accessible Area	

Eaves Linings	Flat AC Sheeting	8m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00K - R0001 - Toilets - Boys - 11.5 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0002 - Toilets - Girls - 13.67 m2							
Partition Walls (Cubicles)	Compressed AC Sheet						
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - R0003 - Movement - 15.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - Pupil Facilities - 1975 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Eaves Linings	Flat AC Sheeting	10m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Compressed AC Sheet	15m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00L - R0001 - Movement - 29.21 m2							
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0002 - Main Switch Board - 9.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00L - R0003 - Toilets - Girls - 30.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	12.00m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0004 - Toilets - Boys - 30.26 m2							
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10.00m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00L - R0005 - Movement - 47.97 m2							

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
----------------------------	------------------	------	---------------	--------------------	---------	--------------------	-----------------------------

B00M - General Learning - 2010 - Brick/Veneer

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00M - R0001 - Practical Activities - 1hb - 14.25 m2

No Asbestos

B00M - R0002 - Personal Effects Storage - 4.73 m2

No Asbestos

B00M - R0003 - Home Base Store - 6.17 m2

No Asbestos

B00M - R0004 - Home Base - 60.41 m2

No Asbestos

B00M - R0005 - Withdrawal Space - 2hb - 11.71 m2

No Asbestos

B00M - R0006 - Practical Activities - 1hb - 14.21 m2

No Asbestos

B00M - R0007 - Personal Effects Storage - 3.96 m2

No Asbestos

B00M - R0008 - Home Base Store - 6.17 m2

No Asbestos

B00M - R0009 - Home Base - 60.41 m2

No Asbestos

B00M - R0010 - Practical Activities - 1hb - 15.51 m2

No Asbestos

B00M - R0011 - Personal Effects Storage - 3.54 m2

No Asbestos

B00M - R0012 - Home Base Store - 6.04 m2

No Asbestos

B00M - R0013 - Withdrawal Space - 1hb - 9.28 m2

No Asbestos

B00M - R0014 - Home Base - 58.71 m2

No Asbestos

B00M - R0015 - Movement - 6.92 m2

No Asbestos

B00M - R0016 - Special Programs Store - 12.82 m2

No Asbestos

B00M - R0017 - Special Programs Room - 42.36 m2

No Asbestos

B00M - R0018 - General Storeroom - 9.64 m2

No Asbestos

B00M - R0019 - General Storeroom - 9.39 m2

No Asbestos

B00M - R0020 - Distribution Board - .33 m2

Note: No inspection of live electrical installation

No Asbestos

B00M - R0021 - External Movement - 84.43 m2

No Asbestos

B00M - R0022 - Stairs - 5.77 m2

No Asbestos

B00M - R0023 - Stairs - 5.64 m2	
No Asbestos	
B00M - R1001 - Practical Activities - 1hb - 14.17 m2	
No Asbestos	
B00M - R1002 - Personal Effects Storage - 4.68 m2	
No Asbestos	
B00M - R1003 - Home Base Store - 6.08 m2	
No Asbestos	
B00M - R1004 - Home Base - 60.17 m2	
No Asbestos	
B00M - R1005 - Withdrawal Space - 2hb - 11.54 m2	
No Asbestos	
B00M - R1006 - Practical Activities - 1hb - 14.17 m2	
No Asbestos	
B00M - R1007 - Personal Effects Storage - 4.06 m2	
No Asbestos	
B00M - R1008 - Home Base Store - 6.08 m2	
No Asbestos	
B00M - R1009 - Home Base - 60.17 m2	
No Asbestos	
B00M - R1010 - Practical Activities - 1hb - 17.33 m2	
No Asbestos	
B00M - R1011 - Personal Effects Storage - 3.31 m2	
No Asbestos	
B00M - R1012 - Withdrawal Space - 1hb - 9.14 m2	
No Asbestos	
B00M - R1013 - Home Base Store - 5.92 m2	
No Asbestos	
B00M - R1014 - Home Base - 58.06 m2	
No Asbestos	
B00M - R1015 - Distribution Board - .38 m2	
No Asbestos	Note: No inspection of live electrical installation
B00M - R1016 - External Movement - 77.97 m2	
No Asbestos	
B00M - R1017 - External Stairs - 18.82 m2	
No Asbestos	
B00M - R1018 - External Stairs - 17.78 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020