

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Koorungal Public School (4173)
Region:	Southern NSW AMU
State Electorate:	Wagga Wagga
Local Government Area:	Wagga Wagga

Last Reviewed By:	Greencap 18-FEB-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

4173 - Koorungal Public School
Site Plan (12592)

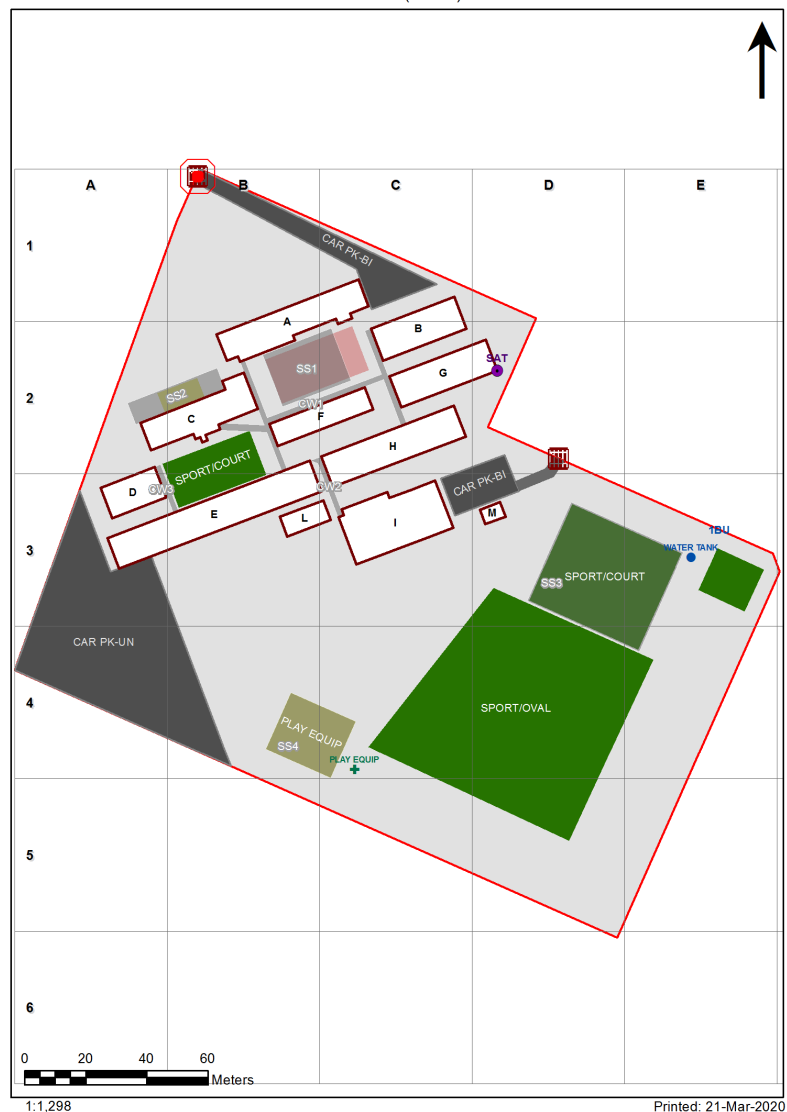

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning - 1960 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	30m2	South facing	Mnimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Entry Steps	Flat AC Sheeting						
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00A - R0001 - Home Base - 66.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0002 - Personal Effects Storage - 13.96 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0003 - External Movement - 8.52 m2							
Wall Linings Internal	Flat AC Sheeting						
Floor Coverings Res/Textile	Flat AC Sheeting						
B00A - R0004 - Home Base - 66.51 m2							
No Asbestos							
B00A - R0005 - Home Base - 66.57 m2							
No Asbestos							
B00A - R0006 - Personal Effects Storage - 7.53 m2							
No Asbestos							
B00A - R0007 - External Movement - 13.9 m2							
No Asbestos							
B00A - R0008 - Staff Toilet - 4.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0009 - Staff Room Annexe - 15.01 m2							
No Asbestos							
B00A - R0010 - General Storeroom - 15.08 m2							
No Asbestos							
B00A - R0011 - Interview - 17.55 m2							
No Asbestos							
B00A - R0012 - Staff Toilet - 4.78 m2							
No Asbestos							
B00A - R0013 - Security Store - 2.64 m2							
No Asbestos							
B00A - R0014 - Movement - 2.76 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0015 - Entry Vestibule - 19.43 m2							
No Asbestos							
B00A - R0016 - Principal - 15.29 m2							
No Asbestos							
B00A - R0017 - General Storeroom - 3.38 m2							
No Asbestos							
B00A - R0018 - Distribution Board - 1.31 m2							
							Note: No inspection of live electrical installation

Electrical - Mounting Board	Resinous Board	1	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0019 - General Storeroom - 3.59 m2							
No Asbestos							
B00A - R0020 - Movement - 6.94 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0021 - Clerical Office - 16.82 m2							
No Asbestos							
B00A - R0022 - Sick Bay - 8.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0023 - Deputy Principal - 12.63 m2							
No Asbestos							
B00A - R0024 - Staff Room Annexe - 10.5 m2							
No Asbestos							
B00A - R0025 - Movement - 21.61 m2							
No Asbestos							
B00A - R0026 - Home Base Store - 9.52 m2							
No Asbestos							
B00A - R0027 - Home Base Store - 9.83 m2							
No Asbestos							
B00A - R0028 - Home Base Store - 9.87 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0029 - External Movement - 19.77 m2							
Wall Linings Internal	Flat AC Sheeting						
Floor Coverings Res/Textile	Flat AC Sheeting						
B00B - General Learning - 1960 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	45m2	South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00B - R0001 - Home Base Store - 12.19 m2							
No Asbestos							
B00B - R0002 - Home Base - 66 m2							
No Asbestos							
B00B - R0003 - Home Base - 66.56 m2							
No Asbestos							
B00B - R0004 - Home Base Store - 9.68 m2							
No Asbestos							
B00B - R0005 - Home Base Store - 9.59 m2							
No Asbestos							
B00B - R0006 - Home Base - 66.09 m2							
No Asbestos							
B00B - R0007 - Movement - 8.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0008 - Personal Effects Storage - 13.65 m2							

No Asbestos							
B00B - R0009 - Personal Effects Storage - 8.32 m2							
No Asbestos							
B00B - R0010 - Movement - 15.52 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0011 - Movement - 17.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0012 - Movement - 8.8 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - Staff Facilities/General Learning - 1960 - Brick/Veneer							
Exterior							
Wall Cladding	Flat AC Sheeting	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00C - R0001 - Cleaning Supplies - 4.2 m2							
No Asbestos							
B00C - R0002 - Staff Toilet - 4.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0003 - Staff Toilet - 4.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0004 - Home Base - 99.75 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00C - R0005 - External Movement - 18.86 m2							
Wall Linings Internal	Flat AC Sheeting						
Floor Coverings Res/Textile	Flat AC Sheeting						
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0006 - Practical Activities - 1hb - 1.56 m2							
No Asbestos							
B00C - R0007 - Toilets - Boys/Girls - 3.44 m2							
No Asbestos							
B00C - R0008 - Personal Effects Storage - 11.71 m2							
No Asbestos							
B00C - R0009 - Home Base - 65.58 m2							
No Asbestos							
B00C - R0010 - Staff Room Annexe - 16.12 m2							
No Asbestos							
B00C - R0011 - Withdrawal Space - 1hb - 21.01 m2							
No Asbestos							
B00C - R0012 - Uniform Shop - 6.77 m2							
No Asbestos							
B00C - R0013 - Staff Toilet - 4.41 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00C - R0014 - External Movement - 1.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0015 - Movement - 12.11 m2							
No Asbestos							
B00C - R0016 - Home Base Store - 4.27 m2							
No Asbestos							
B00C - R0017 - Home Base Store - 4.46 m2							
No Asbestos							
B00C - R0018 - General Storeroom - 6.14 m2							
No Asbestos							
B00C - R0019 - Staff Room - 66.9 m2							
No Asbestos							
B00C - R0020 - Movement - 6.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00C - R0021 - Movement - 2.21 m2							
No Asbestos							
B00D - General Learning - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00D - M0001 - Withdrawal Space - 1hb - 11.66 m2							
No Asbestos							
B00D - R0001 - Home Base Store - 3.84 m2							
No Asbestos							
B00D - R0002 - Home Base - 56.95 m2							
No Asbestos							
B00D - R0003 - Home Base - 56.8 m2							
No Asbestos							
B00D - R0004 - Home Base Store - 3.73 m2							
No Asbestos							
B00D - R0005 - Personal Effects Storage - 7.69 m2							
No Asbestos							
B00D - R0006 - Movement - 1.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0007 - Movement - 26.09 m2							
No Asbestos							
B00D - R0008 - Movement - 1.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0009 - Personal Effects Storage - 7.71 m2							
No Asbestos							
B00D - R0010 - Movement - 9.48 m2							
No Asbestos							
B00D - R0011 - Movement - 10.43 m2							
No Asbestos							
B00E - Pupil Facilities/General Learning - 1960 - Brick/Veneer							
Exterior							

Eaves Linings	Flat AC Sheeting	100m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00E - R0001 - Toilets - Boys - 37.54 m2							
No Asbestos							
B00E - R0002 - Out Of School Hours Care Centre - 56.72 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00E - R0003 - Toilets - Girls - 37.23 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting						
B00E - R0004 - Home Base - 57.41 m2							
No Asbestos							
B00E - R0005 - Home Base Store - 4.25 m2							
No Asbestos							
B00E - R0006 - Home Base Store - 4.06 m2							
No Asbestos							
B00E - R0007 - Home Base - 56.55 m2							
No Asbestos							
B00E - R0008 - Home Base - 56.72 m2							
No Asbestos							
B00E - R0009 - Home Base Store - 3.82 m2							
No Asbestos							
B00E - R0010 - Craft Store - 21.22 m2							
No Asbestos							
B00E - R0011 - Home Base Store - 3.93 m2							
No Asbestos							
B00E - R0012 - Home Base - 56.85 m2							
No Asbestos							
B00E - R0013 - Home Base - 86.03 m2							
No Asbestos							
B00E - R0014 - Toilets - Boys/Girls - 3.41 m2							
No Asbestos							
B00E - R0015 - Personal Effects Storage - 8.21 m2							
No Asbestos							
B00E - R0016 - Movement - 1.62 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0017 - Movement - 176.11 m2							
No Asbestos							
B00E - R0018 - Movement - 6.66 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0019 - Personal Effects Storage - 7.74 m2							
No Asbestos							
B00E - R0020 - Cleaning Supplies - 2.63 m2							
No Asbestos							
B00E - R0021 - Personal Effects Storage - 7.89 m2							
No Asbestos							

B00E - R0022 - Personal Effects Storage - 7.57 m2							
No Asbestos							
B00E - R0023 - Personal Effects Storage - 7.79 m2							
No Asbestos							
B00E - R0024 - Movement - 3.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - Pupil Facilities/General Learning - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00F - R0005 - Home Base - 52.92 m2							
No Asbestos							
B00F - R0006 - Darkroom Space - 14.35 m2							
No Asbestos							
B00F - R0007 - Staff Room Annexe - 11.66 m2							
No Asbestos							
B00F - R0008 - General Storeroom - 2.73 m2							
No Asbestos							
B00F - R0009 - Staff Toilet - 4.43 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00F - R0010 - Movement - 6.96 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00F - R0011 - Staff Room Annexe - 8.64 m2							
No Asbestos							
B00F - R0012 - Staff Room Annexe - 8.46 m2							
No Asbestos							
B00F - R0013 - Interview - 8.32 m2							
No Asbestos							
B00F - R0014 - Movement - 2.31 m2							
No Asbestos							
B00F - R0015 - Handwashing Facilities - 12.67 m2							
Wall Linings Internal	Compressed AC Sheet	45m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0016 - Toilets - Girls - 24.47 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Compressed AC Sheet	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0017 - Staff Toilet - 3 m2							
No Asbestos							
B00F - R0019 - Staff Toilet - 7.04 m2							
No Asbestos							
B00F - R0020 - General Storeroom - 9.92 m2							
No Asbestos							
B00F - R0021 - Toilets - Boys - 34.6 m2							
No Asbestos							

B00F - R0022 - Toilets - Boys - 12.53 m2							
No Asbestos							
B00F - R0023 - Movement - 8.71 m2							
No Asbestos							
B00G - Library - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00G - R0001 - Reading Area - 233.46 m2							
No Asbestos							
B00G - R0002 - General Storeroom - 13.59 m2							
No Asbestos							
B00G - R0003 - General Storeroom - 13.91 m2							
No Asbestos							
B00G - R0004 - Movement - 15.32 m2							
No Asbestos							
B00G - R0005 - Library Office/Workroom - 25.99 m2							
No Asbestos							
B00G - R0006 - General Storeroom - 12.6 m2							
No Asbestos							
B00G - R0007 - Movement - 27.56 m2							
No Asbestos							
B00H - General Learning - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Compressed AC Sheet	5m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00H - R0001 - Home Base - 56.71 m2							
No Asbestos							
B00H - R0002 - Home Base Store - 4.12 m2							
No Asbestos							
B00H - R0003 - Home Base Store - 4.14 m2							
No Asbestos							
B00H - R0004 - Home Base - 56.16 m2							
No Asbestos							
B00H - R0005 - Home Base - 56.48 m2							
No Asbestos							
B00H - R0006 - Security Store - 5.81 m2							
No Asbestos							
B00H - R0007 - Home Base Store - 5.47 m2							
No Asbestos							
B00H - R0008 - Home Base - 56.34 m2							

No Asbestos							
B00H - R0009 - Home Base - 56.63 m2							
No Asbestos							
B00H - R0010 - Home Base Store - 5.93 m2							
No Asbestos							
B00H - R0011 - Personal Effects Storage - 5.94 m2							
No Asbestos							
B00H - R0012 - Movement - 1.63 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0013 - Movement - 25.93 m2							
No Asbestos							
B00H - R0014 - Movement - 3.33 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0015 - Personal Effects Storage - 5.54 m2							
No Asbestos							
B00H - R0016 - Personal Effects Storage - 5.86 m2							
No Asbestos							
B00H - R0017 - Personal Effects Storage - 15.19 m2							
No Asbestos							
B00H - R0018 - Movement - 3.37 m2							
No Asbestos							
B00H - R0019 - Movement - 9.06 m2							
No Asbestos							
B00H - R0020 - Movement - 21.42 m2							
No Asbestos							
B00H - R0021 - Movement - 25.94 m2							
No Asbestos							
B00H - R0022 - Movement - 18.61 m2							
No Asbestos							
B00H - R0023 - Movement - 12.77 m2							
No Asbestos							
B00I - Communal Facilities/Pupil Facilities - 1991 - Brick/Block							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
External Wall Structure - Awnings	Compressed AC Sheet	75	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
Interior							
B00I - R0001 - General Storeroom - .87 m2							
Wall Linings Internal	Flat AC Sheeting						
B00I - R0002 - Plant - .87 m2							
Wall Linings Internal	Flat AC Sheeting						
B00I - R0003 - Shower/Change - 2.14 m2							
Wall Linings Internal	Flat AC Sheeting						
B00I - R0004 - Movement - 6.5 m2							

No Asbestos		
B001 - R0005 - Toilets - Girls - 10.92 m2		
Wall Linings Internal	Flat AC Sheeting	
Partition Walls (Cubicles)	Compressed AC Sheet	
B001 - R0006 - External Movement - 99.86 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B001 - R0007 - Canteen - 43.5 m2		
Floor Coverings Res/Textile	Vinyl Sheet	
B001 - R0008 - Uniform Shop - 5.93 m2		
Floor Coverings Res/Textile	Vinyl Sheet	
B001 - R0009 - Canteen Office/Store - 5.78 m2		
Floor Coverings Res/Textile	Vinyl Sheet	
B001 - R0010 - Sports Store - 13.96 m2		
No Asbestos		
B001 - R0011 - Plant - 3.14 m2		
No Asbestos		
B001 - R0012 - Disabled Toilet - 3.34 m2		
No Asbestos		
B001 - R0014 - Music Store - 12 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B001 - R0015 - Communal Space - 186.38 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
B001 - R0016 - Hall Chair Store - 2.62 m2		
No Asbestos		
B001 - R0017 - Toilets - Boys - 2.67 m2		
Wall Linings Internal	Flat AC Sheeting	
B001 - R0018 - Distribution Board - 1.49 m2		
No Asbestos		Note: No inspection of live electrical installation
B001 - R0019 - Movement - 6.54 m2		
No Asbestos		
B001 - R0020 - Movement - 16.5 m2		
Wall Linings Internal	Flat AC Sheeting	
B001 - R0021 - Raised Platform - 50.5 m2		
No Asbestos		
B001 - R0022 - Hall Chair Store - 2.54 m2		
No Asbestos		
B001 - R0023 - Shower/Change - 10.88 m2		
Wall Linings Internal	Flat AC Sheeting	
Partition Walls (Cubicles)	Compressed AC Sheet	
B001 - R0024 - External Movement - 68.24 m2		
No Asbestos		
B00L - Building Services - 2006 - Steel		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	

Ceiling Voids	Non Accessible Area	
Underfloor Voids	Non Accessible Area	
Interior		
B00L - R0001 - General Assistant/Bulk Store - 94.39 m2		
No Asbestos		
B00L - R0002 - General Assistant/Bulk Store - 11.55 m2		
No Asbestos		
B00M - Pupil Facilities - 2016 - Metal Shed		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00M - R0001 - Sports Store - 33.24 m2		
No Asbestos		

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020