


# Asbestos Register

(Hazardous Materials and Risk Assessment)

<b>School:</b>	<b>Lake Albert Public School (2357)</b>
<b>Region:</b>	<b>Southern NSW AMU</b>
<b>State Electorate:</b>	<b>Wagga Wagga</b>
<b>Local Government Area:</b>	<b>Wagga Wagga</b>

<b>Last Reviewed By:</b>	<b>WSP 15-SEP-2017</b>
<b>Last Revised By:</b>	

<b>Historical Fibro In Grounds Investigations/Events</b>	<b>No</b>
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

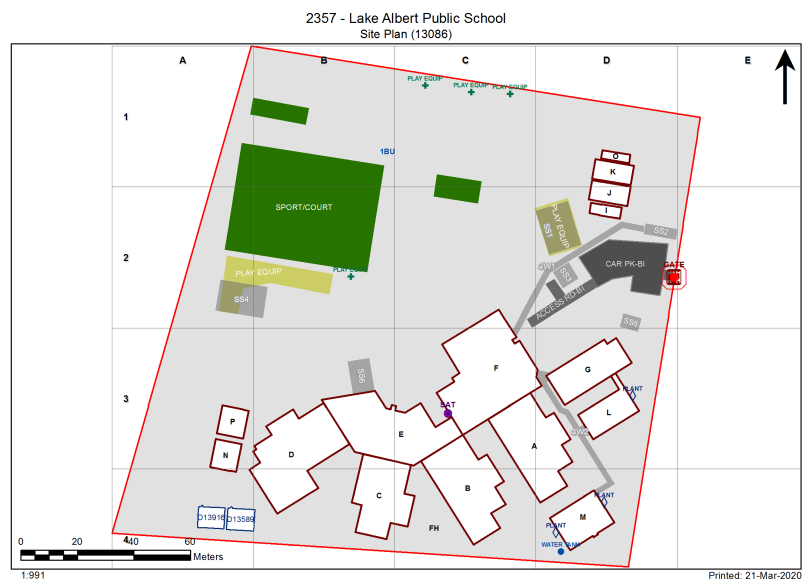

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

### Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

### Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>  
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

### Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

#### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
<b>B00A - General Learning - 1980 - Brick/Block</b>							
<b>Exterior</b>							
External Wall Structure - Awnings	Compressed AC Sheet	50	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00A - M0001 - Withdrawal Space - 1hb - 17.21 m2</b>							
No Asbestos							
<b>B00A - R0001 - Movement - 17.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0002 - Withdrawal Space - 1hb - 18.35 m2</b>							
No Asbestos							
<b>B00A - R0003 - Cleaning Supplies - 3.52 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0004 - Distribution Board Cupboard - .9 m2</b>							
						<b>Note: No inspection of live electrical installation</b>	
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0005 - Movement - 2.4 m2</b>							
No Asbestos							
<b>B00A - R0007 - Home Base - 63.89 m2</b>							
No Asbestos							
<b>B00A - R0008 - Home Base Store - 5.57 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0009 - Home Base Store - 7.47 m2</b>							
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0010 - Staff Study - 12 m2</b>							
No Asbestos							
<b>B00A - R0011 - Movement - 16.15 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0012 - Home Base - 62.42 m2</b>							
No Asbestos							
<b>B00A - R0013 - Movement - 10.48 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0014 - Home Base - 56.19 m2</b>							
Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0015 - Withdrawal Space - 1hb - 15.03 m2</b>							
No Asbestos							
<b>B00A - R0016 - Movement - 16.51 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00A - R0017 - Home Base - 55.12 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0018 - Home Base Store - 5.6 m2</b>							
No Asbestos							
<b>B00A - R0019 - Home Base Store - 5.92 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0020 - Practical Activities - 37.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00A - R0021 - Movement - 83.53 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00A - R0022 - Movement - 18.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0023 - Kin Space - 11.86 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00A - R0025 - General Storeroom - 5.88 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00A - R0026 - Disabled Toilet - 10.26 m2</b>							
No Asbestos							
<b>B00A - R0028 - Disabled Toilet - 10.35 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - General Learning - 1980 - Brick/Block</b>							
<b>Exterior</b>							
External Wall Structure - Awnings	Flat AC Sheeting	80	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00B - M0001 - Withdrawal Space - 1hb - 17.73 m2</b>							
No Asbestos							
<b>B00B - R0001 - Movement - 17.6 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0003 - Cleaning Supplies - 3.78 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0004 - Distribution Board Cupboard - .93 m2</b>							
<b>Note: No inspection of live electrical installation</b>							
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0005 - Movement - 2.35 m2</b>							
No Asbestos							
<b>B00B - R0008 - Home Base Store - 5.63 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00B - R0009 - Home Base Store - 7.46 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0010 - Computer Resource - 11.97 m2</b>							
No Asbestos							
<b>B00B - R0011 - Movement - 16.61 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0012 - Home Base - 62.45 m2</b>							
No Asbestos							
<b>B00B - R0013 - Movement - 10.77 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0014 - Home Base - 56.19 m2</b>							
No Asbestos							
<b>B00B - R0015 - Withdrawal Space - 1hb - 15.35 m2</b>							
No Asbestos							
<b>B00B - R0016 - Movement - 16.52 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0017 - Home Base - 54.78 m2</b>							
No Asbestos							
<b>B00B - R0018 - Home Base Store - 5.35 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0019 - Home Base Store - 5.94 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0020 - Practical Activities - 37.61 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00B - R0021 - Movement - 84.01 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00B - R0022 - Movement - 18.09 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00B - R0023 - Practical Activities - 11.79 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00B - R0025 - Craft Store - 5.69 m2</b>							
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0026 - Toilets - Girls - 10.33 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0028 - Toilets - Boys - 10.31 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00B - R0030 - Home Base - 82.85 m2</b>							
Require Inspection							
<b>B00C - General Learning - 1980 - Brick/Block</b>							
<b>Exterior</b>							
External Wall Structure - Awnings	Flat AC Sheeting	60	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Voids	Non Accessible Area							
Underfloor Voids	Non Accessible Area							
<b>Interior</b>								
<b>B00C - R0001 - Movement - 18.67 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0002 - General Storeroom - 18.37 m2</b>								
No Asbestos								
<b>B00C - R0003 - Cleaning Supplies - 3.9 m2</b>								
Floor Coverings Res/Textile	Vinyl Tiles							
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0004 - Distribution Board Cupboard - .77 m2</b>								
<b>Note: No inspection of live electrical installation</b>								
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0005 - Movement - 2.36 m2</b>								
No Asbestos								
<b>B00C - R0007 - Home Base - 63.16 m2</b>								
No Asbestos								
<b>B00C - R0008 - Home Base Store - 5.3 m2</b>								
Wall Linings Internal	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0009 - General Storeroom - 12.04 m2</b>								
No Asbestos								
<b>B00C - R0010 - Movement - 16.71 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0011 - Home Base - 63.49 m2</b>								
No Asbestos								
<b>B00C - R0012 - Home Base Store - 5.93 m2</b>								
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0013 - Withdrawal Space - 1hb - 8.99 m2</b>								
No Asbestos								
<b>B00C - R0014 - Movement - 16.37 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0015 - Home Base - M - 55.96 m2</b>								
No Asbestos								
<b>B00C - R0016 - Home Base Store - S - 5.27 m2</b>								
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
<b>B00C - R0017 - Movement - 10.38 m2</b>								
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos	
<b>B00C - R0018 - Practical Activities - 96.2 m2</b>								
Floor Coverings Res/Textile	Vinyl Sheet							
<b>B00C - R0019 - Toilets - Girls - 10.42 m2</b>								
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

<b>B00C - R0021 - Toilets - Boys - 10.38 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00C - R0023 - General Storeroom - 4.15 m2</b>							
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - General Learning - 1980 - Brick/Block</b>							
<b>Exterior</b>							
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00D - M0001 - Withdrawal Space - 1hb - 17.68 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0001 - Toilets - Boys - 10.31 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0004 - Toilets - Girls - 10.39 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0005 - Kin Room - 12.3 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00D - R0006 - Movement - 19.38 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0007 - General Storeroom - 5.88 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0008 - Withdrawal Space - 1hb - 12.11 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0009 - Movement - 29.95 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00D - R0011 - Home Base Store - 5.88 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0012 - Home Base - 56.16 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0013 - Movement - 27.57 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0014 - Home Base - 54.84 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0015 - Home Base Store - 5.88 m2</b>							
Wall Linings Internal	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0016 - Home Base Store - 5.85 m2</b>							
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0017 - Withdrawal Space - 1hb - 15.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0018 - Home Base - 56.12 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0019 - Movement - 10.55 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0020 - Home Base - 61.99 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0021 - Movement - 16.5 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0022 - Withdrawal Space - 1hb - 11.83 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0023 - Home Base Store - 7.25 m2</b>							
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0024 - Home Base Store - 5.88 m2</b>							
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0025 - Music Store - 5.83 m2</b>							
Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00D - R0026 - Practical Activities - 49.08 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00D - R0027 - Home Base - 63.59 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0028 - External Movement - 15.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos



<b>B00D - R0029 - Withdrawal Space - 1hb - 18.06 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0030 - Cleaning Supplies - 3.46 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0031 - Distribution Board Cupboard - .73 m2</b>							
							<b>Note: No inspection of live electrical installation</b>
Wall Linings Internal	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00D - R0032 - Movement - 2.38 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0034 - Movement - 28.05 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
<b>B00D - R0035 - Practical Activities - 1hb - 35.79 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00D - R0036 - External Movement - 6.36 m2</b>							
No Asbestos							
<b>B00E - Library - 1980 - Brick/Block</b>							
<b>Exterior</b>							
External Wall Structure - Awnings	Flat AC Sheeting	50	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00E - R0001 - Main Switchroom - 8.59 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board						
<b>B00E - R0002 - Special Programs Room - 46.85 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0003 - Cleaning Supplies - 8.81 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0004 - Cleaning Supplies Store - 9.12 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0005 - Library Office/Workroom - 17.28 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0006 - Security Store - 12.58 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

<b>B00E - R0007 - Movement - 255.69 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	256m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0008 - General Storeroom - 11.93 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0009 - General Storeroom - 16.23 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0010 - Reading Area - 240.72 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	241m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0011 - General Storeroom - 12.37 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0012 - Movement - 6.62 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0013 - Library Office/Workroom - 8.42 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0014 - Plant - 14.65 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0015 - Movement - 17.84 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00E - R0016 - External Movement - 2.75 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - Communal Facilities/Pupil Facilities - 1980 - Brick/Block</b>							
<b>Exterior</b>							
External Wall Structure - Awnings	Compressed AC Sheet	60	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Underfloor Voids	Non Accessible Area						
<b>Interior</b>							
<b>B00F - R0002 - Canteen - 38.11 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	North, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00F - R0003 - Canteen Office/Store - 2.73 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00F - R0004 - Staff Toilet - 2.85 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0005 - Canteen Office/Store - 6.18 m2</b>							

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00F - R0006 - General Storeroom - 23.15 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0007 - Movement - 124.35 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	125m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0008 - Stage - 70.19 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	15m2	North, East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00F - R0009 - Distribution Board Cupboard - .55 m2</b>						<b>Note: No inspection of live electrical installation</b>	
No Asbestos							
<b>B00F - R0010 - Special Programs Room - 31.8 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0011 - P.E Store - 30.72 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0012 - Toilets - Girls - 10.87 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0013 - Movement - 1.02 m2</b>							
No Asbestos							
<b>B00F - R0014 - Toilets - Boys - 10.4 m2</b>							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0015 - Movement - 1.02 m2</b>							
No Asbestos							
<b>B00F - R0016 - Communal Space - 186.99 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	188m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	50m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0017 - General Storeroom - 5.79 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00F - R0019 - Covered Outdoor Learning Area - 320.97 m2</b>							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G - Administration/Staff Facilities - 1967 - Brick/Veneer</b>							
<b>Exterior</b>							

Eaves Linings	Corrugated AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	Requires Inspection						
Ceiling Voids	Requires Inspection						
<b>Interior</b>							
<b>B00G- R0002 - Staff Toilet - 2.02 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
<b>B00G- R0003 - Cleaning Supplies - 2.08 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00G- R0004 - Deputy Principal - 19.44 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0005 - Staff Room Annexe - 12.49 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0006 - Staff Room Annexe - 12.57 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0007 - Ancillary Staff - 12.56 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	2m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0008 - Staff Toilet - 5.24 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00G- R0009 - Staff Toilet - 7.9 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles						
<b>B00G- R0010 - Staff Room - 68.86 m2</b>							
Wall Linings Internal - Infill	Compressed AC Sheet	7m2	North, South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00G- R0011 - Movement - 44.63 m2</b>							
Ceiling Structures/Linings	Corrugated AC Sheeting	45m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0012 - Sick Bay - 8.23 m2</b>							
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00G- R0015 - Duplicating Workroom - 32.88 m2</b>							
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Compressed AC Sheet	4m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00G- R0016 - Distribution Board Cupboard - .36 m2</b>						<b>Note: No inspection of live electrical installation</b>	
Floor Coverings Res/Textile	Vinyl Sheet						
<b>B00G- R0019 - Clerical Office - 11.67 m2</b>							
Non Accessible							
<b>B00G- R0020 - Entry Vestibule - 14.31 m2</b>							
Non Accessible							
<b>B00G- R0021 - Movement - 19.23 m2</b>							
Non Accessible							
<b>B00G- R0022 - Principal - 25.22 m2</b>							

Require Inspection

### B00I - Building Services - 2000 - Steel

#### Exterior

Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	

#### Interior

##### B00I - R0001 - Garden Store - 26.43 m2

No Asbestos

##### B00I - R0002 - Personal Effects Storage - 13.91 m2

No Asbestos

### B00J - Building Services - 2001 - Steel

#### Exterior

Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	

#### Interior

##### B00J - R0001 - Chair Store - 91.24 m2

No Asbestos

### B00K - Other - 2007 - Metal Shed

#### Exterior

Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	

No Asbestos

#### Interior

##### B00K - R0001 - Store - 92.66 m2

No Asbestos

### B00L - General Learning/Multi Purpose Facilities - 2010 - Brick/Veneer

#### Exterior

Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	

#### Interior

##### B00L - R0001 - Other - 44.79 m2

No Asbestos

##### B00L - R0002 - Special Programs Room - 38.75 m2

No Asbestos

##### B00L - R0003 - Special Programs Store - 12.09 m2

No Asbestos

##### B00L - R0004 - Special Programs Store - 12.03 m2

No Asbestos

##### B00L - R0005 - Special Programs Room - 38.66 m2

No Asbestos

##### B00L - R0006 - Special Programs Store - 6.74 m2

No Asbestos

##### B00L - R0007 - Movement - 7.64 m2

No Asbestos

<b>B00L - R0008 - Main Switch Board - .85 m2</b>		
No Asbestos		
<b>B00L - R0009 - External Movement - 23.46 m2</b>		
No Asbestos		
<b>B00M - General Learning - 2010 - Brick/Veneer</b>		
<b>Exterior</b>		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00M - R0001 - Practical Activities - 19.17 m2</b>		
No Asbestos		
<b>B00M - R0002 - Home Base - 61.22 m2</b>		
No Asbestos		
<b>B00M - R0003 - Home Base Store - 6.34 m2</b>		
No Asbestos		
<b>B00M - R0004 - Practical Activities - 19.15 m2</b>		
No Asbestos		
<b>B00M - R0005 - Home Base - 61.13 m2</b>		
No Asbestos		
<b>B00M - R0006 - Home Base Store - 6.38 m2</b>		
No Asbestos		
<b>B00M - R0007 - Withdrawal Space - 2hb - 11.78 m2</b>		
No Asbestos		
<b>B00M - R0008 - External Movement - 45.31 m2</b>		
No Asbestos		
<b>B00M - R0009 - Main Switch Board - .69 m2</b>		
No Asbestos		
<b>B00N - General Learning - 2011 - Fibre Cement Clad</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00N - R0001 - External Movement - 19.95 m2</b>		
No Asbestos		
<b>B00N - R0002 - Home Base - 59.65 m2</b>		
No Asbestos		
<b>B00N - R0003 - Practical Activities - 3.76 m2</b>		
No Asbestos		
<b>B00N - R0004 - Home Base Store - 6.21 m2</b>		
No Asbestos		
<b>B00O - Storage - 2014 - Metal Shed</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	

Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00O - R0001 - Other - Regional Use - 27.52 m2</b>		
No Asbestos		
<b>B00P - General Learning - 2016 - Steel</b>		
<b>Exterior</b>		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
<b>Interior</b>		
<b>B00P - R0001 - External Movement - 20.01 m2</b>		
No Asbestos		
<b>B00P - R0002 - Home Base - 59.65 m2</b>		
No Asbestos		
<b>B00P - R0003 - Staff Kitchen - 3.7 m2</b>		
No Asbestos		
<b>B00P - R0004 - Home Base Store - 6.25 m2</b>		
No Asbestos		

**Demountables****OS 602 13589 - Learning Unit - Standard With P.A.A. - Placement Date : 09-NOV-2006****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Learning space/withdrawal/entry**

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

**R2- Home Base Store**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

**OS 601 13916 - Learning Unit - Standard/Withdrawal - Placement Date : 11-DEC-2014****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

**Interior****R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

**R2- General Learning Space**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

**R3- Store**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------