


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Lennox Head Public School (4184)
Region:	North Coast AMU
State Electorate:	Ballina
Local Government Area:	Ballina

Last Reviewed By:	Greencap 04-MAY-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

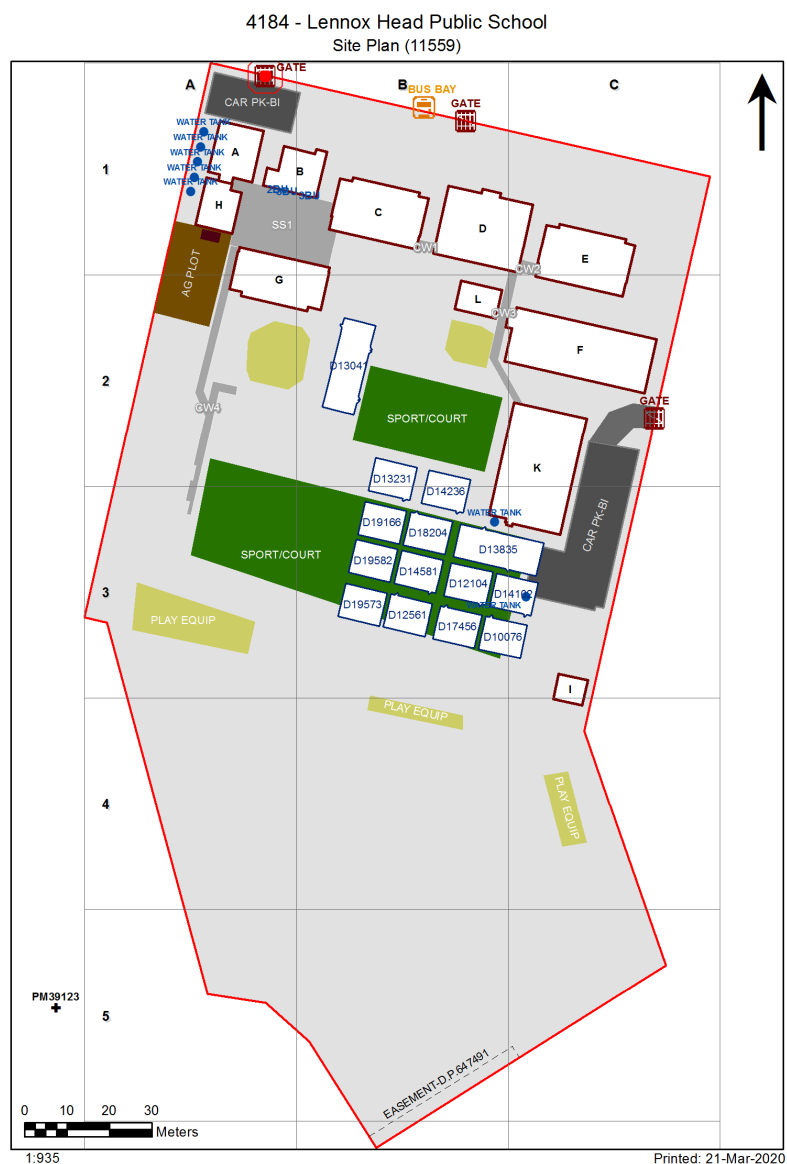

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration - 1961 - Timber							
Exterior							
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Interior							
B00A - R0001 - Movement - 23.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00A - R0002 - Clerical Office - 21.27 m2							
No Asbestos							
B00A - R0003 - Sick Bay - 8.41 m2							
No Asbestos							
B00A - R0004 - Duplicating Workroom - 10.87 m2							
No Asbestos							
B00A - R0005 - Movement - 9.68 m2							
No Asbestos							
B00A - R0006 - Clerical Office - 19.64 m2							
No Asbestos							
B00A - R0007 - Principal - 13.23 m2							
No Asbestos							
B00A - R0008 - Entry Vestibule - 13.2 m2							
No Asbestos							
B00A - R0009 - Movement - 4.35 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00B - General Learning/Pupil Facilities - 1961 - Timber							
Exterior							
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Wall Cladding	Flat AC Sheeting	200m2	Throughout Level 1	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Wall Cladding	Flat AC Sheeting	2m2	East, below Windows	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area						
Interior							
B00B - R0001 - Movement - 2.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0002 - General Storeroom - 53.14 m2							

Ceiling Structures/Linings	Flat AC Sheeting	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0003 - No Access - 12.04 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0004 - Craft Store - 3.84 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0005 - General Storeroom - 16.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0006 - No Access - 8.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0008 - Stairs - 7.1 m2							
No Asbestos							
B00B - R1001 - General Storeroom - 5.91 m2							
No Asbestos							
B00B - R1002 - Withdrawal Space - 1hb - 67.51 m2							
No Asbestos							
B00B - R1003 - General Storeroom - 4.45 m2							
No Asbestos							
B00B - R1004 - Staff Room Annexe - 5.91 m2							
No Asbestos							
B00B - R1005 - Seminar/Study - 11.62 m2							
No Asbestos							
B00B - R1006 - Movement - 1.54 m2							
No Asbestos							
B00B - R1007 - Stairs - 1.87 m2							
No Asbestos							
B00C - General Learning - 1990 - Brick/Veneer							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting						
Interior							
B00C - R0001 - Withdrawal Space - 1hb - 6.61 m2							
No Asbestos							
B00C - R0002 - Home Base Store - 6.59 m2							
No Asbestos							
B00C - R0003 - Home Base - 61.5 m2							
Wall Linings Internal	Flat AC Sheeting						
B00C - R0004 - Practical Activities - 1hb - 18.84 m2							

No Asbestos		
B00C - R0005 - Movement - 48.99 m2		
No Asbestos		
B00C - R0006 - Home Base - 61.27 m2		
Wall Linings Internal	Flat AC Sheeting	
B00C - R0007 - Practical Activities - 1hb - 18.84 m2		
No Asbestos		
B00C - R0008 - Withdrawal Space - 1hb - 5.9 m2		
No Asbestos		
B00C - R0009 - Home Base Store - 5.9 m2		
No Asbestos		
B00C - R0010 - Toilets - Girls - 12.27 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00C - R0011 - Kiln Room - 5.29 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00C - R0012 - Distribution Board - .33 m2		
Note: No inspection of live electrical installation		
Wall Linings Internal	Flat AC Sheeting	
Ceiling Structures/Linings	Flat AC Sheeting	
B00D - General Learning - 1991 - Brick/Veneer		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Eaves Linings	Flat AC Sheeting	
Wall Cladding	Flat AC Sheeting	
Interior		
B00D - R0001 - Movement - 114.11 m2		
Wall Linings Internal	Flat AC Sheeting	
B00D - R0002 - Home Base - 62.09 m2		
No Asbestos		
B00D - R0003 - Home Base Store - 3.92 m2		
No Asbestos		
B00D - R0004 - Home Base Store - 3.17 m2		
No Asbestos		
B00D - R0005 - Practical Activities - 1hb - 36.32 m2		
No Asbestos		
B00D - R0006 - Withdrawal Space - 1hb - 11.98 m2		
No Asbestos		
B00D - R0007 - Home Base - 62.33 m2		
No Asbestos		
B00D - R0008 - Home Base Store - 3.9 m2		
No Asbestos		

B00D - R0009 - Toilets - Boys - 13 m2		
No Asbestos		
B00E - General Learning - 1990 - Brick/Veneer		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Eaves Linings	Flat AC Sheeting	
Interior		
B00E - R0001 - Distribution Board - .34 m2		Note: No inspection of live electrical installation
Ceiling Structures/Linings	Flat AC Sheeting	
Wall Linings Internal	Flat AC Sheeting	
B00E - R0002 - No Access - 5.88 m2		
No Asbestos		
B00E - R0003 - Movement - 49.36 m2		
No Asbestos		
B00E - R0004 - Withdrawal Space - 1hb - 6.54 m2		
No Asbestos		
B00E - R0005 - Home Base Store - 6.58 m2		
No Asbestos		
B00E - R0006 - Home Base - 61.43 m2		
No Asbestos		
B00E - R0007 - Practical Activities - 1hb - 19.02 m2		
Wall Linings Internal	Flat AC Sheeting	
B00E - R0008 - Home Base - 61.39 m2		
No Asbestos		
B00E - R0009 - Practical Activities - 1hb - 19.02 m2		
Wall Linings Internal	Flat AC Sheeting	
B00E - R0010 - Withdrawal Space - 1hb - 5.92 m2		
No Asbestos		
B00E - R0011 - Home Base Store - 5.92 m2		
No Asbestos		
B00E - R0012 - Toilets - Boys - 12.01 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - Library - 1961 - Brick/Veneer		
Exterior		
Ceiling Voids - Raked Ceiling	Non Accessible Area	
Underfloor Voids	No Asbestos Found	
Interior		
B00F - R0001 - Movement - 60.21 m2		
No Asbestos		
B00F - R0002 - Library Office/Workroom - 8.02 m2		
No Asbestos		

B00F - R0005 - Disabled Toilet - 6.88 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Partition Walls (Cubicles)	Compressed AC Sheet	
B00F - R0006 - Disabled Toilet - 6.92 m2		
Ceiling Structures/Linings	Flat AC Sheeting	
Partition Walls (Cubicles)	Compressed AC Sheet	
B00F - R0007 - Movement - 11.57 m2		
No Asbestos		
B00F - R0008 - Distribution Board - .77 m2		Note: No inspection of live electrical installation
Ceiling Structures/Linings	Flat AC Sheeting	
B00F - R0009 - Reading Area - 164.37 m2		
No Asbestos		
B00F - R0010 - Library Office/Workroom - 23.56 m2		
No Asbestos		
B00F - R0011 - Communications Room - 13.18 m2		
No Asbestos		
B00F - R0012 - Movement - 4.54 m2		
No Asbestos		
B00F - R0013 - Special Programs Room - 91 m2		
No Asbestos		
B00F - R0014 - Special Education Support Centre - 19.44 m2		
No Asbestos		
B00G - General Learning - 1961 - Brick/Veneer		
Exterior		
Eaves Linings	Flat AC Sheeting	
Ceiling Voids - Raked Ceiling	Non Accessible Area	
Underfloor Voids	Non Accessible Area	
Interior		
B00G - R0002 - Toilets - Girls - 12.15 m2		
Wall Linings Internal	Flat AC Sheeting	
Ceiling Structures/Linings	Flat AC Sheeting	
B00G - R0003 - Home Base Store - 5.42 m2		
No Asbestos		
B00G - R0004 - Staff Room Annexe - 6.01 m2		
No Asbestos		
B00G - R0005 - Home Base - 61.59 m2		
No Asbestos		
B00G - R0006 - Practical Activities - 1hb - 18.89 m2		
Wall Linings Internal	Flat AC Sheeting	
B00G - R0007 - Home Base - 61.59 m2		
No Asbestos		
B00G - R0008 - Practical Activities - 1hb - 18.89 m2		

Wall Linings Internal	Flat AC Sheeting							
B00G - R0009 - Withdrawal Space - 1hb - 5.95 m2								
No Asbestos								
B00G - R0010 - Home Base Store - 5.86 m2								
No Asbestos								
B00G - R0011 - Toilets - Boys - 12.06 m2								
Ceiling Structures/Linings	Flat AC Sheeting							
Wall Linings Internal	Flat AC Sheeting							
B00G - R0012 - Distribution Board - .36 m2								
Note: No inspection of live electrical installation								
Wall Linings Internal	Flat AC Sheeting							
B00G - R0013 - Movement - 2.61 m2								
No Asbestos								
B00G - R0014 - Movement - 2.62 m2								
No Asbestos								
B00H - Staff Facilities - 1961 - Timber								
Exterior								
Ceiling Voids - Raked Ceiling	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Interior								
B00H - R0001 - Staff Room Annexe - 6.51 m2								
No Asbestos								
B00H - R0002 - Movement - 3.54 m2								
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0004 - Movement - 2.86 m2								
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0005 - Staff Toilet - 4.2 m2								
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0006 - Staff Toilet - 6.09 m2								
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0007 - Movement - 8.62 m2								
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0008 - Staff Room - 44.14 m2								
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00H - R0009 - Staff Kitchen - 13.25 m2								
Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

B00I - Shed - 1961 - Metal Shed**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found	
Underfloor Voids - Slab on Ground	No Asbestos Found	

Interior**B00I - R0001 - Garden Store - 40.71 m2**

No Asbestos

B00K - Multi Purpose Facilities - 2010 - Brick/Veneer**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	

Interior**B00K - R0001 - Communal Space - 146.89 m2**

No Asbestos

B00K - R0002 - Raised Platform - 56.62 m2

No Asbestos

B00K - R0003 - Hall Chair Store - 9.55 m2

No Asbestos

B00K - R0004 - Communal/Performance Store - 9.53 m2

No Asbestos

B00K - R0005 - P.E Store - 13.05 m2

No Asbestos

B00K - R0006 - Movement - 2.42 m2

No Asbestos

B00K - R0007 - Toilets - Girls - 7.1 m2

No Asbestos

B00K - R0008 - Sound Cupboard - 1.98 m2

No Asbestos

B00K - R0009 - Movement - 3.34 m2

No Asbestos

B00K - R0010 - Toilets - Boys - 5.8 m2

No Asbestos

B00K - R0011 - Cleaning Distributed Store - 3.53 m2

No Asbestos

B00K - R0012 - Plant - 1.61 m2

No Asbestos

B00K - R0013 - Distribution Board - 3.4 m2**Note: No inspection of live electrical installation**

No Asbestos

B00K - R0014 - Access Shower/Toilet - 6.58 m2

No Asbestos

B00K - R0015 - Other - 153.21 m2

No Asbestos

B00K - R0016 - Movement - 7.11 m2

No Asbestos

B00K - R0017 - Movement - 11.26 m2

No Asbestos

B00K - R0018 - Movement - 11.85 m2

No Asbestos

B00K - R0019 - External Movement - .88 m2		
No Asbestos		
B00L - Pupil Facilities - 2010 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00L - R0001 - External Movement - 13.2 m2		
No Asbestos		
B00L - R0002 - Toilets - Boys - 15.33 m2		
No Asbestos		
B00L - R0003 - Laundry - S - 6.07 m2		
No Asbestos		
B00L - R0004 - Toilets - Girls - 22.76 m2		
No Asbestos		

Demountables

OS 603 10076 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 28-APR-2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 12104 - Learning Unit - Standard/Withdrawal - Placement Date : 27-AUG-2003

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 603 12561 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 02-JAN-2006

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 810 13041 - FSU/Shelter/Stores - Placement Date : 14-JUL-2008

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

Eaves Linings	Flat AC Sheeting	25.92m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Canteen

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Assumed Asbestos

R2- Covered Area

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	109m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

R4- Sports Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R5- Garden Store

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

R6- Change Room

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

R7- Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Assumed Asbestos
----------------------------	------------------	-----	------------------

OS 602 13231 - Learning Unit - Standard With P.A.A. - Placement Date : 10-JAN-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 502 13835 - Admin Staff/Principal/Clerk/Dup/Clinic - Placement Date : 27-SEP-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 14102 - Learning Unit - Standard/Withdrawal - Placement Date : 25-JAN-2007

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 602 14236 - Learning Unit - Standard With P.A.A. - Placement Date : 26-NOV-2019			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 603 14581 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 28-APR-2008			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 603 17456 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 03-SEP-2015			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 602 18204 - Learning Unit - Standard With P.A.A. - Placement Date : 09-JAN-2017			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 606 19166 - Learning Unit - Standard With P.A.A A/C - Placement Date : 10-JAN-2019			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 606 19573 - Learning Unit - Standard With P.A.A A/C - Placement Date : 10-JAN-2019			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 606 19582 - Learning Unit - Standard With P.A.A A/C - Placement Date : 10-JAN-2019			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			