


Asbestos Register

(Hazardous Materials and Risk Assessment)

| | |
|-------------------------------|--|
| School: | Lalor Park Public School (4191) |
| Region: | Western Sydney AMU |
| State Electorate: | Blacktown |
| Local Government Area: | Blacktown |

| | |
|--------------------------|------------------------|
| Last Reviewed By: | WSP 25-NOV-2016 |
| Last Revised By: | |

| | |
|--|-----------|
| Historical Fibro In Grounds Investigations/Events | No |
| <p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p> | |

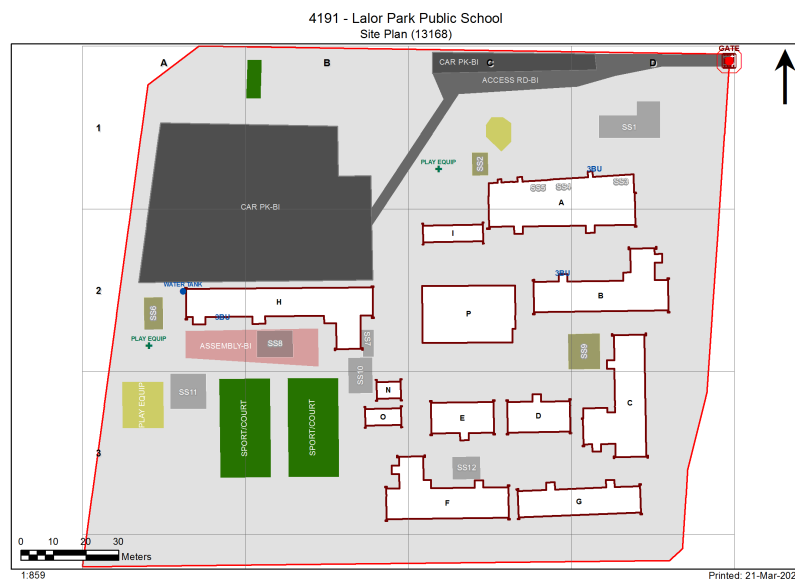

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

| Rating | Description |
|----------------------------|--|
| Good condition (1) | For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles |
| Minimal damage (2) | For non-friable asbestos that has a very small amount of damage, eg hairline cracks. |
| Some damage / unsealed (3) | For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed. |
| Poor condition (4) | For non-friable asbestos that has extensive damage. Visible asbestos debris |
| Friable asbestos (5) | Any occurrence of friable asbestos |

| Product | Material Description | Extent | Location | Material Condition | Risk Status | Remediation Priority | Result |
|---|----------------------|--------|--------------------------|---------------------------------------|-------------|-----------------------|--|
| B00A - General Learning/Pre-School Facilities - 1958 - Concrete Framed | | | | | | | |
| Exterior | | | | | | | |
| Underfloor Voids | AC Fragments/Debris | 1 | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Eaves Linings | Flat AC Sheeting | 150m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00A - R0001 - External Movement - 74.35 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0002 - Home Base - 93.7 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0003 - Home Base Store - 7.1 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0004 - Toilets - Boys/Girls - 1.54 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0005 - Personal Effects Storage - 10.05 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0006 - Movement - 5.64 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0007 - Movement - 5.2 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0008 - Personal Effects Storage - 10.05 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0009 - Toilets - Boys/Girls - 1.54 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0010 - Home Base Store - 7.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0011 - Home Base - 91.52 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0012 - External Movement - 64.63 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0013 - External Movement - 33.76 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0014 - Home Base - 65.75 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0015 - Personal Effects Storage - 7.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0016 - Staff Kitchen - 4.61 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0017 - Movement - 7.55 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0018 - Movement - 5.2 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0019 - General Storeroom - Pre - 3.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0020 - Practical Activities - Pre - 5.4 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|---|---------------------|-------|--------------------------|---------------------------------------|---------|-----------------------|--|
| No Asbestos | | | | | | | |
| B00A - R0021 - Personal Effects - Pre - 3.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0022 - Toilets - Boys/Girls - Pre - 7.2 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0023 - Home Base - Pre - 53.8 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0024 - Practical Activities - Pre - 4.41 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0025 - Staff Room - Pre - 5.68 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0027 - External Movement - 8.23 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0028 - External Movement - 1.14 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0029 - External Movement - 2.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0030 - Outdoor Learning Area - 25.39 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00A - R0031 - Staff Toilet - Pre - 4.38 m2 | | | | | | | |
| Wall Linings Internal | Flat AC Sheeting | | | | | | |
| B00B - General Learning/Other-Community Use - 1958 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 200m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Underfloor Voids | AC Fragments/Debris | 1 | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Interior | | | | | | | |
| B00B - R0001 - Movement - 5.17 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0002 - Practical Activities - 1hb - 10.05 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0003 - Staff Room Annexe - 18.4 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0004 - Home Base - 67.49 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0005 - General Storeroom - 11.68 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0006 - Staff Room Annexe - 21.65 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0007 - Personal Effects Storage - 4.52 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0008 - Movement - 22.61 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0009 - Home Base - 65.87 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0010 - Home Base Store - 6.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|--|---------------------|-------|--------------------------|---------------------------------------|---------|-----------------------|--|
| B00B - R0011 - Home Base - 65.57 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0012 - Home Base Store - 3.62 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0013 - Home Base Store - 7.95 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0014 - Movement - 7.88 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0015 - Other-Community Use - 11.74 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0016 - Other-Community Use - 44.55 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0017 - Community Clinic - 22.05 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0018 - Movement - 5.17 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0019 - Movement - 4.93 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0020 - General Storeroom - 3.67 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0021 - Practical Activities - 1hb - 25.23 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0022 - Staff Toilet - 3.95 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00B - R0023 - General Storeroom - .85 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - General Learning/Pupil Facilities - 1958 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 200m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Underfloor Voids | AC Fragments/Debris | 1 | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Interior | | | | | | | |
| B00C - R0001 - Home Base - 68.09 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0002 - Home Base Store - 7.94 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0003 - Personal Effects Storage - 3.41 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0004 - Movement - 7.88 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0005 - Movement - 5.22 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0006 - Personal Effects Storage - 3.49 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0007 - General Storeroom - 8.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|--|-------------------|-------|--------------------------|----------------------------|---------|-----------------------|--|
| B00C - R0008 - Communal Space - 114.71 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0009 - Raised Platform - 17.34 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0010 - General Storeroom - 8.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0011 - Personal Effects Storage - 3.44 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0012 - Movement - 11.37 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0013 - Personal Effects Storage - 3.42 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0014 - Home Base Store - 7.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0015 - Home Base - 68.32 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0016 - Staff Room Annexe - 12.47 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0017 - Canteen Office/Store - 5.77 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0018 - Canteen - 23.45 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0019 - Canteen Office/Store - 5.36 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0020 - Canteen Office/Store - 10.03 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0021 - Movement - 5.2 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0022 - Cleaning Distributed Store - .84 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0023 - Staff Toilet - 3.85 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0024 - Movement - 25.07 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0025 - Movement - 4.9 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00C - R0026 - Distribution Board - .14 m2 | | | | | | | Note: No inspection of live electrical installation |
| No Asbestos | | | | | | | |
| B00D - Support Unit/General Learning - 1958 - Concrete Framed | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 100m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00D - R0001 - Home Base - M - 67.91 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0002 - Toilet - M - 8.04 m2 | | | | | | | |

| | | | | | | | |
|--|-------------------|-------|--------------------------|----------------------------|---------|-----------------------|--|
| No Asbestos | | | | | | | |
| B00D - R0003 - Home Base Store - M - 3.45 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0004 - Movement - 7.86 m2 | | | | | | | |
| Electrical - Backing Board | Resinous Board | 1 | North | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00D - R0005 - Movement - 5.17 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0006 - Personal Effects Storage - 3.42 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0007 - Home Base Store - 8.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00D - R0008 - Home Base - 67.91 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - General Learning - 1958 - Concrete Framed | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 100m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00E - R0001 - Home Base - 67.65 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0002 - Home Base Store - 7.98 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0003 - Personal Effects Storage - 3.46 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0004 - Movement - 7.9 m2 | | | | | | | |
| Electrical - Backing Board | Resinous Board | 1 | West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00E - R0005 - Movement - 5.2 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0006 - Personal Effects Storage - 3.46 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0007 - Home Base Store - 8.03 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00E - R0008 - Home Base - 67.65 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - General Learning/Staff Facilities - 1958 - Brick/Block | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 150m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00F - R0001 - Home Base - 67.56 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|--|------------------|-------|--------------------------|--------------------|---------|--------------------|--|
| B00F - R0002 - Home Base Store - 7.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0003 - General Storeroom - 3.54 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0004 - Movement - 7.87 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0005 - Movement - 5.22 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0006 - Personal Effects Storage - 3.44 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0007 - Home Base Store - 7.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0008 - Practical Activities - 1hb - 65.83 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0009 - Practical Activities - 1hb - 65.58 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0010 - Home Base Store - 7.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0011 - Personal Effects Storage - 3.44 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0012 - Personal Effects Storage - 3.44 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0013 - Home Base Store - 7.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0014 - Home Base - 67.47 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0015 - Staff Room Annexe - 17.77 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0016 - Movement - 4.84 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0017 - Movement - 5.22 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0018 - Staff Toilet - 5.24 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0019 - General Storeroom - .81 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0020 - Staff Toilet - 3.75 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0021 - Staff Room - 23.45 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0022 - Movement - 12.21 m2 | | | | | | | |
| Electrical - Backing Board | Resinous Board | 1 | East | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00F - R0023 - Cleaning Distributed Store - 5.59 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00F - R0024 - Movement - 4.9 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - General Learning/Other-D.E.C. Admin - 1958 - Concrete Framed | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 100m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |

| | | | | | | | |
|---|---------------------|------|------------|---------------------------------------|---------|-----------------------|--|
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Crocidolite (blue asbestos) |
| Interior | | | | | | | |
| B00G - R0001 - Other - Regional Use - 12.97 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0002 - Other - Regional Use - 16.63 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0003 - Other - Regional Use - 11.65 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0004 - Other - Regional Use - 6.58 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0005 - Other - Regional Use - 15.98 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0006 - Withdrawal Space - 1hb - 13.87 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0007 - Movement - 5.2 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0008 - Home Base Store - 6.58 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0009 - Home Base - 56.96 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0010 - Home Base - 56.89 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0011 - Home Base Store - 6.58 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0012 - Personal Effects Storage - 3.44 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0013 - Movement - 6.37 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0014 - Movement - 5.2 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0015 - Personal Effects Storage - 3.44 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0016 - Home Base Store - 6.58 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00G - R0017 - Home Base - 58.46 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - Administration/Library - 1958 - Concrete Framed | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 20m2 | East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Underfloor Voids | AC Fragments/Debris | 1 | Throughout | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| Interior | | | | | | | |

| | |
|--|--|
| B00H - R0002 - Staff Toilet - 5.6 m2 | |
| No Asbestos | |
| B00H - R0003 - Staff Room Annexe - 3.52 m2 | |
| No Asbestos | |
| B00H - R0004 - Entry Vestibule - 8.21 m2 | |
| No Asbestos | |
| B00H - R0005 - Movement - 3.78 m2 | |
| No Asbestos | |
| B00H - R0006 - Principal - 17.13 m2 | |
| No Asbestos | |
| B00H - R0007 - Staff Toilet - 5 m2 | |
| No Asbestos | |
| B00H - R0008 - Interview - 26.16 m2 | |
| No Asbestos | |
| B00H - R0009 - Movement - 11.86 m2 | |
| No Asbestos | |
| B00H - R0010 - Cleaning Distributed Store - 3.71 m2 | |
| No Asbestos | |
| B00H - R0011 - Movement - 7.36 m2 | |
| No Asbestos | |
| B00H - R0012 - External Movement - 7.58 m2 | |
| No Asbestos | |
| B00H - R0013 - Movement - 24.65 m2 | |
| No Asbestos | |
| B00H - R0014 - Clerical Office - 43.98 m2 | |
| No Asbestos | |
| B00H - R0015 - General Storeroom - 5.75 m2 | |
| No Asbestos | |
| B00H - R0016 - General Storeroom - 3.78 m2 | |
| No Asbestos | |
| B00H - R0017 - Clerical Office - 36.58 m2 | |
| No Asbestos | |
| B00H - R0018 - General Storeroom - 5.57 m2 | |
| No Asbestos | |
| B00H - R0019 - Sick Bay - 6.88 m2 | |
| No Asbestos | |
| B00H - R0020 - General Storeroom - 3.61 m2 | |
| No Asbestos | |
| B00H - R0021 - Sports Store - 13.62 m2 | |
| No Asbestos | |
| B00H - R0022 - Movement - 15.21 m2 | |
| No Asbestos | |
| B00H - R0023 - External Movement - 7.39 m2 | |
| No Asbestos | |
| B00H - R0024 - Personal Effects Storage - 3.66 m2 | |
| No Asbestos | |
| B00H - R0025 - Home Base Store - 5.64 m2 | |
| No Asbestos | |
| B00H - R0026 - Home Base - 57.18 m2 | |
| No Asbestos | |
| B00H - R0027 - Home Base - 56.95 m2 | |
| No Asbestos | |

| | | | | | | | |
|--|-------------|------|------------|--------------------|---------|--------------------|--|
| B00H - R0028 - Home Base Store - 5.54 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0029 - Personal Effects Storage - 3.62 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0030 - Movement - 11.81 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0031 - External Movement - 7.22 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0032 - Craft Store - 13.93 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0033 - Staff Room - 49.64 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0034 - Staff Kitchen - 6.47 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0036 - Security Store - 13.28 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0037 - Stairs - 4.81 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0038 - Stairs - 5.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0039 - Stairs - 4.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R0040 - Distribution Board - .14 m2 | | | | | | | Note: No inspection of live electrical installation |
| No Asbestos | | | | | | | |
| B00H - R1001 - Other - Regional Use - 60.96 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 61m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00H - R1002 - Other - Regional Use - 6.92 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1003 - Library Office/Workroom - 4.01 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1005 - Movement - 3.32 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1007 - K.L.A. Store - 7.04 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1008 - Reading Area - 122.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1009 - K.L.A. Store - 7.02 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1010 - Personal Effects Storage - 4.01 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1011 - Movement - 20.27 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 21m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00H - R1012 - Personal Effects Storage - 4.04 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1013 - K.L.A. Store - 6.94 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1014 - Seminar/Study - 60.62 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1015 - Other - Regional Use - 60.62 m2 | | | | | | | |
| No Asbestos | | | | | | | |

| | | | | | | | |
|--|---------------------|------|--------------------------|---------------------------------------|---------|-----------------------|--|
| B00H - R1016 - Other - Regional Use - 6.96 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1017 - General Storeroom - 3.99 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1018 - Movement - 17.12 m2 | | | | | | | |
| Floor Coverings Res/Textile | Vinyl Tiles | 18m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00H - R1019 - Stairs - 15.75 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1020 - Movement - 8.03 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1021 - Library Office/Workroom - 12.42 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1022 - Stairs - 15.03 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00H - R1023 - Stairs - 14.88 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00I - Pupil Facilities - 1958 - Concrete | | | | | | | |
| Exterior | | | | | | | |
| Eaves Linings | Flat AC Sheeting | 50m2 | North, South, East, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Underfloor Voids | Flat AC Sheeting | 1 | Throughout | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Ceiling Voids | AC Fragments/Debris | 1 | Variable positions | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Interior | | | | | | | |
| B00I - R0001 - Toilets - Boys/Girls - 53.09 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 54m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| B00I - R0002 - Toilets - Girls - 35.13 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 36m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| B00N - Pupil Facilities - 1958 - Concrete | | | | | | | |
| Exterior | | | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | | |
| Eaves Linings | Flat AC Sheeting | 30m2 | North, South, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00N - R0001 - Toilets - Girls - 34.89 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 35m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00O - Pupil Facilities - 1958 - Concrete | | | | | | | |
| Exterior | | | | | | | |
| Gable Verge Lining | Flat AC Sheeting | | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Underfloor Voids - Slab on Ground | No Asbestos Found | | | | | | |

| | | | | | | | |
|--|-------------------|------|--------------------|--------------------|---------|--------------------|--|
| Eaves Linings | Flat AC Sheeting | 30m2 | North, South, West | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Interior | | | | | | | |
| B00O - R0001 - Toilets - Girls - 51.18 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 52m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00O - R0002 - Cleaning Distributed Store - 1.12 m2 | | | | | | | |
| Ceiling Structures/Linings | Flat AC Sheeting | 2m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| B00P - Pupil Facilities/Communal Facilities - 2010 - Brick/Veneer | | | | | | | |
| Exterior | | | | | | | |
| Ceiling Voids | No Asbestos Found | | | | | | |
| Underfloor Voids | No Asbestos Found | | | | | | |
| Interior | | | | | | | |
| B00P - R0001 - Communal Space - 146.96 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0002 - Raised Platform - 57.08 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0003 - Movement - 7.74 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0004 - Ramp - 11.64 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0005 - Movement - 13.7 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0006 - Hall Chair Store - 9.55 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0007 - Communal/Performance Store - 9.51 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0008 - P.E. Store - 13.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0009 - Toilet - Lobby - 2.27 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0010 - Toilets - Girls - 7.17 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0011 - Sound Cupboard - 2.06 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0012 - Toilet - Lobby - 3.23 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0013 - Toilets - Boys - 5.71 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0014 - Cleaning Distributed Store - 5.17 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0015 - Disabled Shower/Toilet - 6.92 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0016 - Main Switch Board - 3.33 m2 | | | | | | | |
| No Asbestos | | | | | | | |
| B00P - R0017 - Covered Outdoor Learning Area - 161.6 m2 | | | | | | | |
| No Asbestos | | | | | | | |

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020