


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Five Dock Public School (1920)
Region:	Sydney AMU
State Electorate:	Drummoyne
Local Government Area:	Canada Bay

Last Reviewed By:	Greencap 13-DEC-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

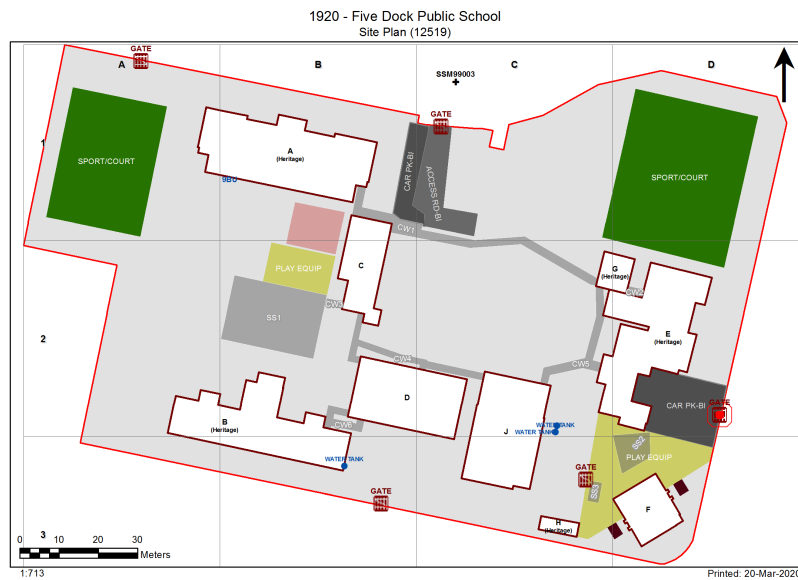

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning/Administration - 1929 - Brick/Block							
Exterior							
External Wall Structure - Awnings	Flat AC Sheeting	9	Over East and West entrances 3x	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	80m2	Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00A - R0001 - External Movement - 3.75 m2							
No Asbestos							
B00A - R0002 - Entry Vestibule - 20.53 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0003 - External Movement - 3.7 m2							
No Asbestos							
B00A - R0004 - Movement - 22.54 m2							
No Asbestos							
B00A - R0005 - Clerical Office - 13.83 m2							
No Asbestos							
B00A - R0006 - Interview - 14.7 m2							
No Asbestos							
B00A - R0007 - Duplicating Workroom - 26.04 m2							
No Asbestos							
B00A - R0008 - Interview - 8.52 m2							
No Asbestos							
B00A - R0009 - Principal - 16.84 m2							
No Asbestos							
B00A - R0010 - Security Store - 12.11 m2							
No Asbestos							
B00A - R0011 - Staff Room - 47.08 m2							
No Asbestos							
B00A - R0012 - Home Base - 46.81 m2							
No Asbestos							
B00A - R0013 - Home Base - 47.13 m2							
No Asbestos							
B00A - R0014 - External Movement - 3.75 m2							
No Asbestos							
B00A - R0015 - Movement - 22.76 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0016 - Uniform Shop - 7.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0017 - Staff Toilet - 3.77 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0018 - Staff Toilet - 5.15 m2							

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0019 - Movement - 4.93 m2							
No Asbestos							
B00A - R0020 - P.E. Store - 8.44 m2							
No Asbestos							
B00A - R0023 - External Movement - 13.12 m2							
No Asbestos							
B00A - R0024 - General Storeroom - 19.05 m2							
No Asbestos							
B00A - R0025 - Interview - 13.23 m2							
No Asbestos							
B00A - R0026 - Movement - 2.53 m2							
No Asbestos							
B00A - R0027 - Cleaning Supplies - 5.07 m2							
No Asbestos							
B00A - R0028 - Movement - 3.87 m2							
No Asbestos							
B00A - R0029 - Stairs - 6.58 m2							
No Asbestos							
B00A - R0030 - Stairs - 11.52 m2							
No Asbestos							
B00A - R0031 - Home Base - 61 m2							
No Asbestos							
No Asbestos							
B00A - R0032 - Movement - 66.3 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0033 - Home Base - 41 m2							
No Asbestos							
B00A - R1001 - Craft Store - 9.43 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R1002 - Personal Effects Storage - 8.86 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1003 - Home Base - 48.29 m2							
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1004 - Home Base - 47.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1005 - Home Base - 48.16 m2							
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1006 - Home Base - 48.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1007 - Home Base - 48.29 m2							
Ceiling Structures/Linings	Flat AC Sheeting	49m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1008 - Handwashing Facilities - 8.89 m2							

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1009 - Personal Effects Storage - 9.59 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1010 - Movement - 7.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1011 - Movement - 15.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1012 - General Storeroom - 20.93 m2							
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1013 - Movement - 47.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1014 - Home Base - 79.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1015 - Practical Activities - 1hb - 11.14 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1016 - Staff Room Annexe - 9.16 m2							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1017 - Home Base Store - 9.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1018 - Withdrawal Space - 1hb - 19.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1019 - Movement - 23.08 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1020 - Stairs - 12.69 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1021 - Stairs - 12.68 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R9001 - Cleaning Supplies - 5.47 m2							
No Asbestos							
No Asbestos							
B00A - R9002 - Movement - 3.84 m2							
No Asbestos							
B00A - R9003 - Movement - 6.58 m2							
No Asbestos							
B00A - R9004 - Sports Store - 17.58 m2							
No Asbestos							
B00A - R9005 - Stairs - 7.25 m2							
No Asbestos							

B00B - Other-D.E.C. Admin/Other-After School Care - 1920 - Brick/Block

Exterior

Wall Cladding	Flat AC Sheeting	8m2	External adjacent Rooms BR0010 & BR0011, Upper Portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Interior

B00B - R0001 - Out Of School Hours Care Centre - 6.64 m2

No Asbestos

B00B - R0002 - Home Base - 47.22 m2

Furniture / Fixtures - Blackboard	Flat AC Sheeting	20	All surfaces, Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R0003 - Home Base - 47.16 m2

Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	All surfaces, Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	16m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R0004 - Home Base - 47.04 m2

Furniture / Fixtures - Blackboard	Flat AC Sheeting	20	All surfaces, Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R0005 - Home Base - 46.91 m2

Furniture / Fixtures - Blackboard	Flat AC Sheeting	20	All surfaces, Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R0006 - Home Base - 47.03 m2

Furniture / Fixtures - Blackboard	Flat AC Sheeting	10	All surfaces, Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	16m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R0007 - Home Base - 47.23 m2

Furniture / Fixtures - Blackboard	Flat AC Sheeting	20	All surfaces, Middle portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R0009 - Other - Regional Use - 11.27 m2

No Asbestos

B00B - R0010 - Other - Regional Use - 2.28 m2

No Asbestos

B00B - R0011 - Other - Regional Use - 2.32 m2

No Asbestos

B00B - R0012 - General Storeroom - 16.58 m2

No Asbestos

B00B - R0013 - Other - Regional Use - 23.65 m2

No Asbestos

B00B - R0014 - Other - Regional Use - 22.71 m2

No Asbestos

B00B - R0015 - Other - Regional Use - 8.95 m2

Wall Linings Internal	Flat AC Sheeting	5m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
-----------------------	------------------	-----	-------------	--------------------	---------	--------------------	-----------------------------

B00B - R0016 - Movement - 24.12 m2							
No Asbestos							
B00B - R0017 - Movement - 23.27 m2							
No Asbestos							
B00B - R0018 - General Assistant/Bulk Store - 4.52 m2							
No Asbestos							
B00B - R0019 - Out Of School Hours Care Centre - 6.15 m2							
No Asbestos							
B00B - R0020 - Practical Activities - 1hb - 3.56 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0021 - Movement - 56.18 m2							
Wall Linings Internal	Flat AC Sheeting	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - Pupil Facilities - 1978 - Brick/Block							
Exterior							
Ceiling Voids	AC Fragments/Debris	1	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Underfloor Voids	No Asbestos Found						
Interior							
B00C - R0001 - Canteen - 32.24 m2							
No Asbestos							
B00C - R0002 - Canteen Office/Store - 8.08 m2							
No Asbestos							
B00C - R0003 - Canteen Office/Store - 5.96 m2							
No Asbestos							
B00C - R0004 - Toilets - Boys - 22.28 m2							
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0005 - Toilets - Girls - 28.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	29m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0006 - External Movement - 107.46 m2							
No Asbestos							
B00C - R0007 - Main Switch Board - 5.34 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0009 - Disabled Toilet - 12.29 m2							
No Asbestos							
B00D - Library - 1980 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00D - R0001 - External Movement - 148.04 m2							

No Asbestos							
B00D - R0002 - Reading Area - 226.45 m2							
No Asbestos							
B00D - R0003 - Library Office/Workroom - 12.94 m2							
No Asbestos							
B00D - R0004 - Library Office/Workroom - 24.63 m2							
No Asbestos							
B00D - R0005 - Distribution Board - 1.55 m2						Note: No inspection of live electrical installation	
Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - General Learning - 1876 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0003 - Security Store - 8.49 m2							
No Asbestos							
B00E - R0006 - External Movement - 21.73 m2							
No Asbestos							
B00E - R0007 - Home Base - 52.91 m2							
No Asbestos							
B00E - R0009 - Clerical Office - 19.79 m2							
No Asbestos							
B00E - R0011 - External Movement - 7.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0013 - External Movement - 17.36 m2							
No Asbestos							
B00E - R0015 - Home Base - 54.41 m2							
No Asbestos							
B00E - R0017 - Movement - 1.6 m2							
No Asbestos							
B00E - R0018 - External Movement - 3.99 m2							
No Asbestos							
B00E - R0019 - Home Base - 46.72 m2							
No Asbestos							
B00E - R0020 - Home Base - 52.16 m2							
No Asbestos							
B00E - R0022 - Movement - 6.46 m2							
No Asbestos							
B00E - R0023 - Movement - 53.89 m2							
No Asbestos							
B00E - R0024 - Practical Activities - 2hb - 2.78 m2							
No Asbestos							
B00E - R0025 - Home Base - 47.19 m2							
No Asbestos							
B00E - R0026 - Ramp - 82.13 m2							
No Asbestos							
B00E - R0027 - Home Base - 94.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

B00E - R0028 - Cleaning Distributed Store - 2.29 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0029 - Staff Toilet - 1.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00F - Pre-School Facilities - 1978 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Compressed AC Sheet	20	Ceiling North-East Floor to Room R0010 above)	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00F - R0003 - Staff Toilet - Pre - 2 m2							
No Asbestos							
B00F - R0004 - Kitchen - Pre - 4.33 m2							
No Asbestos							
B00F - R0010 - Toilets - Boys/Girls - Pre - 19.82 m2							
No Asbestos							
No Asbestos							
B00F - R0011 - External Movement - 3.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0012 - Movement - 3.48 m2							
No Asbestos							
No Asbestos							
B00F - R0013 - Practical Activities - Pre - 43.35 m2							
No Asbestos							
No Asbestos							
B00F - R0014 - Practical Activities - Pre - 28.8 m2							
No Asbestos							
B00F - R0015 - General Storeroom - Pre - 3.81 m2							
No Asbestos							
No Asbestos							
B00F - R0016 - General Storeroom - Pre - 3.63 m2							
No Asbestos							
No Asbestos							
B00F - R0017 - Withdrawal - Pre - 7.65 m2							
No Asbestos							
No Asbestos							
B00F - R0018 - General Storeroom - Pre - 3.92 m2							
No Asbestos							
No Asbestos							
B00F - R0019 - External Movement - 15.75 m2							
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00F - R0020 - Staff Room - Pre - 17.45 m2							
No Asbestos							
No Asbestos							
B00G - Pupil Facilities - 1911 - Brick/Block							
Exterior							

Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00G - R0001 - Toilets - Boys - 19.23 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0002 - Sports Store - 3.5 m2							
No Asbestos							
B00G - R0003 - Cleaning Distributed Store - 3.32 m2							
No Asbestos							
B00G - R0004 - Toilets - Girls - 19.35 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0005 - External Movement - 16.13 m2							
No Asbestos							
B00H - Shed - 1955 - Timber							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00H - R0001 - Garden Store - 2.06 m2							
No Asbestos							
B00H - R0002 - General Storeroom - 4.5 m2							
No Asbestos							
B00H - R0003 - Garden Store - 26.21 m2							
No Asbestos							
B00J - Communal Facilities - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0001 - Communal Space - 145.21 m2							
No Asbestos							
B00J - R0002 - Raised Platform - 59.08 m2							
No Asbestos							
B00J - R0003 - Hall Chair Store - 9.21 m2							
No Asbestos							
B00J - R0004 - Communal/Performance Store - 9.13 m2							
No Asbestos							
B00J - R0005 - P.E Store - 12.06 m2							
No Asbestos							
B00J - R0006 - Toilet - Lobby - 2.37 m2							
No Asbestos							
B00J - R0007 - Toilets - Girls - 7.31 m2							
No Asbestos							
B00J - R0008 - Sound Cupboard - 2.06 m2							

No Asbestos	
B00J - R0009 - Toilet - Lobby - 3.31 m2	
No Asbestos	
B00J - R0010 - Toilets - Boys - 5.71 m2	
No Asbestos	
B00J - R0011 - Cleaning Distributed Store - 3.02 m2	
No Asbestos	
B00J - R0012 - General Storeroom - 1.6 m2	
No Asbestos	
B00J - R0013 - Main Switch Board - 3.65 m2	
No Asbestos	
B00J - R0014 - Access Shower/Toilet/Change - 6.87 m2	
No Asbestos	
B00J - R0015 - Covered Outdoor Learning Area - 146.74 m2	
No Asbestos	
B00J - R0016 - Movement - 7.07 m2	
No Asbestos	
B00J - R0017 - Movement - 12.43 m2	
No Asbestos	
B00J - R0018 - General Storeroom - .34 m2	
No Asbestos	
B00J - R0019 - Movement - 13 m2	
No Asbestos	

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020