


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Fairfield Heights Public School (3632)
Region:	South Western Sydney AMU
State Electorate:	Fairfield
Local Government Area:	Fairfield

Last Reviewed By:	WSP 28-DEC-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

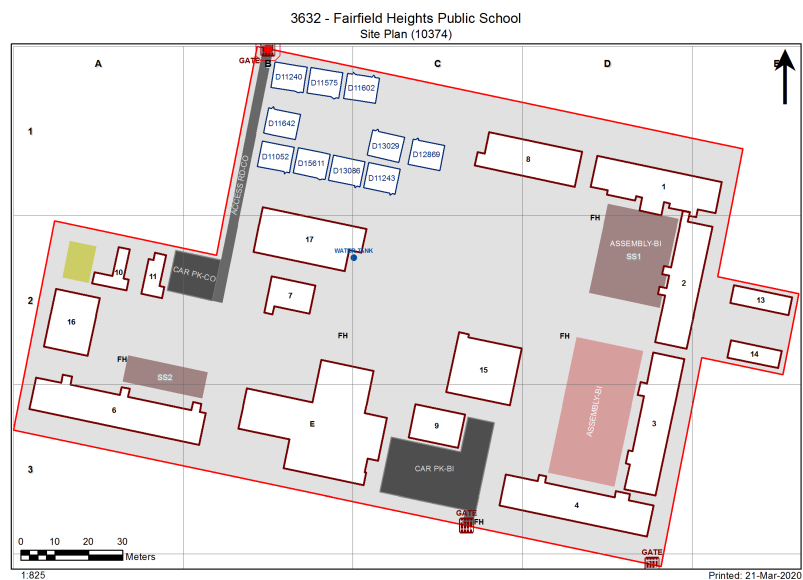

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B001 - General Learning - 1969 - Concrete							
Exterior							
Gable Ends	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B001 - R0001 - Home Base - 66.8 m2							
No Asbestos							
B001 - R0002 - Home Base Store - 4.4 m2							
No Asbestos							
B001 - R0003 - Home Base Store - 4.38 m2							
No Asbestos							
B001 - R0004 - Movement - 10.63 m2							
No Asbestos							
B001 - R0005 - Personal Effects Storage - 4.4 m2							
No Asbestos							
B001 - R0006 - Personal Effects Storage - 4.4 m2							
No Asbestos							
B001 - R0007 - Home Base - 66.98 m2							
No Asbestos							
B001 - R0008 - Home Base Store - 4.41 m2							
No Asbestos							
B001 - R0009 - Home Base Store - 4.4 m2							
No Asbestos							
B001 - R0010 - Home Base - 66.89 m2							
No Asbestos							
B001 - R0011 - Home Base Store - 4.36 m2							
No Asbestos							
B001 - R0012 - Home Base Store - 4.4 m2							
No Asbestos							
B001 - R0013 - Personal Effects Storage - 4.42 m2							
No Asbestos							
B001 - R0014 - Cleaning Distributed Store - 4.34 m2							
No Asbestos							
B001 - R0015 - Movement - 10.55 m2							
No Asbestos							
B001 - R0016 - Home Base Store - 4.4 m2							
No Asbestos							
B001 - R0017 - Home Base Store - 4.36 m2							
No Asbestos							
B001 - R0018 - Home Base - 67.26 m2							
No Asbestos							
B001 - R0019 - Toilets - Boys/Girls - 3.8 m2							
No Asbestos							
B001 - R0020 - Movement - 2.82 m2							
No Asbestos							

B001 - R0021 - Raised Platform - 25.24 m2							
No Asbestos							
B001 - R0022 - Movement - 2.9 m2							
No Asbestos							
B001 - R0023 - Movement - 2.87 m2							
No Asbestos							
B002 - General Learning - 1969 - Concrete							
Exterior							
Underfloor Voids	No Asbestos Found						
Gable Ends	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	40m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority(2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Cladding	Flat AC Sheeting						
Ceiling Voids	Non Accessible Area						
Interior							
B002 - R0001 - Home Base - 53.58 m2							
No Asbestos							
B002 - R0002 - Home Base - 53.51 m2							
No Asbestos							
B002 - R0003 - General Assistant/Bulk Store - 13.7 m2							
No Asbestos							
B002 - R0004 - Personal Effects Storage - 6.64 m2							
No Asbestos							
B002 - R0005 - Sports Store - 11.1 m2							
No Asbestos							
B002 - R0006 - Staff Room Annexe - 10.4 m2							
No Asbestos							
B002 - R0007 - Personal Effects Storage - 6.64 m2							
No Asbestos							
B002 - R0008 - Home Base - 53.36 m2							
No Asbestos							
B002 - R0009 - Home Base - 53.51 m2							
No Asbestos							
B002 - R0010 - Movement - 71.73 m2							
No Asbestos							
B002 - R0011 - Movement - 3.84 m2							
No Asbestos							
B002 - R0012 - Movement - 4.2 m2							
No Asbestos							
B003 - General Learning/Communal Facilities - 1969 - Concrete Framed							
Exterior							
Gable Ends	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority(2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						

Interior							
B003 - R0001 - Home Base - 66.73 m2							
No Asbestos							
B003 - R0002 - Home Base Store - 8.97 m2							
No Asbestos							
B003 - R0003 - Personal Effects Storage - 2.18 m2							
No Asbestos							
B003 - R0004 - Withdrawal Space - 1hb - 22.5 m2							
No Asbestos							
B003 - R0005 - Personal Effects Storage - 2.21 m2							
No Asbestos							
B003 - R0006 - Movement - 21.15 m2							
No Asbestos							
B003 - R0007 - Movement - 6.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0008 - Cleaning Distributed Store - 8.83 m2							
No Asbestos							
B003 - R0009 - Home Base - 67.86 m2							
No Asbestos							
B003 - R0010 - Home Base - 68.06 m2							
No Asbestos							
B003 - R0011 - Music Store - 8.89 m2							
No Asbestos							
B003 - R0012 - Personal Effects Storage - 3.31 m2							
No Asbestos							
B003 - R0013 - Personal Effects Storage - 3.31 m2							
No Asbestos							
B003 - R0014 - Home Base Store - 8.88 m2							
No Asbestos							
B003 - R0015 - Home Base - 66.74 m2							
No Asbestos							
B003 - R0016 - Movement - 8.24 m2							
No Asbestos							
B003 - R0017 - Movement - 4.33 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B004 - General Learning - 1969 - Concrete Framed							
Exterior							
Gable Ends	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B004 - R0001 - Movement - 3.57 m2							
No Asbestos							
B004 - R0002 - Toilets - Boys/Girls - 3.06 m2							
No Asbestos							

B004 - R0003 - Home Base - 67.37 m2							
No Asbestos							
B004 - R0004 - Home Base Store - 7.81 m2							
No Asbestos							
B004 - R0005 - Personal Effects Storage - 3.81 m2							
No Asbestos							
B004 - R0006 - Cleaning Distributed Store - .72 m2							
No Asbestos							
B004 - R0007 - General Storeroom - 3.96 m2							
No Asbestos							
B004 - R0008 - Interview - 16.11 m2							
No Asbestos							
B004 - R0009 - Movement - 2.73 m2							
No Asbestos							
B004 - R0010 - Personal Effects Storage - 3.87 m2							
No Asbestos							
B004 - R0011 - Movement - 15.43 m2							
No Asbestos							
B004 - R0012 - Home Base - 65.91 m2							
No Asbestos							
B004 - R0013 - Home Base Store - 7.8 m2							
No Asbestos							
B004 - R0014 - Home Base - 65.74 m2							
No Asbestos							
B004 - R0015 - Home Base Store - 7.8 m2							
No Asbestos							
B004 - R0016 - Personal Effects Storage - 3.8 m2							
No Asbestos							
B004 - R0017 - Community Clinic - 17.73 m2							
No Asbestos							
B004 - R0018 - Movement - 2.61 m2							
No Asbestos							
B004 - R0019 - General Storeroom - 3.35 m2							
No Asbestos							
B004 - R0020 - Personal Effects Storage - 3.81 m2							
No Asbestos							
B004 - R0021 - Movement - 15.12 m2							
No Asbestos							
B004 - R0022 - Home Base Store - 7.78 m2							
No Asbestos							
B004 - R0023 - Home Base - 67.75 m2							
No Asbestos							
B004 - R0024 - Movement - 3.7 m2							
No Asbestos							
B006 - General Learning - 1969 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						

Underfloor Voids	No Asbestos Found							
Interior								
B006 - R0001 - Special Programs Room - 18.51 m2								
No Asbestos								
B006 - R0002 - Movement - 17.1 m2								
No Asbestos								
B006 - R0003 - Home Base Store - 1.86 m2								
No Asbestos								
B006 - R0004 - Personal Effects Storage - 10.49 m2								
No Asbestos								
B006 - R0005 - Toilets - Boys/Girls - 1.53 m2								
Wall Linings Internal	Flat AC Sheeting							
B006 - R0006 - Home Base - 94.41 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B006 - R0007 - Home Base - 64.95 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B006 - R0008 - Personal Effects Storage - 12.33 m2								
No Asbestos								
B006 - R0009 - Movement - 3.17 m2								
No Asbestos								
B006 - R0010 - Home Base - 65.42 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B006 - R0011 - Home Base - 64.96 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B006 - R0012 - Home Base Store - 8.96 m2								
No Asbestos								
B006 - R0013 - Personal Effects Storage - 9.61 m2								
No Asbestos								
B006 - R0014 - Movement - 4.8 m2								
No Asbestos								
B006 - R0015 - Home Base - 65.41 m2								
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	
B006 - R0016 - Movement - 5.47 m2								
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B006 - R0017 - Movement - 5.01 m2								
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B006 - R0018 - Movement - 5.27 m2								
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B007 - General Learning - 1969 - Brick/Veneer								
Exterior								

Gable Ends	Flat AC Sheeting						
Gable Verge Lining	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B007 - R0001 - Movement - 4.54 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	North, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B007 - R0002 - Personal Effects Storage - 6.45 m2							
No Asbestos							
B007 - R0003 - Home Base Store - 3.13 m2							
No Asbestos							
B007 - R0004 - Toilets - Boys/Girls - 4.21 m2							
Wall Linings Internal	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B007 - R0005 - Home Base - 85.75 m2							
No Asbestos							
B008 - Administration - 1969 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	20m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting	6m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	24	North, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	Non Accessible Area						
Interior							
B008 - R0001 - Movement - 60.3 m2							
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	18m2	North, Upper portion, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B008 - R0003 - Movement - 2.98 m2							
No Asbestos							
B008 - R0004 - Clerical Office - 8.32 m2							
No Asbestos							
B008 - R0005 - Entry Vestibule - 12.13 m2							
No Asbestos							
B008 - R0006 - Clerical Office/Workroom - 12.38 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B008 - R0007 - Duplicating Workroom - 14.69 m2							

Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B008 - R0009 - Principal - 20.23 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B008 - R0012 - Deputy Principal - 12.87 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B008 - R0013 - Staff Toilet - 3.83 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B008 - R0014 - Cleaning Distributed Store - 3.8 m2							
No Asbestos							
B008 - R0015 - Staff Toilet - 3.85 m2							
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B008 - R0016 - Movement - 8.73 m2							
No Asbestos							
B008 - R0017 - Staff Kitchen - 20.26 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	2m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B008 - R0018 - Staff Room - 69.8 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	4m2	North, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B008 - R0019 - Sick Bay - 13.88 m2							
No Asbestos							
B009 - General Learning - 1952 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B009 - R0001 - Home Base Store - 5.88 m2							
No Asbestos							
B009 - R0002 - Home Base - 53.72 m2							
No Asbestos							
B009 - R0003 - Home Base - 53.87 m2							
No Asbestos							
B009 - R0004 - Home Base Store - 5.86 m2							
No Asbestos							
B009 - R0005 - Movement - 23.08 m2							
No Asbestos							
B00E - Communal Facilities/Pupil Facilities - 2003 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00E - R0001 - Covered Outdoor Learning Area - 323.08 m2							
No Asbestos							
B00E - R0002 - Main Switch Board - 2.32 m2							

No Asbestos							
B00E - R0003 - Access Shower/Toilet - 5.45 m2							
No Asbestos							
B00E - R0004 - Communications Cupboard - 2.25 m2							
No Asbestos							
B00E - R0005 - Toilets - Girls - 11.82 m2							
No Asbestos							
B00E - R0006 - Garden Store - 14.07 m2							
No Asbestos							
B00E - R0007 - Movement - 4.96 m2							
No Asbestos							
B00E - R0008 - Movement - 2.56 m2							
No Asbestos							
B00E - R0009 - Hall Chair Store - 11.15 m2							
No Asbestos							
B00E - R0010 - Movement - 31.16 m2							
No Asbestos							
B00E - R0011 - Movement - 13.43 m2							
No Asbestos							
B00E - R0012 - Raised Platform - 64.42 m2							
No Asbestos							
B00E - R0013 - Movement - 27.54 m2							
No Asbestos							
B00E - R0014 - Communal/Performance Store - 15.88 m2							
No Asbestos							
B00E - R0015 - Cleaning Supplies - 7.37 m2							
No Asbestos							
B00E - R0016 - Cleaning Distributed Store - 2.89 m2							
No Asbestos							
B00E - R0017 - Movement - 4.59 m2							
No Asbestos							
B00E - R0018 - Communal Space - 198.92 m2							
No Asbestos							
B00E - R0019 - P.E Store - 17.04 m2							
No Asbestos							
B00E - R0020 - Toilets - Boys - 8.85 m2							
No Asbestos							
B00E - R0021 - Sports Store - 16.57 m2							
No Asbestos							
B00E - R0022 - General Assistant/Bulk Store - 15.45 m2							
No Asbestos							
B00E - R0023 - Canteen - 41.31 m2							
No Asbestos							
B00E - R0024 - Canteen Office/Store - 10.66 m2							
No Asbestos							
B00E - R0025 - Movement - 17.7 m2							
No Asbestos							
B010 - Pupil Facilities - 1969 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B010 - R0001 - Drinking Facilities - 13.92 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B010 - R0002 - Handwashing Facilities - 11.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B010 - R0003 - Toilets - Boys - 23.46 m2							
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B011 - Pupil Facilities - 1969 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B011 - R0001 - Handwashing Facilities - 11.74 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B011 - R0002 - Toilets - Girls - 25.2 m2							
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet						
B011 - R0003 - Cleaning Distributed Store - 3.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Crocidolite (blue asbestos)
B011 - R0004 - Garden Store - 9.38 m2							
No Asbestos							
B013 - Pupil Facilities - 1969 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Interior							
B013 - R0001 - Drinking Facilities - 12.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B013 - R0002 - Movement - 8.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B013 - R0003 - Handwashing Facilities - 13.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B013 - R0004 - Toilets - Boys - 39.48 m2							
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B013 - R0005 - Cleaning Supplies - 1.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B013 - R0006 - Movement - .98 m2							
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B013 - R0007 - Cleaning Supplies - 1.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B014 - Pupil Facilities - 1969 - Brick/Block							
Exterior							
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B014 - R0001 - Handwashing Facilities - 24.58 m2							
Partition Walls (Cubides)	Compressed AC Sheet						
B014 - R0002 - Toilets - Girls - 40.98 m2							
Partition Walls (Cubides)	Compressed AC Sheet						
Partition Walls (Cubides)	Compressed AC Sheet						
B015 - Library - 1998 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B015 - R0001 - Reading Area - 231.43 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B015 - R0002 - Communications Room - 12.73 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B015 - R0003 - Library Office/Workroom - 26.65 m2							
Floor Coverings Res/Textile	No Asbestos Found						
B015 - R0004 - Movement - 14.18 m2							
No Asbestos							
B015 - R0005 - Movement - 2.44 m2							
No Asbestos							
B016 - General Learning - 2004 - Fibre Cement Clad							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B016 - R0001 - Movement - 34.73 m2							
No Asbestos							
B016 - R0002 - Practical Activities - 1hb - 19.98 m2							
No Asbestos							

B016 - R0003 - Home Base Store - 5.48 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B016 - R0004 - Home Base - 59.02 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B016 - R0005 - Withdrawal Space - 2hb - 11.64 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B016 - R0006 - Home Base - 59.03 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B016 - R0007 - Home Base Store - 5.48 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B016 - R0008 - Practical Activities - 1hb - 19.97 m2		
No Asbestos		
B017 - General Learning - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B017 - R0001 - External Movement - 79.4 m2		
No Asbestos		
B017 - R0002 - Practical Activities - 19.12 m2		
No Asbestos		
B017 - R0003 - Home Base Store - 6.26 m2		
No Asbestos		
B017 - R0004 - Home Base - 61.12 m2		
No Asbestos		
B017 - R0005 - Withdrawal Space - 2hb - 11.74 m2		
No Asbestos		
B017 - R0006 - Home Base - 61.22 m2		
No Asbestos		
B017 - R0007 - Home Base Store - 6.23 m2		
No Asbestos		
B017 - R0008 - Practical Activities - 18.68 m2		
No Asbestos		
B017 - R0009 - Main Switch Board - .4 m2		
No Asbestos		
B017 - R0010 - Practical Activities - 19.01 m2		
No Asbestos		
B017 - R0011 - Withdrawal Space - 1hb - 7.66 m2		
No Asbestos		
B017 - R0012 - Home Base Store - 6.09 m2		
No Asbestos		
B017 - R0013 - Home Base - 59.81 m2		
No Asbestos		
B017 - R0014 - External Stairs - 11.3 m2		
No Asbestos		
B017 - R1001 - External Movement - 75.99 m2		

No Asbestos	
B017 - R1002 - Practical Activities - 19.22 m2	
No Asbestos	
B017 - R1003 - Home Base Store - 6.09 m2	
No Asbestos	
B017 - R1004 - Home Base - 61.07 m2	
No Asbestos	
B017 - R1005 - Withdrawal Space - 2hb - 11.85 m2	
No Asbestos	
B017 - R1006 - Home Base - 61.19 m2	
No Asbestos	
B017 - R1007 - Home Base Store - 6.13 m2	
No Asbestos	
B017 - R1008 - Practical Activities - 19.43 m2	
No Asbestos	
B017 - R1009 - Practical Activities - 19.08 m2	
No Asbestos	
B017 - R1010 - Withdrawal Space - 1hb - 7.66 m2	
No Asbestos	
B017 - R1011 - Home Base Store - 6.1 m2	
No Asbestos	
B017 - R1012 - Home Base - 59.51 m2	
No Asbestos	
B017 - R1013 - External Stairs - 17.02 m2	
No Asbestos	

Demountables**OS 601 11052 - Learning Unit - Standard/Withdrawal - Placement Date : 23-JAN-2001****Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 601 11240 - Learning Unit - Standard/Withdrawal - Placement Date : 22-DEC-2002**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 602 11243 - Learning Unit - Standard With P.A.A. - Placement Date : 10-JUL-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 11575 - Learning Unit - Standard/Withdrawal - Placement Date : 22-DEC-2002**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior**R1- Entry**

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 751 11602 - Learning Unit - ESL - Placement Date : 02-DEC-2014**Exterior**

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
---------------	------------------	---------	------------------

Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Esl			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos
R2- Esl			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos
OS 601 11642 - Learning Unit - Standard/Withdrawal - Placement Date : 05-JAN-1999			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 602 12869 - Learning Unit - Standard With P.A.A. - Placement Date : 04-JAN-2016			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 603 13029 - Learning Unit - Standard With P.A.A. A/C - Placement Date : 06-DEC-2005			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 601 13086 - Learning Unit - Standard/Withdrawal - Placement Date : 28-FEB-2014			
No Asbestos Found			
OS 601 15611 - Learning Unit - Standard/Withdrawal - Placement Date : 22-DEC-2002			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos