


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Forestville Public School (4019)
Region:	Northern Sydney AMU
State Electorate:	Wakehurst
Local Government Area:	Northern Beaches

Last Reviewed By:	Greencap 13-AUG-2014
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

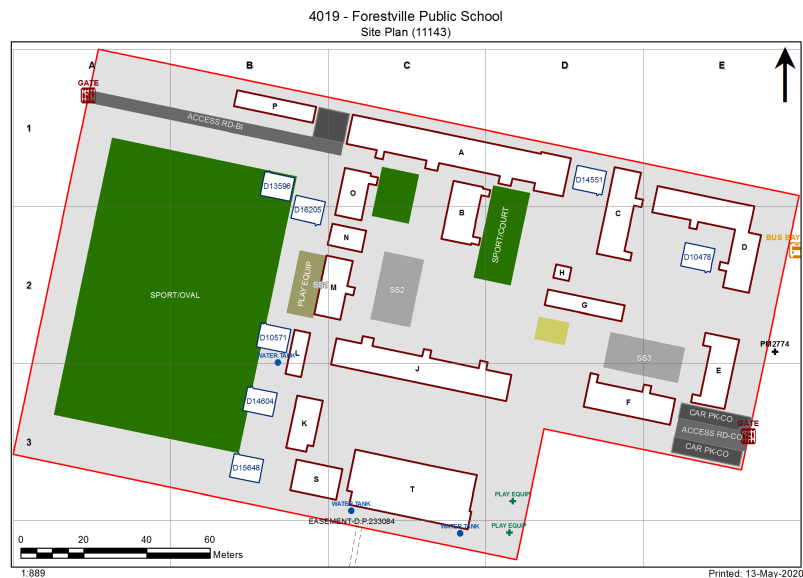

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning - 1959 - Brick/Block							
Exterior							
Gable Verge Lining	Flat AC Sheeting	25m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - Home Base - 64.85 m2							
No Asbestos							
B00A - R0002 - Home Base Store - 4.8 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0003 - Personal Effects Storage - 7.93 m2							
Wall Linings Internal - Electrical Box/ Cabinet	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0004 - Personal Effects Storage - 3.66 m2							
No Asbestos							
B00A - R0005 - Movement - 3.11 m2							
No Asbestos							
B00A - R0006 - Movement - 4.01 m2							
No Asbestos							
B00A - R0007 - Movement - 4.9 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0008 - Home Base Store - 7.83 m2							
No Asbestos							
B00A - R0009 - Home Base - 64.85 m2							
No Asbestos							
B00A - R0010 - Home Base - 64.85 m2							
No Asbestos							
B00A - R0011 - Home Base Store - 7.63 m2							
No Asbestos							
B00A - R0012 - Movement - 8.63 m2							
No Asbestos							
B00A - R0013 - Personal Effects Storage - 3.65 m2							
No Asbestos							
B00A - R0014 - Personal Effects Storage - 3.65 m2							
No Asbestos							
B00A - R0015 - Movement - 8.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0016 - Home Base Store - 7.63 m2							
No Asbestos							
B00A - R0017 - Home Base - 64.58 m2							
No Asbestos							

B00A - R0018 - Home Base - 64.67 m2							
No Asbestos							
B00A - R0019 - Home Base Store - 7.54 m2							
No Asbestos							
B00A - R0020 - Cleaning Distributed Store - 3.61 m2							
No Asbestos							
B00A - R0021 - Staff Room Annexe - 15.71 m2							
No Asbestos							
B00A - R0022 - General Storeroom - 2.7 m2							
No Asbestos							
B00A - R0023 - Duplicating Workroom - 18.83 m2							
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0024 - Duplicating Workroom - 18.39 m2							
Wall Linings Internal - Electrical Box/ Cabinet	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0025 - General Storeroom - 3.91 m2							
No Asbestos							
B00A - R0026 - Movement - 36.55 m2							
Floor Coverings Res/Textile	Vinyl Tiles	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0027 - Movement - 8.4 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0028 - Staff Toilet - 6.59 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0029 - Staff Toilet - 5.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0030 - General Storeroom - .79 m2							
No Asbestos							
B00A - R0031 - General Storeroom - 1.61 m2							
Floor Coverings Res/Textile	Vinyl Tiles	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - Staff Toilet - 3.87 m2							
Wall Linings Internal	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0033 - Principal - 21.67 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0034 - Clerical Office - 17.63 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0035 - General Storeroom - 13.48 m2							
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0036 - Sick Bay - 6.73 m2							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0037 - General Storeroom - 11.47 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0038 - General Assistant/Bulk Store - 4.39 m2							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00A - R0039 - Entry Vestibule - 33.35 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0040 - Movement - 6.19 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00A - R0041 - General Storeroom - 3.13 m2							
No Asbestos							
B00B - Staff Facilities - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00B - R0001 - Movement - 4.44 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00B - R0002 - Movement - 3.88 m2							
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00B - R0003 - General Storeroom - 3.83 m2							
No Asbestos							
B00B - R0004 - General Storeroom - 7.97 m2							
No Asbestos							
B00B - R0005 - Staff Room - 65.67 m2							

No Asbestos							
B00B - R0006 - Staff Room - 64.95 m2							
No Asbestos							
B00B - R0007 - Music Store - 7.99 m2							
No Asbestos							
B00B - R0008 - General Storeroom - 3.83 m2							
No Asbestos							
B00B - R0009 - Movement - 3.95 m2							
No Asbestos							
B00B - R0010 - Movement - 4.44 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - Library - 1959 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	30m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Eaves Linings	Flat AC Sheeting	6m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00C - R0001 - Reading Area - 57.3 m2							
No Asbestos							
B00C - R0002 - Movement - 4.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R0003 - Movement - 6.32 m2							
No Asbestos							
B00C - R0004 - Library Office/Workroom - 21.16 m2							
Electrical - Mounting Board	Resinous Board	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00C - R0005 - Reading Area - 114.28 m2							
No Asbestos							
B00C - R0006 - General Storeroom - 3.94 m2							
No Asbestos							
B00C - R0007 - General Storeroom - 6.37 m2							
No Asbestos							
B00C - R0008 - Movement - 3.19 m2							
No Asbestos							
B00C - R0009 - Movement - 4.57 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - General Learning - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Gable Verge Lining	Flat AC Sheeting	40m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Staff Toilet - 3.36 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0002 - General Storeroom - 2.2 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0003 - Staff Room Annexe - 18.77 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0004 - Interview - 21.3 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0005 - General Storeroom - 10.26 m2							
No Asbestos							
B00D - R0006 - General Storeroom - 6.35 m2							
Electrical - Mounting Board	Resinous Board	1	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00D - R0007 - Movement - 3.84 m2							
No Asbestos							
B00D - R0008 - Movement - 17.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0009 - Home Base Store - 4.52 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0010 - Home Base - 56.91 m2							
No Asbestos							
B00D - R0011 - Movement - 51.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00D - R0012 - Home Base - 80.2 m2							
No Asbestos							
B00D - R0013 - Home Base Store - 2.51 m2							
No Asbestos							
B00D - R0014 - Staff Toilet - 1.46 m2							
No Asbestos							
B00D - R0015 - Personal Effects Storage - 7.89 m2							
No Asbestos							
B00D - R0016 - Movement - 6.41 m2							
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos

B00D - R0017 - Movement - 4.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0018 - K.L.A. Store - 57.44 m2							
No Asbestos							
B00D - R0019 - Sports Store - 18.5 m2							
No Asbestos							
B00D - R0020 - Cleaning Distributed Store - 3.22 m2							
No Asbestos							
B00D - R0021 - Staff Toilet - 2.47 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0022 - Movement - 2.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0023 - Movement - 1.25 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R9001 - General Storeroom - 51.02 m2							
No Asbestos							
B00E - Communal Facilities - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	50m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Staff Toilet - 3.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0002 - Movement - 3.29 m2							
No Asbestos							
B00E - R0003 - Movement - 4.03 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00E - R0007 - Movement - 3.43 m2							
No Asbestos							
B00E - R0008 - Movement - 4.86 m2							

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00E - R0009 - Personal Effects Storage - 6.41 m2							
No Asbestos							
B00E - R0010 - Personal Effects Storage - 6.14 m2							
No Asbestos							
B00E - R0011 - Home Base - 62.24 m2							
No Asbestos							
B00E - R0012 - Practical Activities - 9.2 m2							
No Asbestos							
B00E - R0013 - Withdrawal Space - 2hb - 11.86 m2							
No Asbestos							
B00E - R0014 - Home Base Store - 5.79 m2							
No Asbestos							
B00E - R0015 - Home Base - 60.65 m2							
No Asbestos							
B00F - General Learning - 1959 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Gable Verge Lining	Flat AC Sheeting	20m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Interior							
B00F - R0001 - Home Base - 57.52 m2							
No Asbestos							
B00F - R0002 - Home Base Store - 3.83 m2							
No Asbestos							
B00F - R0003 - Personal Effects Storage - 6.31 m2							
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00F - R0004 - Personal Effects Storage - 6.31 m2							
No Asbestos							
B00F - R0005 - Movement - 6.32 m2							
No Asbestos							
B00F - R0006 - Movement - 4.99 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00F - R0007 - Home Base - 57.2 m2							
No Asbestos							
B00F - R0008 - Home Base Store - 3.83 m2							
No Asbestos							
B00F - R0009 - Home Base - 57.2 m2							
No Asbestos							
B00F - R0010 - Home Base Store - 3.85 m2							
No Asbestos							
B00F - R0011 - Personal Effects Storage - 6.33 m2							
No Asbestos							
B00F - R0012 - Movement - 3.04 m2							
No Asbestos							

B00F - R0013 - Movement - 4.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - Pupil Facilities/Building Services - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00G - R0001 - Toilets - Boys - 34.27 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00G - R0002 - General Assistant/Bulk Store - 31.93 m2							
No Asbestos							
B00G - R0003 - Toilets - Girls - 42.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00H - Pupil Facilities - 1959 - Timber							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00H - R0001 - Drinking Facilities - 9.99 m2							
No Asbestos							
B00H - R0002 - Drinking Facilities - 9.66 m2							
No Asbestos							
B00J - General Learning - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	100m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00J - R0001 - Home Base - 57.52 m2							
No Asbestos							
B00J - R0002 - Home Base Store - 6.09 m2							
No Asbestos							
B00J - R0003 - Personal Effects Storage - 8.35 m2							
Wall Linings Internal - Electrical Box/ Cabinet	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00J - R0004 - Movement - 6.32 m2							
No Asbestos							

B00J - R0005 - Home Base Store - 6.09 m2							
No Asbestos							
B00J - R0006 - Home Base - 57.04 m2							
No Asbestos							
B00J - R0007 - Home Base - 57.12 m2							
No Asbestos							
B00J - R0008 - Home Base Store - 6.16 m2							
No Asbestos							
B00J - R0009 - Personal Effects Storage - 8.31 m2							
No Asbestos							
B00J - R0010 - Movement - 6.39 m2							
No Asbestos							
B00J - R0011 - Movement - 4.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00J - R0012 - Home Base Store - 6.16 m2							
No Asbestos							
B00J - R0013 - Home Base - 57.52 m2							
No Asbestos							
B00J - R0014 - Home Base - 56.73 m2							
No Asbestos							
B00J - R0015 - Home Base Store - 5.2 m2							
No Asbestos							
B00J - R0016 - Personal Effects Storage - 9.97 m2							
No Asbestos							
B00J - R0017 - Movement - 6.41 m2							
No Asbestos							
B00J - R0018 - Movement - 4.88 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00J - R0019 - Home Base Store - 5.2 m2							
No Asbestos							
B00J - R0020 - Home Base - 57.36 m2							
No Asbestos							
B00J - R0021 - Movement - 4.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00K - General Learning - 1959 - Timber							
Exterior							
External Roof Structure - Barge Board/Capping	Fibre Cement Moulded	3	East	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Cladding	Flat AC Sheeting	90m2	North facing, South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Interior							
B00K - R0001 - Special Programs Room - 47.01 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00K - R0002 - Home Base - 45.92 m2							

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00K - R0003 - Home Base Store - 3.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00K - R0004 - General Storeroom - 8.56 m2							
No Asbestos							
B00K - R0005 - Staff Toilet - 2.7 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	South facing, East facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00K - R0006 - Movement - 21.94 m2							
No Asbestos							
B00L - Pupil Facilities - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	5m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00L - R0001 - Toilets - Boys - 37.23 m2							
No Asbestos							
B00L - R0002 - Handwashing Facilities - 11.28 m2							
No Asbestos							
B00L - R0003 - General Storeroom - 11.87 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00M - General Learning - 1959 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	15m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00M - R0001 - Home Base - 57.83 m2							
No Asbestos							
B00M - R0002 - Home Base Store - 6.69 m2							
No Asbestos							
B00M - R0003 - Personal Effects Storage - 7.21 m2							
Wall Linings Internal - Electrical Box / Cabinet	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)

Electrical - Mounting Board	Resinous Board	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00M - R0004 - No Access - 6.14 m2							
No Asbestos							
B00M - R0005 - Movement - 5.06 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00M - R0006 - Home Base Store - 6.69 m2							
No Asbestos							
B00M - R0007 - Home Base - 57.83 m2							
No Asbestos							
B00N - Pupil Facilities - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00N - R0001 - Staff Toilet - 3.35 m2							
No Asbestos							
B00N - R0002 - Canteen Office/Store - 1.82 m2							
No Asbestos							
B00N - R0003 - Canteen - 31.25 m2							
No Asbestos							
B00N - R0004 - Canteen Office/Store - 2.75 m2							
No Asbestos							
B00N - R0005 - Movement - 24.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00O - General Learning - 1959 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting						
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00O - R0001 - Movement - 4.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
B00O - R0002 - Uniform Shop - 21.62 m2							
No Asbestos							
B00O - R0003 - Special Programs Room - 92.93 m2							
Wall Linings Internal - Electrical Box/ Cabinet	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00P - Pupil Facilities - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Ceiling Voids - Flat Roof	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00P - R0001 - Toilets - Girls - 40.4 m2							
No Asbestos							
B00P - R0002 - Handwashing Facilities - 15.96 m2							
Wall Linings Internal	Flat AC Sheeting	4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos), Amosite (brown asbestos)
B00P - R0003 - Toilets - Girls - 25.08 m2							
No Asbestos							
B00P - R0004 - Sports Store - 2.89 m2							
No Asbestos							
B00P - R0005 - General Storeroom - 4.67 m2							
No Asbestos							
B00P - R0006 - Sports Store - 16.64 m2							
No Asbestos							
B00P - R0007 - General Storeroom - 4.52 m2							
No Asbestos							
B00S - Other-Community Use - 1959 - Steel							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00S - R0001 - General Storeroom - 5.64 m2							
No Asbestos							
B00S - R0004 - Other-Community Use - 5.64 m2							
No Asbestos							
B00S - R0005 - Other-Community Use - 22.41 m2							
No Asbestos							
B00S - R0006 - Out Of School Hours Care Centre - 105.26 m2							
No Asbestos							
B00T - Communal Facilities - 2010 - Brick/Veneer							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B00T - R0001 - Covered Outdoor Learning Area - 226.08 m2							
No Asbestos							
B00T - R0002 - Communal Space - 199.76 m2							
No Asbestos							
B00T - R0003 - Chair Storeroom - 11.16 m2							
No Asbestos							
B00T - R0004 - Communal/Performance Store - 10.92 m2							
No Asbestos							
B00T - R0005 - P.E. Store - 16.36 m2							
No Asbestos							
B00T - R0006 - Toilets - Girls - 7.36 m2							
No Asbestos							

B00T - R0007 - Sound Cupboard - 2.04 m2	
No Asbestos	
B00T - R0008 - Toilet - Lobby - 2.53 m2	
No Asbestos	
B00T - R0009 - Toilet - Lobby - 3.46 m2	
No Asbestos	
B00T - R0010 - Toilets - Boys - 5.79 m2	
No Asbestos	
B00T - R0011 - Cleaning Distributed Store - 3.56 m2	
No Asbestos	
B00T - R0012 - Plant - 1.6 m2	
No Asbestos	
B00T - R0013 - Main Switch Board - 3.26 m2	
No Asbestos	
B00T - R0014 - Access Shower/Toilet/Change - 6.9 m2	
No Asbestos	
B00T - R0015 - Canteen - 41.62 m2	
No Asbestos	
B00T - R0016 - Canteen Office/Store - 10.21 m2	
No Asbestos	
B00T - R0017 - Raised Platform - 58.59 m2	
No Asbestos	
B00T - R0018 - Movement - 16.26 m2	
No Asbestos	
B00T - R0019 - Movement - 12.98 m2	
No Asbestos	
B00T - R0020 - Movement - 5.96 m2	
No Asbestos	

Demountables

OS 602 10478 - Learning Unit - Standard With P.A.A. - Placement Date : 07-NOV-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 10571 - Learning Unit - Standard With P.A.A. - Placement Date : 13-JAN-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13596 - Learning Unit - Standard With P.A.A. - Placement Date : 12-JAN-2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 14551 - Learning Unit - Standard With P.A.A. - Placement Date : 20-NOV-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 14604 - Learning Unit - Standard With P.A.A. - Placement Date : 28-APR-2012

No Asbestos Found

OS 602 15648 - Learning Unit - Standard With P.A.A. - Placement Date : 13-MAR-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 16205 - Learning Unit - Standard With P.A.A. - Placement Date : 22-FEB-2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found