


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Hastings Public School (4524)
Region:	North Coast AMU
State Electorate:	Port Macquarie
Local Government Area:	Port Macquarie-Hastings

Last Reviewed By:	WSP 25-OCT-2016
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

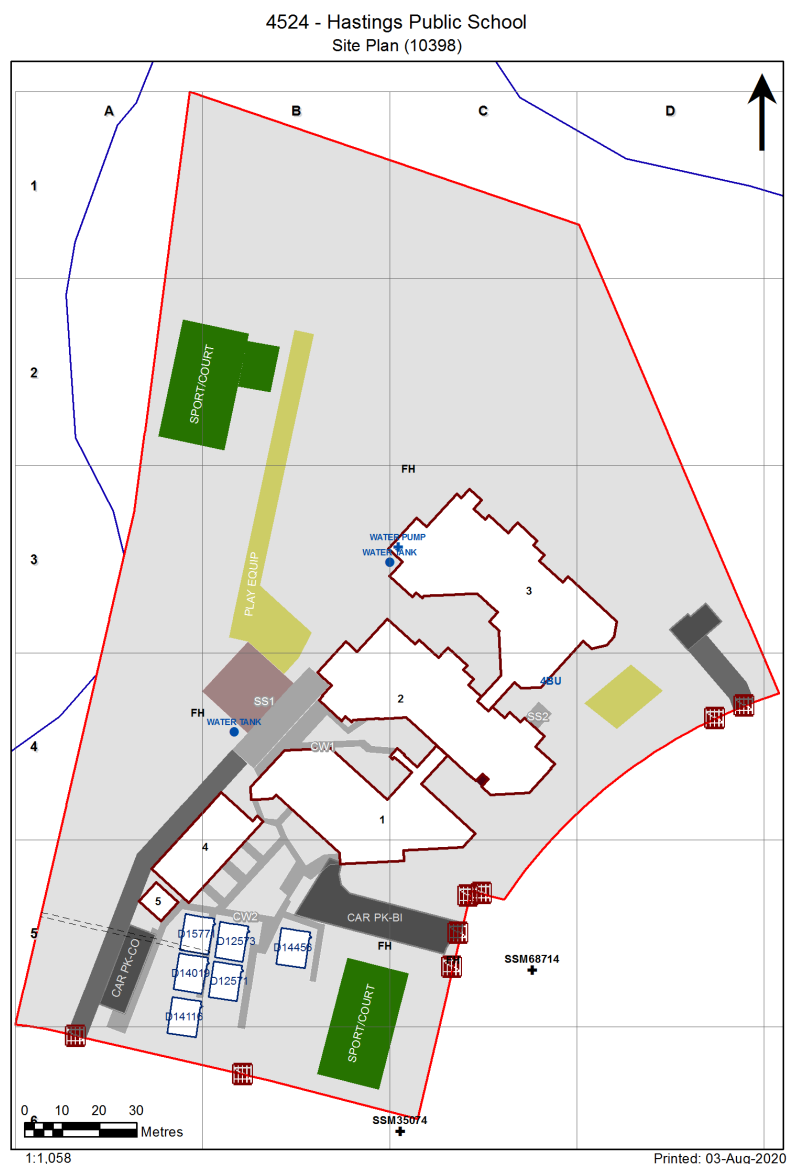

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B001 - Administration/Communal Facilities - 1981 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Interior							
B001 - R0001 - Staff Toilet - 1.83 m2							
No Asbestos							
B001 - R0002 - Community Clinic - 19.51 m2							
No Asbestos							
B001 - R0003 - Movement - 5.22 m2							
No Asbestos							
B001 - R0004 - Deputy Principal - 13.6 m2							
No Asbestos							
B001 - R0005 - Staff Toilet - 8.47 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0006 - Staff Toilet - 8.47 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0007 - Interview - 9.65 m2							
No Asbestos							
B001 - R0008 - Interview - 16.38 m2							
No Asbestos							
B001 - R0009 - Sick Bay - 12.05 m2							
No Asbestos							
B001 - R0010 - Principal - 20.71 m2							
No Asbestos							
B001 - R0011 - Clerical Office - 13.25 m2							
No Asbestos							
B001 - R0012 - Staff Room - 71.25 m2							
No Asbestos							
B001 - R0013 - Security Store - 11.23 m2							
No Asbestos							
B001 - R0014 - Entry Vestibule - 47.63 m2							
No Asbestos							
B001 - R0015 - Duplicating Workroom - 32.38 m2							
No Asbestos							
B001 - R0016 - External Movement - 3.07 m2							
No Asbestos							
B001 - R0018 - General Storeroom - 21.27 m2							
No Asbestos							
B001 - R0019 - Communal Space - 191.58 m2							
No Asbestos							
B001 - R0020 - P.E Store - 12.68 m2							
No Asbestos							
B001 - R0021 - General Storeroom - 5.9 m2							
No Asbestos							
B001 - R0022 - Cleaning Supplies - 1.41 m2							
No Asbestos							
B001 - R0023 - Main Switch Board - 6.37 m2							

No Asbestos							
B001 - R0024 - Toilets - Boys - 9.99 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0025 - Toilets - Girls - 9.99 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0026 - Canteen - 47.62 m2							
No Asbestos							
B001 - R0027 - Garden Store - 12.71 m2							
No Asbestos							
B001 - R0028 - Canteen Office/Store - 4.59 m2							
No Asbestos							
B001 - R0029 - Movement - 5.67 m2							
No Asbestos							
B001 - R0030 - Staff Toilet - 2.18 m2							
No Asbestos							
B001 - R0031 - Distribution Board - .39 m2							Note: No inspection of live electrical installation
No Asbestos							
B001 - R0032 - External Movement - 1.7 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0033 - Distribution Board - .9 m2							Note: No inspection of live electrical installation
No Asbestos							
B001 - R0034 - Movement - 4.93 m2							
No Asbestos							
B001 - R0035 - External Movement - 82.85 m2							
Ceiling Structures/Linings	Flat AC Sheeting	83m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B001 - R0036 - Movement - 67.27 m2							
No Asbestos							
B001 - R0037 - Raised Platform - 94.3 m2							
No Asbestos							
B001 - R0038 - Movement - 27 m2							
No Asbestos							
B001 - R0039 - External Movement - 9.7 m2							
Requires Inspection							
B001 - R0040 - Lift - 1.51 m2							
Requires Inspection							
B001 - R0041 - Plant - .75 m2							
Requires Inspection							
B001 - R0042 - External Movement - 54.8 m2							
Requires Inspection							
B002 - General Learning - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B002 - R0001 - Home Base - 66.65 m2							
No Asbestos							
B002 - R0002 - Home Base Store - 6.78 m2							
No Asbestos							

B002 - R0003 - Distribution Board - .36 m2							Note: No inspection of live electrical installation
No Asbestos							
B002 - R0004 - Home Base Store - 4.08 m2							
No Asbestos							
B002 - R0005 - Staff Room Annexe - 15.24 m2							
No Asbestos							
B002 - R0006 - Practical Activities - 1hb - 47.91 m2							
No Asbestos							
B002 - R0008 - Home Base - 58.78 m2							
No Asbestos							
B002 - R0009 - Home Base Store - 5.75 m2							
No Asbestos							
B002 - R0010 - Toilets - Girls - 6.66 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0011 - Toilets - Boys - 5.75 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0012 - Cleaning Supplies - 7.25 m2							
No Asbestos							
B002 - R0013 - Distribution Board - .64 m2							Note: No inspection of live electrical installation
No Asbestos							
B002 - R0014 - General Assistant/Bulk Store - 7.01 m2							
No Asbestos							
B002 - R0015 - Withdrawal Space - 1hb - 12.27 m2							
No Asbestos							
B002 - R0016 - Home Base - 61.8 m2							
No Asbestos							
B002 - R0017 - Home Base Store - 6.59 m2							
No Asbestos							
B002 - R0018 - Movement - 83.81 m2							
No Asbestos							
B002 - R0019 - Cleaning Supplies - 2.09 m2							
No Asbestos							
B002 - R0020 - Disabled Toilet - 2.97 m2							
No Asbestos							
B002 - R0021 - Toilets - Boys - 8.65 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0022 - Toilets - Girls - 8.94 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0023 - Home Base Store - 6.59 m2							
No Asbestos							
B002 - R0024 - Home Base - 57.44 m2							
No Asbestos							
B002 - R0025 - Withdrawal Space - 1hb - 12.27 m2							
No Asbestos							
B002 - R0026 - Home Base - 64.7 m2							
No Asbestos							
B002 - R0027 - Home Base Store - 5.75 m2							
No Asbestos							
B002 - R0028 - Practical Activities - 1hb - 46.48 m2							

No Asbestos							
B002 - R0029 - Home Base - 58.76 m2							
No Asbestos							
B002 - R0030 - General Storeroom - 5.89 m2							
No Asbestos							
B002 - R0031 - General Storeroom - 5.89 m2							
No Asbestos							
B002 - R0032 - Home Base Store - 6.03 m2							
No Asbestos							
B002 - R0033 - Home Base Store - 5.89 m2							
No Asbestos							
B002 - R0034 - Practical Activities - 1hb - 47.66 m2							
No Asbestos							
B002 - R0035 - Staff Room Annexe - 15.03 m2							
No Asbestos							
B002 - R0036 - Home Base Store - 4.91 m2							
No Asbestos							
B002 - R0037 - Withdrawal Space - 1hb - 16.38 m2							
No Asbestos							
B002 - R0038 - Home Base - 58.77 m2							
No Asbestos							
B002 - R0039 - Toilets - Boys - 9.62 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0040 - Toilets - Girls - 11.63 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0041 - Home Base - 58.79 m2							
No Asbestos							
B002 - R0042 - Home Base Store - 5.85 m2							
No Asbestos							
B002 - R0043 - Withdrawal Space - 1hb - 12.27 m2							
No Asbestos							
B002 - R0044 - Home Base - 59.02 m2							
No Asbestos							
B002 - R0045 - Movement - 20.92 m2							
No Asbestos							
B002 - R0046 - Movement - 7.73 m2							
No Asbestos							
B002 - R0047 - Movement - 9.76 m2							
No Asbestos							
B002 - R0048 - Kiln Room - 2.04 m2							
No Asbestos							
B002 - R0049 - Distribution Board - .9 m2						Note: No inspection of live electrical installation	
No Asbestos							
B002 - R0050 - Movement - 29.27 m2							
No Asbestos							
B002 - R0051 - External Movement - 10.24 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0052 - External Movement - 6.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B002 - R0053 - External Movement - 6.97 m2							
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0054 - External Movement - 10.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0055 - External Movement - 10.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0056 - External Movement - 17.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0057 - External Movement - 16.89 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0058 - External Movement - 12.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0059 - External Movement - 12.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0060 - External Movement - 11.32 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0061 - External Movement - 10.93 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B002 - R0062 - Personal Effects Storage - 1.94 m2							
No Asbestos							
B002 - R0063 - External Movement - 4.27 m2							
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - Library - 1981 - Brick/Block							
Exterior							
Ceiling Voids - Raked Ceiling	No Asbestos Found						
Underfloor Voids - Slab on Ground	No Asbestos Found						
Interior							
B003 - R0001 - Communications Room - 40.07 m2							
No Asbestos							
B003 - R0002 - K.L.A. Store - 14.78 m2							
No Asbestos							
B003 - R0003 - Library Office/Workroom - 26.95 m2							
No Asbestos							
B003 - R0004 - Reading Area - 236.81 m2							
No Asbestos							
B003 - R0005 - K.L.A. Store - 24.02 m2							
No Asbestos							
B003 - R0006 - K.L.A. Store - 13.46 m2							
No Asbestos							
B003 - R0007 - Security Store - 10.99 m2							
No Asbestos							
B003 - R0009 - Home Base - 58.85 m2							
No Asbestos							
B003 - R0010 - Cleaning Supplies - 2.63 m2							

No Asbestos							
B003 - R0011 - Toilets - Boys - 10.44 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0012 - Toilets - Girls - 9.28 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0013 - Home Base Store - 6.68 m2							
No Asbestos							
B003 - R0014 - Withdrawal Space - 1hb - 12.27 m2							
No Asbestos							
B003 - R0015 - Home Base - 64.13 m2							
No Asbestos							
B003 - R0016 - Home Base Store - 5.76 m2							
No Asbestos							
B003 - R0017 - Practical Activities - 1hb - 47.13 m2							
No Asbestos							
B003 - R0018 - Staff Room Annexe - 14.94 m2							
No Asbestos							
B003 - R0019 - Craft Store - 5.99 m2							
No Asbestos							
B003 - R0020 - General Storeroom - 5.99 m2							
No Asbestos							
B003 - R0021 - Home Base Store - 5.85 m2							
No Asbestos							
B003 - R0022 - Home Base Store - 5.96 m2							
No Asbestos							
B003 - R0023 - Home Base - 58.36 m2							
No Asbestos							
B003 - R0024 - Withdrawal Space - 1hb - 16.47 m2							
No Asbestos							
B003 - R0025 - P.E Store - 22.36 m2							
No Asbestos							
B003 - R0026 - Home Base - 59.78 m2							
No Asbestos							
B003 - R0027 - Home Base - 59.01 m2							
No Asbestos							
B003 - R0028 - Home Base Store - 5.68 m2							
No Asbestos							
B003 - R0029 - Practical Activities - 1hb - 49.67 m2							
No Asbestos							
B003 - R0030 - Home Base Store - 4.07 m2							
No Asbestos							
B003 - R0031 - Home Base - 58.39 m2							
No Asbestos							
B003 - R0032 - Withdrawal Space - 1hb - 12.27 m2							
No Asbestos							
B003 - R0033 - Movement - 20.72 m2							
No Asbestos							
B003 - R0034 - Movement - 9.49 m2							
No Asbestos							
B003 - R0035 - Movement - 7.86 m2							

No Asbestos							
B003 - R0036 - Distribution Board - 1.18 m2							Note: No inspection of live electrical installation
No Asbestos							
B003 - R0037 - Distribution Board - .73 m2							Note: No inspection of live electrical installation
No Asbestos							
B003 - R0038 - External Movement - 12.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0039 - External Movement - 10.67 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0040 - External Movement - 10.44 m2							
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0041 - External Movement - 17.95 m2							
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0042 - External Movement - 16.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0043 - External Movement - 12.31 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0044 - External Movement - 12.41 m2							
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0045 - External Movement - 11.33 m2							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B003 - R0046 - Personal Effects Storage - 1.93 m2							
No Asbestos							
B003 - R0047 - Personal Effects Storage - 1.96 m2							
No Asbestos							
B003 - R0048 - External Movement - 45.19 m2							
No Asbestos							
B003 - R0049 - No Access - 13.34 m2							
No Asbestos							
B003 - R0050 - Staff Room Annexe - 28.93 m2							
No Asbestos							
B003 - R0052 - Toilets-Unisex - 9.52 m2							
Requires Inspection							
B003 - R0053 - General Storeroom - 4.68 m2							
Requires Inspection							
B003 - R0054 - Lift - 1.41 m2							
Requires Inspection							
B003 - R0055 - Movement - 144.07 m2							
Requires Inspection							
B004 - General Learning - 2011 - Brick/Veneer							
Exterior							
Underfloor Voids - Slab on Ground	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						
Ceiling Voids	No Asbestos Found						

Interior	
B004 - R0002 - Practical Activities - 1hb - 19.3 m2	
No Asbestos	
B004 - R0003 - Home Base Store - 6.23 m2	
No Asbestos	
B004 - R0004 - Home Base - 60.47 m2	
No Asbestos	
B004 - R0005 - Withdrawal Space - 2hb - 11.58 m2	
No Asbestos	
B004 - R0006 - Home Base - 60.09 m2	
No Asbestos	
B004 - R0007 - Home Base Store - 6.23 m2	
No Asbestos	
B004 - R0008 - Practical Activities - 1hb - 18.61 m2	
No Asbestos	
B004 - R0009 - No Access - 4.68 m2	
No Asbestos	
B004 - R0010 - Special Programs Store - 5.63 m2	
No Asbestos	
B004 - R0011 - Special Programs Room - 40.22 m2	
No Asbestos	
B004 - R0012 - No Access - 12.42 m2	
No Asbestos	
B004 - R0013 - Uniform Shop - 16.13 m2	
No Asbestos	
B004 - R0014 - General Storeroom - 12.38 m2	
No Asbestos	
B004 - R0015 - Distribution Board - .59 m2	
No Asbestos	Note: No inspection of live electrical installation
B004 - R0016 - External Movement - 71.96 m2	
No Asbestos	
B004 - R1001 - External Movement - 61.41 m2	
No Asbestos	
B004 - R1002 - Practical Activities - 1hb - 19.28 m2	
No Asbestos	
B004 - R1003 - Home Base Store - 6.06 m2	
No Asbestos	
B004 - R1004 - Home Base - 60.52 m2	
No Asbestos	
B004 - R1005 - Withdrawal Space - 2hb - 11.77 m2	
No Asbestos	
B004 - R1006 - Home Base - 60.6 m2	
No Asbestos	
B004 - R1007 - Home Base Store - 6.14 m2	
No Asbestos	
B004 - R1008 - Practical Activities - 1hb - 18.64 m2	
No Asbestos	
B004 - R1009 - Withdrawal Space - 1hb - 8.97 m2	
No Asbestos	
B004 - R1010 - Home Base Store - 5.94 m2	
No Asbestos	
B004 - R1011 - Home Base - 59.28 m2	

No Asbestos		
B004 - R1012 - Practical Activities - 1hb - 19.58 m2		
No Asbestos		
B004 - R1013 - Distribution Board - .61 m2		Note: No inspection of live electrical installation
No Asbestos		
B004 - R9001 - General Assistant/Bulk Store - 289.32 m2		
No Asbestos		
B005 - Pupil Facilities - 2011 - Brick/Veneer		
Exterior		
Underfloor Voids - Slab on Ground	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B005 - R0001 - Access Shower/Toilet/Change - 5.82 m2		
No Asbestos		
B005 - R0002 - Toilets - Girls - 22.51 m2		
No Asbestos		
B005 - R0003 - Toilets - Boys - 15.97 m2		
No Asbestos		

Demountables

OS 602 12571 - Learning Unit - Standard With P.A.A. - Placement Date : 21-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 12573 - Learning Unit - Standard With P.A.A. - Placement Date : 21-DEC-2011

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 14019 - Learning Unit - Standard With P.A.A. - Placement Date : 06-NOV-2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 14116 - Learning Unit - Standard With P.A.A. - Placement Date : 30-SEP-2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 14456 - Learning Unit - Standard With P.A.A. - Placement Date : 20-OCT-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 15771 - Learning Unit - Standard With P.A.A. - Placement Date : 18-OCT-2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found