


# Asbestos Register

(Hazardous Materials and Risk Assessment)

|                               |   |
|-------------------------------|---|
| <b>School:</b>                | <b>Henry Kendall High School (8467)</b> |
| <b>Region:</b>                | <b>Hunter/Central Coast AMU</b>         |
| <b>State Electorate:</b>      | <b>Gosford</b>                          |
| <b>Local Government Area:</b> | <b>Central Coast</b>                    |

|                          |                             |
|--------------------------|-----------------------------|
| <b>Last Reviewed By:</b> | <b>WSP 29-JUN-2017</b>      |
| <b>Last Revised By:</b>  | <b>Greencap 25-JUL-2020</b> |

|  |           |
|--|-----------|
| Historical Fibro In Grounds Investigations/Events  | <b>No</b> |
| <p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p> |           |

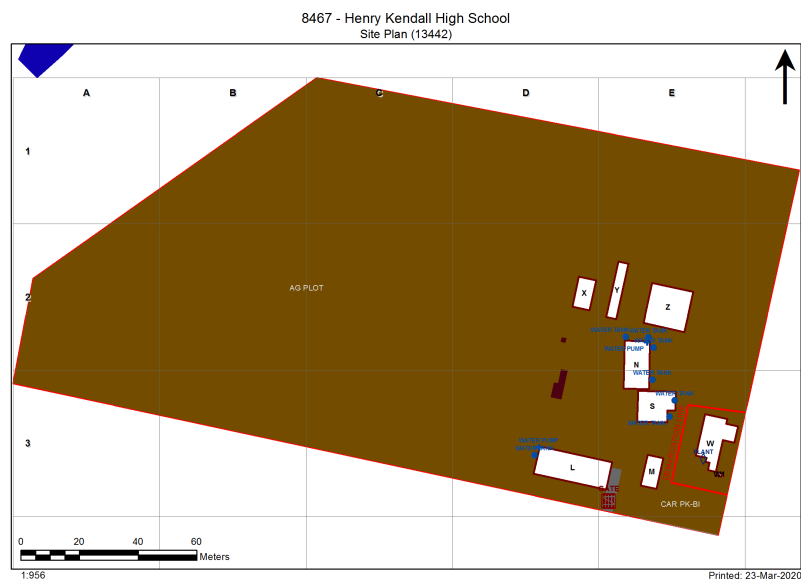

# Preface to Asbestos Register

## Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
  - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
  - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
  - o Any wall cavity
  - o Sub floor area, particularly formwork for slabs in/on ground,
  - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.  
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

## Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

## Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

## Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

## Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

## Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

### 3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

| Rating                     | Description  |
|----------------------------|--|
| Good condition (1)         | For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles  |
| Minimal damage (2)         | For non-friable asbestos that has a very small amount of damage, eg hairline cracks.   |
| Some damage / unsealed (3) | For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed. |
| Poor condition (4)         | For non-friable asbestos that has extensive damage. Visible asbestos debris  |
| Friable asbestos (5)       | Any occurrence of friable asbestos   |

| Product   | Material Description                      | Extent | Location | Material Condition         | Risk Status | Remediation Priority  | Result   |
|---|---|--------|----------|----------------------------|-------------|-----------------------|--|
| <b>B00F - General Learning - 1975 - Brick/Block</b>   |   |        |          |                            |             |                       |  |
| <b>Exterior</b>   |   |        |          |                            |             |                       |  |
| Underfloor Voids - Slab on Ground   | No Asbestos Found                         |        |          |                            |             |                       |  |
| Ceiling Voids - Raked Ceiling   | No Asbestos Found                         |        |          |                            |             |                       |  |
| <b>Interior</b>   |   |        |          |                            |             |                       |  |
| <b>B00F - R0001 - General Learning Space - 51.52 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0002 - General Learning Space - 51.15 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0003 - General Learning Space - 51.3 m2</b>  |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0005 - General Learning Space - 51.29 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0006 - General Learning Space - 51.87 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0011 - Bulk Store - 8.99 m2</b>  |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0012 - Staff Kitchen - 4.71 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0013 - Staff Study - 35.97 m2</b>  |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0014 - Music Learning Space - 73.11 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0015 - Music Store - 11.91 m2</b>  |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0016 - Music Store - 11.19 m2</b>  |   |        |          |                            |             |                       |  |
| Floor Coverings Res/Textile   | Vinyl Tiles (Under Floor Covering/Carpet) |        |          |                            |             |                       |  |
| <b>B00F - R0017 - External Movement - 165.97 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0018 - Stairs - 15.35 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R0019 - Bulk Store - 1.42 m2</b>  |   |        |          |                            |             |                       |  |
| Door - Infill   | Flat AC Sheeting                          | 3      | East     | Some Damage - Unsealed (3) | Low (1)     | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00F - R9003 - Distribution Board Cupboard - 1.05 m2</b> <span style="float: right;"><b>Note: No inspection of live electrical installation</b></span> |   |        |          |                            |             |                       |  |
| Electrical - Mounting Board   | Resinous Board                            |        |          |                            |             |                       |  |
| <b>B00F - R9004 - Cleaning Store - Distributed - 3.83 m2</b>  |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R9006 - General Learning Space - 74.14 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R9007 - Bulk Store - 12.36 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R9008 - External Movement - 24.31 m2</b>  |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00F - R9009 - Stairs - 11.41 m2</b>   |   |        |          |                            |             |                       |  |
| No Asbestos   |   |        |          |                            |             |                       |  |
| <b>B00G - General Learning - 1959 - Timber</b>  |   |        |          |                            |             |                       |  |

| Exterior   |   |      |                               |                       |            |                       |                  |
|--|---|------|-------------------------------|-----------------------|------------|-----------------------|------------------|
| Eaves Linings  | Flat AC Sheeting                          | 40m2 | North facing,<br>South facing | Minimal Damage<br>(2) | Low<br>(1) | Low Priority<br>(2-3) | Assumed Asbestos |
| Gable Verge Lining                                   | Flat AC Sheeting                          | 20m2 | East facing,<br>West facing   | Good Condition (1)    | Low<br>(1) | Low Priority<br>(2-3) | Assumed Asbestos |
| Ceiling Voids  | Non Accessible Area                       |      |                               |                       |            |                       |                  |
| Underfloor Voids                                     | Non Accessible Area                       |      |                               |                       |            |                       |                  |
| Interior   |   |      |                               |                       |            |                       |                  |
| B00G - R0001 - Aboriginal Resource Centre - 81.39 m2 |   |      |                               |                       |            |                       |                  |
| Floor Coverings Res/Textile                          | Vinyl Tiles (Under Floor Covering/Carpet) |      |                               |                       |            |                       |                  |
| B00G - R0002 - General Storeroom - 8.91 m2           |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0003 - Interview - 8.76 m2                   |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0004 - General Learning Space - 53.54 m2     |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0009 - General Storeroom - .72 m2            |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0013 - General Learning Space - 51.48 m2     |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0014 - Practical Activities - 6.56 m2        |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0015 - Movement - 63.75 m2                   |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0016 - Practical Activities - 7.68 m2        |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0017 - General Learning Space - 46.24 m2     |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0018 - Staff Kitchen - 7.17 m2               |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0019 - Staff Lounge - 35.67 m2               |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0020 - Staff Kitchen - 7.26 m2               |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0021 - Staff Study - 40.76 m2                |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0022 - Sport Equipment Store - 26.18 m2      |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00G - R0023 - G.L.S. Store - 25.4 m2                |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00I - Administration/Library - 1978 - Brick/Block   |   |      |                               |                       |            |                       |                  |
| Exterior   |   |      |                               |                       |            |                       |                  |
| Ceiling Voids  | Non Accessible Area                       |      |                               |                       |            |                       |                  |
| Ceiling Voids  | Non Accessible Area                       |      |                               |                       |            |                       |                  |
| Underfloor Voids                                     | No Asbestos Found                         |      |                               |                       |            |                       |                  |
| Interior   |   |      |                               |                       |            |                       |                  |
| B00I - M0001 - Seminar - 11.23 m2                    |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00I - M0002 - Seminar - 14.68 m2                    |   |      |                               |                       |            |                       |                  |
| No Asbestos  |   |      |                               |                       |            |                       |                  |
| B00I - M0004 - Study Space - 131.13 m2               |   |      |                               |                       |            |                       |                  |

|  |                     |        |             |                            |         |  |                             |
|--|---------------------|--------|-------------|----------------------------|---------|--|-----------------------------|
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - M0005 - Interview/Meeting - 19.15 m2</b>           |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - M0006 - Stairs - 8.63 m2</b>                       |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - M0007 - Stairs - 1.4 m2</b>                        |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0001 - Principal Office - 28.43 m2</b>            |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0002 - Interview/Office - Type 1 - 12.36 m2</b>   |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0003 - Interview/Office - Type 1 - 12.36 m2</b>   |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0004 - Interview - 12.29 m2</b>                   |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0005 - Administration - Clerical - 12.36 m2</b>   |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0006 - Clinic - Girls - 12.29 m2</b>              |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0007 - Clinic-Toilets - 2.93 m2</b>               |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0008 - Clinic - Boys - 12.4 m2</b>                |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0009 - Clinic-Toilets - 2.93 m2</b>               |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0010 - Staff - Toilet - 9.22 m2</b>               |                     |        |             |                            |         |  |                             |
| Partition Walls (Cubicles)                                   | Compressed AC Sheet | 6m2    | East facing | Good Condition (1)         | Low (1) | Low Priority (2-3)   | Chrysotile (white asbestos) |
| <b>B001 - R0011 - Staff - Toilet - 9.22 m2</b>               |                     |        |             |                            |         |  |                             |
| Partition Walls (Cubicles)                                   | Compressed AC Sheet | 6m2    | East facing | Good Condition (1)         | Low (1) | Low Priority (2-3)   | Chrysotile (white asbestos) |
| <b>B001 - R0013 - Distribution Board Cupboard - .59 m2</b>   |                     |        |             |                            |         | <b>Note: No inspection of live electrical installation</b> |                             |
| Door - Lining  | Flat AC Sheeting    | 2.00   | inner       | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5)                                      | Chrysotile (white asbestos) |
| Electrical - Mounting Board                                  | Resinous Board      |        |             |                            |         |  |                             |
| <b>B001 - R0014 - Deputy Principal Office - 16.4 m2</b>      |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0016 - Public Entry - 46.83 m2</b>                |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0017 - Distribution Board Cupboard - 1.24 m2</b>  |                     |        |             |                            |         | <b>Note: No inspection of live electrical installation</b> |                             |
| Ceiling Structures/Linings                                   | Flat AC Sheeting    | 1.50m2 | Throughout  | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5)                                      | Chrysotile (white asbestos) |
| Door - Lining  | Flat AC Sheeting    | 2.00   | inner       | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5)                                      | Chrysotile (white asbestos) |
| Electrical - Mounting Board                                  | Resinous Board      |        |             |                            |         |  |                             |
| <b>B001 - R0018 - Administration - Clerical - 38.07 m2</b>   |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0019 - Printing/Photocopying - 28.32 m2</b>       |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0020 - Movement - 76.93 m2</b>                    |                     |        |             |                            |         |  |                             |
| No Asbestos  |                     |        |             |                            |         |  |                             |
| <b>B001 - R0021 - Cleaning Store - Distributed - 1.85 m2</b> |                     |        |             |                            |         |  |                             |

|  |                     |      |              |                    |         |                    |                             |
|--|---------------------|------|--------------|--------------------|---------|--------------------|-----------------------------|
| Floor Coverings Res/Textile                                | Vinyl Tiles         | 2m2  | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B001 - R0026 - Audio Visual Workroom - 50 m2</b>        |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0027 - Workroom - 35.92 m2</b>                  |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0028 - Librarian - 12.65 m2</b>                 |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0030 - Toilets-Boys - 18.27 m2</b>              |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0031 - Toilets-Girls - 18.27 m2</b>             |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0035 - External Movement - 67.98 m2</b>         |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0036 - Cleaning Supplies Store - 6.91 m2</b>    |                     |      |              |                    |         |                    |                             |
| Floor Coverings Res/Textile                                | Vinyl Tiles         | 7m2  | Throughout   | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B001 - R0037 - Plant - 17.47 m2</b>                     |                     |      |              |                    |         |                    |                             |
| Door - Lining  | Flat AC Sheeting    | 2.00 | inner        | Minimal Damage (2) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| Plant / Equipment - Heater Bank                            | Millboard           | 3    | A/C Ductwork | Good Condition (1) | Low (1) | Low Priority (2-3) | Assumed Asbestos            |
| <b>B001 - R0038 - External Movement - 32.24 m2</b>         |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0039 - External Movement - 44.28 m2</b>         |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0040 - External Movement - 51.19 m2</b>         |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0041 - Other - 2.05 m2</b>                      |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0042 - Administration - Clerical - 13.87 m2</b> |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0043 - Toilet - Lobby - 1.66 m2</b>             |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0044 - Toilets-Boys - 3.73 m2</b>               |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet | 2m2  | South        | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B001 - R0045 - Toilet - Lobby - 2.24 m2</b>             |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0046 - Toilets-Girls - 3.38 m2</b>              |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| Partition Walls (Cubicles)                                 | Compressed AC Sheet | 2m2  | South        | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B001 - R0047 - Staff Kitchen - 8.93 m2</b>              |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0048 - Commonroom - 59.54 m2</b>                |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0049 - Printing/Photocopying - 13.37 m2</b>     |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0050 - Commonroom - 27.25 m2</b>                |                     |      |              |                    |         |                    |                             |
| No Asbestos  |                     |      |              |                    |         |                    |                             |
| <b>B001 - R0051 - Printing/Photocopying - 5.24 m2</b>      |                     |      |              |                    |         |                    |                             |

|   |                     |      |              |                    |         |  |                             |
|---|---------------------|------|--------------|--------------------|---------|--|-----------------------------|
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0052 - Staff Kitchen - 18.79 m2</b>              |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0053 - Staff Study - 21.39 m2</b>                |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0054 - Staff Kitchen - 2.37 m2</b>               |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0055 - Multi Media Studio - 62.89 m2</b>         |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0056 - Staff Kitchen - 2.99 m2</b>               |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0057 - Staff Study - 28.49 m2</b>                |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0058 - Staff Study - 26.92 m2</b>                |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0059 - Main Area - 206.86 m2</b>                 |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0060 - Entry - 106.74 m2</b>                     |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0061 - Stairs - 1.62 m2</b>                      |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0062 - Ramp - 31.36 m2</b>                       |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0063 - Stairs - 1.31 m2</b>                      |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00I - R0064 - Movement - 75.65 m2</b>                   |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00J - Various - 1978 - Brick/Block</b>                  |                     |      |              |                    |         |  |                             |
| <b>Exterior</b>   |                     |      |              |                    |         |  |                             |
| Ceiling Voids   | Non Accessible Area |      |              |                    |         |  |                             |
| Ceiling Voids   | Non Accessible Area |      |              |                    |         |  |                             |
| Underfloor Voids - Slab on Ground                           | No Asbestos Found   |      |              |                    |         |  |                             |
| <b>Interior</b>   |                     |      |              |                    |         |  |                             |
| <b>B00J - R0001 - General Storeroom - 7.5 m2</b>            |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00J - R0012 - Distribution Board Cupboard - 1.26 m2</b> |                     |      |              |                    |         | <b>Note: No inspection of live electrical installation</b> |                             |
| Door - Lining   | Flat AC Sheeting    | 2    | inner        | Good Condition (1) | Low (1) | Low Priority (2-3)   | Chrysotile (white asbestos) |
| Electrical - Mounting Board                                 | Resinous Board      | 2    | to wall      | Good Condition (1) | Low (1) | Low Priority (2-3)   | Chrysotile (white asbestos) |
| <b>B00J - R0014 - External Movement - 80.76 m2</b>          |                     |      |              |                    |         |  |                             |
| Ceiling Structures/Linings                                  | Flat AC Sheeting    | 81m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3)   | Chrysotile (white asbestos) |
| <b>B00J - R0018 - Stairs - 18.95 m2</b>                     |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00J - R0020 - Bulk Store - 16.56 m2</b>                 |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00J - R0021 - Clinic - 14.86 m2</b>                     |                     |      |              |                    |         |  |                             |
| No Asbestos   |                     |      |              |                    |         |  |                             |
| <b>B00J - R0022 - Bulk Store - 5.84 m2</b>                  |                     |      |              |                    |         |  |                             |

|   |   |
|---|---|
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0023 - Practical Activities - 6.71 m2</b>    |   |
| No Asbestos   |   |
| <b>B00J - R0024 - General Learning Space - 66.72 m2</b> |   |
| No Asbestos   |   |
| <b>B00J - R0025 - Kitchen - Type 1 - 23.79 m2</b>       |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0026 - Laundry - 7.89 m2</b>                 |   |
| No Asbestos   |   |
| <b>B00J - R0027 - General Learning Space - 68.2 m2</b>  |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0028 - Practical Activities - 6.74 m2</b>    |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0029 - Bulk Store - 6.09 m2</b>              |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0030 - General Learning Space - 57.47 m2</b> |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0031 - Kitchen - Type 1 - 25.33 m2</b>       |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0032 - Computer Resource - 12.62 m2</b>      |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0033 - Laundry - 7.32 m2</b>                 |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0034 - Toilets-Disabled - 13.64 m2</b>       |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0035 - Toilets-Disabled - 3.92 m2</b>        |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0036 - Toilets-Disabled - 7.12 m2</b>        |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0037 - Movement - 6.06 m2</b>                |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R0038 - General Learning Space - 58.92 m2</b> |   |
| No Asbestos   |   |
| No Asbestos   |   |
| <b>B00J - R1001 - General Learning Space - 63.93 m2</b> |   |
| Floor Coverings Res/Textile                             | Vinyl Tiles (Under Floor Covering/Carpet) |
| <b>B00J - R1002 - General Learning Space - 52.31 m2</b> |   |



|  |   |         |                          |                    |         |                    |                             |
|--|---|---------|--------------------------|--------------------|---------|--------------------|-----------------------------|
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)           |         |                          |                    |         |                    |                             |
| <b>B00J - R1005 - Design L.S. - 52.31 m2</b>                 |   |         |                          |                    |         |                    |                             |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)           |         |                          |                    |         |                    |                             |
| <b>B00J - R1006 - Toilets-Girls - 25.24 m2</b>               |   |         |                          |                    |         |                    |                             |
| Partition Walls (Cubicles)                                   | Compressed AC Sheet                                 | 20.00m2 | East facing, West facing | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B00J - R1007 - Staff - Toilet - 4.31 m2</b>               |   |         |                          |                    |         |                    |                             |
| No Asbestos  |   |         |                          |                    |         |                    |                             |
| <b>B00J - R1008 - Staff - Toilet - 4.31 m2</b>               |   |         |                          |                    |         |                    |                             |
| No Asbestos  |   |         |                          |                    |         |                    |                             |
| <b>B00J - R1009 - Toilets-Boys - 22.7 m2</b>                 |   |         |                          |                    |         |                    |                             |
| Partition Walls (Cubicles)                                   | Compressed AC Sheet                                 | 10.00m2 | East facing              | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B00J - R1010 - Staff Study - 25.9 m2</b>                  |   |         |                          |                    |         |                    |                             |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)           |         |                          |                    |         |                    |                             |
| <b>B00J - R1011 - General Storeroom - .81 m2</b>             |   |         |                          |                    |         |                    |                             |
| No Asbestos  |   |         |                          |                    |         |                    |                             |
| <b>B00J - R1012 - Cleaning Store - Distributed - 6.66 m2</b> |   |         |                          |                    |         |                    |                             |
| Floor Coverings Res/Textile                                  | Vinyl Tiles   |         |                          |                    |         |                    |                             |
| <b>B00J - R1013 - Movement - 88.8 m2</b>                     |   |         |                          |                    |         |                    |                             |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                    | 93.00m2 | All surfaces             | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B00J - R1014 - Stairs - 27.38 m2</b>                      |   |         |                          |                    |         |                    |                             |
| Ceiling Structures/Linings                                   | Flat AC Sheeting                                    | 28.00m2 | All surfaces             | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B00J - R1015 - Staff Study - 74.54 m2</b>                 |   |         |                          |                    |         |                    |                             |
| Floor Coverings Res/Textile                                  | Vinyl Tiles (Under Floor Covering/Carpet)           |         |                          |                    |         |                    |                             |
| <b>B00K - Multi Purpose Facilities - 1978 - Brick/Block</b>  |   |         |                          |                    |         |                    |                             |
| <b>Exterior</b>  |   |         |                          |                    |         |                    |                             |
| Ceiling Voids  | Non Accessible Area                                 |         |                          |                    |         |                    |                             |
| Ceiling Voids  | Non Accessible Area                                 |         |                          |                    |         |                    |                             |
| Underfloor Voids   | No Asbestos Found                                   |         |                          |                    |         |                    |                             |
| <b>Interior</b>  |   |         |                          |                    |         |                    |                             |
| <b>B00K - R0001 - Movement - 15.2 m2</b>                     |   |         |                          |                    |         |                    |                             |
| No Asbestos  |   |         |                          |                    |         |                    |                             |
| <b>B00K - R0003 - General Storeroom - 8.6 m2</b>             |   |         |                          |                    |         |                    |                             |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - (< 10 m2) - ( X2 ) |         |                          |                    |         |                    |                             |
| <b>B00K - R0004 - Stage - 96.24 m2</b>                       |   |         |                          |                    |         |                    |                             |
| No Asbestos  |   |         |                          |                    |         |                    |                             |
| <b>B00K - R0005 - General Storeroom - 8.88 m2</b>            |   |         |                          |                    |         |                    |                             |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - (< 10 m2) - ( X2 ) |         |                          |                    |         |                    |                             |
| Floor Coverings Res/Textile                                  | Vinyl Tiles   | 9m2     | All surfaces             | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B00K - R0007 - Movement - 15.2 m2</b>                     |   |         |                          |                    |         |                    |                             |
| No Asbestos  |   |         |                          |                    |         |                    |                             |
| <b>B00K - R0009 - Cleaning Store - Distributed - 2.33 m2</b> |   |         |                          |                    |         |                    |                             |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - (< 10 m2) - ( X2 ) |         |                          |                    |         |                    |                             |

|  |   |      |              |                    |         |                    |                             |
|--|---|------|--------------|--------------------|---------|--------------------|-----------------------------|
| <b>B00K - R0010 - Movement - 9.75 m2</b>               |   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 ) |      |              |                    |         |                    |                             |
| Floor Coverings Res/Textile                            | Vinyl Tiles   | 10m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B00K - R0011 - Sport Equipment Store - 30.01 m2</b> |   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 ) |      |              |                    |         |                    |                             |
| <b>B00K - R0012 - Movement - 10.06 m2</b>              |   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 ) |      |              |                    |         |                    |                             |
| Floor Coverings Res/Textile                            | Vinyl Tiles   | 10m2 | All surfaces | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) |
| <b>B00K - R0013 - Multi-Purpose Space - 693.99 m2</b>  |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0014 - Control Room - 1.7 m2</b>            |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0015 - Plant - 1.14 m2</b>                  |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0016 - Shower - 2.61 m2</b>                 |   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )    |      |              |                    |         |                    |                             |
| Floor Coverings Res/Textile                            | Vinyl Tiles   |      |              |                    |         |                    |                             |
| <b>B00K - R0017 - Bulk Store - 5.98 m2</b>             |   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )    |      |              |                    |         |                    |                             |
| Floor Coverings Res/Textile                            | Vinyl Tiles   |      |              |                    |         |                    |                             |
| <b>B00K - R0018 - Bulk Store - 2.38 m2</b>             |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0019 - Stairs - 13.19 m2</b>                |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0020 - Plant - 1.11 m2</b>                  |   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Flat AC Sheeting  |      |              |                    |         |                    |                             |
| <b>B00K - R0021 - Bulk Store - 2.57 m2</b>             |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0022 - Movement - 6.01 m2</b>               |   |      |              |                    |         |                    |                             |
| Floor Coverings Res/Textile                            | Vinyl Tiles   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )    |      |              |                    |         |                    |                             |
| <b>B00K - R0023 - Shower - 2.56 m2</b>                 |   |      |              |                    |         |                    |                             |
| Ceiling Structures/Linings                             | Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )    |      |              |                    |         |                    |                             |
| Floor Coverings Res/Textile                            | Vinyl Tiles   |      |              |                    |         |                    |                             |
| <b>B00K - R0024 - Movement - 1.62 m2</b>               |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0025 - External Movement - 7.39 m2</b>      |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0026 - External Movement - 16.08 m2</b>     |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |
| <b>B00K - R0027 - External Movement - 7.43 m2</b>      |   |      |              |                    |         |                    |                             |
| No Asbestos  |   |      |              |                    |         |                    |                             |

|  |   |         |                    |                                       |         |                       |                             |
|--|---|---------|--------------------|---------------------------------------|---------|-----------------------|-----------------------------|
| <b>B00K - R0028 - Movement - 2.12 m2</b>   |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| Ceiling Structures/Linings   | Vermiculite - Composite Sample - (< 10 m2) - ( X2 ) |         |                    |                                       |         |                       |                             |
| <b>B00K - R0029 - Chair Store - 18.05 m2</b>                                       |   |         |                    |                                       |         |                       |                             |
| Ceiling Structures/Linings Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 ) |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R0030 - Stairs - 13.19 m2</b>  |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R1001 - Toilets-Girls - 13.45 m2</b>                                     |   |         |                    |                                       |         |                       |                             |
| Partition Walls (Cubicles)   | Corrugated AC Sheeting                              | 10m2    | Variable positions | Some Damage - Unsealed (3)            | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) |
| Ceiling Structures/Linings   | Flat AC Sheeting                                    |         |                    |                                       |         |                       |                             |
| <b>B00K - R1004 - Movement - 6.84 m2</b>   |   |         |                    |                                       |         |                       |                             |
| Ceiling Structures/Linings   | Flat AC Sheeting                                    |         |                    |                                       |         |                       |                             |
| Wall Linings Internal  | Flat AC Sheeting                                    |         |                    |                                       |         |                       |                             |
| <b>B00K - R1007 - Toilets-Boys - 13.51 m2</b>                                      |   |         |                    |                                       |         |                       |                             |
| Ceiling Structures/Linings   | Flat AC Sheeting                                    |         |                    |                                       |         |                       |                             |
| Partition Walls (Cubicles)   | Corrugated AC Sheeting                              | 4m2     | South              | Some Damage - Unsealed (3)            | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) |
| Material - Stored / Debris Material  | AC Fragments/Debris                                 | 0.5     | Throughout         | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) |
| <b>B00K - R1008 - Movement - 7.63 m2</b>   |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R1009 - Plant - 1.26 m2</b>  |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R1010 - General Learning Space - 60.78 m2</b>                            |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R1011 - Plant - 1.26 m2</b>  |   |         |                    |                                       |         |                       |                             |
| Ceiling Structures/Linings   | Flat AC Sheeting                                    |         |                    |                                       |         |                       |                             |
| <b>B00K - R1012 - General Storeroom - 1.17 m2</b>                                  |   |         |                    |                                       |         |                       |                             |
| Non Accessible   |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R1013 - Shower - 28.96 m2</b>  |   |         |                    |                                       |         |                       |                             |
| Partition Walls (Cubicles)   | Compressed AC Sheet                                 | 20.00m2 | West               | Minimal Damage (2)                    | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos) |
| <b>B00K - R1014 - Shower - 29.06 m2</b>  |   |         |                    |                                       |         |                       |                             |
| Partition Walls (Cubicles)   | Compressed AC Sheet                                 | 20.00m2 | West               | Minimal Damage (2)                    | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos) |
| <b>B00K - R1015 - General Storeroom - 1.11 m2</b>                                  |   |         |                    |                                       |         |                       |                             |
| Non Accessible   |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R1016 - Stairs - 13.69 m2</b>  |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R1017 - Stairs - 13.62 m2</b>  |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R9001 - Movement - 2.61 m2</b>   |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R9002 - General Storeroom - 4.73 m2</b>                                  |   |         |                    |                                       |         |                       |                             |
| No Asbestos  |   |         |                    |                                       |         |                       |                             |
| <b>B00K - R9003 - Movement - 56.65 m2</b>  |   |         |                    |                                       |         |                       |                             |

|  |  |   |       |                            |         |  |                             |  |
|--|--|---|-------|----------------------------|---------|--|-----------------------------|--|
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 40 - 70 m2)             |   |       |                            |         |  |                             |  |
| <b>B00K - R9004 - General Storeroom - 7.6 m2</b>             |  |   |       |                            |         |  |                             |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( < 10 m2) - ( X2 )       |   |       |                            |         |  |                             |  |
| <b>B00K - R9005 - Toilets-Boys - 12.87 m2</b>                |  |   |       |                            |         |  |                             |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )    |   |       |                            |         |  |                             |  |
| <b>B00K - R9006 - Toilets-Girls - 17.47 m2</b>               |  |   |       |                            |         |  |                             |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )    |   |       |                            |         |  |                             |  |
| <b>B00K - R9008 - Movement - 2.55 m2</b>                     |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9010 - Cleaning Store - Distributed - 5.04 m2</b> |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9011 - General Storeroom - 11.74 m2</b>           |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9012 - Distribution Board Cupboard - .75 m2</b>   |  |   |       |                            |         | <b>Note: No inspection of live electrical installation</b> |                             |  |
| Door - Lining  | Flat AC Sheeting   | 2 | inner | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5)                                      | Chrysotile (white asbestos) |  |
| <b>B00K - R9013 - Sport Equipment Store - 17.36 m2</b>       |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9014 - Movement - 203.17 m2</b>                   |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9016 - Student Canteen - 71.61 m2</b>             |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9017 - General Storeroom - 4.5 m2</b>             |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9018 - Movement - 127.27 m2</b>                   |  |   |       |                            |         |  |                             |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 120 - 250 m2) - ( X15 ) |   |       |                            |         |  |                             |  |
| <b>B00K - R9020 - External Movement - 15.69 m2</b>           |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9021 - External Movement - 15.69 m2</b>           |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9025 - Staff - Toilet - 1.98 m2</b>               |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9026 - Change - 41.83 m2</b>                      |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9027 - Change - 37.18 m2</b>                      |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9028 - Plant - .76 m2</b>                         |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9029 - Plant - 14.94 m2</b>                       |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9030 - General Assistants - 24.03 m2</b>          |  |   |       |                            |         |  |                             |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 10 - 40 m2) - ( X3 )    |   |       |                            |         |  |                             |  |
| <b>B00K - R9031 - Cleaning Store - Distributed - 3.25 m2</b> |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9032 - Stairs - 8.94 m2</b>                       |  |   |       |                            |         |  |                             |  |
| No Asbestos  |  |   |       |                            |         |  |                             |  |
| <b>B00K - R9033 - Stairs - 9.85 m2</b>                       |  |   |       |                            |         |  |                             |  |

|   |                        |         |                               |                    |            |                       |  |
|---|------------------------|---------|-------------------------------|--------------------|------------|-----------------------|--|
| No Asbestos   |                        |         |                               |                    |            |                       |  |
| <b>B00K - R9034 - External Movement - 79.05 m2</b>      |                        |         |                               |                    |            |                       |  |
| No Asbestos   |                        |         |                               |                    |            |                       |  |
| <b>B00K - R9035 - External Movement - 14.75 m2</b>      |                        |         |                               |                    |            |                       |  |
| No Asbestos   |                        |         |                               |                    |            |                       |  |
| <b>B00L - Agricultural Science - 1959 - Brick/Block</b> |                        |         |                               |                    |            |                       |  |
| <b>Exterior</b>   |                        |         |                               |                    |            |                       |  |
| Eaves Linings   | Flat AC Sheeting       | 40m2    | North facing,<br>South facing | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Chrysotile (white asbestos)  |
| <b>Interior</b>   |                        |         |                               |                    |            |                       |  |
| <b>B00L - R0001 - General Learning Space - 51.35 m2</b> |                        |         |                               |                    |            |                       |  |
| Floor Coverings<br>Res/Textile                          | Vinyl Tiles            |         |                               |                    |            |                       |  |
| <b>B00L - R0002 - Office/Store - 12.12 m2</b>           |                        |         |                               |                    |            |                       |  |
| Floor Coverings<br>Res/Textile                          | Vinyl Tiles            |         |                               |                    |            |                       |  |
| <b>B00L - R0003 - General Storeroom - 34.09 m2</b>      |                        |         |                               |                    |            |                       |  |
| Floor Coverings<br>Res/Textile                          | Vinyl Tiles            |         |                               |                    |            |                       |  |
| <b>B00L - R0004 - Staff - Toilet - 3.24 m2</b>          |                        |         |                               |                    |            |                       |  |
| No Asbestos   |                        |         |                               |                    |            |                       |  |
| <b>B00L - R0005 - Laboratory L.S. - 95.57 m2</b>        |                        |         |                               |                    |            |                       |  |
| Floor Coverings<br>Res/Textile                          | Vinyl Tiles            |         |                               |                    |            |                       |  |
| <b>B00L - R0006 - Movement - 21.31 m2</b>               |                        |         |                               |                    |            |                       |  |
| Ceiling<br>Structures/Linings                           | Flat AC Sheeting       | 21.00m2 | Throughout                    | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Chrysotile (white asbestos)  |
| <b>B00M - Pupil Facilities - 1959 - Brick/Block</b>     |                        |         |                               |                    |            |                       |  |
| <b>Exterior</b>   |                        |         |                               |                    |            |                       |  |
| Eaves Linings   | Flat AC Sheeting       | 20m2    | East facing,<br>West facing   | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Chrysotile (white asbestos) , Amosite<br>(brown asbestos) , Crocidolite (blue<br>asbestos) |
| Underfloor Voids -<br>Slab on Ground                    | No Asbestos Found      |         |                               |                    |            |                       |  |
| Ceiling Voids   | Non Accessible Area    |         |                               |                    |            |                       |  |
| Electrical -<br>Backing Board                           | Resinous Board         | 1       | Southwest                     | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Assumed Asbestos   |
| <b>Interior</b>   |                        |         |                               |                    |            |                       |  |
| <b>B00M - R0001 - Shower/Change - 24.41 m2</b>          |                        |         |                               |                    |            |                       |  |
| Partition Walls<br>(Cubides)                            | Corrugated AC Sheeting | 2m2     | West facing                   | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Chrysotile (white asbestos)  |
| Ceiling<br>Structures/Linings                           | Flat AC Sheeting       | 24m2    | Throughout                    | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Chrysotile (white asbestos) , Amosite<br>(brown asbestos) , Crocidolite (blue<br>asbestos) |
| <b>B00M - R0002 - Shower/Change - 24.42 m2</b>          |                        |         |                               |                    |            |                       |  |
| Partition Walls<br>(Cubides)                            | Corrugated AC Sheeting | 12m2    | East facing,<br>West facing   | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Chrysotile (white asbestos)  |
| Ceiling<br>Structures/Linings                           | Flat AC Sheeting       | 24m2    | Throughout                    | Good Condition (1) | Low<br>(1) | Low Priority<br>(2-3) | Chrysotile (white asbestos) , Amosite<br>(brown asbestos) , Crocidolite (blue<br>asbestos) |
| <b>B00N - Agricultural Science - 1959 - Steel</b>       |                        |         |                               |                    |            |                       |  |
| <b>Exterior</b>   |                        |         |                               |                    |            |                       |  |
| Underfloor Voids -<br>Slab on Ground                    | No Asbestos Found      |         |                               |                    |            |                       |  |
| Ceiling Voids -<br>Raked Ceiling                        | No Asbestos Found      |         |                               |                    |            |                       |  |

|   |                   |     |              |                            |         |                       |  |
|---|-------------------|-----|--------------|----------------------------|---------|-----------------------|--|
| <b>Interior</b>   |                   |     |              |                            |         |                       |  |
| <b>B00N - R0001 - Machine Storage - 115.48 m2</b>                       |                   |     |              |                            |         |                       |  |
| Wall Linings Internal   | Flat AC Sheeting  | 6m2 | North facing | Some Damage - Unsealed (3) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos)                                |
| <b>B00N - R0002 - Office/Store - 12.21 m2</b>                           |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - Technological &amp; Applied Studies - 2004 - Brick/Veneer</b> |                   |     |              |                            |         |                       |  |
| <b>Exterior</b>   |                   |     |              |                            |         |                       |  |
| Ceiling Voids   | No Asbestos Found |     |              |                            |         |                       |  |
| Underfloor Voids  | No Asbestos Found |     |              |                            |         |                       |  |
| <b>Interior</b>   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0001 - General Learning Space - 60.29 m2</b>                 |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0002 - General Learning Space - 60.51 m2</b>                 |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0003 - Materials Store - 31.32 m2</b>                        |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0004 - Materials Workshop - Type 2 - 120.25 m2</b>           |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0007 - Dust Extraction Space - 6.83 m2</b>                   |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0008 - Distribution Board Cupboard - 4.58 m2</b>             |                   |     |              |                            |         |                       | <b>Note: No inspection of live electrical installation</b> |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0009 - Materials Workshop - Type 2 - 119.04 m2</b>           |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0010 - General Learning Space - 60.65 m2</b>                 |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0011 - General Learning Space - 59.95 m2</b>                 |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0013 - External Stairs - 25.4 m2</b>                         |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0014 - Welding/Hot Metals Area - 13.69 m2</b>                |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0015 - Outdoor Workshop - 85.92 m2</b>                       |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0016 - Kiln Space - 9.25 m2</b>                              |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0019 - Movement - 15.85 m2</b>                               |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0021 - General Storeroom - 4.3 m2</b>                        |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0022 - Distribution Board Cupboard - 1.17 m2</b>             |                   |     |              |                            |         |                       | <b>Note: No inspection of live electrical installation</b> |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0023 - External Movement - 126.81 m2</b>                     |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0024 - Welding Area - 3.75 m2</b>                            |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0025 - Welding Area - 3.9 m2</b>                             |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0026 - Welding Area - 3.77 m2</b>                            |                   |     |              |                            |         |                       |  |
| No Asbestos   |                   |     |              |                            |         |                       |  |
| <b>B00O - R0027 - Welding Area - 3.77 m2</b>                            |                   |     |              |                            |         |                       |  |

|  |                   |  |
|--|-------------------|--|
| No Asbestos  |                   |  |
| <b>B000 - R0028 - Movement - 45.21 m2</b>                    |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R0029 - External Movement - 11.11 m2</b>           |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R0030 - External Movement - 58.33 m2</b>           |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1001 - General Learning Space - 58.86 m2</b>      |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1003 - Kitchen - Type 1 - 104.02 m2</b>           |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1004 - General Learning Space - 58.86 m2</b>      |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1006 - Laundry - 9.26 m2</b>                      |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1007 - Pantry - 7.75 m2</b>                       |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1008 - Cleaning Store - Distributed - 3.03 m2</b> |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1010 - Movement - 12.4 m2</b>                     |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1011 - General Learning Space - 58.93 m2</b>      |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1012 - General Learning Space - 58.57 m2</b>      |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1013 - Kitchen - Type 1 - 104.1 m2</b>            |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1014 - Resources Store - 18.22 m2</b>             |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1016 - External Stairs - 33.84 m2</b>             |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1017 - Bulk Store - 6.1 m2</b>                    |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1018 - Bulk Store - 11.5 m2</b>                   |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1019 - Preparation - Materials - 24.95 m2</b>     |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1020 - Bulk Store - 19.39 m2</b>                  |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1021 - Distribution Board Cupboard - .68 m2</b>   |                   |  |
| <b>Note: No inspection of live electrical installation</b>   |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1022 - External Movement - 3.16 m2</b>            |                   |  |
| No Asbestos  |                   |  |
| <b>B000 - R1023 - External Movement - 125.98 m2</b>          |                   |  |
| No Asbestos  |                   |  |
| <b>B00P - Art - 2004 - Brick/Veneer</b>                      |                   |  |
| <b>Exterior</b>  |                   |  |
| Ceiling Voids  | No Asbestos Found |  |
| Underfloor Voids   | No Asbestos Found |  |
| <b>Interior</b>  |                   |  |
| <b>B00P - R0001 - Resources Store - 10.26 m2</b>             |                   |  |

|   |                   |  |
|---|-------------------|--|
| No Asbestos   |                   |  |
| <b>B00P - R0002 - Cleaning Supplies Store - 10.87 m2</b>    |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0003 - General Learning Space - 59.73 m2</b>     |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0004 - General Learning Space - 59.24 m2</b>     |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0005 - Visual Arts Workshop - 104.49 m2</b>      |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0006 - Distribution Board Cupboard - .69 m2</b>  |                   |  |
|   |                   | <b>Note: No inspection of live electrical installation</b> |
| No Asbestos   |                   |  |
| <b>B00P - R0007 - Resources Store - 19.02 m2</b>            |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0008 - Bulk Store - 20.8 m2</b>                  |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0010 - General Learning Space - 59.45 m2</b>     |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0011 - General Learning Space - 59.94 m2</b>     |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0013 - External Movement - 112.2 m2</b>          |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0014 - General Learning Space - 51.76 m2</b>     |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0015 - General Learning Space - 51.9 m2</b>      |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0016 - Movement - 2.86 m2</b>                    |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0017 - Dark Room - 28.67 m2</b>                  |                   |  |
| No Asbestos   |                   |  |
| <b>B00P - R0018 - External Movement - 32.73 m2</b>          |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - Mechanical Services - 2004 - Brick/Veneer</b>     |                   |  |
| <b>Exterior</b>   |                   |  |
| Ceiling Voids   | No Asbestos Found |  |
| Underfloor Voids  | No Asbestos Found |  |
| <b>Interior</b>   |                   |  |
| <b>B00Q - R0001 - Lift - 6.24 m2</b>                        |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - R0002 - Plant - 7.47 m2</b>                       |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - R0004 - Cleaning Store - Distributed - 5.8 m2</b> |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - R0005 - External Movement - 40.47 m2</b>          |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - R0006 - External Stairs - .55 m2</b>              |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - R1001 - Lift - 6.24 m2</b>                        |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - R1003 - External Movement - 40.17 m2</b>          |                   |  |
| No Asbestos   |                   |  |
| <b>B00Q - R1004 - External Stairs - 4.13 m2</b>             |                   |  |



|   |                   |       |            |                    |         |                    |  |
|---|-------------------|-------|------------|--------------------|---------|--------------------|--|
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00R - Technological &amp; Applied Studies - 2012 - Brick/Veneer</b> |                   |       |            |                    |         |                    |  |
| <b>Exterior</b>   |                   |       |            |                    |         |                    |  |
| Ceiling Voids   | No Asbestos Found |       |            |                    |         |                    |  |
| Underfloor Voids  | No Asbestos Found |       |            |                    |         |                    |  |
| <b>Interior</b>   |                   |       |            |                    |         |                    |  |
| <b>B00R - R0001 - Materials Store - Type 2 - 43.03 m2</b>               |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00R - R0002 - Plant - 2.5 m2</b>                                    |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00S - Agricultural Science - 2013 - Steel</b>                       |                   |       |            |                    |         |                    |  |
| <b>Exterior</b>   |                   |       |            |                    |         |                    |  |
| Ceiling Voids   | No Asbestos Found |       |            |                    |         |                    |  |
| Underfloor Voids  | No Asbestos Found |       |            |                    |         |                    |  |
| <b>Interior</b>   |                   |       |            |                    |         |                    |  |
| <b>B00S - R0001 - Machine Storage - 21.88 m2</b>                        |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00S - R0002 - Chemical Store - 7.21 m2</b>                          |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00S - R0003 - General Storeroom - 5.39 m2</b>                       |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00S - R0004 - Agriculture Covered Area - 83.83 m2</b>               |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00T - Storage - 2010 - Brick/Block</b>                              |                   |       |            |                    |         |                    |  |
| <b>Exterior</b>   |                   |       |            |                    |         |                    |  |
| Ceiling Voids   | No Asbestos Found |       |            |                    |         |                    |  |
| Underfloor Voids  | No Asbestos Found |       |            |                    |         |                    |  |
| <b>Interior</b>   |                   |       |            |                    |         |                    |  |
| <b>B00T - R0001 - Garden Store Room - 9.99 m2</b>                       |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00U - Storage - 2010 - Metal Shed</b>                               |                   |       |            |                    |         |                    |  |
| <b>Exterior</b>   |                   |       |            |                    |         |                    |  |
| Ceiling Voids   | No Asbestos Found |       |            |                    |         |                    |  |
| Underfloor Voids  | No Asbestos Found |       |            |                    |         |                    |  |
| <b>Interior</b>   |                   |       |            |                    |         |                    |  |
| <b>B00U - R0001 - Bulk Store - 31.77 m2</b>                             |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00V - Storage - 2010 - Metal Shed</b>                               |                   |       |            |                    |         |                    |  |
| <b>Exterior</b>   |                   |       |            |                    |         |                    |  |
| Ceiling Voids   | No Asbestos Found |       |            |                    |         |                    |  |
| Underfloor Voids  | No Asbestos Found |       |            |                    |         |                    |  |
| <b>Interior</b>   |                   |       |            |                    |         |                    |  |
| <b>B00V - R0001 - Sport Equipment Store - 34.83 m2</b>                  |                   |       |            |                    |         |                    |  |
| No Asbestos   |                   |       |            |                    |         |                    |  |
| <b>B00W - General Learning/Technological - 1959 - Fibre Cement Clad</b> |                   |       |            |                    |         |                    |  |
| <b>Exterior</b>   |                   |       |            |                    |         |                    |  |
| Eaves Linings   | Flat AC Sheeting  | 20m2  | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Wall Cladding   | Flat AC Sheeting  | 120m2 | Throughout | Minimal Damage (2) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) |

|   |                        |         |                      |                                       |         |                       |  |
|---|------------------------|---------|----------------------|---------------------------------------|---------|-----------------------|--|
| Ceiling Voids   | AC Fragments/Debris    | 1       | Throughout           | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| External Roof Structure                                       | Corrugated AC Sheeting | 2       | South (Roof to Shed) | Some Damage - Unsealed (3)            | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| Underfloor Voids  | AC Fragments/Debris    | 1       | Throughout           | Poor Condition - Extensive Damage (4) | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>Interior</b>   |                        |         |                      |                                       |         |                       |  |
| <b>B00W - R0001 - General Learning Space - 66.08 m2</b>       |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| <b>B00W - R0002 - Movement - 2.52 m2</b>                      |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| <b>B00W - R0004 - Shower - 3.3 m2</b>                         |                        |         |                      |                                       |         |                       |  |
| Wall Linings Internal   | Flat AC Sheeting       |         |                      |                                       |         |                       |  |
| Ceiling Structures/Linings                                    | Flat AC Sheeting       |         |                      |                                       |         |                       |  |
| <b>B00W - R0005 - General Storeroom - 9.72 m2</b>             |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| <b>B00W - R0006 - Student Kitchen - 16.12 m2</b>              |                        |         |                      |                                       |         |                       |  |
| Wall Linings Internal   | Flat AC Sheeting       | 40m2    | Throughout           | Good Condition (1)                    | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00W - R0007 - Laundry - 6.23 m2</b>                       |                        |         |                      |                                       |         |                       |  |
| Ceiling Structures/Linings                                    | Flat AC Sheeting       | 7m2     | Throughout           | Good Condition (1)                    | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00W - R0008 - Covered Area - 13.46 m2</b>                 |                        |         |                      |                                       |         |                       |  |
| Ceiling Structures/Linings                                    | Flat AC Sheeting       | 14m2    | Throughout           | Good Condition (1)                    | Low (1) | Low Priority (2-3)    | Chrysotile (white asbestos) , Amosite (brown asbestos) |
| <b>B00W - R0009 - External Movement - 23.03 m2</b>            |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| <b>B00X - Agricultural Science - 1959 - Steel</b>             |                        |         |                      |                                       |         |                       |  |
| <b>Exterior</b>   |                        |         |                      |                                       |         |                       |  |
| Underfloor Voids - Slab on Ground                             | No Asbestos Found      |         |                      |                                       |         |                       |  |
| Ceiling Voids   | No Asbestos Found      |         |                      |                                       |         |                       |  |
| <b>Interior</b>   |                        |         |                      |                                       |         |                       |  |
| <b>B00X - R0001 - Animal Space - 59.77 m2</b>                 |                        |         |                      |                                       |         |                       |  |
| No Asbestos   |                        |         |                      |                                       |         |                       |  |
| <b>B00Y - Agricultural Science - 1959 - Fibre Cement Clad</b> |                        |         |                      |                                       |         |                       |  |
| <b>Exterior</b>   |                        |         |                      |                                       |         |                       |  |
| Wall Cladding   | Flat AC Sheeting       | 80.00m2 | Throughout           | Some Damage - Unsealed (3)            | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos)                            |
| <b>Interior</b>   |                        |         |                      |                                       |         |                       |  |
| <b>B00Y - R0001 - Animal Space - 63.43 m2</b>                 |                        |         |                      |                                       |         |                       |  |
| Wall Linings Internal   | Flat AC Sheeting       | 80.00m2 | Throughout           | Some Damage - Unsealed (3)            | Low (1) | Medium Priority (4-5) | Chrysotile (white asbestos)                            |
| <b>B00Z - Agricultural Science - 2014 - Greenhouse</b>        |                        |         |                      |                                       |         |                       |  |
| <b>Exterior</b>   |                        |         |                      |                                       |         |                       |  |
| Ceiling Voids   | No Asbestos Found      |         |                      |                                       |         |                       |  |
| Underfloor Voids  | No Asbestos Found      |         |                      |                                       |         |                       |  |

|  |   |  |
|--|---|--|
| <b>Interior</b>  |   |  |
| <b>B00Z - R0001 - Growing/Breeding - 195.11 m2</b>           |   |  |
| No Asbestos  |   |  |
| <b>B0AS - Science/General Learning - 1978 - Brick/Block</b>  |   |  |
| <b>Exterior</b>  |   |  |
| No Asbestos  |   |  |
| <b>Interior</b>  |   |  |
| <b>B0AS - R0004 - Distribution Board Cupboard - .76 m2</b>   |   | <b>Note: No inspection of live electrical installation</b> |
| No Asbestos  |   |  |
| <b>B0AS - R0005 - Cleaning Store - Distributed - 4.41 m2</b> |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0006 - Materials Store - 23.42 m2</b>             |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0026 - Stairs - 7.92 m2</b>                       |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0027 - Stairs - 8.17 m2</b>                       |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0028 - General Learning Space - 50.62 m2</b>      |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0029 - Science Laboratory - 48.35 m2</b>          |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0030 - Preparation - Science - 26 m2</b>          |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0031 - Music Learning Space - 51.85 m2</b>        |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0032 - Music Store - 16.39 m2</b>                 |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0033 - Science Laboratory - 42.15 m2</b>          |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0034 - General Learning Space - 50.25 m2</b>      |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0035 - Staff Study - 22.85 m2</b>                 |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0036 - Staff Kitchen - 2.99 m2</b>                |   |  |
| No Asbestos  |   |  |
| <b>B0AS - R0037 - General Learning Space - 52.59 m2</b>      |   |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0038 - General Learning Space - 59 m2</b>         |   |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0039 - Toilet - Lobby - 1.89 m2</b>               |   |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0040 - Toilets-Unisex - 1.64 m2</b>               |   |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0041 - Cleaning Supplies Store - 3.83 m2</b>      |   |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0042 - General Learning Space - 51.94 m2</b>      |   |  |
| Ceiling Structures/Linings                                   | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |

|   |   |  |
|---|---|--|
| <b>B0AS - R0043 - General Learning Space - 49.33 m2</b>     |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0044 - Bulk Store - 7.65 m2</b>                  |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0045 - Chemical Store - 15.14 m2</b>             |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0046 - Staff Study - 46.95 m2</b>                |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0047 - Staff Kitchen - 2.95 m2</b>               |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0048 - Distribution Board Cupboard - 5.22 m2</b> |   | <b>Note: No inspection of live electrical installation</b> |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0049 - General Learning Space - 52.52 m2</b>     |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0050 - General Learning Space - 43.31 m2</b>     |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0051 - Science Laboratory - 49.38 m2</b>         |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0052 - Preparation - Science - 39.12 m2</b>      |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0053 - Science Laboratory - 44.56 m2</b>         |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0054 - General Learning Space - 43.02 m2</b>     |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0055 - Movement - 297.22 m2</b>                  |   |  |
| Ceiling Structures/Linings                                  | Vermiculite - Composite Sample - ( 40 - 70 m2) - ( X5 ) |  |
| <b>B0AS - R0056 - Stairs - 9.17 m2</b>                      |   |  |
| No Asbestos   |   |  |
| <b>B0AS - R0057 - Store - 1.74 m2</b>                       |   |  |
| No Asbestos   |   |  |
| <b>B0AS - R1001 - Adjoining School - 2 m2</b>               |   |  |
| No Asbestos   |   |  |
| <b>B0AS - R1003 - Adjoining School - 5.67 m2</b>            |   |  |
| No Asbestos   |   |  |
| <b>B0AS - R1005 - Distribution Board Cupboard - .72 m2</b>  |   | <b>Note: No inspection of live electrical installation</b> |
| No Asbestos   |   |  |
| <b>B0AS - R1006 - Cleaning Store - Distributed - 2 m2</b>   |   |  |
| No Asbestos   |   |  |
| <b>B0AS - R1007 - Adjoining School - 47.73 m2</b>           |   |  |
| No Asbestos   |   |  |
| <b>B0AS - R1019 - Staff - Toilet - 3.32 m2</b>              |   |  |
| No Asbestos   |   |  |
| <b>B0AS - R1036 - Stairs - 8.57 m2</b>                      |   |  |

|  |  |
|--|--|
| No Asbestos  |  |
| <b>B0AS - R1037 - Stairs - 7.46 m2</b>                     |  |
| No Asbestos  |  |
| <b>B0AS - R1038 - Stairs - 16.85 m2</b>                    |  |
| No Asbestos  |  |
| <b>B0AS - R1039 - Adjoining School - 64.22 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1040 - Distribution Board Cupboard - .83 m2</b> | <b>Note: No inspection of live electrical installation</b> |
| No Asbestos  |  |
| <b>B0AS - R1041 - Adjoining School - 18.38 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1042 - Adjoining School - 6.63 m2</b>           |  |
| No Asbestos  |  |
| <b>B0AS - R1043 - Adjoining School - 11.69 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1044 - Adjoining School - 6.63 m2</b>           |  |
| No Asbestos  |  |
| <b>B0AS - R1045 - Adjoining School - 17.87 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1046 - Adjoining School - 58.27 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1047 - Adjoining School - 44.09 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1048 - Adjoining School - 21.43 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1049 - Adjoining School - 6.63 m2</b>           |  |
| No Asbestos  |  |
| <b>B0AS - R1050 - Adjoining School - 11.69 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1051 - Adjoining School - 6.7 m2</b>            |  |
| No Asbestos  |  |
| <b>B0AS - R1052 - Adjoining School - 21.18 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1053 - Adjoining School - 50.34 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1054 - Adjoining School - 54.33 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1055 - Adjoining School - 18.07 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1056 - Adjoining School - 4.6 m2</b>            |  |
| No Asbestos  |  |
| <b>B0AS - R1057 - Adjoining School - 10.9 m2</b>           |  |
| No Asbestos  |  |
| <b>B0AS - R1058 - Adjoining School - 7.67 m2</b>           |  |
| No Asbestos  |  |
| <b>B0AS - R1059 - Adjoining School - 18.5 m2</b>           |  |
| No Asbestos  |  |
| <b>B0AS - R1060 - Adjoining School - 61.52 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1061 - Adjoining School - 60.23 m2</b>          |  |
| No Asbestos  |  |
| <b>B0AS - R1062 - Adjoining School - 18.7 m2</b>           |  |

|  |                  |      |            |                    |         |                    |  |
|--|------------------|------|------------|--------------------|---------|--------------------|--|
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1063 - Adjoining School - 6.63 m2</b>             |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1064 - Adjoining School - 11.66 m2</b>            |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1065 - Adjoining School - 6.63 m2</b>             |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1066 - Adjoining School - 18.5 m2</b>             |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1067 - Adjoining School - 63.68 m2</b>            |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1068 - Distribution Board Cupboard - .8 m2</b>    |                  |      |            |                    |         |                    |  |
| <b>Note: No inspection of live electrical installation</b>   |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1069 - Access Staff Shower/Toilet - 6.91 m2</b>   |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1070 - Cleaning Store - Distributed - 3.21 m2</b> |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1071 - Staff - Toilet - 4.84 m2</b>               |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1072 - Adjoining School - 11.3 m2</b>             |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1073 - Adjoining School - 6.82 m2</b>             |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1074 - Adjoining School - 18.05 m2</b>            |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1075 - Adjoining School - 56.8 m2</b>             |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0AS - R1076 - Movement - 317.82 m2</b>                   |                  |      |            |                    |         |                    |  |
| No Asbestos  |                  |      |            |                    |         |                    |  |
| <b>B0W1 - Pupil Facilities - 1959 - Fibre Cement Clad</b>    |                  |      |            |                    |         |                    |  |
| <b>Exterior</b>  |                  |      |            |                    |         |                    |  |
| Eaves Linings  | Flat AC Sheeting | 2m2  | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos) |
| <b>Interior</b>  |                  |      |            |                    |         |                    |  |
| <b>B0W1 - R0001 - Toilets-Unisex - 1.42 m2</b>               |                  |      |            |                    |         |                    |  |
| Wall Linings Internal  | Flat AC Sheeting | 10m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)  |
| Ceiling Structures/Linings                                   | Flat AC Sheeting | 2m2  | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) | Chrysotile (white asbestos)  |

**Demountables**

**OS 970 70106 - Store - Single Module - Placement Date : 22-JUN-2004**

No Asbestos Found