


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Katoomba High School (8150)
Region:	Western Sydney AMU
State Electorate:	Blue Mountains
Local Government Area:	Blue Mountains

Last Reviewed By:	Greencap 18-DEC-2017
Last Revised By:	OHMS Hygiene 16-JUL-2020

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

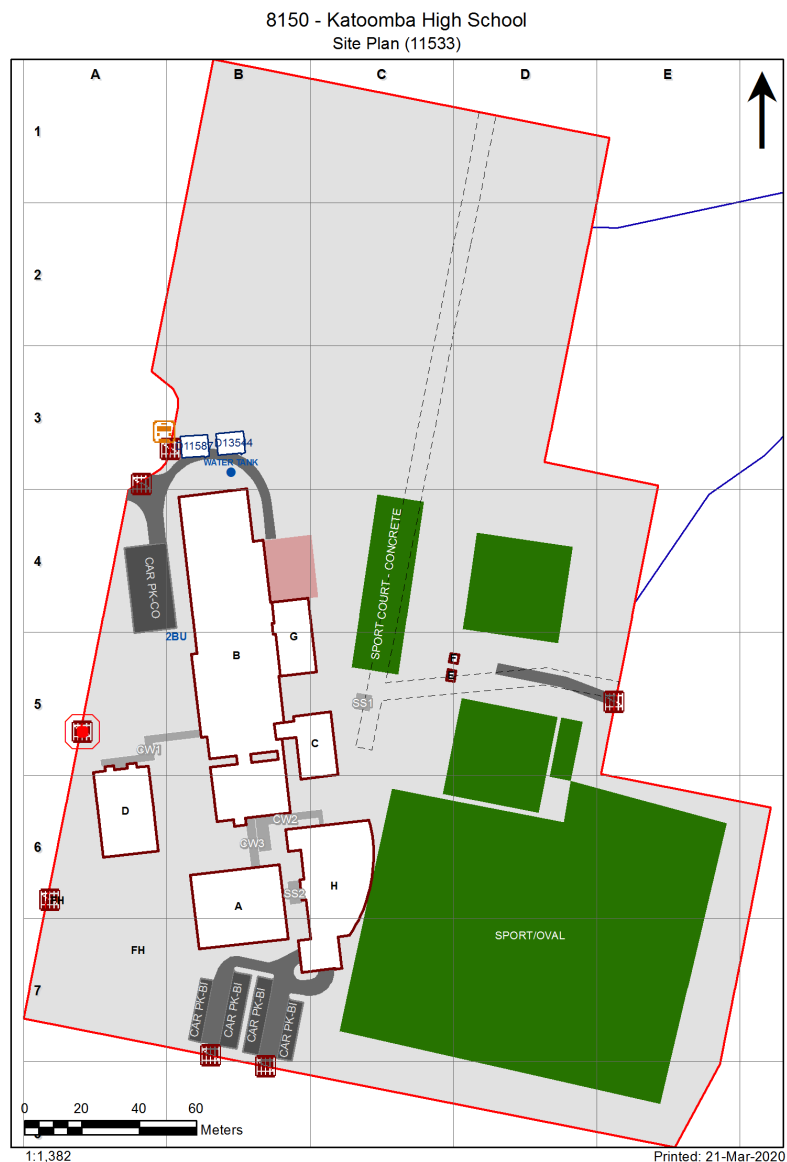

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Library/Science - 1978 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - M1001 - Main Area - 181.99 m2							
No Asbestos							
B00A - M1002 - Lift - 1.69 m2							
No Asbestos							
B00A - M1003 - Stairs - 6.76 m2							
No Asbestos							
B00A - R0001 - Laboratory L.S. - 92.85 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0002 - Preparation - 54.9 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0003 - Laboratory L.S. - 94.36 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0004 - Laboratory L.S. - 94.37 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0006 - Laboratory L.S. - 92.86 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0007 - Apparatus Store - 24.63 m2							
No Asbestos							
B00A - R0008 - Main Switchroom - 9.21 m2							
No Asbestos							
B00A - R0009 - Movement - 160.89 m2							
No Asbestos							
B00A - R0010 - Preparation - 47.65 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0011 - Chemical Store - 6.44 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00A - R0012 - Stairs - 17.19 m2							
No Asbestos							
B00A - R1001 - Movement - 44.4 m2							
No Asbestos							
B00A - R1002 - Staff Study - 35.57 m2							
No Asbestos							
B00A - R1003 - Staff - Toilet - 8.06 m2							
No Asbestos							
B00A - R1004 - Cleaning Store - Distributed - 2.86 m2							
No Asbestos							
B00A - R1005 - Staff - Toilet - 11.41 m2							
No Asbestos							
B00A - R1006 - Staff - Toilet - 3.36 m2							
No Asbestos							

B00A - R1007 - Workroom - 37.33 m2							
No Asbestos							
B00A - R1008 - Workroom - 36.81 m2							
No Asbestos							
B00A - R1009 - Administration - Clerical - 10.92 m2							
No Asbestos							
B00A - R1010 - Librarian - 11.2 m2							
No Asbestos							
B00A - R1011 - Computer Room - 35.5 m2							
No Asbestos							
B00A - R1012 - Workroom - 19.93 m2							
No Asbestos							
B00A - R1013 - Distribution Board Cupboard - .63 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R1014 - Seminar - 14.99 m2							
No Asbestos							
B00A - R1015 - Seminar - 14.52 m2							
No Asbestos							
B00A - R1016 - Seminar - 14.92 m2							
No Asbestos							
B00A - R1018 - Lift - 1.69 m2							
No Asbestos							
B00A - R1019 - Stairs - 2.7 m2							
No Asbestos							
B00A - R1020 - Main Area - 397.98 m2							
No Asbestos							
B00A - R1021 - Stairs - 16.96 m2							
No Asbestos							
B00A - R9001 - General Storeroom - 111.48 m2							
No Asbestos							
B00A - R9002 - Movement - 17.19 m2							
No Asbestos							
B00B - Administration/Various - 1962 - Brick/Veneer							
Exterior							
Underfloor Voids	No Asbestos Found						
Ceiling Voids - Pitched Roof	Bituminous Membrane						
Interior							
B00B - R0001 - Music Store - 17.4 m2							
No Asbestos							
B00B - R0002 - Practice/Seminar - 11.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0003 - Distribution Board Cupboard - .41 m2						Note: No inspection of live electrical installation	
Ceiling Structures/Linings	Non Accessible Area	m2					
B00B - R0004 - Music Learning Space - 59.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0005 - Music Learning Space - 56.1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0006 - Music Store - 12.05 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0007 - Self Help Toilet - 24.25 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0008 - Movement - 97.9 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00B - R0009 - Staff - Toilet - 10.8 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0010 - Laboratory L.S. - 83.7 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00B - R0011 - Preparation - 22.89 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R0012 - Apparatus Store - 8.23 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R0013 - Materials Technology L.S. - 70.79 m2		
No Asbestos		
B00B - R0014 - Materials Store - 18.72 m2		
No Asbestos		
B00B - R0015 - Dust Extraction Space - 4.42 m2		
No Asbestos		
B00B - R0016 - Materials Store - 14.1 m2		
No Asbestos		
B00B - R0017 - Materials Technology L.S. - 92.72 m2		
No Asbestos		
B00B - R0018 - Movement - 3.83 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
Floor Coverings Res/Textile	Vinyl Tiles	
B00B - R0019 - Movement - 51.85 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
Floor Coverings Res/Textile	Vinyl Tiles	
B00B - R0020 - Materials Technology L.S. - 100.91 m2		
No Asbestos		
B00B - R0021 - Welding Area - 6.37 m2		
No Asbestos		
B00B - R0023 - Materials Store - 17.22 m2		
No Asbestos		
B00B - R0025 - Materials Technology L.S. - 99.76 m2		
No Asbestos		
B00B - R0026 - Movement - 32.15 m2		
Floor Coverings Res/Textile	Vinyl Tiles	
B00B - R0027 - Cleaning Store - Distributed - 8.52 m2		
No Asbestos		
B00B - R0028 - Movement - 11.45 m2		
No Asbestos		
B00B - R0029 - General Storeroom - 21.69 m2		

No Asbestos		
B00B - R0030 - Maintenance Bulk Store - 50.07 m2		
No Asbestos		
B00B - R0031 - Movement - 385.2 m2		
No Asbestos		
B00B - R0032 - Materials Store - 15.66 m2		
No Asbestos		
B00B - R0033 - Cleaning Supplies Store - 36.32 m2		
No Asbestos		
B00B - R0034 - Toilets-Boys - 54.48 m2		
Partition Walls (Cubicles)	Compressed AC Sheet	
B00B - R0035 - Movement - 249.44 m2		
No Asbestos		
B00B - R0036 - Toilets-Girls - 60.6 m2		
Partition Walls (Cubicles)	Compressed AC Sheet	
B00B - R0038 - Movement - 28.68 m2		
No Asbestos		
B00B - R0039 - Movement - 191.29 m2		
No Asbestos		
B00B - R0040 - General Storeroom - 16.85 m2		
No Asbestos		
B00B - R0041 - General Assistants - 34.45 m2		
No Asbestos		
B00B - R0042 - Cleaning Supplies Store - 15.92 m2		
No Asbestos		
B00B - R0043 - Main Switchroom - 4.87 m2		
No Asbestos		
B00B - R0044 - General Storeroom - 20.85 m2		
No Asbestos		
B00B - R0045 - Sport Equipment Store - 12.66 m2		
No Asbestos		
B00B - R0046 - Cleaning Store - Distributed - 5.15 m2		
No Asbestos		
B00B - R0048 - Shower/Change - 55.99 m2		
No Asbestos		
B00B - R0049 - Sport Equipment Store - 5.78 m2		
No Asbestos		
B00B - R0050 - Movement - 7.77 m2		
No Asbestos		
B00B - R0051 - Sport Equipment Store - 7.94 m2		
No Asbestos		
B00B - R0052 - Shower/Change - 56.77 m2		
No Asbestos		
B00B - R0053 - Sport Equipment Store - 5.82 m2		
No Asbestos		
B00B - R0054 - Student Canteen - 41.4 m2		
Floor Coverings Res/Textile	Vinyl Tiles	
B00B - R0055 - General Storeroom - 2.41 m2		
Floor Coverings Res/Textile	Vinyl Tiles	

B00B - R0056 - Staff - Toilet - 4.97 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
B00B - R0057 - Distribution Board Cupboard - .15 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00B - R0058 - Lift - 1.62 m2							
No Asbestos							
B00B - R0059 - Plant - 3.28 m2							
No Asbestos							
B00B - R0060 - Movement - 12.97 m2							
No Asbestos							
B00B - R0061 - Other-Vacant - 10.29 m2							
No Asbestos							
B00B - R0062 - Movement - 55.21 m2							
No Asbestos							
B00B - R0063 - Movement - 51.61 m2							
No Asbestos							
B00B - R0064 - Movement - 85.32 m2							
No Asbestos							
B00B - R0065 - Movement - 107.48 m2							
No Asbestos							
B00B - R0066 - Plant - 6.08 m2							
No Asbestos							
B00B - R0067 - Stairs - 6.16 m2							
No Asbestos							
B00B - R0068 - Stairs - 2.44 m2							
No Asbestos							
B00B - R0069 - General Storeroom - 14.33 m2							
No Asbestos							
B00B - R0070 - General Storeroom - 8.69 m2							
Electrical - Backing Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Electrical - Backing Board	Resinous Board	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0071 - Stairs - 5.46 m2							
No Asbestos							
B00B - R0072 - Stairs - 5.24 m2							
No Asbestos							
B00B - R0073 - Stairs - 10.62 m2							
No Asbestos							
B00B - R0074 - Stairs - 10.62 m2							
No Asbestos							
B00B - R0075 - Welding Area - 20.08 m2							
No Asbestos							
B00B - R0076 - Welding/Hot Metals Area - 5.75 m2							
No Asbestos							
B00B - R0077 - Welding/Hot Metals Area - 6 m2							
No Asbestos							
B00B - R1004 - General Learning Space - 67.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1006 - Design L.S. - 66.98 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1007 - Staff Study - 32.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1008 - Design L.S. - 66.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1009 - General Learning Space - 66.97 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1010 - General Learning Space - 66.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1011 - General Learning Space - 66.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1012 - Staff Study - 32.89 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1013 - General Storeroom - 3.01 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1014 - Commonroom - 135.65 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)	
B00B - R1015 - Cleaning Store - Distributed - 3.01 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1017 - Administration - Clerical - 13.62 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1018 - Movement - 12.75 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1019 - Careers Advisers Office - 19.16 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1020 - Staff - Toilet - 9.35 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1021 - Clinic - Boys - 10.36 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1024 - General Storeroom - 2.72 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1025 - Staff - Toilet - 3.14 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1026 - Principal Office - 20.38 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1027 - Public Entry - 8.14 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1033 - Bulk Store - 15.14 m2		

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1034 - Darkroom Space - 11.71 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1035 - Art Learning Space - 80.09 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00B - R1036 - Preparation - 21.9 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1037 - Preparation - 15.13 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1038 - Performance Workshop - 96.49 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00B - R1039 - Laboratory L.S. - 97.31 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00B - R1040 - Preparation - 26.47 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1050 - General Learning Space - 55.7 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1051 - Cleaning Store - Distributed - 2.85 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1052 - General Learning Space - 59.96 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1053 - Resources Store - 9.77 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1054 - General Storeroom - 5.35 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1058 - Computer Learning Space - 68.67 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R1059 - Movement - 2.69 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1060 - Computer Resource - 10.55 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1061 - General Storeroom - 6.73 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R1062 - Leading Teacher - 20.34 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1063 - Deputy Principal Office - 13.74 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R1064 - Pupil Entry - 12.45 m2		

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1065 - Distribution Board Cupboard - .41 m2								Note: No inspection of live electrical installation
Wall Linings Internal	Flat AC Sheeting	3m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	No Asbestos Found							
B00B - R1066 - Lift - 1.62 m2								
No Asbestos								
B00B - R1068 - Toilets-Disabled - 3.73 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1069 - Toilets-Disabled - 10.12 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1070 - Main Entry - 23.53 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1071 - Administration - Clerical - 103.09 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Floor Coverings Res/Textile	Vinyl Tiles	103m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1072 - Administration - Executive - 18.22 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1073 - Duplicating Workroom - 22.73 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1074 - Secure Storeroom - 7.69 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1075 - Movement - 13.04 m2								
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R1076 - Clinic - 8.82 m2								
Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1077 - Clinic - 5.8 m2								
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1078 - Toilets-Boys/Girls - 2.07 m2								
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1079 - Toilets-Boys/Girls - 3.21 m2								
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R1080 - Toilets-Disabled - 5.3 m2								
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1081 - Plant - 1.75 m2								
Floor Coverings Res/Textile	Vinyl Tiles	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1083 - Office/Store - 12.96 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1084 - Uniform Shop - 19.5 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1085 - Careers Advisers Office - 12.86 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1086 - Careers Advisers Office - 19.68 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1087 - Stairs - 29.77 m2								
Floor Coverings Res/Textile	Vinyl Tiles	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1088 - Stairs - 21.61 m2								
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1089 - Stairs - 21.61 m2								
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R1091 - Stairs - 30.39 m2								
No Asbestos								
B00B - R1092 - Movement - 52.5 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1093 - Preparation/Printing - 24.24 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1094 - Food Technology L.S. - 103.31 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00B - R1095 - Movement - 4.52 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1096 - Toilets-Girls - 4.02 m2								

Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1097 - Toilets-Boys - 4.07 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1098 - Pantry - 15.53 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1099 - Laundry - 8.02 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1100 - Movement - 5.12 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1101 - Movement - 296.63 m2								
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	297m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)							
B00B - R1102 - Kitchen - Type 1 - 120.18 m2								
Ceiling Structures/Linings	Non Accessible Area	m2						
B00B - R1103 - Movement - 51.68 m2								
No Asbestos								
B00B - R1104 - Movement - 31.64 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2001 - Stage - 24.43 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2002 - Performance Workspace - 53.45 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2003 - Secure Storeroom - 6.14 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R2004 - General Storeroom - 9.35 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2005 - General Learning Space - 53.45 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2006 - General Learning Space - 66.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2007 - General Learning Space - 66.9 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2008 - General Learning Space - 66.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2009 - General Learning Space - 66.9 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2010 - General Learning Space - 66.9 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2011 - Staff Study - 36.14 m2								

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R2012 - General Learning Space - 53.89 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R2013 - General Learning Space - 40.11 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R2014 - General Learning Space - 40.24 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R2015 - Cleaning Store - Distributed - 2.99 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R2016 - General Learning Space - 53.89 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R2017 - General Storeroom - 9.34 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R2018 - General Learning Space - 52.69 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R2019 - Sport Equipment Store - 9.97 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R2020 - Interview/Office - Type 1 - 10.09 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R2021 - Administration - Clerical - 9.56 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R2022 - Administration - Clerical - 44.22 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00B - R2023 - Staff - Toilet - 3.22 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R2024 - Ancillary Staff - 5.11 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R2025 - Staff - Toilet - 4.34 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R2026 - Duplicating Workroom - 15.09 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R2027 - Duplicating Workroom - 16.41 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00B - R2030 - Distribution Board Cupboard - .14 m2		
Ceiling Structures/Linings	No Asbestos Found	Note: No inspection of live electrical installation
B00B - R2033 - Kiln Space - 5.05 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00B - R2035 - General Storeroom - 15.67 m2		

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R2036 - Resources Store - 6.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R2037 - Art Learning Space - 100.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R2038 - Resources Store - 4.5 m2							
Ceiling Structures/Linings	Non Accessible Area	m2					
B00B - R2039 - Art Learning Space - 53.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R2040 - Movement - 3.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R2041 - Staff Study - 20.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R2042 - General Storeroom - 2.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R2043 - General Learning Space - 67.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R2044 - General Learning Space - 66.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R2045 - General Storeroom - 3.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R2046 - General Storeroom - 3.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R2047 - Computer Resource - 8.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R2048 - Staff Study - 65.31 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R2049 - Staff Study - 23.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R2050 - Movement - 388.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)						
B00B - R2051 - General Learning Space - 62.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R2052 - General Learning Space - 59.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R2053 - General Storeroom - 12.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R2054 - Interview/Office - Type 1 - 28.1 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2055 - Staff Study - 40.18 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2056 - General Learning Space - 70.23 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00B - R2057 - General Storeroom - 13.5 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2058 - Computer Resource - 12.23 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2059 - Movement - 73.43 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
B00B - R2060 - Distribution Board Cupboard - .41 m2								
				Note: No inspection of live electrical installation				
Wall Linings Internal	Flat AC Sheeting	3m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	No Asbestos Found							
B00B - R2061 - Lift - 1.62 m2								
No Asbestos								
B00B - R2062 - Stairs - 6.22 m2								
Ceiling Structures/Linings	No Asbestos Found							
B00B - R2063 - Stairs - 6.24 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R2064 - Stairs - 6.24 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R2065 - Stairs - 6.24 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R2066 - Stairs - 20.71 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2067 - Stairs - 20.78 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R2068 - Staff Study - 49.52 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2069 - General Learning Space - 49.75 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2070 - General Learning Space - 66.79 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2071 - General Learning Space - 50.1 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00B - R2072 - General Learning Space - 61.13 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00C - Physical Education - 1962 - Brick/Veneer								

Exterior							
Eaves Linings	Flat AC Sheeting						
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Window	Mastic	400	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00C - R0001 - Movement - 23.26 m2							
No Asbestos							
B00C - R0002 - Staff - Toilet - 4.05 m2							
No Asbestos							
B00C - R0003 - Sport Equipment Store - 8.76 m2							
No Asbestos							
B00C - R0004 - Gymnasium - 263.59 m2							
No Asbestos							
B00D - Performing Arts - 1962 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - M0001 - Control Room - 22.12 m2							
No Asbestos							
B00D - M0002 - Chair Store - 22.12 m2							
No Asbestos							
B00D - R0001 - Cleaning Store - Distributed - 3.65 m2							
No Asbestos							
B00D - R0002 - Chair Store - 3.65 m2							
No Asbestos							
B00D - R0004 - Staff Kitchen - 10.72 m2							
No Asbestos							
B00D - R0005 - General Storeroom - 4.23 m2							
No Asbestos							
B00D - R0007 - Performing Arts Store - 15.05 m2							
No Asbestos							
B00D - R0011 - Stairs - 6.41 m2							
No Asbestos							
B00D - R0012 - Stairs - 6.44 m2							
No Asbestos							
B00D - R0013 - Stage - 111.47 m2							
No Asbestos							
B00D - R0014 - Multi-Purpose Space - 374.81 m2							
No Asbestos							
B00D - R0015 - Movement - 2.06 m2							
No Asbestos							
B00D - R0016 - Lift - 1.15 m2							
No Asbestos							
B00D - R9001 - General Storeroom - 4.1 m2							
No Asbestos							
B00D - R9002 - Shower/Change - 36.34 m2							
No Asbestos							

B00D - R9003 - Gymnasium - 44.18 m2		
No Asbestos		
B00D - R9004 - Shower/Change - 36.33 m2		
No Asbestos		
B00D - R9005 - General Storeroom - 4.1 m2		
No Asbestos		
B00D - R9006 - Stairs - 2.11 m2		
No Asbestos		
B00D - R9007 - Stairs - 2.21 m2		
No Asbestos		
B00E - Building Services - 2001 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00E - R0001 - General Assistants - 9.36 m2		
No Asbestos		
B00F - Building Services - 2001 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00F - R0001 - Cleaning Supplies Store - 7.84 m2		
No Asbestos		
B00G - Pupil Facilities - 2003 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00G - R0001 - Covered Area - 289.06 m2		
No Asbestos		
B00G - R0002 - Movement - 40.14 m2		
No Asbestos		
B00H - Support Unit - 1995 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00H - R0001 - Practical Activity Area - 17.26 m2		
No Asbestos		
B00H - R0002 - General Learning Space - S/P - 46.2 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0003 - Seminar - Type 3 - 8.74 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0004 - Home Base Store - S - 8.16 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0005 - Practical Activity Area - 79.43 m2		
No Asbestos		

B00H - R0006 - Practical Activity Area - 16.64 m2		
No Asbestos		
B00H - R0007 - General Learning Space - S/P - 48.04 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0008 - Seminar - Type 3 - 8.3 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0009 - Home Base Store - S - 7.93 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0010 - Staff - Toilet - 6.41 m2		
No Asbestos		
B00H - R0011 - Wheelchair Store-Special Ed - 61.14 m2		
No Asbestos		
B00H - R0012 - Covered Vehicle Area/Porte Cochere - 143.7 m2		
No Asbestos		
B00H - R0013 - Distribution Board Cupboard - .69 m2		Note: No inspection of live electrical installation
No Asbestos		
B00H - R0014 - Commonroom - 32.45 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0015 - Cleaning Store - Distributed - 2.76 m2		
No Asbestos		
B00H - R0016 - Practical Activity Area - 16.69 m2		
No Asbestos		
B00H - R0017 - General Learning Space - S/P - 42.85 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0018 - Toilets-Disabled - 29.01 m2		
No Asbestos		
B00H - R0019 - Student Laundry - Type 3 - 11.32 m2		
No Asbestos		
B00H - R0020 - Toilets-Disabled - 29.21 m2		
No Asbestos		
B00H - R0021 - Practical Activity Area - 17.09 m2		
No Asbestos		
B00H - R0022 - General Learning Space - S/P - 45.83 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0023 - Home Base Store - S - 6.56 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0024 - Seminar - Type 3 - 8.65 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00H - R0025 - Movement - 54.68 m2		
No Asbestos		
B00H - R0026 - Movement - 7.49 m2		
No Asbestos		
B00H - R0027 - Outdoor Learning Area - 227.14 m2		
No Asbestos		
B00H - R0028 - Distribution Board Cupboard - 1.12 m2		Note: No inspection of live electrical installation

No Asbestos	
B00H - R0029 - Movement - 10.19 m2	
No Asbestos	

Demountables

OS 602 11587 - Learning Unit - Standard With P.A.A. - Placement Date : 01-MAR-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 13544 - Learning Unit - Standard With P.A.A. - Placement Date : 01-MAR-2019

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found