


Asbestos Register

(Hazardous Materials and Risk Assessment)

School:	Kirrawee High School (8437)
Region:	Sydney AMU
State Electorate:	Cronulla
Local Government Area:	Sutherland

Last Reviewed By:	WSP 11-SEP-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

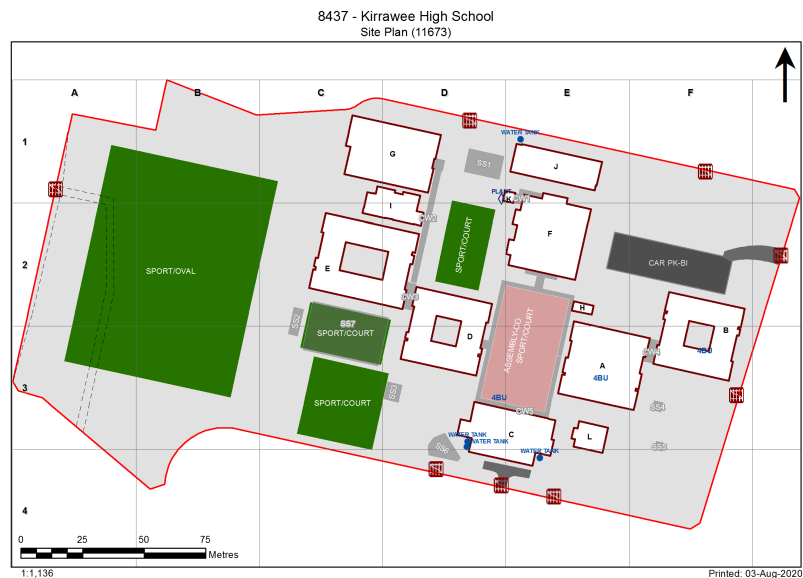

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>
<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/Various - 1965 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00A - R0001 - Deputy Principal Office - 11.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0002 - Public Entry - 28.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0003 - Cleaning Store - Distributed - 2.05 m2							
No Asbestos							
B00A - R0004 - Distribution Board Cupboard - 1.46 m2 Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0006 - General Storeroom - 6.45 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0007 - Preparation - 19.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0008 - Duplicating Workroom - 23.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0009 - Administration - Clerical - 59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0010 - Staff - Toilet - 3.3 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - Distribution Board Cupboard - .42 m2 Note: No inspection of live electrical installation							
No Asbestos							
B00A - R0012 - Duplicating Workroom - 21.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0013 - Interview/Office - Type 1 - 10.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0014 - Principal Office - 19.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0015 - Staff - Toilet - 2.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0016 - General Storeroom - 3.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00A - R0017 - Administration - Clerical - 39.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0018 - Administration - Clerical - 8.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0019 - Administration - Clerical - 8.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0020 - Movement - 17.69 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0021 - Interview/Office - Type 1 - 7.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0022 - Staff - Toilet - 3.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0023 - Staff - Toilet - 3.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0024 - Clinic - Girls - 7.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0025 - Administration - Clerical - 7.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00A - R0026 - Public Entry - 12.68 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0028 - Music Store - 13.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R0029 - Laboratory L.S. - 80.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00A - R0030 - Darkroom Space - 18.95 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0032 - External Stairs - 5.36 m2							
No Asbestos							
B00A - R0033 - External Stairs - 5.45 m2							
No Asbestos							
B00A - R0035 - Lift - 2.38 m2							
Non Accessible							
B00A - R0036 - Interview/Office - Type 1 - 22.04 m2							
Require Inspection							
B00A - R0037 - Administration - Clerical - 6.45 m2							
Require Inspection							
B00A - R0038 - Interview/Office - Type 1 - 16.35 m2							
Require Inspection							
B00A - R0039 - General Storeroom - 12.14 m2							
Require Inspection							
B00A - R0040 - External Movement - 234.96 m2							

Require Inspection							
B00A - R1001 - Art Learning Space - 58.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1002 - No Access - 10.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1003 - Art Learning Space - 53.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1004 - Cleaning Store - Distributed - 2.05 m2							
No Asbestos							
B00A - R1005 - Distribution Board Cupboard - 1.47 m2							
Note: No inspection of live electrical installation							
Wall Linings Internal	Flat AC Sheeting	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1006 - General Storeroom - 18.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00A - R1007 - General Learning Space - 39.25 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1008 - General Learning Space - 52.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1009 - General Learning Space - 52.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1010 - General Learning Space - 59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1011 - Staff - Toilet - 3.32 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1012 - Distribution Board Cupboard - .43 m2							
Note: No inspection of live electrical installation							
Non Accessible							
B00A - R1014 - General Storeroom - 12.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1015 - Practice/Seminar - 12.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R1016 - Music Store - 66.12 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1017 - Interview/Office - Type 1 - 13.03 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R1018 - Staff Study - 12.57 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R1019 - Music Learning Space - 52.57 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1021 - Music Store - 9.2 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R1022 - Music Store - 9.49 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R1023 - Computer Resource - 13.07 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00A - R1024 - Staff Study - 39.66 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00A - R1025 - External Stairs - 4.77 m2								
No Asbestos								
B00A - R1026 - External Stairs - 5 m2								
No Asbestos								
B00A - R1027 - External Movement - 138 m2								
Non Accessible								
B00B - Technological & Applied Studies/Art - 1965 - Brick/Block								
Exterior								
Ceiling Voids	No Asbestos Found							
Underfloor Voids	No Asbestos Found							
Interior								
B00B - R0001 - Staff Study - 26.1 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0002 - Laundry - 10.22 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
B00B - R0003 - Staff - Toilet - 3.3 m2								
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0004 - Distribution Board Cupboard - .56 m2								
Note: No inspection of live electrical installation								
No Asbestos								
B00B - R0005 - Staff Study - 26.98 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00B - R0006 - Cleaning Store - Distributed - 3.4 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00B - R0007 - Dust Extraction Space - 9 m2								

No Asbestos							
B00B - R0008 - Resource/Project Store - 12.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0009 - Materials Technology L.S. - 86.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0010 - Materials Store - 23.88 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0013 - Resource/Project Store - 5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0014 - Resource/Project Store - 5.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R0015 - Design L.S. - 53.82 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0017 - Food Technology L.S. - 72.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0018 - Food/Research Space - 12.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0019 - Food/Research Space - 12.54 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0020 - Food Technology L.S. - 86.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0022 - Computer Resource - 11.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0023 - Materials Store - 13.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R0024 - Materials Technology L.S. - 113 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R0025 - Communications Cupboard - 1.71 m2							
No Asbestos							
B00B - R0026 - Movement - 136.8 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00B - R0027 - Stairs - 6.04 m2							
No Asbestos							
B00B - R0028 - Stairs - 5.88 m2							
No Asbestos							
B00B - R1001 - Design L.S. - 55.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R1002 - Staff - Toilet - 3.34 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1003 - Distribution Board Cupboard - .56 m2							
No Asbestos							
B00B - R1004 - Design L.S. - 66.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	67m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1005 - Resource/Project Store - 6.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1006 - Resource/Project Store - 6.32 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1007 - Materials Store - 8.89 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1008 - Resource/Project Store - 9.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1009 - Materials Technology L.S. - 79.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R1010 - Materials Technology L.S. - 113.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00B - R1011 - Resource/Project Store - 12.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1012 - Resources Store - 5.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00B - R1013 - General Storeroom - 5.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1014 - General Learning Space - 53.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1015 - Cleaning Store - Distributed - 2.25 m2							
No Asbestos							
B00B - R1016 - Distribution Board Cupboard - 1.58 m2							
No Asbestos							
B00B - R1017 - Resources Store - 10.68 m2							

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1018 - Kin Space - 21.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1019 - Art Learning Space - 52.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1020 - Art Learning Space - 53.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1021 - Staff Study - 25.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00B - R1022 - Movement - 133.59 m2							
No Asbestos							
B00B - R1023 - Stairs - 4.92 m2							
No Asbestos							
B00B - R1024 - Stairs - 4.88 m2							
No Asbestos							
B00C - Pupil Facilities - 1965 - Brick/Block							
Exterior							
No Asbestos							
Interior							
B00C - R0001 - Maintenance Bulk Store - 23.14 m2							
No Asbestos							
B00C - R0002 - Movement - 19.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R0003 - Sport Equipment Store - 13.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R0004 - Office/Store - 5.77 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00C - R0005 - Student Canteen - 59.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

B00C - R0006 - Staff - Toilet - 3.06 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00C - R0007 - Office/Store - 2.98 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00C - R0008 - Security Store - 6.18 m2		
No Asbestos		
B00C - R0009 - General Storeroom - 6.18 m2		
No Asbestos		
B00C - R0010 - General Storeroom - 14.39 m2		
No Asbestos		
B00C - R0011 - Secure Storeroom - 2.02 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00C - R0012 - General Assistants - 19.38 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00C - R0013 - Cleaning Store - Distributed - 1.17 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00C - R0014 - Staff - Toilet - 5.32 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00C - R0015 - Movement - 19.72 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00C - R0016 - Maintenance Bulk Store - 23.08 m2		
No Asbestos		
B00C - R0017 - Movement - 341.24 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (> 250 m2) - (X25)	
B00C - R0018 - External Movement - 4.65 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00C - R0019 - Stairs - 13.98 m2		
No Asbestos		
B00C - R0020 - Stairs - 9.29 m2		
No Asbestos		

B00C - R0021 - Sport Equipment Store - 3.94 m2							
No Asbestos							
B00C - R0022 - Bulk Store - 22.31 m2							
No Asbestos							
B00C - R1001 - Movement - 16.56 m2							
No Asbestos							
B00C - R1002 - Staff Change - 7.18 m2							
Non Accessible							
B00C - R1003 - Toilets-Boys - 33.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R1004 - Shower/Change - 39.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00C - R1005 - Shower/Change - 36.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R1006 - Toilets-Girls - 36.57 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R1007 - Staff Change - 7.18 m2							
No Asbestos							
B00C - R1008 - Movement - 16.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00C - R1009 - Stairs - 13.73 m2							
No Asbestos							
B00C - R1010 - Stairs - 13.73 m2							
No Asbestos							
B00D - General Learning/Science - 1965 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00D - R0001 - Laboratory L.S. - 93.16 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0002 - Toilets-Boys - 33.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0003 - General Storeroom - 12.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						

B00D - R0004 - General Storeroom - 13.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0005 - Cleaning Store - Distributed - 2.2 m2							
Wall Linings Internal	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0006 - General Storeroom - 1.6 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0007 - Toilets-Girls - 53.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Partition Walls (Cubides)	Compressed AC Sheet	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0008 - General Storeroom - 52.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0009 - Preparation - 19.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0010 - Apparatus Store - 6.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0011 - Laboratory L.S. - 85.73 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0012 - Staff - Toilet - 3.32 m2							
No Asbestos							
B00D - R0013 - Distribution Board Cupboard - .48 m2							
No Asbestos							Note: No inspection of live electrical installation
B00D - R0014 - Staff Study - 26.44 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0016 - Laboratory L.S. - 93.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00D - R0017 - General Storeroom - 9.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00D - R0018 - Preparation - 27.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	28m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0019 - Movement - 149.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00D - R0020 - Apparatus Store - 23.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0021 - Computer Resource - 13.1 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R0022 - Stairs - 5.89 m2							
No Asbestos							
B00D - R0023 - Stairs - 6.01 m2							
No Asbestos							
B00D - R1001 - General Learning Space - 59.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1002 - Interview/Office - Type 1 - 23.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1003 - General Learning Space - 54.03 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1004 - Cleaning Store - Distributed - 2.2 m2							
No Asbestos							
B00D - R1005 - Distribution Board Cupboard - 1.63 m2							
Non Accessible							Note: No inspection of live electrical installation
B00D - R1006 - General Learning Space - 58.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1007 - Staff Study - 38.99 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1008 - General Storeroom - 12.6 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00D - R1009 - General Learning Space - 52.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00D - R1010 - Computer Learning Space - 58.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1011 - Staff - Toilet - 3.3 m2							
No Asbestos							
B00D - R1012 - Distribution Board Cupboard - .48 m2							
Non Accessible							
Note: No inspection of live electrical installation							
B00D - R1014 - General Learning Space - 59.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1015 - General Learning Space - 52.72 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1016 - General Learning Space - 52.79 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1017 - Movement - 133.18 m2							
No Asbestos							
B00D - R1018 - General Learning Space - 44.85 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	45m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1019 - Computer Resource - 19.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1020 - Stairs - 5.61 m2							
No Asbestos							
B00D - R1021 - Stairs - 5.8 m2							
No Asbestos							
B00E - General Learning/Science - 1969 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00E - R0001 - Chemical Store - 19.08 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0002 - Staff - Toilet - 5.86 m2							
No Asbestos							
B00E - R0003 - Computer Learning Space - 53.89 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	54m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0004 - General Learning Space - 45.72 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0005 - General Learning Space - 52.21 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0006 - General Storeroom - 6.14 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0007 - General Storeroom - 6.16 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0008 - General Storeroom - 9.58 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0009 - Preparation - 26.89 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Plant / Equipment - Fume Cupboard	Flat AC Sheeting	1	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0010 - Laboratory L.S. - 92.4 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)							
Floor Coverings Res/Textile	Vinyl Tiles	93m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0011 - Apparatus Store - 32.37 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)							
Floor Coverings Res/Textile	Vinyl Tiles	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0012 - General Storeroom - 5.01 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)							
B00E - R0013 - Distribution Board Cupboard - 1.3 m2								
No Asbestos								Note: No inspection of live electrical installation
B00E - R0014 - General Learning Space - 52.51 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							

Floor Coverings Res/Textile	Vinyl Tiles	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0015 - General Storeroom - 6.19 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R0016 - General Storeroom - 19.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0017 - Laboratory L.S. - 99.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00E - R0020 - Laboratory L.S. - 92.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00E - R0021 - Staff Study - 25.7 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0022 - Movement - 180.59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)						
B00E - R0023 - Preparation - Science - 39.58 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R0024 - Stairs - 8.99 m2							
No Asbestos							
B00E - R0025 - Stairs - 8.83 m2							
No Asbestos							
B00E - R1001 - Computer Store - 9.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1002 - General Storeroom - 8.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R1003 - Staff Kitchen - 6.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)						
B00E - R1004 - Commonroom - 63.63 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1005 - Audio Visual Workroom - 32.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1006 - Duplicating Workroom - 12.78 m2							
Non Accessible							
B00E - R1007 - Staff Kitchen - 15.84 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)						
B00E - R1008 - Commonroom - 102.47 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)						
B00E - R1009 - General Learning Space - 52.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1010 - General Learning Space - 59.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1011 - Cleaning Store - Distributed - 5.04 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1012 - Distribution Board Cupboard - .87 m2		Note: No inspection of live electrical installation
No Asbestos		
B00E - R1013 - General Learning Space - 52.58 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1014 - General Storeroom - 6.08 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1015 - Performing Arts Store - 12.14 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (10 - 40 m2) - (X3)	
B00E - R1018 - Stage - 25.91 m2		
Non Accessible		
B00E - R1019 - Staff Kitchen - 6.07 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1020 - General Storeroom - 6.14 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R1021 - Staff Study - 39.35 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1022 - Computer Learning Space - 65.93 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R1023 - Movement - 181.77 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (120 - 250 m2) - (X15)	
B00E - R1024 - Performance Workspace - 111.74 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (70 - 120 m2) - (X8)	
B00E - R1025 - Stairs - 1.37 m2		
No Asbestos		
B00E - R1026 - Stairs - 7.33 m2		
No Asbestos		
B00E - R1027 - Stairs - 1.37 m2		
No Asbestos		
B00E - R1028 - Stairs - 7.18 m2		
No Asbestos		
B00E - R2001 - General Learning Space - 58.91 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2002 - Staff - Toilet - 6.44 m2		
Wall Linings Internal	Flat AC Sheeting	
B00E - R2003 - Staff Study - 57.24 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2004 - General Storeroom - 5.35 m2		
No Asbestos		
B00E - R2005 - General Learning Space - 59 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2006 - General Learning Space - 52.58 m2		

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2007 - General Learning Space - 52.57 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2008 - General Learning Space - 52.57 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2009 - General Learning Space - 59.14 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2010 - Cleaning Store - Distributed - 5.21 m2		
No Asbestos		
B00E - R2011 - Distribution Board Cupboard - .87 m2		Note: No inspection of live electrical installation
No Asbestos		
B00E - R2012 - Computer Learning Space - 52.42 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2013 - Computer Resource - 5.77 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2014 - General Storeroom - 5.9 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2015 - General Storeroom - 5.64 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (< 10 m2) - (X2)	
B00E - R2016 - General Learning Space - 58.62 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2017 - General Learning Space - 51.25 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2018 - General Learning Space - 52.13 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2019 - General Learning Space - 52.43 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00E - R2020 - Movement - 183.64 m2		
No Asbestos		
B00E - R2021 - Stairs - 6.52 m2		
No Asbestos		
B00E - R2022 - Stairs - 6.32 m2		
No Asbestos		
B00F - Multi Purpose Facilities - 1984 - Brick/Block		
Exterior		
Ceiling Structures/Linings	Flat AC Sheeting	
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00F - R0001 - Sport Equipment Store - 30.78 m2		
No Asbestos		
B00F - R0002 - Multi-Purpose Space - 473.18 m2		

No Asbestos		
B00F - R0003 - Toilets-Disabled - 4.07 m2		
No Asbestos		
B00F - R0004 - Staff Change - 6.76 m2		
No Asbestos		
B00F - R0005 - Staff Kitchen - 11.07 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0006 - Staff Study - 21.83 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R0007 - Chair Store - 29.6 m2		
No Asbestos		
B00F - R0008 - Toilets-Girls - 21.02 m2		
Partition Walls (Cubicles)	Compressed AC Sheet	
Wall Linings Internal	Flat AC Sheeting	
B00F - R0009 - Stage - 86.63 m2		
No Asbestos		
B00F - R0011 - Distribution Board Cupboard - .56 m2		Note: No inspection of live electrical installation
No Asbestos		
B00F - R0012 - Toilets-Boys - 19.75 m2		
Partition Walls (Cubicles)	Compressed AC Sheet	
Wall Linings Internal	Flat AC Sheeting	
B00F - R0013 - External Movement - 15.74 m2		
No Asbestos		
B00F - R0015 - Movement - .84 m2		
No Asbestos		
B00F - R0016 - Movement - .84 m2		
No Asbestos		
B00F - R0017 - Stairs - 1.28 m2		
No Asbestos		
B00F - R0018 - Stairs - 1.46 m2		
No Asbestos		
B00F - R0019 - Stairs - 9.14 m2		
No Asbestos		
B00F - R0020 - Stairs - 8.81 m2		
No Asbestos		
B00F - R0021 - External Movement - 11.42 m2		
No Asbestos		
B00F - R0022 - External Movement - 11.25 m2		
No Asbestos		
B00F - R0023 - Movement - 31.07 m2		
No Asbestos		
B00F - R0024 - Lift - 1.39 m2		
No Asbestos		
B00F - R0025 - Movement - 4.93 m2		
No Asbestos		
B00F - R0026 - Plant - .43 m2		
No Asbestos		
B00F - R1001 - Performing Arts Changeroom - 45.08 m2		
Wall Linings Internal	Flat AC Sheeting	
Partition Walls (Cubicles)	Compressed AC Sheet	

B00F - R1002 - Cleaning Store - Distributed - 4.72 m2		
Wall Linings Internal	Flat AC Sheeting	
B00F - R1003 - Control Room - 5.74 m2		
No Asbestos		
B00F - R1004 - Performing Arts Changeroom - 44.66 m2		
Wall Linings Internal	Flat AC Sheeting	
Partition Walls (Cubicles)	Compressed AC Sheet	
B00F - R1005 - Movement - 87.94 m2		
No Asbestos		
B00F - R1006 - Control Room - 4.89 m2		
No Asbestos		
B00F - R1007 - Stairs - 3.14 m2		
No Asbestos		
B00F - R1008 - Stairs - 3.12 m2		
No Asbestos		
B00F - R1009 - Stairs - 2.27 m2		
No Asbestos		
B00F - R1010 - Movement - 1.16 m2		
No Asbestos		
B00F - R1011 - Stairs - 2.4 m2		
No Asbestos		
B00F - R1012 - Movement - 1.16 m2		
No Asbestos		
B00G - Library - 1989 - Brick/Block		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00G - R0001 - Seminar - 14.52 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0002 - Seminar - 14.52 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0003 - Seminar - 14.62 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0004 - Entry - 17.26 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0005 - Distribution Board Cupboard - .57 m2		
Note: No inspection of live electrical installation		
No Asbestos		
B00G - R0006 - Cleaning Store - Distributed - 2.32 m2		
No Asbestos		
B00G - R0007 - Staff - Toilet - 4.89 m2		
Partition Walls (Cubicles)	Compressed AC Sheet	
B00G - R0008 - Audio Visual Workroom - 26.67 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0009 - Workroom - 37.35 m2		
Floor Coverings Res/Textile	No Asbestos Found	

B00G - R0010 - Librarian - 11.3 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0011 - Main Area - 401.44 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0012 - Computer Learning Space - 87.5 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0013 - Administration - Clerical - 13.17 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0014 - Interview/Office - Type 1 - 13.09 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0015 - General Storeroom - 11.7 m2		
No Asbestos		
B00G - R0016 - Administration - Clerical - 11.95 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00G - R0017 - Staff - Toilet - 7.02 m2		
Wall Linings Internal	Flat AC Sheeting	
B00G - R0018 - Multi-Purpose Space - 112.05 m2		
No Asbestos		
B00H - Building Services - 1965 - Brick/Block		
Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00H - R0001 - Main Switchroom - 8.25 m2		
No Asbestos		
B00H - R0002 - Maintenance Bulk Store - 17.33 m2		
No Asbestos		
B00I - Other - 1999 - Timber		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00I - R0001 - Main Area - 50.58 m2		
No Asbestos		
B00I - R0002 - General Storeroom - 1.65 m2		
No Asbestos		
B00I - R0003 - General Storeroom - 1.04 m2		
No Asbestos		
B00I - R0004 - General Learning Space - 45.31 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00I - R0005 - Staff Kitchen - 5.38 m2		
No Asbestos		
B00I - R0006 - Staff Study - 12.44 m2		

Floor Coverings Res/Textile	No Asbestos Found	
B00I - R0007 - General Learning Space - 37.26 m2		
No Asbestos		
B00I - R0008 - General Storeroom - 1.3 m2		
No Asbestos		
B00I - R0009 - General Storeroom - 1.2 m2		
No Asbestos		
B00I - R0010 - General Storeroom - 6.39 m2		
No Asbestos		
B00I - R0011 - General Storeroom - 6.39 m2		
No Asbestos		
B00I - R0012 - Distribution Board Cupboard - .45 m2		
		Note: No inspection of live electrical installation
No Asbestos		
B00I - R0013 - General Storeroom - 3.1 m2		
Wall Linings Internal	Flat AC Sheeting	
B00I - R0014 - Disabled Toilet - 4.5 m2		
Wall Linings Internal	Flat AC Sheeting	
B00I - R0015 - Staff - Toilet - 3.57 m2		
Wall Linings Internal	Flat AC Sheeting	
B00I - R0016 - Secure Storeroom - 5.25 m2		
Wall Linings Internal	Flat AC Sheeting	
B00I - R0017 - External Movement - 4.44 m2		
No Asbestos		
B00I - R0018 - External Movement - 16.82 m2		
No Asbestos		
B00I - R0019 - External Movement - 6.71 m2		
No Asbestos		
B00I - R0020 - External Movement - 15.69 m2		
No Asbestos		
B00J - Music - 2005 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00J - R0001 - Music Store - 8.49 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0002 - Music Store - 8.57 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0003 - Music Store - 8.54 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0004 - Music Learning Space - 97.27 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0005 - External Movement - 94.15 m2		
No Asbestos		
B00J - R0006 - Music Learning Space - 57.46 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0007 - Music Learning Space - 60.04 m2		

Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0008 - Music Store - 14.01 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0009 - Staff Study - 24.44 m2		
Floor Coverings Res/Textile	No Asbestos Found	
B00J - R0010 - Staff - Toilet - 3.37 m2		
No Asbestos		
B00J - R0011 - Toilets-Boys - 8.88 m2		
No Asbestos		
B00J - R0012 - Toilets-Girls - 8.88 m2		
No Asbestos		
B00K - Pupil Facilities - 2014 - Brick/Block		
Exterior		
No Asbestos		
Interior		
B00K - R0001 - Toilets-Disabled - 13.47 m2		
No Asbestos		
B00L - Pupil Facilities - 2020 - Metal Clad		
Exterior		
Require Inspection		
Interior		
B00L - R0001 - Student Change - Type 2 - 16.59 m2		
Require Inspection		
B00L - R0002 - Student Change - Type 2 - 16.62 m2		
Require Inspection		
B00L - R0003 - Toilets-Boys - 12.91 m2		
Require Inspection		
B00L - R0004 - Toilets-Girls - 12.91 m2		
Require Inspection		
B00L - R0005 - External Movement - 60.95 m2		
Require Inspection		
B00L - R0006 - Toilets-Disabled - 7.11 m2		
Require Inspection		

Demountables

There are no Demountable(s) Located at this school as per the AMS records as of 09-Sep-2020