

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Liverpool West Public School (4161)
Region:	South Western Sydney AMU
State Electorate:	Liverpool
Local Government Area:	Liverpool

Last Reviewed By:	WSP 11-SEP-2015
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	Yes
Please refer to the latest site specific Asbestos Management Plans available from the Department's website (Refer to Note 2).	

4161 - Liverpool West Public School
Site Plan (11178)

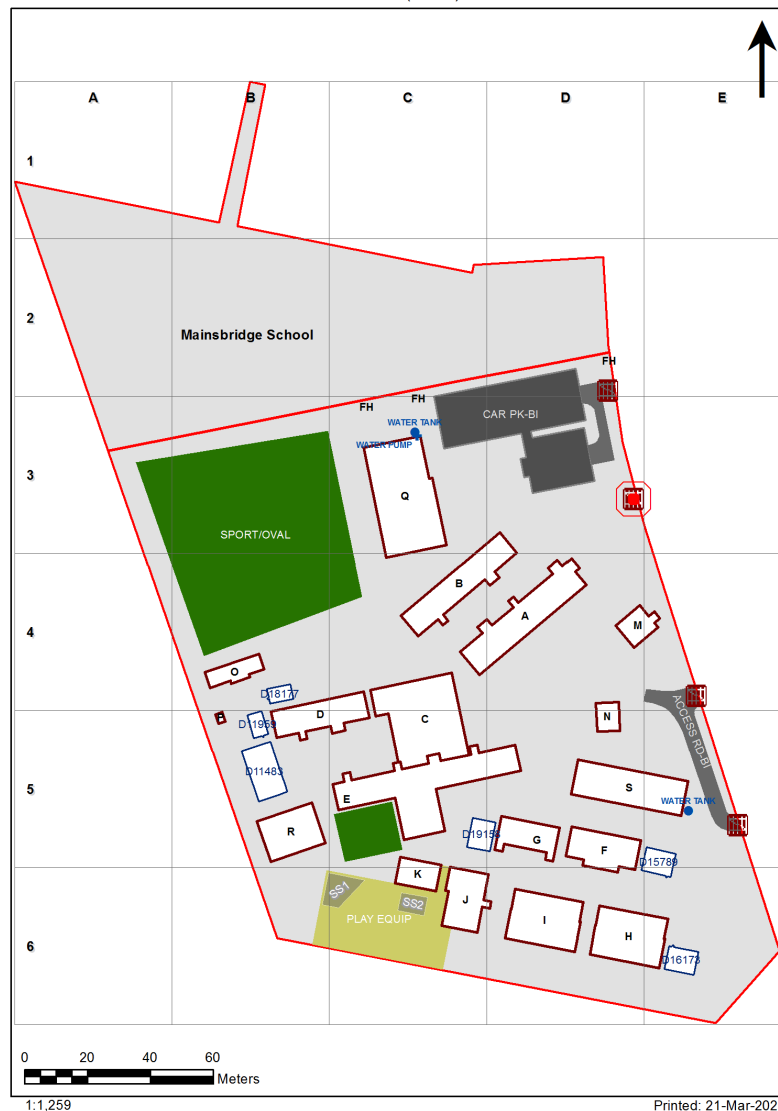

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - General Learning - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	AC Fragments/Debris						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00A - R0003 - Movement - 8.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0010 - Movement - 4.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0011 - Movement - 8.51 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0014 - Staff Kitchen - 7.7 m2							
Wall Linings Internal	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0015 - Staff Toilet - 4.45 m2							
No Asbestos							
B00A - R0016 - Movement - 3.06 m2							
Floor Coverings Res/Textile	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0017 - Home Base - 65.21 m2							
No Asbestos							
B00A - R0018 - Home Base Store - 7.7 m2							
No Asbestos							
B00A - R0019 - General Storeroom - 4.49 m2							
Floor Coverings Res/Textile	Vinyl Sheet						
Floor Coverings Res/Textile	Flat AC Sheeting						
B00A - R0020 - General Storeroom - 18.27 m2							
No Asbestos							
B00A - R0021 - Personal Effects Storage - 3.81 m2							
Floor Coverings Res/Textile	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0022 - Personal Effects Storage - 12.71 m2							
Floor Coverings Res/Textile	Vinyl Sheet						

Floor Coverings Res/Textile	Flat AC Sheeting						
B00A - R0023 - Other-Commercial - 2.89 m2							
Floor Coverings Res/Textile	Flat AC Sheeting						
Floor Coverings Res/Textile	Vinyl Sheet						
B00A - R0024 - Disabled Toilet - 5.09 m2							
No Asbestos							
B00A - R0025 - Home Base Store - 6.94 m2							
No Asbestos							
B00A - R0026 - Home Base - 65.92 m2							
No Asbestos							
B00A - R0027 - Main Switch Board - 5.22 m2							
No Asbestos							
B00A - R0028 - Security Store - 5.34 m2							
No Asbestos							
B00A - R0029 - Clerical Office/Workroom - 37.5 m2							
No Asbestos							
B00A - R0030 - Sick Bay - 10.03 m2							
No Asbestos							
B00A - R0031 - Principal - 16.81 m2							
No Asbestos							
B00A - R0032 - Staff Room - 58.39 m2							
No Asbestos							
B00A - R0033 - Deputy Principal - 13.21 m2							
No Asbestos							
B00A - R0034 - Interview - 12.03 m2							
No Asbestos							
B00A - R0035 - Movement - 22.3 m2							
No Asbestos							
B00B - General Learning - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00B - R0001 - Home Base - 56.75 m2							
No Asbestos							
B00B - R0002 - Home Base Store - 4.9 m2							
No Asbestos							
B00B - R0003 - Personal Effects Storage - 10.63 m2							
No Asbestos							
B00B - R0004 - Movement - 6.44 m2							
No Asbestos							
B00B - R0005 - Movement - 4.42 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0006 - Home Base Store - 4.96 m2							
No Asbestos							
B00B - R0007 - Home Base - 57.54 m2							
No Asbestos							
B00B - R0008 - Home Base - 56.14 m2							
No Asbestos							
B00B - R0009 - Practical Activities - 1hb - 1.07 m2							
No Asbestos							
B00B - R0010 - Home Base Store - 6.71 m2							
No Asbestos							
B00B - R0011 - Personal Effects Storage - 3.49 m2							
No Asbestos							
B00B - R0012 - Movement - 12.85 m2							
No Asbestos							
B00B - R0013 - Movement - 8.39 m2							
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0014 - Cleaning Distributed Store - 3.23 m2							
No Asbestos							
B00B - R0015 - Store - 2.53 m2							
No Asbestos							
B00B - R0016 - Community Clinic - 14.99 m2							
No Asbestos							
B00B - R0017 - Personal Effects Storage - 3.49 m2							
No Asbestos							
B00B - R0018 - Home Base Store - 6.71 m2							
No Asbestos							
B00B - R0019 - Home Base - 55.27 m2							
No Asbestos							
B00B - R0020 - Practical Activities - 1hb - 1.79 m2							
No Asbestos							
B00C - General Learning/Administration - 1959 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00C - M0001 - General Assistant/Bulk Store - 23.72 m2							
Wall Linings Internal	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - M0002 - Stairs - .87 m2							
No Asbestos							
B00C - R0001 - Movement - 4.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0002 - General Storeroom - 2.89 m2							
Non Accessible							
B00C - R0003 - Movement - 2.85 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0004 - Store - 21.9 m2							
No Asbestos							
B00C - R0008 - General Storeroom - 12.25 m2							
No Asbestos							
B00C - R0009 - General Storeroom - 8.28 m2							
No Asbestos							
B00C - R0010 - Movement - 5.87 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Vinyl Tiles						
B00C - R0011 - Movement - 4.71 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00C - R0012 - Home Base - 56.92 m2							
No Asbestos							
B00C - R0014 - Home Base - 56.45 m2							
No Asbestos							
B00C - R0015 - Movement - 385.11 m2							
No Asbestos							
B00C - R0016 - General Assistant/Bulk Store - 25.75 m2							
No Asbestos							
B00C - R0017 - Stairs - 2.33 m2							
No Asbestos							
B00D - General Learning/Administration - 1960 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris						
Underfloor Voids	Packing						
Interior							
B00D - R0001 - Home Base - 56.61 m2							
No Asbestos							
B00D - R0002 - Home Base Store - 5.42 m2							
No Asbestos							
B00D - R0003 - General Storeroom - 4.97 m2							
No Asbestos							
B00D - R0004 - Movement - 3.42 m2							

No Asbestos							
B00D - R0005 - Movement - 4.65 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0006 - Entry Vestibule - 21.98 m2							
No Asbestos							
B00D - R0007 - Staff Toilet - 3.45 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0008 - Movement - 4.37 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0009 - Home Base - 57.15 m2							
No Asbestos							
B00D - R0010 - Home Base Store - 4.99 m2							
No Asbestos							
B00D - R0011 - Personal Effects Storage - 5.11 m2							
No Asbestos							
B00D - R0012 - Withdrawal Space - 2hb - 19.22 m2							
No Asbestos							
B00D - R0013 - General Storeroom - .59 m2							
No Asbestos							
B00D - R0014 - General Storeroom - .62 m2							
No Asbestos							
B00D - R0015 - Distribution Board - .56 m2							
							Note: No inspection of live electrical installation
No Asbestos							
B00D - R0018 - Withdrawal Space - 1hb - 7.33 m2							
No Asbestos							
B00D - R0019 - General Storeroom - 2.85 m2							
No Asbestos							
B00D - R0020 - General Storeroom - 10.8 m2							
No Asbestos							
B00D - R0021 - Withdrawal Space - 1hb - 21.55 m2							
No Asbestos							
B00E - General Learning/Library - 1960 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	80m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00E - R0001 - Staff Room Annexe - 16.73 m2							
No Asbestos							
B00E - R0002 - General Storeroom - 4.7 m2							
No Asbestos							

B00E - R0003 - Movement - 9.92 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Flat AC Sheeting						
B00E - R0004 - General Storeroom - 3.58 m2							
No Asbestos							
B00E - R0005 - Movement - 4.78 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting						
B00E - R0006 - Home Base Store - 6.73 m2							
No Asbestos							
B00E - R0007 - Home Base - 55.66 m2							
No Asbestos							
B00E - R0008 - Practical Activities - 1hb - 1.07 m2							
No Asbestos							
B00E - R0009 - Home Base - 55.65 m2							
No Asbestos							
B00E - R0010 - Practical Activities - 1hb - 1.07 m2							
No Asbestos							
B00E - R0011 - Home Base Store - 6.65 m2							
No Asbestos							
B00E - R0012 - General Storeroom - 3.51 m2							
No Asbestos							
B00E - R0013 - Movement - 3.03 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Flat AC Sheeting						
B00E - R0014 - Movement - 4.83 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting						
B00E - R0015 - Home Base - 56.73 m2							
No Asbestos							
B00E - R0016 - Movement - 2.55 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting						
B00E - R0018 - Movement - 8.42 m2							
No Asbestos							
B00E - R0019 - Movement - 12.69 m2							
Floor Coverings Res/Textile	Vinyl Tiles						
Floor Coverings Res/Textile	Flat AC Sheeting						
B00E - R0020 - Movement - 5.38 m2							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0021 - Staff Toilet - 4.09 m2							
Wall Linings Internal	Flat AC Sheeting	8m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00E - R0022 - Staff Toilet - 3.86 m2							
Wall Linings Internal	Flat AC Sheeting	25m2	All surfaces, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R0023 - General Storeroom - 6.82 m2							
No Asbestos							
B00E - R0024 - General Storeroom - 3.53 m2							
No Asbestos							
B00E - R0025 - General Storeroom - 6.76 m2							
No Asbestos							
B00E - R0026 - Special Programs Room - 57.29 m2							
No Asbestos							
B00E - R0027 - Withdrawal Space - 2hb - 19.48 m2							
No Asbestos							
B00E - R0028 - Movement - 8.43 m2							
No Asbestos							
B00E - R0029 - Movement - 4.79 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting						
B00E - R0030 - Home Base - 85.89 m2							
No Asbestos							
B00E - R0031 - Movement - 174.12 m2							
No Asbestos							
B00E - R0032 - Practical Activities - 1hb - 6.97 m2							
No Asbestos							
B00E - R0033 - Home Base Store - 3.1 m2							
No Asbestos							
B00F - General Learning - 1958 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00F - R0011 - General Storeroom - 4.22 m2							
No Asbestos							
B00F - R0012 - Staff Room Annexe - 16.17 m2							
No Asbestos							
B00F - R0013 - Staff Toilet - 3.01 m2							
No Asbestos							
B00F - R0014 - Movement - 9.03 m2							
No Asbestos							
B00F - R0015 - Home Base Store - 5.93 m2							
No Asbestos							
B00F - R0016 - Home Base - 69.85 m2							
No Asbestos							
B00F - R0017 - Practical Activities - 8.51 m2							
No Asbestos							

B00F - R0018 - Home Base - 68.26 m2							
No Asbestos							
B00F - R0019 - Practical Activities - 8.59 m2							
No Asbestos							
B00F - R0020 - External Movement - 21.35 m2							
No Asbestos							
B00G - General Learning - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior							
B00G - R0001 - Movement - 4.79 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00G - R0002 - Movement - 3.19 m2							
No Asbestos							
B00G - R0003 - Personal Effects Storage - 6.52 m2							
No Asbestos							
B00G - R0004 - Home Base Store - 3.7 m2							
No Asbestos							
B00G - R0005 - Home Base - 56.3 m2							
No Asbestos							
B00G - R0006 - Home Base - 56.15 m2							
No Asbestos							
B00G - R0007 - Home Base Store - 3.7 m2							
No Asbestos							
B00G - R0008 - Personal Effects Storage - 6.52 m2							
No Asbestos							
B00G - R0009 - Movement - 3.19 m2							
No Asbestos							
B00G - R0010 - Movement - 5.11 m2							
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - General Learning/Communal Facilities - 1960 - Brick/Veneer							
Exterior							
Gable Verge Lining	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found						
Interior							
B00H - R0001 - Movement - 136.28 m2							

No Asbestos							
B00H - R0002 - Movement - 2.94 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0003 - Craft Store - 8.23 m2							
No Asbestos							
B00H - R0004 - Home Base Store - 3.81 m2							
No Asbestos							
B00H - R0005 - Home Base - 63.99 m2							
No Asbestos							
B00H - R0006 - Practical Activities - 1hb - 1.07 m2							
No Asbestos							
B00H - R0007 - Home Base - 96.58 m2							
No Asbestos							
B00H - R0008 - Practical Activities - 1hb - 1.07 m2							
No Asbestos							
B00H - R0009 - Movement - 2.9 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00H - R0010 - General Storeroom - 11.29 m2							
No Asbestos							
B00H - R0011 - Staff Toilet - 1.57 m2							
No Asbestos							
B00I - General Learning - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00I - R0001 - Movement - 135.98 m2							
No Asbestos							
B00I - R0002 - Movement - 3.7 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R0003 - Personal Effects Storage - 9.26 m2							
Electrical - Mounting Board	Flat AC Sheeting	1	East facing	Poor Condition - Extensive Damage (4)	Medium (2)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00I - R0004 - Home Base Store - 2.64 m2							
No Asbestos							
B00I - R0005 - Practical Activities - 1hb - 1.08 m2							
No Asbestos							
B00I - R0006 - Home Base - 64.23 m2							
No Asbestos							
B00I - R0007 - Home Base - 64.77 m2							
No Asbestos							
B00I - R0008 - Practical Activities - 1hb - 1.08 m2							
No Asbestos							
B00I - R0009 - Home Base Store - 2.77 m2							

No Asbestos							
B00I - R0010 - Personal Effects Storage - 8.49 m2							
No Asbestos							
B00I - R0011 - Movement - 3.48 m2							
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00I - R0012 - General Storeroom - 4.56 m2							
No Asbestos							
B00I - R0013 - Staff Toilet - 2.73 m2							
No Asbestos							
B00I - R0014 - Cleaning Distributed Store - 2.91 m2							
No Asbestos							
B00I - R0015 - General Storeroom - 2.73 m2							
No Asbestos							
B00I - R0016 - Withdrawal Space - 1hb - 18.56 m2							
No Asbestos							
B00J - Pre-School Facilities - 1960 - Brick/Veneer							
Exterior							
Eaves Linings	Flat AC Sheeting	30m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Verge Lining	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Ceiling Voids	No Asbestos Found						
Underfloor Voids	AC Fragments/Debris	1	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00J - R0001 - Clerical Office - Pre - 8.68 m2							
No Asbestos							
B00J - R0002 - Kitchen - Pre - 11.37 m2							
No Asbestos							
B00J - R0003 - Covered Outdoor Learning Area - Pre - 47.81 m2							
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00J - R0004 - Staff Toilet - Pre - 1.79 m2							
No Asbestos							
B00J - R0005 - Practical Activities - Pre - 56.48 m2							
No Asbestos							
B00J - R0006 - Personal Effects - Pre - 18.41 m2							
No Asbestos							
B00J - R0007 - Toilets - Boys/Girls - Pre - 8.58 m2							
No Asbestos							
B00J - R0008 - Home Base - Pre - 37.97 m2							
No Asbestos							
B00J - R0009 - General Storeroom - Pre - 8.42 m2							
No Asbestos							
B00J - R0010 - Movement - 4.6 m2							
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00K - General Learning - 1960 - Brick/Veneer							
Exterior							

Eaves Linings	Flat AC Sheeting	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00K - R0001 - Movement - 1.18 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Wall Linings Internal - Infill	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
B00K - R0002 - Movement - 2.08 m2							
No Asbestos							
B00K - R0003 - Personal Effects Storage - 3.52 m2							
No Asbestos							
B00K - R0004 - Home Base Store - 2.64 m2							
No Asbestos							
B00K - R0005 - Toilets - Boys/Girls - 3.31 m2							
No Asbestos							
B00K - R0006 - Home Base - 84.73 m2							
No Asbestos							
B00K - R0007 - Practical Activities - 1hb - .68 m2							
No Asbestos							
B00M - Pupil Facilities - 1960 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00M - R0001 - Canteen Office/Store - 3.49 m2							
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00M - R0002 - Staff Toilet - 1.64 m2							
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00M - R0003 - Canteen Office/Store - 2.96 m2							
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00M - R0004 - No Access - 29.72 m2							
Ceiling Structures/Linings	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00M - R0005 - Movement - 5.06 m2							
No Asbestos							
B00M - R0006 - Movement - 40.17 m2							
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Some Damage - Unsealed (3)	Medium (2)	Low Priority (2-3)	Assumed Asbestos
Wall Linings Internal	Flat AC Sheeting	1m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
B00N - Pupil Facilities - 1960 - Brick/Block							
Exterior							
Ceiling Voids	No Asbestos Found						

Underfloor Voids	No Asbestos Found						
Interior							
B00N - R0001 - Drinking Facilities - 12.42 m2							
No Asbestos							
B00N - R0002 - Toilets - Girls - 21.87 m2							
No Asbestos							
B00N - R0003 - Toilets - Boys - 21.71 m2							
No Asbestos							
B00O - Pupil Facilities - 1960 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	10m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00O - R0001 - Drinking Facilities - 4.58 m2							
No Asbestos							
B00O - R0002 - Toilets - Girls - 20.88 m2							
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00O - R0003 - Toilets - Boys - 32.8 m2							
No Asbestos							
B00O - R0004 - General Storeroom - 24.67 m2							
No Asbestos							
B00P - Building Services - 2007 - Metal Shed							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00P - R0001 - Garden Store - 6.83 m2							
No Asbestos							
B00Q - Communal Facilities - 2009 - Brick/Veneer							
Exterior							
Ceiling Voids	No Asbestos Found						
Underfloor Voids	No Asbestos Found						
Interior							
B00Q - R0001 - Communal Space - 209.66 m2							
No Asbestos							
B00Q - R0002 - Raised Platform - 56.27 m2							
No Asbestos							
B00Q - R0003 - Movement - 13 m2							
No Asbestos							
B00Q - R0004 - Movement - 14.96 m2							
No Asbestos							
B00Q - R0005 - Hall Chair Store - 13.16 m2							
No Asbestos							

B00Q - R0006 - Communal/Performance Store - 9.96 m2	
No Asbestos	
B00Q - R0007 - P.E. Store - 14.47 m2	
No Asbestos	
B00Q - R0008 - Toilets - Girls - 19.56 m2	
No Asbestos	
B00Q - R0009 - Toilet - Lobby - 2.78 m2	
No Asbestos	
B00Q - R0010 - Sound Cupboard - 2.12 m2	
No Asbestos	
B00Q - R0011 - Toilet - Lobby - 2.62 m2	
No Asbestos	
B00Q - R0012 - Toilets - Boys - 9.28 m2	
No Asbestos	
B00Q - R0013 - Plant - 1.62 m2	
No Asbestos	
B00Q - R0014 - Cleaning Distributed Store - 3.49 m2	
No Asbestos	
B00Q - R0015 - Main Switch Board - 3.32 m2	
No Asbestos	
B00Q - R0016 - Access Shower/Toilet - 6.92 m2	
No Asbestos	
B00Q - R0017 - Covered Outdoor Learning Area - 234.34 m2	
No Asbestos	
B00Q - R0018 - External Movement - 9.77 m2	
No Asbestos	
B00Q - R0019 - External Movement - 23.51 m2	
No Asbestos	
B00R - General Learning - 2010 - Brick/Veneer	
Exterior	
Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found
Interior	
B00R - R0001 - External Movement - 45.14 m2	
No Asbestos	
B00R - R0002 - Practical Activities - 19.14 m2	
No Asbestos	
B00R - R0003 - Home Base Store - 6.08 m2	
No Asbestos	
B00R - R0004 - Home Base - 61.28 m2	
No Asbestos	
B00R - R0005 - Withdrawal Space - 2hb - 11.81 m2	
No Asbestos	
B00R - R0006 - Home Base - 61.28 m2	
No Asbestos	
B00R - R0007 - Home Base Store - 6.08 m2	
No Asbestos	
B00R - R0008 - Practical Activities - 18.55 m2	
No Asbestos	
B00R - R0009 - Main Switch Board - .39 m2	

No Asbestos		
B00S - Library - 2010 - Brick/Veneer		
Exterior		
Ceiling Voids	No Asbestos Found	
Underfloor Voids	No Asbestos Found	
Interior		
B00S - R0001 - Reading Area - 232.14 m2		
No Asbestos		
B00S - R0002 - Special Programs Room - 39.06 m2		
No Asbestos		
B00S - R0003 - Special Programs Store - 6.01 m2		
No Asbestos		
B00S - R0004 - Cleaning Distributed Store - 5.9 m2		
No Asbestos		
B00S - R0005 - Library Office/Workroom - 26.2 m2		
No Asbestos		
B00S - R0006 - Communications Room - 8.08 m2		
No Asbestos		
B00S - R0007 - Security Store - 19.57 m2		
No Asbestos		
B00S - R0008 - Staff Toilet - 5.05 m2		
No Asbestos		
B00S - R0009 - Toilet - Lobby - 2.57 m2		
No Asbestos		
B00S - R0010 - Cleaning Distributed Store - 3.26 m2		
No Asbestos		
B00S - R0011 - Main Switch Board - .54 m2		
No Asbestos		
B00S - R0012 - External Movement - 19.51 m2		
No Asbestos		

Demountables

NS 101 11483 - Learning Unit - Double Primary/PAA - Placement Date : 16-JAN-2008

No Asbestos Found

OS 750 11959 - Learning Unit - ESL - Placement Date : 07-APR-2003

Exterior

Eaves Linings	Flat AC Sheeting	5.76m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Esl

End Wall Panel	Flat AC Sheeting	50m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Assumed Asbestos

OS 602 15789 - Learning Unit - Standard With P.A.A. - Placement Date : 08-DEC-2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 602 16173 - Learning Unit - Standard With P.A.A. - Placement Date : 27-NOV-2014

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Learning space/withdrawal/entry

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Assumed Asbestos
----------------------------	------------------	------	------------------

R2- Home Base Store

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Assumed Asbestos

OS 750 18177 - Learning Unit - ESL - Placement Date : 01-OCT-2004

No Asbestos Found

OS 606 19158 - Learning Unit - Standard With P.A.A A/C - Placement Date : 12-JAN-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found