

Asbestos Register


(Hazardous Materials and Risk Assessment)

School:	Lurnea High School (8401)
Region:	South Western Sydney AMU
State Electorate:	Holsworthy
Local Government Area:	Liverpool

Last Reviewed By:	WSP 06-JUN-2017
Last Revised By:	

Historical Fibro In Grounds Investigations/Events	No
<p>No previous investigations have been recorded against the school. However, asbestos containing materials maybe present in grounds from time to time and caution must be exercised prior to any grounds disturbance.</p>	

8401 - Lurnea High School
Site Plan (11183)

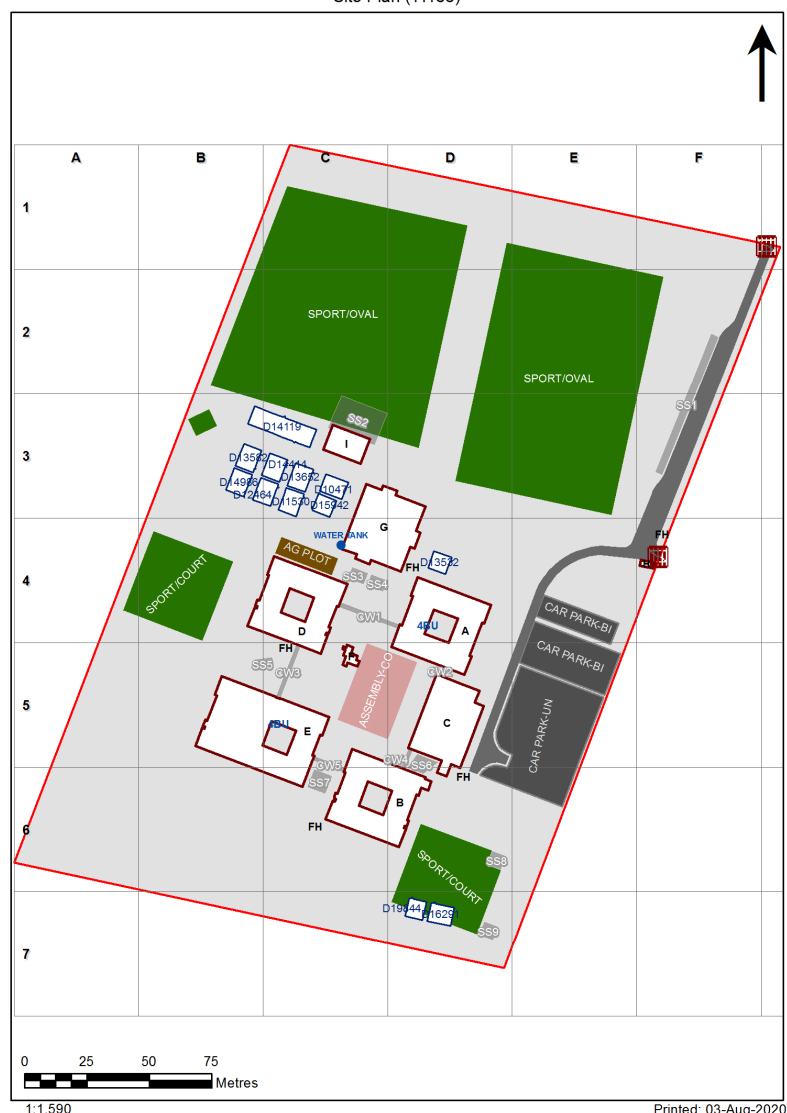

1:1,590

Printed: 03-Aug-2020

Preface to Asbestos Register

Limitations

Asbestos Registers established (first surveyed 2007/08) and maintained for the Department of Education (DoE) are limited in extent, in that:

1. All inspections and surveys of materials and finishes in DoE facilities are non-disturbance, with
2. Samples undertaken by hygienist to determine whether a sample is an Asbestos Containing Material (ACM),
3. The hygienist may apply a single sample to like materials within a space and adjoining spaces, but not normally between buildings,
4. Successive inspections have reduced any inconclusive records such as 'assumed asbestos' in difficult to access areas, by undertaking additional sampling with lifting devices.
5. In compliance with WHS Act 2011 and WHS Regulations 2017, additional inspections have been undertaken in ceiling spaces and sub-floor areas where access is possible.
 - o Where the ground floor is slab on ground, no inspection is made beneath the slab.
 - o Where fibro fragments (ACM taken for sampling) are located in ceiling spaces or sub floor voids air monitoring is normally undertaken at time of sampling, and clearance undertaken as soon as practicable.
6. No attempt has been made to identify any ACM that is hidden from view or encapsulated within
 - o Any wall cavity
 - o Sub floor area, particularly formwork for slabs in/on ground,
 - o Services (that may use ACM) such as: pipe lagging, asbestos cement pipes, flues.
7. All known ACM in Grounds (Fibro in Grounds) is made available in associated site specific asbestos management plans in DoE electronic files.
Notwithstanding information provided, ACM may be present in grounds from time to time and caution must be exercised prior to any grounds disturbance.

Use of the Asbestos Register

Prior to any disturbance works being undertaken in a building to which this asbestos register applies it will be necessary to confirm the extent of any ACM by a disturbance investigation:

- If the building was built prior to 2003
- If any ACM has been identified in the Asbestos Register for the building.

Update of Asbestos Registers

Asbestos Register Data is updated regularly by the DoE Hygienist Panel via the Online Asbestos Register Tool (Managed by Business Systems, School Infrastructure NSW). Internal users can view the latest edition of the Asbestos Register in the AMS.

Please note: The Department's external website may not contain the latest revision of the Asbestos Register.

Notes 1: Vermiculite

- During 2018/19, all vermiculite occurrences in DoE schools identified in 2007/08, were 'composite tested' in accordance with a safe work NSW agreed procedure. This required multiple testing of all vermiculite occurrences.
- During the period 2007/08 to 2018/19, some vermiculite has been over sheeted and a warning is indicated for schools where this has happened.

Note 2: DoE website link for information is here:

<https://www.schoolinfrastructure.nsw.gov.au/about-us/working-with-us/schools-asbestos-register.html>

<https://education.nsw.gov.au/about-us/strategies-and-reports/our-reports-and-reviews/schools-asbestos-register>

Note 3: Material Condition Assessment

The material condition assessment descriptors from Section 3 of the Asbestos Management Plan (AMP) is extracted below. Please read the AMP in its entirety for further information.

3.3.2.1 Material condition assessment

The OART records the material condition of identified ACM in the following format:

Rating	Description
Good condition (1)	For non-friable asbestos that is sealed and has no visible damage. This primarily related to asbestos cement (AC) sheet and vinyl tiles
Minimal damage (2)	For non-friable asbestos that has a very small amount of damage, eg hairline cracks.
Some damage / unsealed (3)	For non-friable asbestos with significant breakage or several small areas where material has been damaged, revealing loose asbestos fibres. Non-friable asbestos that is unsealed.
Poor condition (4)	For non-friable asbestos that has extensive damage. Visible asbestos debris
Friable asbestos (5)	Any occurrence of friable asbestos

Product	Material Description	Extent	Location	Material Condition	Risk Status	Remediation Priority	Result
B00A - Administration/General Learning - 1965 - Brick/Block							
Exterior							
Underfloor Voids	Requires Inspection						
External Wall Structure	Compressed AC Sheet	45	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Vermiculite						
Ceiling Voids - Flat Roof	Non Accessible Area						
Interior							
B00A - R0003 - Movement - 28.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0004 - Clinic - 8.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0005 - Staff - Toilet - 4.02 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0006 - Staff - Toilet - 4.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0007 - Staff Kitchen - 8.35 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0008 - Deputy Principal Office - 8.35 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0010 - Cleaning Store - Distributed - 4.34 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	4.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0011 - Administration - Clerical - 10.83 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10.83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0013 - Principal Office - 19.93 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19.93m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						

B00A - R0014 - General Storeroom - 3.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0015 - Staff - Toilet - 3.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0019 - Art Learning Space - 91.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R0023 - Public Reception - 58.46 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0024 - Deputy Principal Office - 13.18 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0025 - Deputy Principal Office - 12.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00A - R0026 - Printing/Photocopying - 24.96 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	24.96m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00A - R0027 - Tea Room - 4.37 m2							
No Asbestos							
B00A - R0028 - Tea Room - 9.59 m2							
No Asbestos							
B00A - R0029 - Staff Study - 16.34 m2							
No Asbestos							
B00A - R0030 - Darkroom Space - 2.07 m2							
No Asbestos							
B00A - R0031 - Dark Room - 30.27 m2							
No Asbestos							
B00A - R0032 - Art Learning Space - 56.91 m2							
No Asbestos							
B00A - R0033 - Tea Room - 1.95 m2							
No Asbestos							
B00A - R0034 - Plant - .87 m2							
No Asbestos							
B00A - R0035 - General Storeroom - 6.27 m2							

No Asbestos		
B00A - R0036 - External Stairs - 3.97 m2		
No Asbestos		
B00A - R0037 - Toilets-Boys - 3.07 m2		
External Wall Structure	Flat AC Sheeting	
B00A - R0038 - Toilets-Girls - 5.69 m2		
No Asbestos		
B00A - R0039 - Plant - .88 m2		
No Asbestos		
B00A - R0040 - Cleaning Store - Distributed - 2.34 m2		
No Asbestos		
B00A - R0041 - External Stairs - 2.92 m2		
No Asbestos		
B00A - R0042 - External Movement - 292.64 m2		
No Asbestos		
B00A - R0043 - External Movement - 1.6 m2		
No Asbestos		
B00A - R1001 - General Learning Space - 53.53 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1002 - Commonroom - 72.91 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1003 - Staff Study - 12.68 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1004 - Staff Study - 13.03 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1005 - Staff Kitchen - 9.45 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1006 - General Storeroom - 9.16 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1009 - Special Learning Space - 39.45 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1010 - Craft Room - 72.18 m2		
Ceiling Structures/Linings	Vermiculite	
B00A - R1011 - Special Learning Space - 39.23 m2		
Ceiling Structures/Linings	Vermiculite	
B00A - R1012 - Special Learning Space - 40.05 m2		
Ceiling Structures/Linings	Vermiculite	
B00A - R1013 - Cleaning Store - Distributed - 2.04 m2		
No Asbestos		
B00A - R1014 - General Learning Space - 59.09 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	
B00A - R1015 - Tea Room - 12.52 m2		
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)	

B00A - R1016 - Staff Study - 39.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1017 - General Learning Space - 52.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1020 - Distribution Board Cupboard - .87 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R1021 - Distribution Board Cupboard - .87 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00A - R1022 - Interview/Office - Type 1 - 19.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1023 - Handwashing Facilities - .19 m2							
No Asbestos							
B00A - R1024 - General Learning Space - 55.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1025 - Resources Store - 3.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00A - R1026 - External Movement - 119.92 m2							
No Asbestos							
B00A - R1027 - External Stairs - 5.79 m2							
No Asbestos							
B00A - R1028 - External Stairs - 5.92 m2							
No Asbestos							
B00B - Technological & Applied Studies/Music - 1965 - Brick/Block							
Exterior							
Eaves Linings	Flat AC Sheeting	10m2	East, Lower portion, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)	Assumed Asbestos
Eaves Linings	Vermiculite						
Underfloor Voids - Slab on Ground	Non Accessible Area						
External Wall Structure	Compressed AC Sheet	60	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area						
Interior							
B00B - R0001 - Senior Learning Centre - 90.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0002 - Office/Store - 16.27 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0003 - Computer Resource - 25.33 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0004 - Plant - 1.06 m2							
No Asbestos							
B00B - R0005 - Food Technology L.S. - 71.71 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0010 - Archive Store - 10.29 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0011 - Computer Learning Space - 53.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0012 - Resources Store - 3.26 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R0013 - Staff - Toilet - 3.61 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0014 - Staff - Toilet - 3.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0017 - Welding Area - 3.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0018 - Materials Store - 12.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0020 - Distribution Board Cupboard - 1.06 m2							
						Note: No inspection of live electrical installation	
No Asbestos							
B00B - R0025 - Food Technology L.S. - 84.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0026 - Food/Research Space - 21.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0027 - Laundry - 8.81 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0028 - Preparation - Materials - 26.04 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0029 - Tea Room - 7.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0030 - Staff Study - 24.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0031 - Materials Learning Space - Type 1 - 72.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0032 - Computer Resource - 27.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0033 - Garden Store Room - 4.17 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0034 - General Storeroom - 2.73 m2							
Ceiling Structures/Linings	Vermiculite						

B00B - R0035 - External Stairs - 3.54 m2							
No Asbestos							
B00B - R0036 - Cleaning Store - Distributed - 4.09 m2							
No Asbestos							
B00B - R0037 - External Stairs - 3.59 m2							
External Wall Structure	Flat AC Sheeting						
B00B - R0038 - External Movement - 152.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R0039 - Plant - 7.48 m2							
No Asbestos							
B00B - R0040 - Plant - 1.01 m2							
No Asbestos							
B00B - R0041 - External Movement - 1.6 m2							
No Asbestos							
B00B - R1001 - Wood Technology L.S. - 79.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1002 - Materials Store - 16.19 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1003 - Materials Store - 15.74 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1006 - Materials Store - 12.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1007 - Materials Technology L.S. - 67.49 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1008 - Materials Store - 5.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1009 - Materials Store - 6.2 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1010 - Music Learning Space - 58.5 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1012 - Art Learning Space - 52.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1013 - Art Learning Space - 52.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1014 - KIn Space - 21.41 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

B00B - R1015 - Craft Store - 10.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00B - R1016 - Music Store - 8.9 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1017 - Music Learning Space - 50.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1018 - Music Store - 4.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1020 - Distribution Board Cupboard - .9 m2							
No Asbestos							Note: No inspection of live electrical installation
B00B - R1021 - Distribution Board Cupboard - .88 m2							
No Asbestos							Note: No inspection of live electrical installation
B00B - R1022 - Staff Study - 21.24 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1023 - Tea Room - 4.53 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1024 - Music Store - 3.11 m2							
External Wall Structure	Flat AC Sheeting						
B00B - R1025 - Metal Technology L.S. - 85.97 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1026 - Materials Store - 13.37 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00B - R1027 - Resources Store - 3.11 m2							
External Wall Structure	Flat AC Sheeting						
B00B - R1028 - External Stairs - 5.65 m2							
No Asbestos							
B00B - R1029 - External Stairs - 5.89 m2							
No Asbestos							
B00B - R1030 - Handwashing Facilities - .33 m2							
No Asbestos							
B00B - R1031 - External Movement - 134.4 m2							
No Asbestos							
B00B - R1032 - External Movement - 1.54 m2							
No Asbestos							
B00C - Pupil Facilities/Physical Education - 1965 - Brick/Block							
Exterior							
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids	No Asbestos Found						
Interior							
B00C - R0001 - Machine Storage - 39.54 m2							
No Asbestos							

B00C - R0002 - Movement - 318.14 m2	
No Asbestos	
B00C - R0004 - General Storeroom - 6.99 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0005 - Sport Equipment Store - 5.81 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0006 - Student Canteen - 56.35 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0008 - Pantry - 3.65 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0009 - Uniform Shop - 14.04 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0010 - Bulk Store - 19.46 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0011 - Cleaning Supplies Store - 2.03 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0012 - Sport Equipment Store - 16.16 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0013 - General Storeroom - 1.32 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0014 - Movement - 5.52 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0016 - Sport Equipment Store - 6.68 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0019 - External Movement - 59.93 m2	
No Asbestos	
B00C - R0020 - Vending Machines - 17.14 m2	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)
B00C - R0021 - External Movement - 6.31 m2	
Ceiling Structures/Linings	Vermiculite
B00C - R0022 - Cleaning Store - Distributed - 1.4 m2	
No Asbestos	
B00C - R0023 - Staff - Toilet - 1.49 m2	
No Asbestos	
B00C - R0024 - Movement - 8.75 m2	
No Asbestos	
B00C - R0025 - General Storeroom - 9.31 m2	
No Asbestos	
B00C - R0026 - Stairs - 3.93 m2	
No Asbestos	
B00C - R0027 - Movement - 8.75 m2	
No Asbestos	

B00C - R0028 - Stairs - 3.55 m2							
No Asbestos							
B00C - R0029 - General Storeroom - 9.81 m2							
No Asbestos							
B00C - R0030 - Outdoor Equipment Store - 18.21 m2							
No Asbestos							
B00C - R1001 - Cleaning Store - Distributed - 7.12 m2							
No Asbestos							
B00C - R1003 - Change - 38.77 m2							
No Asbestos							
B00C - R1006 - Cleaning Store - Distributed - 7.18 m2							
No Asbestos							
B00C - R1007 - Movement - 8.91 m2							
No Asbestos							
B00C - R1008 - Movement - 8.81 m2							
No Asbestos							
B00C - R1009 - Stairs - 13.74 m2							
No Asbestos							
B00C - R1010 - Stairs - 14.09 m2							
No Asbestos							
B00C - R1011 - Change - 35.93 m2							
No Asbestos							
B00C - R1012 - Plant - 2.42 m2							
No Asbestos							
B00C - R1013 - Toilets-Girls - 35.83 m2							
No Asbestos							
B00C - R1014 - Plant - 2.38 m2							
No Asbestos							
B00C - R1015 - Toilets-Boys - 32.84 m2							
No Asbestos							
B00C - R1016 - Plant - 2.37 m2							
No Asbestos							
B00C - R1017 - Plant - 2.37 m2							
No Asbestos							
B00D - Science Learning/General Learning - 1965 - Brick/Block							
Exterior							
Eaves Linings	Vermiculite						
Underfloor Voids - Slab on Ground	Non Accessible Area						
Ceiling Voids - Flat Roof	Non Accessible Area						
External Wall Structure	Compressed AC Sheet	50	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Interior							
B00D - R0001 - General Learning Space - 65.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0002 - Distribution Board Cupboard - .9 m2							Note: No inspection of live electrical installation
No Asbestos							
B00D - R0004 - Staff - Toilet - 4.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

B00D - R0005 - Cleaning Store - Distributed - 3.58 m2							
No Asbestos							
B00D - R0006 - Staff - Toilet - 4.55 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0008 - General Storeroom - 19.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0009 - Other-Vacant - 6.52 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0010 - Laboratory L.S. - 85.97 m2							
Furniture / Fixtures	Compressed AC Sheet	2	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	86m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0011 - Plant - .9 m2							
No Asbestos							
B00D - R0012 - Apparatus Store - 13.29 m2							
No Asbestos							
B00D - R0013 - Resources Store - 13.36 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0014 - General Learning Space - 51.4 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R0015 - Laboratory L.S. - 92.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0016 - Preparation - Science - 29.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0017 - General Storeroom - 9.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0018 - Laboratory L.S. - 93.05 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0020 - Toilets-Girls - 40.42 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0021 - Plant - 1.04 m2							
Non Accessible							

B00D - R0022 - Plant - 2.85 m2							
Non Accessible							
B00D - R0023 - Toilets-Boys - 31.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R0024 - Plant - 2.39 m2							
Non Accessible							
B00D - R0025 - Plant - 2.38 m2							
Non Accessible							
B00D - R0026 - Cleaning Store - Distributed - 6.5 m2							
No Asbestos							
B00D - R0027 - External Stairs - 3.86 m2							
No Asbestos							
B00D - R0028 - General Storeroom - 6.25 m2							
No Asbestos							
B00D - R0029 - External Stairs - 3.61 m2							
No Asbestos							
B00D - R0030 - External Movement - 150.56 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Wall Linings Internal - Infill	Flat AC Sheeting						
B00D - R0031 - External Movement - 1.81 m2							
No Asbestos							
B00D - R1001 - Resources Store - 12.27 m2							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1002 - Resources Store - 5.11 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1003 - General Learning Space - 53.53 m2							
Floor Coverings Res/Textile	Vinyl Tiles	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1004 - General Learning Space - 58.76 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1006 - Computer Learning Space - 65.65 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1007 - Computer Learning Space - 58.67 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1008 - General Learning Space - 53.53 m2							

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1010 - General Learning Space - 58.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1011 - General Learning Space - 52.43 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1012 - General Learning Space - 52.51 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00D - R1013 - General Learning Space - 59 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1015 - Distribution Board Cupboard - .92 m2 Note: No inspection of live electrical installation							
No Asbestos							
B00D - R1016 - Distribution Board Cupboard - .89 m2 Note: No inspection of live electrical installation							
No Asbestos							
B00D - R1017 - Staff Study - 19.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1018 - Tea Room - 3.92 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1019 - Staff Study - 19.07 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1020 - Tea Room - 3.48 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00D - R1021 - Cleaning Store - Distributed - 2.87 m2							
Wall Linings Internal	Flat AC Sheeting						
B00D - R1022 - External Stairs - 5.86 m2							
No Asbestos							
B00D - R1023 - External Stairs - 5.81 m2							
No Asbestos							
B00D - R1024 - External Movement - 146.94 m2							
No Asbestos							
B00E - Library/General Learning/Science Learning - 1965 - Brick/Block							
Exterior							
External Wall Structure	Compressed AC Sheet	50	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Eaves Linings	Vermiculite						

Underfloor Voids - Slab on Ground	Non Accessible Area							
Ceiling Voids - Flat Roof	Non Accessible Area							
Interior								
B00E - R0001 - Interview/Office - Type 1 - 15.61 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0002 - Tea Room - 11.04 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0003 - Staff Study - 26.03 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0004 - Staff Study - 79.91 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0005 - Tea Room - 5.59 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
B00E - R0006 - Staff Study - 52.65 m2								
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0007 - General Storeroom - 7.51 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0008 - Sport Equipment Store - 2.94 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0009 - Plant - .84 m2								
No Asbestos								
B00E - R0010 - Staff - Toilet - 2.63 m2								
No Asbestos								
B00E - R0011 - Computer Learning Space - 32.25 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0012 - General Learning Space - 52.94 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0013 - General Storeroom - .64 m2								
No Asbestos								
B00E - R0014 - Chemical Store - 25.92 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
B00E - R0015 - Laboratory L.S. - 92.72 m2								
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)							
Furniture / Fixtures	Compressed AC Sheet	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00E - R0016 - General Storeroom - 9.74 m2							
Ceiling Structures/Linings	Vermiculite						
B00E - R0017 - Preparation - Science - 29.06 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0018 - Laboratory L.S. - 85.9 m2							
Furniture / Fixtures	Compressed AC Sheet	1	West	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0019 - Cleaning Store - Distributed - 3.49 m2							
No Asbestos							
B00E - R0021 - Main Entry - 10.08 m2							
No Asbestos							
B00E - R0022 - Main Area - 291.78 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R0023 - Seminar/Study - 13.25 m2							
No Asbestos							
B00E - R0024 - Seminar/Study - 13.14 m2							
No Asbestos							
B00E - R0025 - Staff Study - 13.43 m2							
No Asbestos							
B00E - R0027 - Audio Visual Workroom - 26.84 m2							
No Asbestos							
B00E - R0028 - Librarian - 10.99 m2							
No Asbestos							
B00E - R0030 - Toilet - Lobby - .82 m2							
No Asbestos							
B00E - R0031 - Plant - .85 m2							
No Asbestos							
B00E - R0032 - General Storeroom - 8.35 m2							
No Asbestos							
B00E - R0033 - External Stairs - 3.37 m2							
No Asbestos							
B00E - R0034 - Library Administration - 29.93 m2							
No Asbestos							
B00E - R0035 - Tea Room - 5.96 m2							
No Asbestos							
B00E - R0036 - Other-Vacant - 3.04 m2							
No Asbestos							
B00E - R0037 - External Stairs - 2.96 m2							
No Asbestos							
B00E - R0038 - External Stairs - 3.29 m2							
No Asbestos							
B00E - R0039 - Garden Store Room - 2.72 m2							
No Asbestos							
B00E - R0040 - External Movement - 180.66 m2							
Ceiling Structures/Linings	Flat AC Sheeting						
Wall Linings Internal - Infill	Flat AC Sheeting						

B00E - R0041 - External Movement - 2 m2							
No Asbestos							
B00E - R1001 - General Learning Space - 53.82 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R1002 - General Learning Space - 71.66 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1003 - Resources Store - 7.09 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1004 - Resources Store - 6.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1006 - Staff Study - 5.01 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	5.01m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R1007 - General Storeroom - 5.13 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1008 - Cleaning Supplies Store - 5.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1009 - Staff - Toilet - 2.62 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1010 - General Learning Space - 58.64 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1011 - General Learning Space - 52.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1012 - General Learning Space - 52.29 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1013 - General Storeroom - 6.14 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						

Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1014 - Archive Store - 6.12 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1015 - General Storeroom - 6.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1016 - Resources Store - 6.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6.23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1018 - General Learning Space - 59.23 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	59.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1019 - General Learning Space - 53.75 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1020 - Staff Study - 20.98 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1022 - General Learning Space - 59.01 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	58.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1023 - General Learning Space - 52.65 m2							
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)

Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
B00E - R1024 - General Learning Space - 53.6 m2							
Ceiling Structures/Linings	Vermiculite						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53.58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1026 - Toilet - Lobby - .83 m2							
No Asbestos							
B00E - R1027 - Distribution Board Cupboard - .84 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00E - R1028 - General Learning Space - 52.21 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1029 - Performance Workshop - 25.96 m2							
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	25.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1030 - Staff Study - 36.22 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
Floor Coverings Res/Textile	Vinyl Tiles - Adhesive						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	36.21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	Chrysotile (white asbestos)
B00E - R1031 - Tea Room - 2.28 m2							
Ceiling Structures/Linings	Vermiculite - Composite Sample - (40 - 70 m2) - (X5)						
B00E - R1032 - Distribution Board Cupboard - .87 m2						Note: No inspection of live electrical installation	
No Asbestos							
B00E - R1033 - External Stairs - 4.75 m2							
No Asbestos							
B00E - R1034 - External Stairs - 4.69 m2							
No Asbestos							
B00E - R1035 - External Movement - 2.29 m2							
No Asbestos							
B00E - R1036 - External Stairs - 4.88 m2							
No Asbestos							
B00E - R1037 - External Movement - 216.54 m2							
Ceiling Structures/Linings	Vermiculite						
B00E - R1038 - Cleaning Store - Distributed - 3.49 m2							
No Asbestos							
B00F - Building Services - 1965 - Brick/Block							

Exterior		
Underfloor Voids	No Asbestos Found	
Ceiling Voids	No Asbestos Found	
Interior		
B00F - R0002 - Movement - 1.01 m2		
No Asbestos		
B00F - R0003 - Main Switchroom - 7.99 m2		
No Asbestos		
B00F - R0004 - Stairs - 3.78 m2		
No Asbestos		
B00F - R9001 - Plant - 10 m2		
No Asbestos		
B00F - R9002 - Stairs - 3.78 m2		
No Asbestos		
B00G - Multi Purpose Facilities - 1985 - Brick/Block		
Exterior		
External Wall Structure - Awnings	Flat AC Sheeting	
Wall Linings Internal - Infill	Flat AC Sheeting	
Underfloor Voids - Slab on Ground	Non Accessible Area	
Ceiling Voids	No Asbestos Found	
Interior		
B00G - R0002 - Sport Equipment Store - 29.5 m2		
No Asbestos		
B00G - R0007 - Staff Kitchen - 12 m2		
No Asbestos		
B00G - R0008 - Cleaning Store - Distributed - 9.8 m2		
No Asbestos		
B00G - R0009 - General Storeroom - 7.73 m2		
No Asbestos		
B00G - R0010 - Distribution Board Cupboard - .52 m2		
No Asbestos		Note: No inspection of live electrical installation
B00G - R0011 - Gymnasium - 442.29 m2		
No Asbestos		
B00G - R0012 - Toilet - Lobby - 3.05 m2		
No Asbestos		
B00G - R0013 - Toilets-Boys - 17.78 m2		
No Asbestos		
B00G - R0014 - Toilet - Lobby - 3.03 m2		
No Asbestos		
B00G - R0015 - Toilets-Girls - 18.75 m2		
No Asbestos		
B00G - R0016 - Plant - .48 m2		
No Asbestos		
B00G - R0017 - External Movement - 12.56 m2		
No Asbestos		
B00G - R0018 - External Movement - 10.82 m2		
No Asbestos		
B00G - R0019 - Stairs - 2.59 m2		
No Asbestos		

B00G - R0020 - Stairs - 2.47 m2	
No Asbestos	
B00G - R0021 - Stage - 86.05 m2	
No Asbestos	
B00G - R0022 - Movement - 18.16 m2	
No Asbestos	
B00G - R0023 - Stairs - 1.87 m2	
No Asbestos	
B00G - R0024 - Stairs - 1.92 m2	
No Asbestos	
B00G - R0025 - External Movement - 10.82 m2	
No Asbestos	
B00G - R1001 - Control Room - 5.95 m2	
No Asbestos	
B00G - R1002 - Performing Arts Changeroom - 45.03 m2	
No Asbestos	
B00G - R1003 - Cleaning Store - Distributed - 6.07 m2	
No Asbestos	
B00G - R1004 - Performing Arts Changeroom - 45.14 m2	
No Asbestos	
B00G - R1005 - Stairs - 2.79 m2	
No Asbestos	
B00G - R1006 - Stairs - 2.87 m2	
No Asbestos	
B00G - R1007 - Movement - 2.07 m2	
No Asbestos	
B00G - R1008 - Movement - 1.99 m2	
No Asbestos	
B00H - Building Services - 2009 - Brick/Block	
Exterior	
Ceiling Voids - Flat Roof	Non Accessible Area
Underfloor Voids - Slab on Ground	Non Accessible Area
Interior	
B00H - R0001 - Plant - 10 m2	
No Asbestos	
B00I - Library - 2012 - Fibre Cement Clad	
Exterior	
Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area
Interior	
B00I - R0001 - Main Area - 92.01 m2	
No Asbestos	
B00I - R0002 - General Storeroom - 9.82 m2	
No Asbestos	
B00I - R0003 - Communication Space - 8.45 m2	
No Asbestos	
B00I - R0004 - Librarian - 20.42 m2	
No Asbestos	

B001 - R0005 - External Movement - 31.55 m2

No Asbestos

Demountables

NS 110 10471 - Learning Unit - Single Secondary/Secure - Placement Date : 21-FEB-2007

No Asbestos Found

OS 601 11530 - Learning Unit - Standard/Withdrawal - Placement Date : 03-FEB-2006

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 601 12464 - Learning Unit - Standard/Withdrawal - Placement Date : 13-JAN-2006

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
----------------------------	------------------	------	------------------

OS 600 13532 - Learning Unit - Small - Placement Date : 23-FEB-2018

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 751 13582 - Learning Unit - ESL - Placement Date : 16-NOV-2017

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

No Asbestos Found

OS 601 13652 - Learning Unit - Standard/Withdrawal - Placement Date : 22-FEB-2007

Exterior

Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos

Interior

R1- Entry

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos

R2- General Learning Space

End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos

R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 501 14119 - Admin Staff/Principal/Deputy/Dup/Clinic - Placement Date : 04-JAN-2012			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 601 14414 - Learning Unit - Standard/Withdrawal - Placement Date : 09-JAN-2006			
Exterior			
Eaves Linings	Flat AC Sheeting	11.52m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- Entry			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Assumed Asbestos
R2- General Learning Space			
End Wall Panel	Flat AC Sheeting	18m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
R3- Store			
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Assumed Asbestos
OS 601 14986 - Learning Unit - Standard/Withdrawal - Placement Date : 28-MAY-2020			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 600 15942 - Learning Unit - Small - Placement Date : 08-FEB-2007			
Exterior			
Eaves Linings	Flat AC Sheeting	8.64m2	Assumed Asbestos
Landing	Compressed AC Sheet	1.2m2	Assumed Asbestos
Step Treads	Compressed AC Sheet	1.08m2	Assumed Asbestos
Interior			
R1- General Learning Space			
End Wall Panel	Flat AC Sheeting	50m2	Assumed Asbestos
Ceiling Structures/Linings	Flat AC Sheeting	55m2	Assumed Asbestos
OS 601 16291 - Learning Unit - Standard/Withdrawal - Placement Date : 28-MAY-2020			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			
OS 600 19844 - Learning Unit - Small - Placement Date : 05-JUN-2020			
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.			
No Asbestos Found			